

Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Aberdeen Public School (1002)
Region : Hunter/Central Coast
State Electorate : Upper Hunter
Local Government Area : Upper Hunter

Initial Survey : Noel Arnold & Associates : 21 - May - 2008
Reviewed By : Greencap-NAA : 16 - Jun - 2015



2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1975 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground Non Accessible Area

- Area inaccessible

Ceiling Voids No Asbestos Found

Interior**B00A - R0001 - Home Base**

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet)
1002/B00A/R0006/Floor Coverings Res/Textile/S3 **No Asbestos Detected**

Floor Coverings Res/Textile Adhesive
1002/B00A/R0006/Floor Coverings Res/Textile/S14 **No Asbestos Detected**

B00A - R0002 - Home Base

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet)
1002/B00A/R0006/Floor Coverings Res/Textile/S3 **No Asbestos Detected**

Floor Coverings Res/Textile Adhesive
1002/B00A/R0006/Floor Coverings Res/Textile/S14 **No Asbestos Detected**

B00A - R0003 - Movement

In-fill-panel Flat AC Sheeting 20m North Good Condition (1) Low (1) Low Priority (2-3)
1002/B00A/R0016/In-fill-panel/S1 **Chrysotile (white asbestos)**

Ceiling Structures/Linings Flat AC Sheeting 80m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
1002/B00A/R0016/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

B00A - R0004 - Interview

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet)
1002/B00A/R0006/Floor Coverings Res/Textile/S3 **No Asbestos Detected**

Floor Coverings Res/Textile Adhesive
1002/B00A/R0006/Floor Coverings Res/Textile/S14 **No Asbestos Detected**

B00A - R0005 - Principal

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet)
1002/B00A/R0006/Floor Coverings Res/Textile/S3 **No Asbestos Detected**

Floor Coverings Res/Textile Adhesive
1002/B00A/R0006/Floor Coverings Res/Textile/S14 **No Asbestos Detected**

B00A - R0006 - Entry Vestibule

Floor Coverings Res/Textile Vinyl Tiles
1002/B00A/R0006/Floor Coverings Res/Textile/S3 **No Asbestos Detected**

Floor Coverings Res/Textile Adhesive
1002/B00A/R0006/Floor Coverings Res/Textile/S14 **No Asbestos Detected**

B00A - R0007 - Distribution Board


Note: No inspection of live electrical installation.

Electrical Backing Board Resinous Board 1Unit West Good Condition (1) Low (1) Low Priority (2-3)

Assumed Asbestos - Electrical Hazard**B00A - R0008 - Deputy Principal**

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet)
1002/B00A/R0006/Floor Coverings Res/Textile/S3 **No Asbestos Detected**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive					
	1002/B00A/R0006/Floor Coverings Res/Textile/S14				No Asbestos Detected	
B00A - R0009 - Secure Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles					
	1002/B00A/R0006/Floor Coverings Res/Textile/S3				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive					
	1002/B00A/R0006/Floor Coverings Res/Textile/S14				No Asbestos Detected	
B00A - R0010 - Sick Bay						
No Asbestos						
B00A - R0011 - Staff Room						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1002/B00A/R0006/Floor Coverings Res/Textile/S3				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive					
	1002/B00A/R0006/Floor Coverings Res/Textile/S14				No Asbestos Detected	
B00A - R0012 - Staff Toilet						
No Asbestos						
B00A - R0013 - Staff Toilet						
No Asbestos						
B00A - R0014 - Clerical Office/Workroom						
Floor Coverings Res/Textile	Vinyl Tiles					
	1002/B00A/R0006/Floor Coverings Res/Textile/S3				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive					
	1002/B00A/R0006/Floor Coverings Res/Textile/S14				No Asbestos Detected	
B00A - R0015 - Duplicating Workroom						
Floor Coverings Res/Textile	Vinyl Tiles					
	1002/B00A/R0006/Floor Coverings Res/Textile/S3				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive					
	1002/B00A/R0006/Floor Coverings Res/Textile/S14				No Asbestos Detected	
B00A - R0016 - Movement						
In-fill-panel	Flat AC Sheeting	8m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1002/B00A/R0016/In-fill-panel/S1				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1002/B00A/R0016/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	

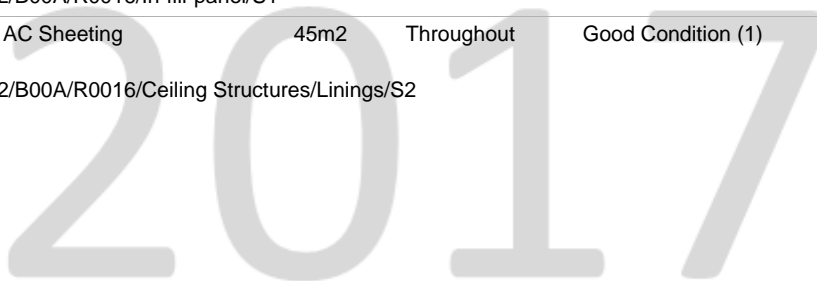

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1994 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids	No Asbestos Found
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible

Interior

B00B - R0001 - Movement

No Asbestos

B00B - R0002 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00B - R0003 - General Storeroom

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00B - R0004 - Movement

No Asbestos

B00B - R0005 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00B - R0006 - Movement

No Asbestos

B00B - R0007 - General Storeroom

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00B - R0008 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Library - 1913 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Extreme Access Issue - Height Restricted - Approx >6m					
Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1002/B00C/R0001/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - Height Restricted - Approx >6m					
Underfloor Voids	No Asbestos Found					

Interior

B00C - M0001 - Plant

No Asbestos

B00C - R0001 - Movement

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1002/B00C/R0001/Wall Linings Internal/S4					
Ceiling Structures/Linings	Flat AC Sheeting	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1002/B00C/R0001/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)

B00C - R0002 - Reading Area

No Asbestos

B00C - R0003 - Library Office/Workroom

No Asbestos

B00C - R0004 - Special Programs Room

No Asbestos

B00C - R0005 - General Storeroom

No Asbestos

B00C - R0006 - Movement

No Asbestos

B00C - R0007 - Library Office/Workroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1985 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 1002/B00D/R0004/Ceiling Structures/Linings/S6					No Asbestos Detected
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior**B00D - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 1002/B00D/R0004/Ceiling Structures/Linings/S6					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00D - R0002 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting 1002/B00D/R0003/Ceiling Structures/Linings/S9					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00D - R0003 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting 1002/B00D/R0003/Ceiling Structures/Linings/S9					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00D - R0004 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet 1002/B00D/R0004/Partition Walls (Cubicles)/S5					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 1002/B00D/R0004/Ceiling Structures/Linings/S6					No Asbestos Detected

B00D - R0005 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet 1002/B00D/R0004/Partition Walls (Cubicles)/S5					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 1002/B00D/R0004/Ceiling Structures/Linings/S6					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1994 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	Packing					
	1002/B00E/Underfloor Voids/S13					No Asbestos Detected

Interior

B00E - R0001 - General Storeroom

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0003 - External Movement

No Asbestos

B00E - R0005 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0006 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0007 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0008 - General Storeroom

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0009 - External Movement

No Asbestos

B00E - R0010 - Home Base

No Asbestos

B00E - R0011 - Practical Activities - 1hb

No Asbestos

B00E - R0012 - Practical Activities - 1hb

No Asbestos

B00E - R0013 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1913 - Timber (Timber)

Exterior

Ceiling Voids	Non Accessible Area - Height Restricted - >6m High					
Wall Cladding	Flat AC Sheeting 1002/B00F/Wall Cladding/S10					No Asbestos Detected
Underfloor Voids	No Asbestos Found					
Ceiling Voids	Non Accessible Area - Height Restriction - Height Restricted - >6m High					

Interior

B00F - R0001 - General Storeroom

No Asbestos

B00F - R0002 - Movement

Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-------	-------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

B00F - R0003 - Special Programs Room

No Asbestos

B00F - R0004 - Darkroom Space

No Asbestos

B00F - R0005 - General Storeroom

No Asbestos

B00F - R0006 - Staff Room

No Asbestos

B00F - R0007 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1913 - Timber (Timber)

Exterior

Wall Cladding	Flat AC Sheeting 1002/B00G/Wall Cladding/S7					No Asbestos Detected
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

Interior

B00G - R0001 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

Assumed Asbestos - Height Restriction

B00G - R0002 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pupil Facilities/General Learning - 1950 - Timber (Timber)**Exterior**

Ceiling Voids	Non Accessible Area - Height Restricted - Unable to Access					
Ceiling Voids	Non Accessible Area - Height Restriction - Height Restricted - Unable to Access					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1002/B00H/R0003/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

Interior**B00H - R0001 - Canteen**

Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1002/B00H/R0003/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	10m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1002/B00H/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00H - R0002 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1002/B00H/R0003/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1002/B00H/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00H - R0003 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1002/B00H/R0003/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

B00H - R0004 - Personal Effects Storage

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1002/B00H/R0003/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

B00H - R0005 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1002/B00H/R0003/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

B00H - R0006 - External Movement

No Asbestos

B00H - R9001 - General Storeroom

No Asbestos

B00H - R9002 - General Storeroom

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Building Services - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B001 - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Communal Facilities/General Learning - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior**B00J - R0001 - Covered Outdoor Learning Area**

No Asbestos

B00J - R0002 - Communal Space

No Asbestos

B00J - R0003 - Movement

No Asbestos

B00J - R0004 - Ramp

No Asbestos

B00J - R0005 - Raised Platform

No Asbestos

B00J - R0006 - Movement

No Asbestos

B00J - R0007 - Chair Storeroom

No Asbestos

B00J - R0008 - Communal/Performance Store

No Asbestos

B00J - R0009 - P.E. Store

No Asbestos

B00J - R0010 - Movement

No Asbestos

B00J - R0011 - Toilets - Girls

No Asbestos

B00J - R0012 - Sound Cupboard

No Asbestos

B00J - R0013 - Movement

No Asbestos

B00J - R0014 - Toilets - Boys

No Asbestos

B00J - R0015 - Cleaning Distributed Store

No Asbestos

B00J - R0016 - General Storeroom

No Asbestos

B00J - R0017 - Main Switch Board

No Asbestos

B00J - R0018 - Access Shower/Toilet

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Building Services - 2010 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00K - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning - 2013 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00L - R0001 - Practical Activities - 1hb

No Asbestos

B00L - R0002 - General Storeroom

No Asbestos

B00L - R0003 - Home Base

No Asbestos

B00L - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 750 - D10286 - Learning Unit - ESL : Placement Date - 9/05/2000

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				5.76 m2

Interior

R1 - Esl

End wall panel	Flat AC Sheet	Assumed Asbestos				50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

1002_ASB_100913_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017