


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Adelong Public School (1009)  
**Region :** Riverina  
**State Electorate :** Wagga Wagga  
**Local Government Area :** Tumut

**Initial Survey :** Noel Arnold & Associates : 14 - May - 2008  
**Reviewed By :** Grencap-NAA : 02 - Sep - 2016

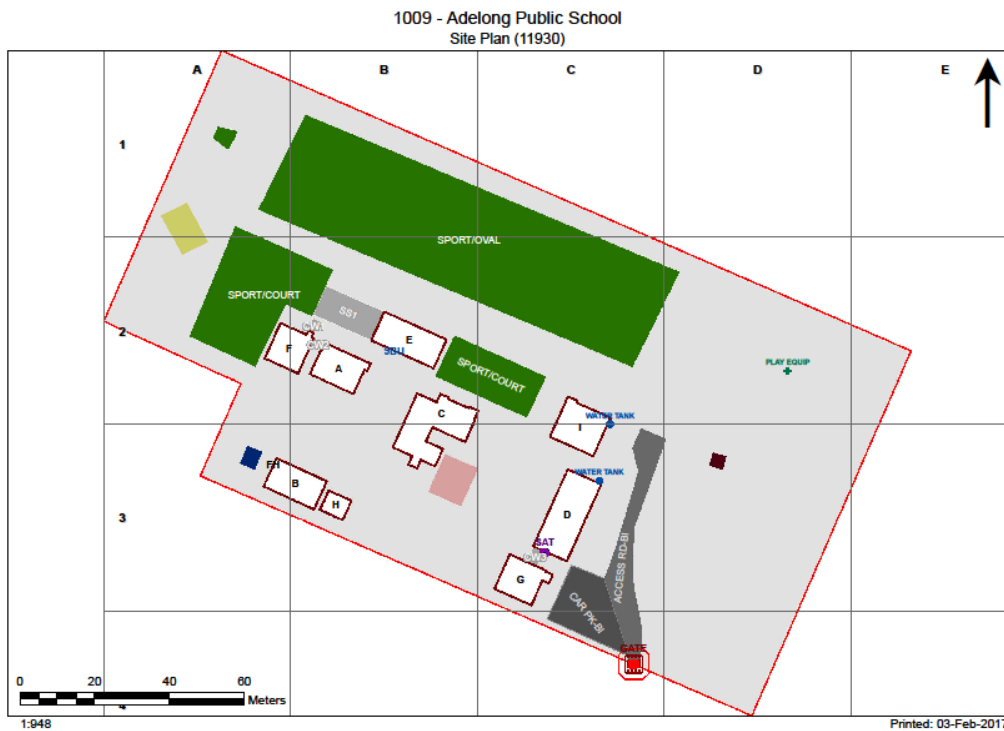

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00A - General Learning - 1900 - Brick/Block (Brick/Block)**

**Exterior**

|                  |   |      |  |                    |         |   |
|------------------|---|------|--|--------------------|---------|---|
| Wall Cladding    | Flat AC Sheeting<br><br>1009/B00A/Wall Cladding/S7    | 10m2 | North facing,<br>East facing,<br>West facing | Good Condition (1) | Low (1) | Low Priority (2-3)  |
|                  |   |      |  |                    |         | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
| Eaves Linings    | Flat AC Sheeting<br>1009/B00C/Eaves Linings/S5        |      |  |                    |         | <b>No Asbestos Detected</b>                                   |
| Ceiling Voids    | Non Accessible Area<br>- Height Restriction 4m height |      |  |                    |         |   |
| Underfloor Voids | Non Accessible Area<br>- Area inaccessible            |      |  |                    |         |   |

**Interior**

**B00A - R0001 - Movement**

No Asbestos

**B00A - R0002 - Movement**

No Asbestos

**B00A - R0003 - Home Base**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00B - Communal Facilities - 1950 - Timber (Timber)**

**Exterior**

|                  |   |  |  |  |  |                             |
|------------------|---|--|--|--|--|-----------------------------|
| Eaves Linings    | Flat AC Sheeting<br>1009/B00C/Eaves Linings/S5        |  |  |  |  | <b>No Asbestos Detected</b> |
| Ceiling Voids    | Non Accessible Area<br>- Height Restriction 4m height |  |  |  |  |                             |
| Underfloor Voids | No Asbestos Found                                     |  |  |  |  |                             |

**Interior**

**B00B - R0001 - Movement**

No Asbestos

**B00B - R0002 - Communal Space**

|                             |  |      |                   |                    |         |   |
|-----------------------------|--|------|-------------------|--------------------|---------|---|
| Ceiling Structures/Linings  | Flat AC Sheeting<br>1009/B00B/R0002/Ceiling Structures/Linings/S15                           | 2m2  | South East Corner | Good Condition (1) | Low (1) | Low Priority (2-3)<br><b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
| Floor Coverings Res/Textile | Adhesive<br>1009/B00B/R0002/Floor Coverings Res/Textile/S17                                  |      |                   |                    |         | <b>No Asbestos Detected</b>   |
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet)<br>1009/B00B/R0002/Floor Coverings Res/Textile/S16 | 79m2 | Throughout        | Good Condition (1) | Low (1) | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>                            |

**B00B - R0003 - General Storeroom**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00C - General Learning - 1877 - Brick/Block (Brick/Block)**

**Exterior**

|                  |   |                             |  |  |  |  |
|------------------|---|-----------------------------|--|--|--|--|
| Eaves Linings    | Flat AC Sheeting<br>1009/B00C/Eaves Linings/S5        | <b>No Asbestos Detected</b> |  |  |  |  |
| Ceiling Voids    | Non Accessible Area<br>- Height Restriction 4m height |                             |  |  |  |  |
| Underfloor Voids | Non Accessible Area<br>- Area inaccessible            |                             |  |  |  |  |

**Interior**

**B00C - R0001 - General Storeroom**

No Asbestos

**B00C - R0002 - Home Base**

No Asbestos

**B00C - R0003 - General Storeroom**

No Asbestos

**B00C - R0004 - Personal Effects Storage**

No Asbestos

**B00C - R0005 - Home Base**

No Asbestos

**B00C - R0006 - Home Base**

No Asbestos

**B00C - R0007 - Practical Activities - 1hb**

No Asbestos

**B00C - R0008 - Movement**

No Asbestos

**B00C - R0009 - Movement**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00D - Administration/Library - 1966 - Brick/Block (Brick/Block)**

**Exterior**

|                    |                                  |     |               |   |         |                    |
|--------------------|----------------------------------|-----|---------------|---|---------|--------------------|
| Ceiling Voids      | No Asbestos Found                |     |               |   |         |                    |
| Underfloor Voids   | No Asbestos Found                |     |               |   |         |                    |
| Gable Verge Lining | Flat AC Sheeting                 | 30m | North & South | Good Condition (1)  | Low (1) | Low Priority (2-3) |
|                    | 1009/B00F/Gable Verge Lining/S14 |     |               | <b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b> |         |                    |

**Interior**

**B00D - R0001 - Library Office/Workroom**

|                             |   |  |  |  |  |                      |
|-----------------------------|---|--|--|--|--|----------------------|
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet)       |  |  |  |  | No Asbestos Detected |
|                             | 1009/B00D/R0002/Floor Coverings Res/Textile/S18 |  |  |  |  |                      |
| Floor Coverings Res/Textile | Adhesive  |  |  |  |  | No Asbestos Detected |
|                             | 1009/B00D/R0002/Floor Coverings Res/Textile/S19 |  |  |  |  |                      |

**B00D - R0002 - Reading Area**

|                             |   |  |  |  |  |                      |
|-----------------------------|---|--|--|--|--|----------------------|
| Floor Coverings Res/Textile | Adhesive  |  |  |  |  | No Asbestos Detected |
|                             | 1009/B00D/R0002/Floor Coverings Res/Textile/S19 |  |  |  |  |                      |
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet)       |  |  |  |  | No Asbestos Detected |
|                             | 1009/B00D/R0002/Floor Coverings Res/Textile/S18 |  |  |  |  |                      |

**B00D - R0003 - Principal**

|                             |   |  |  |  |  |                      |
|-----------------------------|---|--|--|--|--|----------------------|
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet)       |  |  |  |  | No Asbestos Detected |
|                             | 1009/B00D/R0002/Floor Coverings Res/Textile/S18 |  |  |  |  |                      |
| Floor Coverings Res/Textile | Adhesive  |  |  |  |  | No Asbestos Detected |
|                             | 1009/B00D/R0002/Floor Coverings Res/Textile/S19 |  |  |  |  |                      |

**B00D - R0004 - Clerical Office**

|                             |   |  |  |  |  |                      |
|-----------------------------|---|--|--|--|--|----------------------|
| Floor Coverings Res/Textile | Adhesive  |  |  |  |  | No Asbestos Detected |
|                             | 1009/B00F/R0003/Floor Coverings Res/Textile/S13 |  |  |  |  |                      |
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet)       |  |  |  |  | No Asbestos Detected |
|                             | 1009/B00F/R0003/Floor Coverings Res/Textile/S12 |  |  |  |  |                      |

**B00D - R0005 - Movement**

|                            |  |      |            |   |         |                    |
|----------------------------|--|------|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting                               | 46m2 | Throughout | Good Condition (1)  | Low (1) | Low Priority (2-3) |
|                            | 1009/B00D/R9002/Ceiling Structures/Linings/S11 |      |            | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |

**B00D - R0006 - Entry Vestibule**

No Asbestos

**B00D - R0007 - General Storeroom**

No Asbestos

**B00D - R0008 - Staff Toilet**

|                            |   |     |              |   |         |                      |
|----------------------------|---|-----|--------------|---|---------|----------------------|
| Partition Walls (Cubicles) | Compressed AC Sheet                           | 3m2 | All surfaces | Good Condition (1)  | Low (1) | Low Priority (2-3)   |
|                            | 1009/B00E/R0004/Partition Walls (Cubicles)/S8 |     |              | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                      |
| Wall Linings Internal      | Flat AC Sheeting                              |     |              |   |         | No Asbestos Detected |
|                            | 1009/B00D/R0008/Wall Linings Internal/S10     |     |              |   |         |                      |

**B00D - R0009 - Cleaning Supplies**

|                            |  |     |            |   |         |                    |
|----------------------------|--|-----|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting                               | 1m2 | Throughout | Good Condition (1)  | Low (1) | Low Priority (2-3) |
|                            | 1009/B00D/R9002/Ceiling Structures/Linings/S11 |     |            | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |

| Product   | Material Description | Extent | Location Reference | Material Condition  | Risk Status  | Control Priority            |
|---|----------------------|--------|--------------------|---|--|-----------------------------|
| Sample No                                       |                      |        |                    |   | Test Result  |                             |
| Wall Linings Internal                           | Compressed AC Sheet  | 4m2    | Throughout         | Good Condition (1)  | Low (1)  | Low Priority (2-3)          |
| 1009/B00D/R0009/Wall Linings Internal/S20       |                      |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |  |                             |
| <b>B00D - R9001 - Distribution Board</b>        |                      |        |                    |   | Note: No inspection of live electrical installation. |                             |
| Ceiling Structures/Linings                      | Flat AC Sheeting     | 1m2    | East facing        | Good Condition (1)  | Low (1)  | Low Priority (2-3)          |
| 1009/B00D/R9002/Ceiling Structures/Linings/S11  |                      |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |  |                             |
| Wall Linings Internal                           | Flat AC Sheeting     |        |                    |   |  | <b>No Asbestos Detected</b> |
| 1009/B00D/R0008/Wall Linings Internal/S10       |                      |        |                    |   |  |                             |
| <b>B00D - R9002 - Movement</b>                  |                      |        |                    |   |  |                             |
| Ceiling Structures/Linings                      | Flat AC Sheeting     | 50m2   | East facing        | Good Condition (1)  | Low (1)  | Low Priority (2-3)          |
| 1009/B00D/R9002/Ceiling Structures/Linings/S11  |                      |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |  |                             |
| <b>B00D - R9003 - Canteen</b>                   |                      |        |                    |   |  |                             |
| Ceiling Structures/Linings                      | Flat AC Sheeting     | 24m2   | Throughout         | Good Condition (1)  | Low (1)  | Low Priority (2-3)          |
| 1009/B00D/R9002/Ceiling Structures/Linings/S11  |                      |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |  |                             |
| Floor Coverings Res/Textile                     | Vinyl Tiles          |        |                    |   |  | <b>No Asbestos Detected</b> |
| 1009/B00C/R0003/Floor Coverings Res/Textile/S3  |                      |        |                    |   |  |                             |
| Floor Coverings Res/Textile                     | Adhesive             |        |                    |   |  | <b>No Asbestos Detected</b> |
| 1009/B00D/R0002/Floor Coverings Res/Textile/S19 |                      |        |                    |   |  |                             |
| <b>B00D - R9004 - Kiln Room</b>                 |                      |        |                    |   |  |                             |
| No Asbestos                                     |                      |        |                    |   |  |                             |

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    | Test Result        |             |                  |

**B00E - Pupil Facilities/Building Services - 1960 - Brick/Block (Brick/Block)****Exterior**

|                                   |  |      |                               |                    |         |   |
|-----------------------------------|--|------|-------------------------------|--------------------|---------|---|
| Underfloor Voids - Slab on Ground | Non Accessible Area<br>- Area inaccessible                     |      |                               |                    |         |   |
| Eaves Linings                     | Fibre Cement Casting (Monocrete)<br>1009/B00F/Eaves Linings/S2 | 20m2 | North facing,<br>South facing | Good Condition (1) | Low (1) | Low Priority (2-3)<br><br><b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
| Ceiling Voids                     | No Asbestos Found  |      |                               |                    |         |   |
| Gable Verge Lining                | Flat AC Sheeting<br>1009/B00E/Gable Verge Lining/S21           |      |                               |                    |         | <b>No Asbestos Detected</b>   |

**Interior****B00E - R0001 - Cleaning Distributed Store**

|                            |   |      |              |                    |         |   |
|----------------------------|---|------|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting<br>1009/B00E/R0004/Ceiling Structures/Linings/S9 | 18m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)<br><br><b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
|----------------------------|---|------|--------------|--------------------|---------|---|

**B00E - R0002 - General Storeroom**

|                            |   |      |              |                    |         |   |
|----------------------------|---|------|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting<br>1009/B00E/R0004/Ceiling Structures/Linings/S9 | 25m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)<br><br><b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
|----------------------------|---|------|--------------|--------------------|---------|---|

**B00E - R0003 - General Storeroom**

|                            |   |     |              |                    |         |   |
|----------------------------|---|-----|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting<br>1009/B00E/R0004/Ceiling Structures/Linings/S9 | 7m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)<br><br><b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
|----------------------------|---|-----|--------------|--------------------|---------|---|

**B00E - R0004 - Toilets - Boys**

|                            |  |      |              |                    |         |   |
|----------------------------|--|------|--------------|--------------------|---------|---|
| Partition Walls (Cubicles) | Compressed AC Sheet<br>1009/B00E/R0004/Partition Walls (Cubicles)/S8 | 10m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)<br><br><b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
| Ceiling Structures/Linings | Flat AC Sheeting<br>1009/B00E/R0004/Ceiling Structures/Linings/S9    | 31m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)<br><br><b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |

**B00E - R0005 - Plant**

|                            |   |     |              |                    |         |   |
|----------------------------|---|-----|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting<br>1009/B00E/R0004/Ceiling Structures/Linings/S9 | 4m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)<br><br><b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
|----------------------------|---|-----|--------------|--------------------|---------|---|

**B00E - R0006 - Toilets - Girls**

|                            |  |      |              |                    |         |   |
|----------------------------|--|------|--------------|--------------------|---------|---|
| Partition Walls (Cubicles) | Compressed AC Sheet<br>1009/B00E/R0004/Partition Walls (Cubicles)/S8 | 15m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)<br><br><b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
| Ceiling Structures/Linings | Flat AC Sheeting<br>1009/B00E/R0004/Ceiling Structures/Linings/S9    | 24m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)<br><br><b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |

**B00E - R0007 - Plant**

|                            |   |     |              |                    |         |   |
|----------------------------|---|-----|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting<br>1009/B00E/R0004/Ceiling Structures/Linings/S9 | 5m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)<br><br><b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
|----------------------------|---|-----|--------------|--------------------|---------|---|

**B00E - R0008 - Sports Store**

| Product                    | Material Description                          | Extent | Location Reference | Material Condition                                     | Risk Status | Control Priority   |
|----------------------------|---|--------|--------------------|--|-------------|--------------------|
| Sample No                  |   |        |                    |  | Test Result |                    |
| Ceiling Structures/Linings | Flat AC Sheeting                              | 22m2   | All surfaces       | Good Condition (1)                                     | Low (1)     | Low Priority (2-3) |
|                            | 1009/B00E/R0004/Ceiling Structures/Linings/S9 |        |                    | Chrysotile (white asbestos) , Amosite (brown asbestos) |             |                    |

2017



| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00F - General Learning - 1927 - Brick/Block (Brick/Block)****Exterior**

|                          |                                       |      |                               |                    |         |   |
|--------------------------|---------------------------------------|------|-------------------------------|--------------------|---------|---|
| Infill Panels to Windows | Compressed AC Sheet                   | 6m2  | North facing,<br>South facing | Good Condition (1) | Low (1) | Low Priority (2-3)  |
|                          | 1009/B00F/Infill Panels to Windows/S1 |      |                               |                    |         | <b>Chrysotile (white asbestos)</b>  |
| Eaves Linings            | Fibre Cement Casting (Monocrete)      | 20m2 | South                         | Good Condition (1) | Low (1) | Low Priority (2-3)  |
|                          | 1009/B00F/Eaves Linings/S2            |      |                               |                    |         | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>                               |
| Ceiling Voids            | No Asbestos Found                     |      |                               |                    |         |   |
| Underfloor Voids         | No Asbestos Found                     |      |                               |                    |         |   |
| Gable Verge Lining       | Flat AC Sheeting                      | 30m  | East & West                   | Good Condition (1) | Low (1) | Low Priority (2-3)  |
|                          | 1009/B00F/Gable Verge Lining/S14      |      |                               |                    |         | <b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b> |

**Interior****B00F - R0001 - Movement**

No Asbestos

**B00F - R0002 - Movement**

|                            |  |      |               |                    |         |   |
|----------------------------|--|------|---------------|--------------------|---------|---|
| In-fill-panel below Window | Compressed AC Sheet                          | 4m2  | South facing  | Good Condition (1) | Low (1) | Low Priority (2-3)  |
|                            | 1009/B00F/Infill Panels to Windows/S1        |      |               |                    |         | <b>Chrysotile (white asbestos)</b>                            |
| Window In-fill-panel       | Flat AC Sheeting                             | 2m2  | Above windows | Good Condition (1) | Low (1) | Low Priority (2-3)  |
|                            | 1009/B00F/R0002/Infill Panel Above window/S6 |      |               |                    |         | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
| Ceiling Structures/Linings | Fibre Cement Casting (Monocrete)             | 17m2 | Throughout    | Good Condition (1) | Low (1) | Low Priority (2-3)  |
|                            | 1009/B00F/Eaves Linings/S2                   |      |               |                    |         | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |

**B00F - R0003 - Personal Effects Storage**

|                             |   |  |  |  |  |                             |
|-----------------------------|---|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet)       |  |  |  |  | <b>No Asbestos Detected</b> |
|                             | 1009/B00F/R0003/Floor Coverings Res/Textile/S12 |  |  |  |  |                             |
| Floor Coverings Res/Textile | Adhesive  |  |  |  |  | <b>No Asbestos Detected</b> |
|                             | 1009/B00F/R0003/Floor Coverings Res/Textile/S13 |  |  |  |  |                             |

**B00F - R0004 - Home Base Store**

|                             |   |  |  |  |  |                             |
|-----------------------------|---|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles                                     |  |  |  |  | <b>No Asbestos Detected</b> |
|                             | 1009/B00F/R0003/Floor Coverings Res/Textile/S12 |  |  |  |  |                             |
| Floor Coverings Res/Textile | Adhesive  |  |  |  |  | <b>No Asbestos Detected</b> |
|                             | 1009/B00F/R0003/Floor Coverings Res/Textile/S13 |  |  |  |  |                             |

**B00F - R0005 - Home Base**

No Asbestos

**B00F - R0006 - Covered Walkway**

|                            |                                  |     |            |                    |         |   |
|----------------------------|----------------------------------|-----|------------|--------------------|---------|---|
| Ceiling Structures/Linings | Fibre Cement Casting (Monocrete) | 8m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3)  |
|                            | 1009/B00F/Eaves Linings/S2       |     |            |                    |         | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00G - Staff Facilities - 1950 - Timber (Timber)**

**Exterior**

|                  |   |  |  |  |  |                      |
|------------------|---|--|--|--|--|----------------------|
| Eaves Linings    | Flat AC Sheeting<br>1009/B00C/Eaves Linings/S5        |  |  |  |  | No Asbestos Detected |
| Ceiling Voids    | Non Accessible Area<br>- Height Restriction 4m height |  |  |  |  |                      |
| Underfloor Voids | No Asbestos Found                                     |  |  |  |  |                      |

**Interior**

**B00G - R0001 - Movement**

|                             |   |  |  |  |  |                      |
|-----------------------------|---|--|--|--|--|----------------------|
| Floor Coverings Res/Textile | Vinyl Tiles<br>1009/B00C/R0003/Floor Coverings Res/Textile/S3 |  |  |  |  | No Asbestos Detected |
|-----------------------------|---|--|--|--|--|----------------------|

**B00G - R0002 - Staff Room**

|                             |  |  |  |  |  |                      |
|-----------------------------|--|--|--|--|--|----------------------|
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet)<br>1009/B00F/R0003/Floor Coverings Res/Textile/S12 |  |  |  |  | No Asbestos Detected |
| Floor Coverings Res/Textile | Adhesive<br>1009/B00F/R0003/Floor Coverings Res/Textile/S13                                  |  |  |  |  | No Asbestos Detected |

**B00G - R0003 - General Storeroom**

|                             |  |      |              |                    |         |   |
|-----------------------------|--|------|--------------|--------------------|---------|---|
| Floor Coverings Res/Textile | Vinyl Tiles<br>1009/B00C/R0003/Floor Coverings Res/Textile/S3    |      |              |                    |         | No Asbestos Detected  |
| Wall Linings Internal       | Flat AC Sheeting<br>1009/B00F/R0002/Infill Panel Above window/S6 | 30m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)<br><b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
| Floor Coverings Res/Textile | Adhesive<br>1009/B00F/R0003/Floor Coverings Res/Textile/S13      |      |              |                    |         | No Asbestos Detected  |

**B00G - R0004 - Sick Bay**

|                             |   |  |  |  |  |                      |
|-----------------------------|---|--|--|--|--|----------------------|
| Floor Coverings Res/Textile | Vinyl Tiles<br>1009/B00C/R0003/Floor Coverings Res/Textile/S3 |  |  |  |  | No Asbestos Detected |
|-----------------------------|---|--|--|--|--|----------------------|

**B00G - R0005 - Distribution Board**

No Asbestos Note: No inspection of live electrical installation.

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00H - General Learning - 1950 - Timber (Timber)**

**Exterior**

|                  |   |  |  |  |  |  |
|------------------|---|--|--|--|--|--|
| Underfloor Voids | No Asbestos Found                                     |  |  |  |  |  |
| Ceiling Voids    | Non Accessible Area<br>- Height Restriction 4m height |  |  |  |  |  |

**Interior**

**B00H - R0001 - Withdrawal Space - 1hb**

|                             |   |  |  |  |  |                             |
|-----------------------------|---|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles                                     |  |  |  |  |                             |
|                             | 1009/B00C/R0003/Floor Coverings Res/Textile/S3  |  |  |  |  | <b>No Asbestos Detected</b> |
| Floor Coverings Res/Textile | Adhesive  |  |  |  |  |                             |
|                             | 1009/B00B/R0002/Floor Coverings Res/Textile/S17 |  |  |  |  | <b>No Asbestos Detected</b> |

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00I - Library - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

|                                   |  |
|-----------------------------------|--|
| Underfloor Voids - Slab on Ground | Non Accessible Area<br>- Area inaccessible |
| Ceiling Voids                     | No Asbestos Found                          |

**Interior**

**B00I - R0001 - Reading Area**

No Asbestos

**B00I - R0002 - Library Office/Workroom**

No Asbestos

**B00I - R0003 - General Storeroom**

No Asbestos

**B00I - R0004 - Communications Room**

No Asbestos

**B00I - R0005 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017