


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Albion Park Public School (1015)
Region : Illawarra and South East
State Electorate : Kiama
Local Government Area : Shellharbour

Initial Survey : Noel Arnold & Associates : 30 - Mar - 2008
Reviewed By : AECOM : 18 - Jun - 2015

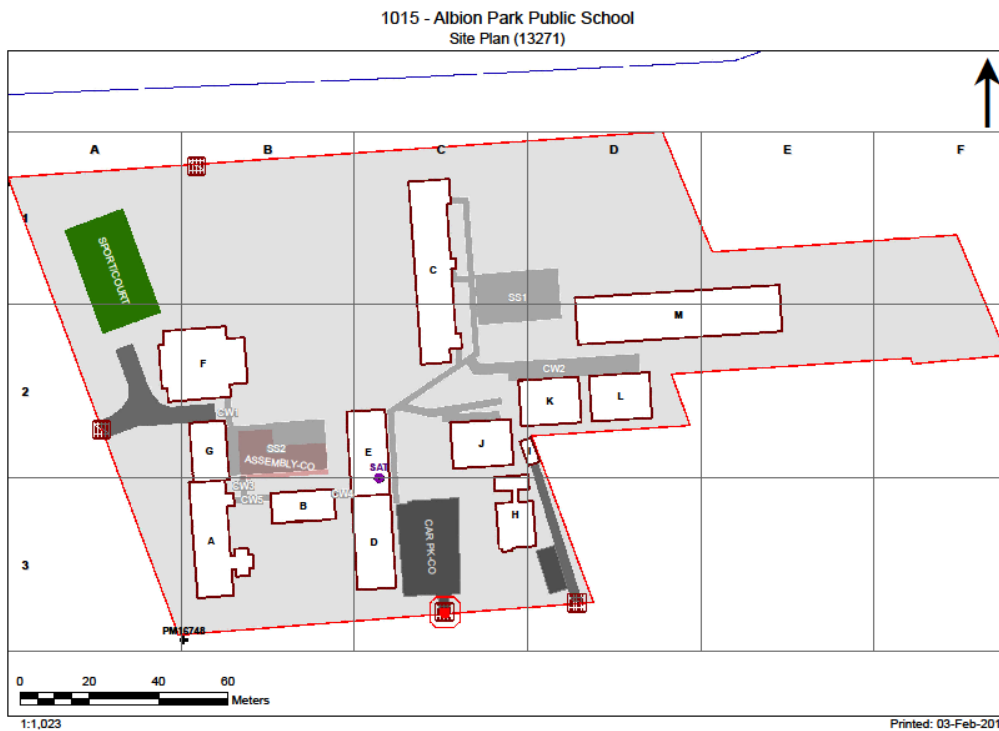

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1963 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	56m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1015/B00A/Eaves Linings/S1					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	58m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1015/B00C/In-fill-panel/S7					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00A - R0001 - Home Base (53.63 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1015/B00A/R0019/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Wall Linings Internal	Vermiculite					Limited Samples Taken
	1015/B00A/R0019/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0002 - Practical Activities - 1hb (11.11 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1015/B00A/R0019/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Wall Linings Internal	Vermiculite					Limited Samples Taken
	1015/B00A/R0019/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0003 - Home Base Store (5.51 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1015/B00A/R0019/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Wall Linings Internal	Vermiculite					Limited Samples Taken
	1015/B00A/R0019/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0004 - Movement (22.02 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1015/B00A/R0019/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Wall Linings Internal	Vermiculite					Limited Samples Taken
	1015/B00A/R0019/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0005 - Movement (7.33 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1015/B00A/R0018/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00A - R0006 - Movement (7.55 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1015/B00A/R0018/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00A - R0008 - Home Base Store (5.93 m2)

No Asbestos

B00A - R0012 - Home Base Store (4.13 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1015/B00A/R0019/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
Wall Linings Internal	Vermiculite 1015/B00A/R0019/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0013 - Movement (56.68 m2)						
Ceiling Structures/Linings	Vermiculite 1015/B00A/R0019/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Wall Linings Internal	Vermiculite 1015/B00A/R0019/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0014 - Cleaning Supplies (16.07 m2)						
No Asbestos						
B00A - R0015 - Withdrawal Space - 1hb (19 m2)						
Ceiling Structures/Linings	Vermiculite 1015/B00A/R0019/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1015/B00A/R0015/Floor Coverings Res/Textile/S13	19m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00A - R0016 - Cleaning Distributed Store (3.35 m2)						
Ceiling Structures/Linings	Vermiculite 1015/B00A/R0019/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0017 - Staff Toilet (3.25 m2)						
Ceiling Structures/Linings	Vermiculite 1015/B00A/R0019/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Wall Linings Internal	Vermiculite 1015/B00A/R0019/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0018 - Movement (7.04 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1015/B00A/R0018/Ceiling Structures/Linings/S2	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00A - R0019 - Stairs (0.84 m2)						
Ceiling Structures/Linings	Vermiculite 1015/B00A/R0019/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Wall Linings Internal	Vermiculite 1015/B00A/R0019/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0020 - Practical Activities (7.98 m2)						
Ceiling Structures/Linings	Vermiculite 1015/B00A/R0019/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0021 - Home Base (57.02 m2)						
Ceiling Structures/Linings	Vermiculite 1015/B00A/R0019/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0022 - Home Base (56.95 m2)						
Ceiling Structures/Linings	Vermiculite 1015/B00A/R0019/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0023 - Practical Activities (9.56 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Vermiculite
 1015/B00A/R0019/Ceiling Structures/Linings/S3 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R1001 - Home Base (53.82 m2)
 No Asbestos

B00A - R1002 - Home Base Store (5.01 m2)
 No Asbestos

B00A - R1003 - Practical Activities - 1hb (11.34 m2)
 No Asbestos

B00A - R1005 - Home Base Store (4.25 m2)
 No Asbestos

B00A - R1008 - Home Base Store (4.16 m2)
 No Asbestos

B00A - R1010 - Movement (61.29 m2)
 No Asbestos

B00A - R1011 - Withdrawal Space - 1hb (20.21 m2)
 No Asbestos

B00A - R1012 - Staff Room Annexe (19.03 m2)
 Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet) 19m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 1015/B00A/R1012/Floor Coverings Res/Textile/S14 **Chrysotile (white asbestos)**

B00A - R1013 - Cleaning Distributed Store (3.37 m2)
 No Asbestos

B00A - R1014 - Staff Toilet (3.25 m2)
 No Asbestos

B00A - R1015 - Stairs (12.37 m2)
 No Asbestos

B00A - R1016 - Practical Activities (9.64 m2)
 No Asbestos

B00A - R1017 - Home Base (56.88 m2)
 No Asbestos

B00A - R1018 - Home Base (56.88 m2)
 No Asbestos

B00A - R1019 - Practical Activities (9.7 m2)
 No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Tiered Learning - 1892 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	------------	--------------------	---------	--------------------

Assumed Asbestos - Height Restriction

Ceiling Voids	Non Accessible Area - Height Restriction					
---------------	---	--	--	--	--	--

Underfloor Voids - Slab on Ground	No Asbestos Found					
-----------------------------------	-------------------	--	--	--	--	--

Interior

B00B - R0001 - Staff Room Annexe (27.02 m2)

No Asbestos

B00B - R0002 - Special Programs Room (49.47 m2)

No Asbestos

B00B - R0003 - Special Programs Store (2.18 m2)

Wall Linings Internal	Flat AC Sheeting 1015/B00B/R0003/Wall Linings Internal/S4					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00B - R0004 - General Storeroom (3.55 m2)

Wall Linings Internal	Flat AC Sheeting 1015/B00B/R0003/Wall Linings Internal/S4					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00B - R0005 - General Storeroom (6.71 m2)

Wall Linings Internal	Flat AC Sheeting 1015/B00B/R0003/Wall Linings Internal/S4					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00B - R0006 - Plant (8.58 m2)

Wall Linings Internal	Flat AC Sheeting 1015/B00B/R0003/Wall Linings Internal/S4					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00B - R0007 - Movement (44.3 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1015/B00B/R0007/Ceiling Structures/Linings/S9					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

Wall Linings Internal	Flat AC Sheeting 1015/B00C/R0022/Ceiling Structures/Linings/S5	2m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	---	-----	------------	--------------------	---------	--------------------

Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Support Unit - 1963 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	26m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1015/B00C/R0022/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	34m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1015/B00C/In-fill-panel/S7				Chrysotile (white asbestos)	
Wall Cladding	Flat AC Sheeting	1m2	Above door-South Entrance	Good Condition (1)	Low (1)	Low Priority (2-3)
	1015/B00C/R0022/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1015/B00C/R0022/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	AC Fragments/Debris	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	1015/B00C/Underfloor Voids - Slab on Ground/S15				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

Interior**B00C - R0005 - Practical Activities - M - 1hb (10.95 m2)**

No Asbestos

B00C - R0006 - Home Base - M (62.18 m2)

No Asbestos

B00C - R0007 - Practical Activities - 1hb (6.95 m2)

No Asbestos

B00C - R0008 - Home Base (66.15 m2)

No Asbestos

B00C - R0009 - Craft Store (14.57 m2)

No Asbestos

B00C - R0010 - Movement (7.89 m2)

No Asbestos

B00C - R0011 - Cleaning Distributed Store (5.74 m2)

No Asbestos

B00C - R0012 - Practical Activities - 1hb (3.67 m2)

No Asbestos

B00C - R0013 - Home Base (69.6 m2)

No Asbestos

B00C - R0014 - Home Base (85.35 m2)

No Asbestos

B00C - R0015 - Practical Activities - 1hb (2.4 m2)

No Asbestos

B00C - R0016 - Toilets - Boys/Girls (4.8 m2)

No Asbestos

B00C - R0017 - Home Base Store (3.29 m2)

No Asbestos

B00C - R0018 - General Storeroom (2.78 m2)

No Asbestos

B00C - R0019 - Movement (11.24 m2)

No Asbestos

B00C - R0020 - Withdrawal Space - 1hb (15.63 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
B00C - R0021 - Staff Toilet (4.45 m2)						
No Asbestos						
B00C - R0022 - Movement (85.14 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	86m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1015/B00C/R0022/Ceiling Structures/Linings/S5						Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	2m2	South Entrance	Good Condition (1)	Low (1)	Low Priority (2-3)
1015/B00C/R0022/Ceiling Structures/Linings/S5						Chrysotile (white asbestos)
B00C - R0023 - Movement (2.61 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
1015/B00C/R0023/Ceiling Structures/Linings/S6						No Asbestos Detected
B00C - R0024 - Stairs (6.72 m2)						
No Asbestos						
B00C - R0025 - Access Shower/Toilet (14.31 m2)						
No Asbestos						
B00C - R0026 - Toilets - Boys/Girls (4.06 m2)						
No Asbestos						
B00C - R0027 - Home Base Store - M (2.48 m2)						
No Asbestos						
B00C - R0028 - Home Base Store - M (6.96 m2)						
No Asbestos						
B00C - R9001 - General Assistant/Bulk Store (30.96 m2)						
No Asbestos						
B00C - R9002 - Toilets - Boys (40.18 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
1015/B00C/R9002/Ceiling Structures/Linings/S8						No Asbestos Detected
B00C - R9003 - Kiln Room (5.02 m2)						
No Asbestos						
B00C - R9004 - Toilets - Girls (40.59 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout except entrance.	Good Condition (1)	Low (1)	Low Priority (2-3)
1015/B00C/R0022/Ceiling Structures/Linings/S5						Chrysotile (white asbestos)
B00C - R9005 - Staff Toilet (1.31 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout except entrance.	Good Condition (1)	Low (1)	Low Priority (2-3)
1015/B00C/R0022/Ceiling Structures/Linings/S5						Chrysotile (white asbestos)
B00C - R9006 - Movement (3.8 m2)						
No Asbestos						
B00C - R9007 - Stairs (4.03 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Administration - 1963 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00D - R0001 - Movement (7.94 m2)**

No Asbestos

B00D - R0002 - Entry Vestibule (21.49 m2)Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00D - R0003 - Clerical Office/Workroom (17.48 m2)**Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00D - R0004 - Duplicating Workroom (19.72 m2)**

No Asbestos

B00D - R0005 - Principal (16.73 m2)Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00D - R0006 - Security Store (18.31 m2)**

No Asbestos

B00D - R0007 - Staff Toilet (4.82 m2)

No Asbestos

B00D - R0008 - Staff Toilet (4.82 m2)

No Asbestos

B00D - R0009 - Staff Toilet (4.82 m2)

No Asbestos

B00D - R0010 - Movement (33.66 m2)Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00D - R0011 - Cleaning Distributed Store (2.79 m2)**

No Asbestos

B00D - R0012 - Staff Room (61.57 m2)Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00D - R0013 - Distribution Board (0.5 m2)**

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0014 - Sick Bay (8.61 m2)

No Asbestos

B00D - R0015 - Deputy Principal (13.01 m2)Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00D - R0016 - Deputy Principal (13.09 m2)**Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00D - R0017 - Interview (13.09 m2)**Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00D - R0018 - Sick Bay - Shower/Toilet (7.33 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library - 1963 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00E - R0001 - Movement (55.56 m2)

No Asbestos

B00E - R0002 - Distribution Board (0.72 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00E - R0004 - Security Store (11.9 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0005 - Library Office/Workroom (23.46 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0006 - Reading Area (153.15 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0007 - Library Office/Workroom (10.17 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00F - Communal Facilities/Pupil Facilities - 1963 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00F - R0001 - Toilets - Boys (6.46 m2)**

No Asbestos

B00F - R0002 - Communal Space (170.07 m2)

No Asbestos

B00F - R0003 - Raised Platform (37 m2)

No Asbestos

B00F - R0004 - Shower/Change (2.69 m2)

No Asbestos

B00F - R0005 - Toilets - Girls (7.92 m2)

No Asbestos

B00F - R0006 - Garden Store (6.14 m2)

No Asbestos

B00F - R0007 - Cleaning Distributed Store (5.76 m2)

No Asbestos

B00F - R0008 - Cleaning Supplies (8.77 m2)

No Asbestos

B00F - R0009 - P.E. Store (8.87 m2)

No Asbestos

B00F - R0010 - Disabled Toilet (5.47 m2)

No Asbestos

B00F - R0011 - Out Of School Hours Care Centre (3.6 m2)

No Asbestos

B00F - R0012 - Sports Store (13.18 m2)

No Asbestos

B00F - R0013 - General Assistant/Bulk Store (16.06 m2)

No Asbestos

B00F - R0014 - Plant (0.58 m2)

No Asbestos

B00F - R0015 - Hall Chair Store (13 m2)

No Asbestos

B00F - R0016 - Plant (0.63 m2)

No Asbestos

B00F - R0017 - Canteen (24.72 m2)

No Asbestos

B00F - R0018 - Canteen Office/Store (9.04 m2)

No Asbestos

B00F - R0019 - Distribution Board (0.77 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0020 - Movement (71.39 m2)

No Asbestos

B00F - R0021 - Movement (4.45 m2)

No Asbestos

B00F - R0022 - Movement (4.47 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 1963 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	14m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1015/B00A/Eaves Linings/S1					Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00G - R0001 - Movement (21.1 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1015/B00A/Eaves Linings/S1					Chrysotile (white asbestos)

B00G - R0002 - Movement (21.56 m2)

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1015/B00A/Eaves Linings/S1					Chrysotile (white asbestos)

B00G - R0003 - Toilets - Girls (57.09 m2)

Ceiling Structures/Linings	Flat AC Sheeting	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1015/B00A/Eaves Linings/S1					Chrysotile (white asbestos)

B00G - R0004 - Cleaning Distributed Store (2.62 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1015/B00A/Eaves Linings/S1					Chrysotile (white asbestos)

B00G - R0005 - Toilets - Boys (60.4 m2)

Ceiling Structures/Linings	Flat AC Sheeting	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1015/B00A/Eaves Linings/S1					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Other-Regional Use - 1892 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	18m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00H - R0001 - Other - Regional Use (18.67 m2)

No Asbestos

B00H - R0002 - Other - Regional Use (4.15 m2)

No Asbestos

B00H - R0003 - Other - Regional Use (16.64 m2)

No Asbestos

B00H - R0004 - Other - Regional Use (22.19 m2)

No Asbestos

B00H - R0005 - Other - Regional Use (14.63 m2)

No Asbestos

B00H - R0006 - Other - Regional Use (15.33 m2)

No Asbestos

B00H - R0007 - Other - Regional Use (4.43 m2)

Wall Linings Internal	Flat AC Sheeting	5m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
1015/B00H/R0007/Wall Linings Internal/S10				Chrysotile (white asbestos)		

B00H - R0008 - Other - Regional Use (1.33 m2)

No Asbestos

B00H - R0009 - Other - Regional Use (10.28 m2)

No Asbestos

B00H - R0010 - Other - Regional Use (15.43 m2)

No Asbestos

B00H - R0011 - Other - Regional Use (3.94 m2)

No Asbestos

B00H - R0012 - Other - Regional Use (3.66 m2)

No Asbestos

B00H - R0013 - Other - Regional Use (9.59 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
1015/B00H/R0013/Floor Coverings Res/Textile/S11						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1015/B00H/R0013/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)		

B00H - R0014 - Other - Regional Use (8.95 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Other-Regional Use - 1963 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B001 - R0001 - Other - Regional Use (24.09 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 2004 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00J - R0001 - Movement (38.48 m2)

No Asbestos

B00J - R0002 - Practical Activities - 1hb (19.4 m2)

No Asbestos

B00J - R0003 - Home Base Store (6.02 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0004 - Home Base (59.2 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0005 - Withdrawal Space - 2hb (11.36 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0006 - Home Base (59.2 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0007 - Home Base Store (6.02 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0008 - Practical Activities - 1hb (19.4 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning - 2005 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00K - R0001 - Movement (38.47 m2)

No Asbestos

B00K - R0002 - Practical Activities - 1hb (19.4 m2)

No Asbestos

B00K - R0003 - Home Base Store (6.02 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0004 - Home Base (59.2 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0005 - Withdrawal Space - 2hb (11.36 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0006 - Home Base (59.19 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0007 - Home Base Store (6.02 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0008 - Practical Activities - 1hb (19.41 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning - 2005 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00L - R0001 - Movement (38.47 m2)

No Asbestos

B00L - R0002 - Practical Activities - 1hb (19.4 m2)

No Asbestos

B00L - R0003 - Home Base Store (6.02 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0004 - Home Base (59.2 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0005 - Withdrawal Space - 2hb (11.36 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0006 - Home Base (59.19 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0007 - Home Base Store (6.02 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0008 - Practical Activities - 1hb (19.41 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00M - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00M - R0001 - P.E. Store (13.3 m2)**

No Asbestos

B00M - R0002 - General Assistant/Bulk Store (16.56 m2)

No Asbestos

B00M - R0003 - Garden Store (13.31 m2)

No Asbestos

B00M - R0004 - External Movement (136.24 m2)

No Asbestos

B00M - R0005 - Practical Activities (19.2 m2)

No Asbestos

B00M - R0006 - Home Base Store (6.28 m2)

No Asbestos

B00M - R0007 - Home Base (61.06 m2)

No Asbestos

B00M - R0008 - Withdrawal Space - 2hb (11.78 m2)

No Asbestos

B00M - R0009 - Home Base (61.82 m2)

No Asbestos

B00M - R0010 - Home Base Store (6.34 m2)

No Asbestos

B00M - R0011 - Practical Activities (19.42 m2)

No Asbestos

B00M - R0012 - Practical Activities (19.54 m2)

No Asbestos

B00M - R0013 - Home Base Store (6.63 m2)

No Asbestos

B00M - R0014 - Home Base (61.46 m2)

No Asbestos

B00M - R0015 - Withdrawal Space - 2hb (11.81 m2)

No Asbestos

B00M - R0016 - Home Base (61.71 m2)

No Asbestos

B00M - R0017 - Home Base Store (6.34 m2)

No Asbestos

B00M - R0018 - Practical Activities (19.44 m2)

No Asbestos

B00M - R0019 - Practical Activities (19.45 m2)

No Asbestos

B00M - R0020 - Home Base Store (6.34 m2)

No Asbestos

B00M - R0021 - Home Base (61.79 m2)

No Asbestos

B00M - R0022 - Withdrawal Space - 2hb (11.78 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00M - R0023 - Home Base (61.25 m2)

No Asbestos

B00M - R0024 - Home Base Store (6.34 m2)

No Asbestos

B00M - R0025 - Practical Activities (19.29 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

1015_ASB_010713_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017