


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Albury Public School (1017)
Region : Riverina
State Electorate : Albury
Local Government Area : Albury

Initial Survey : Noel Arnold & Associates : 11 - Mar - 2008
Reviewed By : AECOM : 29 - Oct - 2014

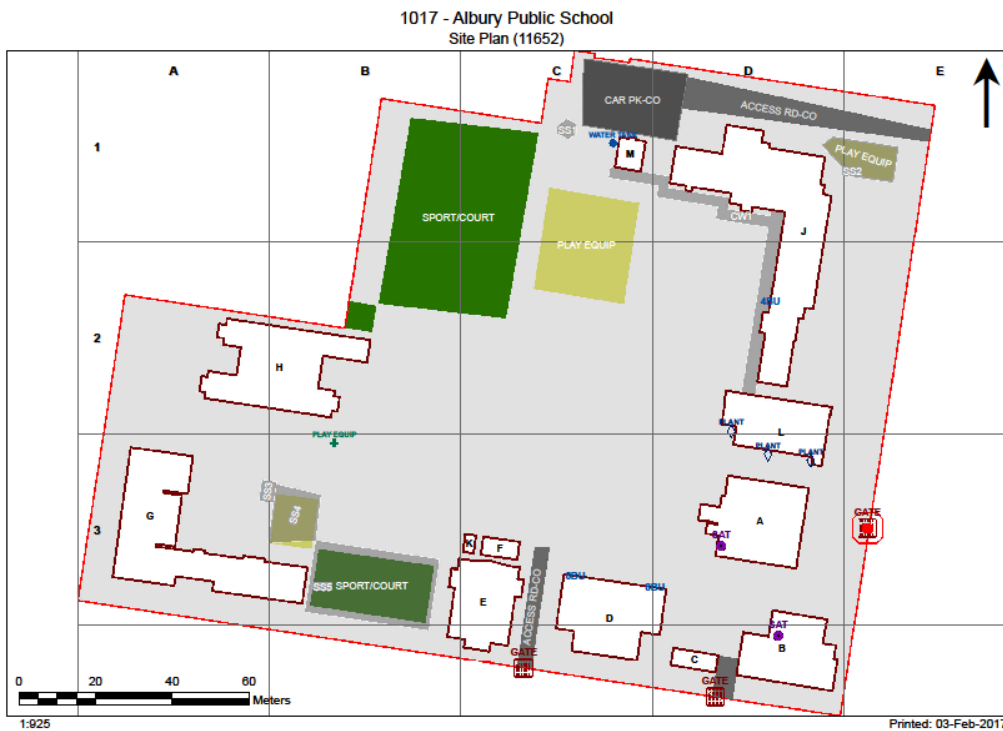

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Library - 1964 - Brick/Block (Brick/Block)**Exterior**

In-fill panels under windows	Flat AC Sheeting	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00A/New Exterior/S1					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground						
Ceiling Voids	Non Accessible Area - Area inaccessible - Generally vermiculite/slab to lower level. No access to cavity on upper level via AR1004 due to storage.					

Interior**B00A - R0001 - Movement (84.51 m2)**

No Asbestos

B00A - R0002 - Deputy Principal (14.07 m2)

Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0003 - Entry Vestibule (20.69 m2)

Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00A/R0012/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00A - R0004 - Clerical Office (29.28 m2)

Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00A/R0012/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00A - R0005 - Principal (16.1 m2)

Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0006 - Staff Toilet (2.21 m2)

Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0007 - General Storeroom (1.55 m2)

Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00A/R0012/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00A - R0008 - Duplicating Workroom (10.68 m2)

Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0009 - Staff Room Annexe (14.88 m2)

Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0010 - Staff Room (75.19 m2)

Register Issue Date : Friday, 07 Jul 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00A - R0011 - Staff Kitchen (6.54 m2)						
Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles					
	1017/B00A/R0011/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00A - R0012 - Movement (29.91 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00A/R0012/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00A - R0013 - Distribution Board (0.39 m2)						
Note: No inspection of live electrical installation.						
Internal door lining	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00A/R0013/Internal door lining/S5					Chrysotile (white asbestos)
B00A - R0014 - Cleaning Supplies (2.86 m2)						
Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00A/R0012/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0015 - Sick Bay (21.77 m2)						
Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00A - R0016 - Staff Toilet (8.52 m2)						
Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00A - R0017 - Staff Toilet (10.52 m2)						
Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00A - R0018 - Staff Toilet (3.21 m2)						
Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00A - R0019 - General Storeroom (11.24 m2)						
Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00A/R0012/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0020 - Security Store (15.44 m2)						
Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1017/B00A/R0012/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B00A - R0021 - General Storeroom (10.57 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
1017/B00A/R0012/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1017/B00A/R0012/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B00A - R0022 - Movement (15.1 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
1017/B00A/R0012/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00A - R0023 - Stairs (12.71 m2)						
No Asbestos						
B00A - R0024 - Lift (2.24 m2)						
No Asbestos						
B00A - R1001 - Reading Area (214.64 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
1017/B00A/R0012/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00A - R1002 - Reading Area (52.81 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
1017/B00A/R0012/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00A - R1003 - Movement (19.73 m2)						
No Asbestos						
B00A - R1004 - K.L.A. Store (19.09 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
1017/B00A/R0012/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00A - R1005 - Library Office/Workroom (6.26 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
1017/B00A/R0012/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00A - R1006 - Distribution Board (0.41 m2)						
				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1017/B00A/R0013/Internal door lining/S5				Chrysotile (white asbestos)		
B00A - R1007 - Toilets - Boys (3.47 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
1017/B00A/R0012/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00A - R1008 - Toilets - Girls (3.46 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
1017/B00A/R0012/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00A - R1009 - Cleaning Supplies (1.56 m2)						
No Asbestos						
B00A - R1010 - Library Office/Workroom (12.77 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
1017/B00A/R0012/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - R1011 - Library Office/Workroom (12.66 m2)

Ceiling Structures/Linings Vermiculite
 1017/B00A/R0012/Ceiling Structures/Linings/S3

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R1012 - Stairs (8.58 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Other-D.E.C. Admin/General Learning - 1891 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids	Non Accessible Area - Area inaccessible - slab on ground and/or no designated access point identified.
Ceiling Voids	Non Accessible Area - Height Restriction - Fixed ceilings to lower level approximately 5m high. Ceilings to upper level approximately 5m high. No asbestos identified via access hatches above BR0007 and BR1003.

Interior

B00B - R0001 - Entry Vestibule (8.52 m2)

No Asbestos

B00B - R0002 - Other - Regional Use (20.68 m2)

No Asbestos

B00B - R0003 - Other - Regional Use (20.8 m2)

No Asbestos

B00B - R0004 - Other - Regional Use (25.52 m2)

No Asbestos

B00B - R0005 - Other - Regional Use (80.39 m2)

No Asbestos

B00B - R0006 - Staff Toilet (8.14 m2)

No Asbestos

B00B - R0007 - General Storeroom (17.76 m2)

No Asbestos

B00B - R0008 - Security Store (3.63 m2)

No Asbestos

B00B - R0009 - Staff Kitchen (20.59 m2)

No Asbestos

B00B - R0011 - General Storeroom (18.74 m2)

No Asbestos

B00B - R0012 - Movement (4.32 m2)

No Asbestos

B00B - R0013 - Cleaning Distributed Store (3.19 m2)

No Asbestos

B00B - R0014 - Other - Regional Use (47.01 m2)

No Asbestos

B00B - R0015 - Movement (30.5 m2)

No Asbestos

B00B - R1001 - Home Base (49.16 m2)

No Asbestos

B00B - R1003 - Movement (77.17 m2)

No Asbestos

B00B - R1004 - Home Base (49.88 m2)

No Asbestos

B00B - R1005 - Home Base (49.29 m2)

No Asbestos

B00B - R1006 - Home Base (49.44 m2)

No Asbestos

B00B - R1007 - General Storeroom (4.24 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00B - R1008 - Staff Toilet (4.28 m2)

No Asbestos

B00B - R1009 - Staff Room Annexe (18.53 m2)

No Asbestos

B00B - R1010 - General Storeroom (3.81 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1920 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground

Ceiling Voids Non Accessible Area
- Area inaccessible - Generally fixed ceilings

Interior

B00C - R0001 - Staff Toilet (7.21 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1017/B00C/R0001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00C - R0002 - Toilets - Boys (20 m2)

Ceiling Structures/Linings	Flat AC Sheeting	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1017/B00C/R0001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00C - R0003 - Sports Store (13.12 m2)

Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1017/B00C/R0001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00C - R0004 - Staff Toilet (1.28 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1017/B00C/R0001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities/Communal Facilities - 1964 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground

Ceiling Voids Non Accessible Area
- Area inaccessible - fixed raked ceilings to main hall. Fixed ceilings to canteen.

Interior**B00D - R0001 - Toilets - Girls (47.08 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00D/R0001/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00D/R0001/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)

B00D - R0002 - Communal Space (279.56 m2)

Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

B00D - R0003 - General Storeroom (6.79 m2)

Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

B00D - R0004 - Staff Toilet (3.23 m2)

Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

B00D - R0005 - Staff Shower/Change (3.29 m2)

Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

Floor Coverings Res/Textile	Vinyl Tiles					
	1017/B00D/R0005/Floor Coverings Res/Textile/S9					No Asbestos Detected

B00D - R0006 - Canteen (36.76 m2)

Ceiling Structures/Linings	Vermiculite					
	1017/B00A/R0012/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

B00D - R0007 - External Movement (46.46 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Building Services - 1964 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	28m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00E/R0006/Ceiling Structures/Linings/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Non Accessible Area - Area inaccessible - fixed ceilings					
Underfloor Voids - Packing to Floor Joists	Packing	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	1017/B00E/Underfloor Voids - Packing to Floor Joists/S18			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Underfloor Voids	AC Fragments/Debris	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	1017/B00E/Underfloor Voids/S19			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior

B00E - R0001 - Toilets - Boys (1.49 m2)

No Asbestos

B00E - R0002 - Movement (3.51 m2)

Switchboard cabinet lining	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00E/R0002/Switchboard cabinet lining/S10			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0003 - Handwashing Facilities (8.77 m2)

No Asbestos

B00E - R0004 - External Movement (7.43 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00E/R0006/Ceiling Structures/Linings/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0005 - Communal Space (222.37 m2)

No Asbestos

B00E - R0006 - External Movement (14.36 m2)

Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00E/R0006/Ceiling Structures/Linings/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0007 - External Movement (7.63 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00E/R0006/Ceiling Structures/Linings/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0008 - Movement (3.46 m2)

No Asbestos

B00E - R0009 - Toilets - Girls (1.5 m2)

No Asbestos

B00E - R0010 - Handwashing Facilities (8.85 m2)

No Asbestos

B00E - R0011 - Raised Platform (49.57 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Communal Facilities - 1947 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00F/Eaves Linings/S12					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground						
Ceiling Voids	No Asbestos Found					

Interior

B00F - R0001 - General Assistant/Bulk Store (16.23 m2)

No Asbestos

B00F - R0002 - General Storeroom (20.78 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1920 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground

Ceiling Voids Non Accessible Area
- Area inaccessible - height approximately 3.5-4 m.

Ceiling Voids Encapsulated Insulation material within unit
1017/B00G/Ceiling Voids/S20

No Asbestos Detected

Interior

B00G - R0001 - General Storeroom (3.66 m2)

No Asbestos

B00G - R0002 - Drinking Facilities (11.78 m2)

No Asbestos

B00G - R0003 - Staff Room (24.54 m2)

No Asbestos

B00G - R0004 - Home Base (47.55 m2)

No Asbestos

B00G - R0005 - Home Base (47.5 m2)

No Asbestos

B00G - R0006 - General Storeroom (12.84 m2)

No Asbestos

B00G - R0007 - Cleaning Supplies (3.5 m2)

Ceiling Structures/Linings Flat AC Sheeting 4m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)

1017/B00G/R0007/Ceiling Structures/Linings/S22

Chrysotile (white asbestos)

B00G - R0008 - Cleaning Supplies (2.68 m2)

No Asbestos

B00G - R0009 - General Storeroom (2.74 m2)

Ceiling Structures/Linings Flat AC Sheeting 3m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)

1017/B00G/R0007/Ceiling Structures/Linings/S22

Chrysotile (white asbestos)

B00G - R0010 - Security Store (3.5 m2)

No Asbestos

B00G - R0011 - Withdrawal Space - 1hb (15.38 m2)

No Asbestos

B00G - R0012 - Home Base (45.06 m2)

No Asbestos

B00G - R0013 - Home Base (56.04 m2)

Cupboard ceiling Flat AC Sheeting 2m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)

1017/B00G/R0013/Cupboard ceiling/S13

Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0014 - Movement (151.69 m2)

Wall Linings Internal Flat AC Sheeting
1017/B00G/R0014/Wall Linings Internal/S14

No Asbestos Detected

B00G - R0015 - Home Base (47.54 m2)

No Asbestos

B00G - R0016 - Home Base (49.22 m2)

No Asbestos

B00G - R0017 - Home Base (46.59 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00G - R0018 - Home Base (52.59 m2)						
No Asbestos						
B00G - R0019 - Practical Activities - 1hb (9.14 m2)						
No Asbestos						
B00G - R0020 - External Movement (2.09 m2)						
No Asbestos						
B00G - R0021 - Handwashing Facilities (0.87 m2)						
No Asbestos						
B00G - R0022 - External Movement (1.58 m2)						
No Asbestos						
B00G - R0023 - General Storeroom (0.52 m2)						
No Asbestos						
B00G - R0024 - Security Store (6.78 m2)						
No Asbestos						
B00G - R0025 - Toilets - Girls (3.37 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1017/B00G/R0026/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	
B00G - R0026 - Toilets - Boys (3.34 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1017/B00G/R0026/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	
B00G - R0027 - Toilets - Girls (3.37 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1017/B00G/R0026/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	
B00G - R0028 - External Movement (66.8 m2)						
Recently Modified Space	Requires Inspection					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning/Pupil Facilities - 1864 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids	Non Accessible Area - Area inaccessible - Slab on ground and/or no designated access point identified.
Ceiling Voids	Non Accessible Area - Area inaccessible - access hatch at 4-5m height in HR0030.

Interior**B00H - R0001 - Toilets - Boys (18.26 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00D/R0001/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00D/R0001/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00H/R0001/Wall Linings Internal/S15					Chrysotile (white asbestos)

B00H - R0002 - Toilets - Girls (14.25 m2)

Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00D/R0001/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00D/R0001/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1017/B00G/R0014/Wall Linings Internal/S14					

B00H - R0003 - Cleaning Supplies (2.06 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00D/R0001/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00H/R0001/Wall Linings Internal/S15					Chrysotile (white asbestos)

B00H - R0004 - General Storeroom (24.63 m2)

No Asbestos

B00H - R0005 - Home Base (46.78 m2)

No Asbestos

B00H - R0007 - Home Base (43.63 m2)

No Asbestos

B00H - R0008 - Home Base (58.8 m2)

No Asbestos

B00H - R0009 - Movement (4.32 m2)

No Asbestos

B00H - R0010 - External Movement (7.22 m2)

No Asbestos

B00H - R0011 - Movement (9.58 m2)

No Asbestos

B00H - R0014 - Movement (4.92 m2)

No Asbestos

B00H - R0015 - Home Base (44.28 m2)

No Asbestos

B00H - R0017 - Movement (84.11 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Bag rack lining	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1017/B00H/R0017/Bag rack lining/S16					Chrysotile (white asbestos)	

- B00H - R0018 - Home Base (62.66 m2)**
No Asbestos
- B00H - R0019 - Movement (6.81 m2)**
No Asbestos
- B00H - R0020 - General Storeroom (9.57 m2)**
No Asbestos
- B00H - R0021 - Movement (6.56 m2)**
No Asbestos
- B00H - R0022 - Staff Toilet (2.57 m2)**
No Asbestos
- B00H - R0023 - Drinking Facilities (5.32 m2)**
No Asbestos
- B00H - R0024 - Home Base (17.2 m2)**
No Asbestos
- B00H - R0025 - Home Base Store (11.48 m2)**
No Asbestos
- B00H - R0026 - Home Base (14.04 m2)**
No Asbestos
- B00H - R0027 - Sports Store (5.3 m2)**
No Asbestos
- B00H - R0028 - Plant (1.95 m2)**
No Asbestos
- B00H - R0029 - General Storeroom (8.29 m2)**
No Asbestos
- B00H - R0030 - Movement (8.59 m2)**
No Asbestos
- B00H - R0031 - Home Base (13.9 m2)**
No Asbestos
- B00H - R0032 - Home Base (29.64 m2)**
No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning/Pupil Facilities - 1941 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Area inaccessible - ceiling heights approximately 4m. Limited access via R10007 did not identify asbestos.					
Ceiling Voids	Encapsulated Insulation material within unit 1017/B00J/Ceiling Voids/S21					No Asbestos Detected
Underfloor Voids	Non Accessible Area - Area inaccessible - access generally restricted by construction materials/waste.					

Interior

B00J - R0001 - Staff Toilet (3.81 m2)						
No Asbestos						
B00J - R0002 - Staff Room Annexe (20.6 m2)						
No Asbestos						
B00J - R0003 - Movement (153.1 m2)						
No Asbestos						
B00J - R0004 - External Movement (2.16 m2)						
No Asbestos						
B00J - R0005 - Home Base (47.32 m2)						
No Asbestos						
B00J - R0008 - Home Base (47.45 m2)						
No Asbestos						
B00J - R0009 - External Movement (12.2 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00J/R0009/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)
B00J - R0010 - External Movement (12.03 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00J/R0009/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)
B00J - R0011 - External Movement (12.18 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00J/R0009/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)
B00J - R0012 - External Movement (12.2 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1017/B00J/R0009/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)
B00J - R0013 - Withdrawal Space - 1hb (11.9 m2)						
No Asbestos						
B00J - R0014 - External Movement (2.46 m2)						
No Asbestos						
B00J - R0015 - General Storeroom (10.47 m2)						
No Asbestos						
B00J - R0016 - External Movement (8 m2)						
No Asbestos						
B00J - R0017 - Cleaning Supplies (3.67 m2)						
No Asbestos						
B00J - R0024 - Raised Platform (32.78 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	33m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1017/B00J/R0009/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
B00J - R0025 - External Movement (1.99 m2)						
No Asbestos						
B00J - R0026 - Out Of School Hours Care Centre (136.02 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	137m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1017/B00J/R0009/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
B00J - R0027 - Home Base (64.75 m2)						
No Asbestos						
B00J - R0028 - External Movement (2.19 m2)						
No Asbestos						
B00J - R0029 - Home Base (47.43 m2)						
No Asbestos						
B00J - R0030 - Staff Room Annexe (26.15 m2)						
No Asbestos						
B00J - R0031 - Staff Toilet (4.59 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1017/B00J/R0009/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
B00J - R0032 - Music Store (5.59 m2)						
No Asbestos						
B00J - R0035 - External Movement (3.94 m2)						
No Asbestos						
B00J - R0036 - Cleaning Supplies (1.28 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1017/B00J/R0009/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
B00J - R0037 - Disabled Shower/Toilet (4.38 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1017/B00J/R0009/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
B00J - R0038 - Access Shower/Toilet (13.34 m2)						
No Asbestos						
B00J - R0039 - Other-After School Care (16.06 m2)						
No Asbestos						
B00J - R0040 - Home Base Store (2.69 m2)						
No Asbestos						
B00J - R0041 - Home Base (44.4 m2)						
No Asbestos						
B00J - R0042 - Home Base Store (4.22 m2)						
No Asbestos						
B00J - R0043 - Home Base (42.67 m2)						
No Asbestos						
B00J - R0044 - Covered Outdoor Learning Area (94.14 m2)						
No Asbestos						
B00J - R0045 - Stairs (4.18 m2)						
No Asbestos						
B00J - R0046 - Stairs (7.9 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00J - R1001 - Home Base (47.31 m2)						
No Asbestos						
B00J - R1002 - Home Base (47.51 m2)						
No Asbestos						
B00J - R1003 - Home Base (47.44 m2)						
No Asbestos						
B00J - R1004 - Home Base (47.31 m2)						
No Asbestos						
B00J - R1005 - General Storeroom (12.31 m2)						
No Asbestos						
B00J - R1006 - Withdrawal Space - 1hb (11.83 m2)						
No Asbestos						
B00J - R1007 - Movement (85.85 m2)						
No Asbestos						
B00J - R1008 - Stairs (14.96 m2)						
No Asbestos						
B00J - R1009 - Stairs (18.16 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Building Services - 1999 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00K - R0001 - Garden Store (10.49 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00L - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

No Asbestos

Interior**B00L - R0001 - Special Programs Room (37.68 m2)**

No Asbestos

B00L - R0002 - Special Programs Store (4.79 m2)

No Asbestos

B00L - R0003 - Special Programs Store (7.06 m2)

No Asbestos

B00L - R0004 - Main Switch Board (2.19 m2)

No Asbestos

B00L - R0005 - Home Base Store (6.13 m2)

No Asbestos

B00L - R0006 - Home Base (62.28 m2)

No Asbestos

B00L - R0007 - Practical Activities - 1hb (19.03 m2)

No Asbestos

B00L - R0008 - Withdrawal Space - 2hb (12.4 m2)

No Asbestos

B00L - R0009 - Home Base (62.02 m2)

No Asbestos

B00L - R0010 - Home Base Store (6.17 m2)

No Asbestos

B00L - R0011 - Practical Activities - 1hb (18.51 m2)

No Asbestos

B00L - R0012 - External Movement (79.17 m2)

No Asbestos

B00L - R0013 - Distribution Board (0.79 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00L - R0014 - External Stairs (7.16 m2)

No Asbestos

B00L - R1001 - Distribution Board (0.69 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00L - R1002 - Practical Activities - 1hb (19.75 m2)

No Asbestos

B00L - R1003 - Home Base Store (6.06 m2)

No Asbestos

B00L - R1004 - Home Base (60.9 m2)

No Asbestos

B00L - R1005 - Withdrawal Space - 2hb (11.8 m2)

No Asbestos

B00L - R1006 - Home Base (61.34 m2)

No Asbestos

B00L - R1007 - Home Base Store (6.06 m2)

No Asbestos

B00L - R1008 - Practical Activities - 1hb (19.15 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - R1009 - External Movement (56.85 m2)

No Asbestos

B00L - R1010 - External Stairs (22.45 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00M - Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

No Asbestos

Interior

B00M - R0001 - Toilets - Girls (22.61 m2)

No Asbestos

B00M - R0002 - Kiln Room (5.98 m2)

No Asbestos

B00M - R0003 - Toilets - Boys (16.5 m2)

No Asbestos

B00M - R0004 - Distribution Board (0.49 m2)

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017