


Asbestos Register

(Hazardous Materials and Risk Assessment)



School : Alma Public School (1028)
Region : Western NSW
State Electorate : Barwon
Local Government Area : Broken Hill

Initial Survey : Noel Arnold & Associates : 16 - Dec - 2009
Reviewed By : Greencap-NAA : 03 - Mar - 2015

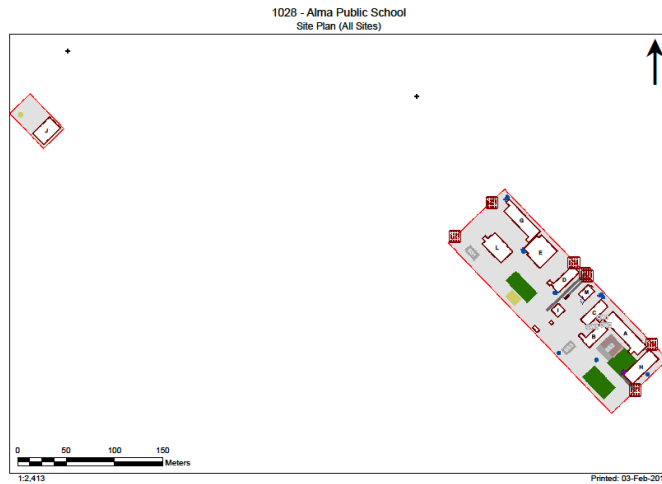

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1972 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	200m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1028/B00A/R0020/Wall Linings Internal/S14					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - Movement

Floor Coverings Res/Textile	Vinyl Tiles					
	1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00A - R0002 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles					
	1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00A - R0003 - Home Base

No Asbestos

B00A - R0004 - Movement

No Asbestos

B00A - R0005 - Home Base

No Asbestos

B00A - R0006 - Movement

Floor Coverings Res/Textile	Vinyl Tiles					
	1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00A - R0007 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles					
	1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00A - R0008 - Movement

No Asbestos

B00A - R0009 - Distribution Board

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	1m2	South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1028/B00A/R0020/Wall Linings Internal/S14					Chrysotile (white asbestos)

B00A - R0010 - Movement

Floor Coverings Res/Textile	Vinyl Tiles					
	1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00A - R0011 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles					
	1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00A - R0012 - Home Base

No Asbestos

B00A - R0013 - Home Base

No Asbestos

B00A - R0014 - Movement

Floor Coverings Res/Textile	Vinyl Tiles					
	1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00A - R0015 - Home Base Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
Floor Coverings Res/Textile	Vinyl Tiles					
	1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00A - R0016 - Movement						
No Asbestos						
B00A - R0017 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles					
	1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00A - R0018 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles					
	1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00A - R0019 - Home Base						
No Asbestos						
B00A - R0020 - Movement						
Wall Linings Internal	Flat AC Sheeting	4m2	Under south stairs	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1028/B00A/R0020/Wall Linings Internal/S14					Chrysotile (white asbestos)
B00A - R1001 - Movement						
No Asbestos						
B00A - R1002 - Home Base Store						
No Asbestos						
B00A - R1003 - Home Base						
No Asbestos						
B00A - R1004 - Movement						
No Asbestos						
B00A - R1005 - Home Base						
No Asbestos						
B00A - R1006 - Movement						
No Asbestos						
B00A - R1007 - Home Base Store						
No Asbestos						
B00A - R1008 - Movement						
No Asbestos						
B00A - R1009 - Distribution Board						
						Note: No inspection of live electrical installation.
Wall Linings Internal	Flat AC Sheeting	1m2	North, South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1028/B00A/R0020/Wall Linings Internal/S14					Chrysotile (white asbestos)
B00A - R1010 - Movement						
No Asbestos						
B00A - R1011 - Home Base Store						
No Asbestos						
B00A - R1012 - Home Base						
No Asbestos						
B00A - R1013 - Home Base						
No Asbestos						
B00A - R1014 - Movement						
No Asbestos						
B00A - R1015 - Home Base Store						
No Asbestos						
B00A - R1016 - Movement						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1017 - Movement						
No Asbestos						
B00A - R1018 - Home Base Store						
No Asbestos						
B00A - R1019 - Home Base						
No Asbestos						
B00A - R1020 - Movement						
No Asbestos						
B00A - R1021 - Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Communal Facilities - 1978 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1028/B00B/Eaves Linings/S7					Chrysotile (white asbestos)
Wall Cladding	Compressed AC Sheet	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible					
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

Interior

B00B - R0001 - Movement

No Asbestos

B00B - R0002 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0003 - Raised Platform

No Asbestos

B00B - R0004 - Communal Space

No Asbestos

B00B - R0005 - Sports Store

No Asbestos

B00B - R0006 - Staff Shower/Change

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	1028/B00B/R0006/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)

B00B - R0007 - Cleaning Supplies

No Asbestos

B00B - R0008 - Movement

No Asbestos

B00B - R1001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1028/B00B/R1001/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)

B00B - R1002 - Cleaning Distributed Store

No Asbestos

B00B - R1003 - Cleaning Supplies

Floor Coverings Res/Textile	Vinyl Tiles					
	1028/B00B/R1003/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00B - R1004 - Movement

Floor Coverings Res/Textile	Vinyl Tiles					
	1028/B00B/R1003/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00B - R1005 - Home Base

No Asbestos

B00B - R1006 - Home Base

No Asbestos

B00B - R1007 - Home Base

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - Staff Facilities/Pupil Facilities - 1960 - Brick/Block (Brick/Block)						
Exterior						
Eaves Linings	Flat AC Sheeting	20m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1028/B00C/Eaves Linings/S10					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	No Asbestos Found					
Interior						
B00C - R0001 - Movement						
No Asbestos						
B00C - R0002 - Toilets - Girls						
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	1028/B00C/R0008/Partition Walls (Cubicles)/S9					Chrysotile (white asbestos)
Incinerator	Encapsulated Insulation material within unit	1Unit(s)	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible					
B00C - R0003 - Distribution Board						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00C - R0004 - Special Programs Room						
No Asbestos						
B00C - R0005 - Staff Toilet						
No Asbestos						
B00C - R0006 - General Storeroom						
No Asbestos						
B00C - R0007 - Craft Store						
No Asbestos						
B00C - R0008 - Toilets - Boys						
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	1028/B00C/R0008/Partition Walls (Cubicles)/S9					Chrysotile (white asbestos)
B00C - R1001 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1028/B00C/R1001/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)
B00C - R1002 - Withdrawal Space - 1hb						
No Asbestos						
B00C - R1003 - Home Base						
No Asbestos						
B00C - R1004 - Staff Room						
Wall Linings Internal	Flat AC Sheeting	5m2	West	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	1028/B00C/R1004/Wall Linings Internal/S17					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R1005 - Movement						
No Asbestos						
B00C - R1006 - Staff Toilet						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1028/B00C/R1006/Wall Linings Internal/S11					
B00C - R1007 - Staff Toilet						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1028/B00C/R1006/Wall Linings Internal/S11					
B00C - R1008 - Movement						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Wall Linings Internal	Flat AC Sheeting		1028/B00C/R1006/Wall Linings Internal/S11			No Asbestos Detected
-----------------------	------------------	--	---	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Library/Pupil Facilities - 1972 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1028/B00D/Eaves Linings/S27					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0001 - Main Switch Board

Ceiling Structures/Linings	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1028/B00D/R0006/Ceiling Structures/Linings/S21					Chrysotile (white asbestos)

B00D - R0002 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1028/B00D/R0006/Ceiling Structures/Linings/S21					Chrysotile (white asbestos)

Partition Walls (Cubicles)	Compressed AC Sheet	16m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Assumed Asbestos

B00D - R0003 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1028/B00D/R0006/Ceiling Structures/Linings/S21					Chrysotile (white asbestos)

B00D - R0004 - General Storeroom

No Asbestos

B00D - R0005 - Cleaning Supplies

No Asbestos

B00D - R0006 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1028/B00D/R0006/Ceiling Structures/Linings/S21					Chrysotile (white asbestos)

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1028/B00D/R0006/Partition Walls (Cubicles)/S12					Chrysotile (white asbestos)

B00D - R0007 - Movement

No Asbestos

B00D - R0008 - General Storeroom

In-fill-panel	Flat AC Sheeting					No Asbestos Detected
	1028/B00D/R0008/In-fill-panel/S28					

B00D - R1001 - Movement

No Asbestos

B00D - R1002 - Movement

Wall Linings Internal	Flat AC Sheeting	1m2	Behind sink	Minimal Damage (2)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Area inaccessible

B00D - R1003 - K.L.A. Store

No Asbestos

B00D - R1004 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1028/B00D/R0006/Ceiling Structures/Linings/S21					Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1028/B00D/R0006/Ceiling Structures/Linings/S21					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R1005 - Reading Area						
No Asbestos						
B00D - R1006 - Reading Area						
No Asbestos						
B00D - R1007 - Library Office/Workroom						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1972 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Non Accessible Area - Extreme Access Issue - Height Restricted - Approx >8m					
Eaves Linings	Flat AC Sheeting 1028/B00E/Eaves Linings/S26					No Asbestos Detected
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - Height Restricted - Approx >8m					
Underfloor Voids	No Asbestos Found					

Interior**B00E - R0001 - Movement**

No Asbestos

B00E - R0002 - Withdrawal Space - 1hb

No Asbestos

B00E - R0003 - Staff Room Annexe

No Asbestos

B00E - R0004 - General Storeroom

No Asbestos

B00E - R0005 - Movement

No Asbestos

B00E - R0006 - Special Programs Room

No Asbestos

B00E - R0007 - General Storeroom

No Asbestos

B00E - R0008 - Home Base

No Asbestos

B00E - R0009 - Communal Space

No Asbestos

B00E - R0010 - Raised Platform

No Asbestos

B00E - R0011 - Home Base

No Asbestos

B00E - R0012 - Withdrawal Space - 1hb

No Asbestos

B00E - R0013 - Practical Activities - 1hb

No Asbestos

B00E - R0014 - Movement

No Asbestos

B00E - R0015 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1028/B00E/R0015/Ceiling Structures/Linings/S22					Chrysotile (white asbestos)

B00E - R0016 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1028/B00E/R0015/Ceiling Structures/Linings/S22					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1028/B00E/R0015/Ceiling Structures/Linings/S22					Chrysotile (white asbestos)
Incinerator	Encapsulated Insulation material within unit	1Unit(s)	East	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1966 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	200m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1028/B00G/Eaves Linings/S25					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

Interior

B00G - R0001 - Home Base

No Asbestos

B00G - R0002 - Home Base Store

No Asbestos

B00G - R0003 - Movement

Wall Linings Internal	Flat AC Sheeting	2m2	Behind sink	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1028/B00G/R1003/Wall Linings Internal/S23					Chrysotile (white asbestos)

B00G - R0004 - Home Base Store

No Asbestos

B00G - R0005 - Home Base

No Asbestos

B00G - R0006 - Cleaning Distributed Store

Floor Coverings Res/Textile	Vinyl Tiles					
	1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00G - R0007 - Staff Room Annexe

No Asbestos

B00G - R0008 - Staff Toilet

Incinerator	Encapsulated Insulation material within unit	1Unit(s)	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible					

B00G - R0009 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00G - R0010 - Distribution Board

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles					
	1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00G - R0011 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00G - R0012 - Movement

No Asbestos

B00G - R0013 - Staff Room Annexe

No Asbestos

B00G - R0014 - Staff Room Annexe

No Asbestos

B00G - R0015 - Movement

Wall Linings Internal	Flat AC Sheeting	6m2	Under south stairs	Good Condition (1)	Low (1)	Low Priority (2-3)
	1028/B00G/R1003/Wall Linings Internal/S23					Chrysotile (white asbestos)

B00G - R0016 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	6m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
1028/B00G/R1003/Wall Linings Internal/S23					Chrysotile (white asbestos)	
B00G - R0017 - Sports Store						
Wall Linings Internal	Flat AC Sheeting	6m2	North	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1028/B00G/R1003/Wall Linings Internal/S23					Chrysotile (white asbestos)	
B00G - R1001 - Home Base						
No Asbestos						
B00G - R1002 - Home Base Store						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1028/B00G/R1003/Wall Linings Internal/S23					Chrysotile (white asbestos)	
B00G - R1003 - Movement						
Wall Linings Internal	Flat AC Sheeting	3m2	Behind sink	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1028/B00G/R1003/Wall Linings Internal/S23					Chrysotile (white asbestos)	
B00G - R1004 - Home Base Store						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1028/B00G/R1003/Wall Linings Internal/S23					Chrysotile (white asbestos)	
B00G - R1005 - Home Base						
No Asbestos						
B00G - R1006 - Home Base						
No Asbestos						
B00G - R1007 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles					
1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected	
B00G - R1008 - Movement						
No Asbestos						
B00G - R1009 - Distribution Board				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	4m2	North, South, West	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
1028/B00G/R1003/Wall Linings Internal/S23					Chrysotile (white asbestos)	
B00G - R1010 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles					
1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected	
B00G - R1011 - Home Base						
No Asbestos						
B00G - R1012 - Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Administration - 1972 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	100m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1028/B00H/Eaves Linings/S5					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

Interior**B00H - R0001 - Principal**

No Asbestos

B00H - R0002 - Staff Toilet

No Asbestos

B00H - R0003 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00H - R0004 - Deputy Principal

No Asbestos

B00H - R0005 - Distribution Board

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles					
	1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00H - R0006 - Entry Vestibule

No Asbestos

B00H - R0007 - Clerical Office

No Asbestos

B00H - R0008 - Sick Bay

Floor Coverings Res/Textile	Vinyl Tiles					
	1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00H - R0009 - Staff Room Annexe

No Asbestos

B00H - R0010 - Staff Toilet

No Asbestos

B00H - R0011 - Cleaning Distributed Store

Floor Coverings Res/Textile	Vinyl Tiles					
	1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00H - R0012 - Staff Toilet

Incinerator	Encapsulated Insulation material within unit	1Unit(s)	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible					

B00H - R0013 - Movement

No Asbestos

B00H - R0014 - Duplicating Workroom

Floor Coverings Res/Textile	Vinyl Tiles					
	1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00H - R0015 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00H - R0016 - General Storeroom

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00H - R0017 - Staff Kitchen						
No Asbestos						
B00H - R0018 - Staff Room						
No Asbestos						
B00H - R0019 - Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Pupil Facilities - 1940 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

Interior

B00I - R0001 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1028/B00I/R0001/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	

B00I - R0002 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1028/B00I/R0001/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	

Incinerator	Encapsulated Insulation material within unit	1Unit(s)	West	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						

B00I - R0003 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1028/B00I/R0001/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Vinyl Tiles					
1028/B00G/R0011/Floor Coverings Res/Textile/S1					No Asbestos Detected	

B00I - R0004 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1028/B00I/R0001/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	

B00I - R0005 - Canteen

No Asbestos						
-------------	--	--	--	--	--	--

B00I - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1028/B00I/R0001/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	

In-fill-panel	Flat AC Sheeting	4m	Above service counters	Good Condition (1)	Low (1)	Low Priority (2-3)
1028/B00I/R0006/In-fill-panel/S20					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pre-School Facilities/Other-Community Use - 1908 - Timber (Timber)

Exterior

Ceiling Voids	Non Accessible Area - Sealed Ceiling					
Eaves Linings	Flat AC Sheeting 1028/B00J/Eaves Linings/S30					No Asbestos Detected
Ceiling Voids	Non Accessible Area - Height Restriction - Sealed Ceiling					
Underfloor Voids	No Asbestos Found					

Interior

B00J - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1028/B00J/R1001/Ceiling Structures/Linings/S3					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00J - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1028/B00J/R1001/Ceiling Structures/Linings/S3					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00J - R0003 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1028/B00J/R1001/Ceiling Structures/Linings/S3					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00J - R0004 - Clerical Office - Pre

No Asbestos

B00J - R0005 - Kitchen - Pre

No Asbestos

B00J - R0006 - Toilets - Boys/Girls - Pre

No Asbestos

B00J - R0007 - Home Base - Pre

No Asbestos

B00J - R0008 - Practical Activities - Pre

No Asbestos

B00J - R0009 - General Storeroom - Pre

No Asbestos

B00J - R0010 - Home Base - Pre

No Asbestos

B00J - R0011 - Practical Activities - Pre

No Asbestos

B00J - R0012 - Staff Toilet - Pre

No Asbestos

B00J - R0013 - Toilets - Boys/Girls - Pre

No Asbestos

B00J - R0014 - Cleaning Distributed Store

No Asbestos

B00J - R0015 - Laundry - Pre

No Asbestos

B00J - R1001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1028/B00J/R1001/Ceiling Structures/Linings/S3					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00J - R1002 - Staff Kitchen

No Asbestos

B00J - R1003 - Other-Community Use

No Asbestos

B00J - R1004 - Staff Toilet

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00J - R1005 - Staff Toilet

No Asbestos

B00J - R1006 - Movement

No Asbestos

B00J - R1007 - Security Store

No Asbestos

B00J - R1008 - Security Store

No Asbestos

B00J - R1009 - Other-Community Use

No Asbestos

B00J - R1010 - Other-Community Use

No Asbestos

B00J - R1011 - General Storeroom

No Asbestos

B00J - R1012 - Cleaning Distributed Store

No Asbestos

B00J - R1013 - Other-Community Use

No Asbestos

B00J - R1014 - Other-Community Use

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Building Services - 1978 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Height Restriction
Underfloor Voids	No Asbestos Found

Interior

B00K - R0001 - Cleaning Distributed Store

In-fill-panel	Flat AC Sheeting	1m	East	Good Condition (1)	Low (1)	Low Priority (2-3)
1028/B00K/R0001/In-fill-panel/S24				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00K - R0002 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Pupil Facilities/Multi Purpose Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Debris	Flat AC Sheeting	1m2	West	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	1028/B00L/Debris/S18 Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)					

Interior

- B00L - R0001 - Hall Chair Store**
No Asbestos
- B00L - R0002 - Communal/Performance Store**
No Asbestos
- B00L - R0003 - P.E. Store**
No Asbestos
- B00L - R0004 - Toilets - Girls**
No Asbestos
- B00L - R0005 - Toilet - Lobby**
No Asbestos
- B00L - R0006 - Toilets - Boys**
No Asbestos
- B00L - R0007 - Sound Cupboard**
No Asbestos
- B00L - R0008 - Toilet - Lobby**
No Asbestos
- B00L - R0009 - Plant**
No Asbestos
- B00L - R0010 - Cleaning Distributed Store**
No Asbestos
- B00L - R0011 - Access Shower/Toilet**
No Asbestos
- B00L - R0012 - Main Switch Board**
No Asbestos
- B00L - R0013 - Covered Outdoor Learning Area**
No Asbestos
- B00L - R0014 - Communal Space**
No Asbestos
- B00L - R0015 - Plant**
No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Special Purpose - 2016 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00M - R0001 - External Movement

No Asbestos

B00M - R0002 - Movement

No Asbestos

B00M - R0003 - Movement

No Asbestos

B00M - R0004 - Staff Kitchen

No Asbestos

B00M - R0005 - Toilets-Unisex

No Asbestos

B00M - R0006 - Clerical Office

No Asbestos

B00M - R0007 - External Movement

No Asbestos

B00M - R0008 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00M - R0009 - Clerical Office

No Asbestos

B00M - R0010 - Community Clinic

No Asbestos

B00M - R0011 - Community Clinic

No Asbestos

B00M - R0012 - Handwashing Facilities

No Asbestos

B00M - R0013 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Storage - 1995 - Metal Shed (Metal Shed)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00N - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Storage - 1978 - Brick/Block (Brick/Block)

Exterior

Ceiling Void	Requires Inspection
Underfloor Void	Requires Inspection

Interior

B000 - R0001 - Garden Store

Recently Modified Space	Requires Inspection
-------------------------	---------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017