


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Alstonville Public School (1030)  
**Region :** North Coast  
**State Electorate :** Ballina  
**Local Government Area :** Ballina

**Initial Survey :** Noel Arnold & Associates : 10 - Jun - 2008  
**Reviewed By :** Parsons Brinckerhoff : 08 - Oct - 2015

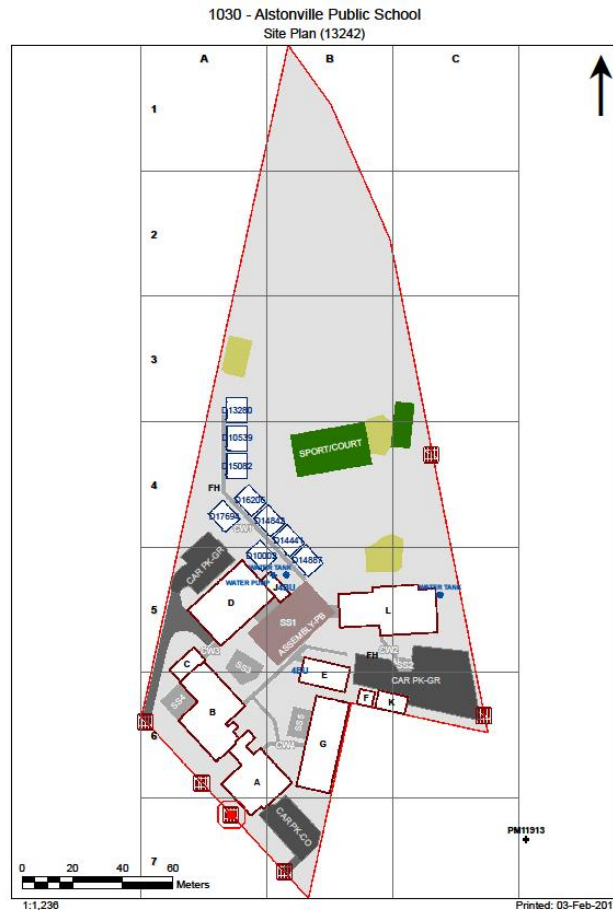

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - Administration/Library - 1976 - Brick/Block (Brick/Block)</b>						
<b>Exterior</b>						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
<b>Interior</b>						
<b>B00A - R0001 - Movement (20.97 m2)</b>						
No Asbestos						
<b>B00A - R0002 - Main Switch Board (9.07 m2)</b>						
Electrical Backing Board	Resinous Board	2Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
1030/B00A/R0002/Electrical Backing Board/S11					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0003 - Staff Toilet (6.26 m2)</b>						
No Asbestos						
<b>B00A - R0004 - Staff Toilet (8.82 m2)</b>						
No Asbestos						
<b>B00A - R0005 - Duplicating Workroom (12.24 m2)</b>						
Decorative Coating	Vermiculite	1030/B00A/R0005/Decorative Coating/S12			<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0006 - Sick Bay (9.07 m2)</b>						
Decorative Coating	Vermiculite	1030/B00A/R0006/Decorative Coating/S13			<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0007 - Clerical Office (12.99 m2)</b>						
Decorative Coating	Vermiculite	1030/B00A/R0007/Decorative Coating/S14			<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0008 - Entry Vestibule (18.7 m2)</b>						
Decorative Coating	Vermiculite	1030/B00A/R0008/Decorative Coating/S15			<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0009 - Principal (19.4 m2)</b>						
Decorative Coating	Vermiculite	1030/B00A/R0009/Decorative Coating/S16			<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0010 - Movement (59.01 m2)</b>						
Decorative Coating	Vermiculite	1030/B00A/R0010/Decorative Coating/S17			<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0011 - Movement (36.12 m2)</b>						
Decorative Coating	Vermiculite	1030/B00A/R0011/Decorative Coating/S18			<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0012 - Staff Room (60.95 m2)</b>						
Decorative Coating	Vermiculite	1030/B00A/R0012/Decorative Coating/S19			<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0013 - Interview (12.24 m2)</b>						
Decorative Coating	Vermiculite	1030/B00A/R0013/Decorative Coating/S20			<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0014 - Clerical Office (12.88 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Decorative Coating	Vermiculite					
	1030/B00A/R0014/Decorative Coating/S21					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0015 - Deputy Principal (12.57 m2)</b>						
Decorative Coating	Vermiculite					
	1030/B00A/R0015/Decorative Coating/S22					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0016 - General Storeroom (16.13 m2)</b>						
Decorative Coating	Vermiculite					
	1030/B00A/R0016/Decorative Coating/S23					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0017 - Cleaning Distributed Store (3.13 m2)</b>						
No Asbestos						
<b>B00A - R0018 - Withdrawal Space - 1hb (15.01 m2)</b>						
No Asbestos						
<b>B00A - R0019 - Movement (43.65 m2)</b>						
No Asbestos						
<b>B00A - R0020 - General Storeroom (5.83 m2)</b>						
No Asbestos						
<b>B00A - R0021 - General Storeroom (6.95 m2)</b>						
No Asbestos						
<b>B00A - R0022 - Movement (3.61 m2)</b>						
No Asbestos						
<b>B00A - R1001 - Movement (14.45 m2)</b>						
No Asbestos						
<b>B00A - R1003 - Seminar/Study (10.55 m2)</b>						
No Asbestos						
<b>B00A - R1005 - Library Office/Workroom (8.08 m2)</b>						
No Asbestos						
<b>B00A - R1006 - Library Office/Workroom (16.49 m2)</b>						
No Asbestos						
<b>B00A - R1007 - Communications Room (13.13 m2)</b>						
No Asbestos						
<b>B00A - R1009 - Cleaning Distributed Store (3.24 m2)</b>						
No Asbestos						
<b>B00A - R1010 - Toilets - Girls (7.35 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1030/B00A/R1010/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)
<b>B00A - R1011 - Toilets - Boys (7.3 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1030/B00A/R1010/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)
<b>B00A - R1012 - Reading Area (208.34 m2)</b>						
No Asbestos						
<b>B00A - R1013 - Movement (22.23 m2)</b>						
No Asbestos						
<b>B00A - R1014 - Special Programs Room (12.26 m2)</b>						
No Asbestos						
<b>B00A - R1015 - Movement (17.21 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - General Learning - 1976 - Brick/Block (Brick/Block)</b>						
<b>Exterior</b>						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
<b>Interior</b>						
<b>B00B - R0001 - Movement (139.4 m2)</b>						
No Asbestos						
<b>B00B - R0002 - Practical Activities - 1hb (18.01 m2)</b>						
Ceiling Structures/Linings	Vermiculite		1030/B00B/R0012/Ceiling Structures/Linings/S5			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0003 - Home Base (52.08 m2)</b>						
Ceiling Structures/Linings	Vermiculite		1030/B00B/R0012/Ceiling Structures/Linings/S5			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0004 - Movement (46.78 m2)</b>						
No Asbestos						
<b>B00B - R0005 - Home Base (52.16 m2)</b>						
Ceiling Structures/Linings	Vermiculite		1030/B00B/R0012/Ceiling Structures/Linings/S5			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0006 - Practical Activities - 1hb (18.09 m2)</b>						
Ceiling Structures/Linings	Vermiculite		1030/B00B/R0012/Ceiling Structures/Linings/S5			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0007 - Distribution Board (0.52 m2)</b>						
						Note: No inspection of live electrical installation.
No Asbestos						
<b>B00B - R0008 - Movement (16.16 m2)</b>						
No Asbestos						
<b>B00B - R0009 - Toilets - Boys/Girls (3.14 m2)</b>						
No Asbestos						
<b>B00B - R0010 - Practical Activities - 1hb (13.61 m2)</b>						
Ceiling Structures/Linings	Vermiculite		1030/B00B/R0012/Ceiling Structures/Linings/S5			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0011 - Home Base (80.46 m2)</b>						
Ceiling Structures/Linings	Vermiculite		1030/B00B/R0012/Ceiling Structures/Linings/S5			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0012 - Home Base (51.45 m2)</b>						
Ceiling Structures/Linings	Vermiculite		1030/B00B/R0012/Ceiling Structures/Linings/S5			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0013 - Practical Activities - 1hb (18.01 m2)</b>						
Ceiling Structures/Linings	Vermiculite		1030/B00B/R0012/Ceiling Structures/Linings/S5			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0014 - Movement (8.84 m2)</b>						
No Asbestos						
<b>B00B - R0015 - Lift (2.25 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R1001 - Movement (79.01 m2)</b>						
No Asbestos						
<b>B00B - R1002 - Practical Activities - 1hb (18.01 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
		1030/B00B/R0012/Ceiling Structures/Linings/S5				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1003 - Home Base (51.84 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
		1030/B00B/R0012/Ceiling Structures/Linings/S5				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1004 - Home Base (52.1 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
		1030/B00B/R0012/Ceiling Structures/Linings/S5				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1005 - Practical Activities - 1hb (17.96 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
		1030/B00B/R0012/Ceiling Structures/Linings/S5				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1006 - Distribution Board (0.54 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00B - R1007 - General Storeroom (27.4 m2)</b>						
No Asbestos						
<b>B00B - R1008 - Practical Activities - 1hb (18.01 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
		1030/B00B/R0012/Ceiling Structures/Linings/S5				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1009 - Special Programs Room (51.45 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
		1030/B00B/R0012/Ceiling Structures/Linings/S5				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1010 - Home Base (51.37 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
		1030/B00B/R0012/Ceiling Structures/Linings/S5				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1011 - Practical Activities - 1hb (18.01 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
		1030/B00B/R0012/Ceiling Structures/Linings/S5				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1012 - Movement (15.93 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities - 1976 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00C - R0001 - Movement (29.57 m2)**

No Asbestos

**B00C - R0002 - Toilets - Girls (24.08 m2)**

Partition Walls (Cubicles)	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1030/B00C/R0003/Partition Walls (Cubicles)/S4					<b>Chrysotile (white asbestos)</b>	

**B00C - R0003 - Toilets - Boys (20.75 m2)**

Partition Walls (Cubicles)	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1030/B00C/R0003/Partition Walls (Cubicles)/S4					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Communal Facilities - 1976 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00D - R0001 - Movement (193.42 m2)**

No Asbestos

**B00D - R0002 - Communal Space (164.38 m2)**

No Asbestos

**B00D - R0003 - Hall Chair Store (4.16 m2)**

No Asbestos

**B00D - R0004 - Raised Platform (37.01 m2)**

No Asbestos

**B00D - R0005 - Hall Chair Store (4.16 m2)**

No Asbestos

**B00D - R0006 - Toilets - Girls (8.3 m2)**

Partition Walls (Cubicles)	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1030/B00D/R0014/Partition Walls (Cubicles)/S2					<b>Chrysotile (white asbestos)</b>	

**B00D - R0007 - Movement (26.49 m2)**

No Asbestos

**B00D - R0008 - Music Store (12.69 m2)**

No Asbestos

**B00D - R0009 - Distribution Board (0.4 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00D - R0010 - Canteen Office/Store (2.65 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
1030/B00D/R0013/Floor Coverings Res/Textile/S3					<b>No Asbestos Detected</b>	

**B00D - R0011 - Staff Toilet (3.37 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
1030/B00D/R0013/Floor Coverings Res/Textile/S3					<b>No Asbestos Detected</b>	

**B00D - R0012 - Canteen Office/Store (5.45 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
1030/B00D/R0013/Floor Coverings Res/Textile/S3					<b>No Asbestos Detected</b>	

**B00D - R0013 - Canteen (26.94 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
1030/B00D/R0013/Floor Coverings Res/Textile/S3					<b>No Asbestos Detected</b>	

**B00D - R0014 - Toilets - Boys (8.3 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1030/B00D/R0014/Partition Walls (Cubicles)/S2					<b>Chrysotile (white asbestos)</b>	

**B00D - R0015 - Cleaning Supplies (5.05 m2)**

No Asbestos

**B00D - R0016 - Kiln Room (14.52 m2)**

No Asbestos

**B00D - R0017 - Sports Store (5.75 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning/Building Services - 1947 - Timber (Timber)**

**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1030/B00E/Eaves Linings/S9			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Barge Boards	Flat AC Sheeting					
	1030/B00E/Barge Boards/S8			<b>No Asbestos Detected</b>		

**Interior**

**B00E - R0002 - Home Base (53.72 m2)**

No Asbestos

**B00E - R0004 - Home Base (54.09 m2)**

No Asbestos

**B00E - R0005 - General Assistant/Bulk Store (15.46 m2)**

No Asbestos

**B00E - R0006 - Craft Store (10.76 m2)**

No Asbestos

**B00E - R0007 - Home Base Store (12.08 m2)**

No Asbestos

**B00E - R0008 - Movement (29.8 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1030/B00E/R0008/Ceiling Structures/Linings/S24			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Mechanical Services - 1976 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00F - R0001 - Garden Store (32.69 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning - 1976 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00G - R0001 - Movement (14.6 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 1030/B00G/R0001/Ceiling Structures/Linings/S25	No Asbestos Detected
----------------------------	--	----------------------

**B00G - R0002 - Home Base (59.2 m2)**

No Asbestos

**B00G - R0003 - Personal Effects Storage (1.27 m2)**

No Asbestos

**B00G - R0004 - Practical Activities - 1hb (12.85 m2)**

No Asbestos

**B00G - R0005 - Home Base Store (5.56 m2)**

No Asbestos

**B00G - R0006 - Withdrawal Space - 1hb (11.47 m2)**

No Asbestos

**B00G - R0007 - Home Base (59.3 m2)**

No Asbestos

**B00G - R0008 - Movement (14.73 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 1030/B00G/R0008/Ceiling Structures/Linings/S26	No Asbestos Detected
----------------------------	--	----------------------

**B00G - R0009 - Home Base Store (5.58 m2)**

No Asbestos

**B00G - R0010 - Practical Activities - 1hb (11.2 m2)**

No Asbestos

**B00G - R0011 - Personal Effects Storage (3.03 m2)**

No Asbestos

**B00G - R0012 - Movement (14.65 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 1030/B00G/R0012/Ceiling Structures/Linings/S27	No Asbestos Detected
----------------------------	--	----------------------

**B00G - R0013 - Home Base (59.26 m2)**

No Asbestos

**B00G - R0014 - Personal Effects Storage (3.14 m2)**

No Asbestos

**B00G - R0015 - Practical Activities - 1hb (11.18 m2)**

No Asbestos

**B00G - R0016 - Home Base Store (5.56 m2)**

No Asbestos

**B00G - R0017 - Withdrawal Space - 1hb (11.47 m2)**

No Asbestos

**B00G - R0018 - Home Base (59.06 m2)**

No Asbestos

**B00G - R0019 - Home Base Store (5.58 m2)**

No Asbestos

**B00G - R0020 - Movement (14.62 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 1030/B00G/R0020/Ceiling Structures/Linings/S28	No Asbestos Detected
----------------------------	--	----------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00G - R0021 - Practical Activities - 1hb (11.16 m2)</b>						
No Asbestos						
<b>B00G - R0022 - Personal Effects Storage (3.03 m2)</b>						
No Asbestos						
<b>B00G - R0023 - Movement (67.73 m2)</b>						
Ceiling Structures/Linings		Flat AC Sheeting				
		1030/B00G/R0023/Ceiling Structures/Linings/S29				<b>No Asbestos Detected</b>
<b>B00G - R0024 - Distribution Board (0.3 m2)</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B00G - R0025 - Distribution Board (0.3 m2)</b>				Note: No inspection of live electrical installation.		
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Pupil Facilities/Staff Facilities - 2007 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1030/B00J/Eaves Linings/S10					<b>No Asbestos Detected</b>

**Interior**

**B00J - R0001 - Toilets - Boys (6.95 m2)**

No Asbestos

**B00J - R0002 - Staff Toilet (4.41 m2)**

No Asbestos

**B00J - R0003 - Toilets - Girls (23.77 m2)**

No Asbestos

**B00J - R0004 - External Movement (16.95 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00K - Administration - 2008 - Steel (Steel)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00K - R0001 - General Storeroom (19.98 m2)**

No Asbestos

**B00K - R0002 - Sports Store (19.98 m2)**

No Asbestos

**B00K - R0003 - General Storeroom (19.97 m2)**

No Asbestos

**B00K - R0004 - General Storeroom (19.77 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00L - Communal Facilities - 2011 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior****B00L - R0001 - Communal Space (203.62 m2)**

No Asbestos

**B00L - R0002 - Raised Platform (57.23 m2)**

No Asbestos

**B00L - R0003 - Ramp (11.99 m2)**

No Asbestos

**B00L - R0004 - Hall Chair Store (12.75 m2)**

No Asbestos

**B00L - R0005 - Communal/Performance Store (10.27 m2)**

No Asbestos

**B00L - R0006 - P.E. Store (16.36 m2)**

No Asbestos

**B00L - R0007 - Toilet - Lobby (2.42 m2)**

No Asbestos

**B00L - R0008 - Toilets - Girls (7.07 m2)**

No Asbestos

**B00L - R0009 - Sound Cupboard (2.09 m2)**

No Asbestos

**B00L - R0010 - Toilet - Lobby (3.37 m2)**

No Asbestos

**B00L - R0011 - Toilets - Boys (5.72 m2)**

No Asbestos

**B00L - R0012 - Cleaning Distributed Store (3.42 m2)**

No Asbestos

**B00L - R0013 - Plant (1.61 m2)**

No Asbestos

**B00L - R0014 - Access Shower/Toilet/Change (6.92 m2)**

No Asbestos

**B00L - R0015 - Main Switch Board (3.44 m2)**

No Asbestos

**B00L - R0016 - Covered Outdoor Learning Area (239.1 m2)**

No Asbestos

**B00L - R0017 - Movement (17.05 m2)**

No Asbestos

**B00L - R0018 - External Movement (6.33 m2)**

No Asbestos

**B00L - R0019 - External Stairs (4.69 m2)**

No Asbestos

**B00L - R9001 - General Storeroom (26.31 m2)**

No Asbestos

**B00L - R9002 - Movement (2.63 m2)**

No Asbestos

**B00L - R9003 - Sports Store (11.5 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00L - R9004 - Sports Store (10.48 m2)**

No Asbestos

**B00L - R9005 - External Movement (5.64 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**Build+1 - Building J**

**Exterior**

No Asbestos

**Interior**

**Build+1 - Room+1 - Boys Toilet**

No Asbestos

**Build+1 - Room+2 - Girls Toilet**

No Asbestos

**Build+1 - Room+3 - Staff torier**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 601 - D10002 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995**

### Exterior

Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

#### R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

#### R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

**OS 601 - D10539 - Learning Unit - Standard/Withdrawal : Placement Date - 22/01/2002**

### Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

#### R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

#### R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

**OS 602 - D13280 - Learning Unit - Standard With P.A.A. : Placement Date - 18/03/2009**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

### Exterior

No Asbestos Found.

### Interior

#### R1 - Learning space/withdrawal/entry

No Asbestos Found.

#### R2 - Home Base Store

No Asbestos Found.

**OS 603 - D14441 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 17/10/2006**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

### Exterior

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D14842 - Learning Unit - Standard With P.A.A. : Placement Date - 11/03/2008**

**Exterior**

Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

**Interior**

**R1 - Learning space/withdrawal/entry**

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

**R2 - Home Base Store**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

**OS 602 - D14887 - Learning Unit - Standard With P.A.A. : Placement Date - 13/04/2010**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 603 - D15082 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 3/04/2007**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 601 - D16206 - Learning Unit - Standard/Withdrawal : Placement Date - 21/03/2003**

**Exterior**

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
<b>OS 602 - D17694 - Learning Unit - Standard With P.A.A. : Placement Date - 6/05/2014</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017