


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Annandale Public School (1041)
Region : Sydney
State Electorate : Balmain
Local Government Area : Leichhardt

Initial Survey : Noel Arnold & Associates : 10 - Mar - 2008
Reviewed By : Greencap-NAA : 20 - Jul - 2015

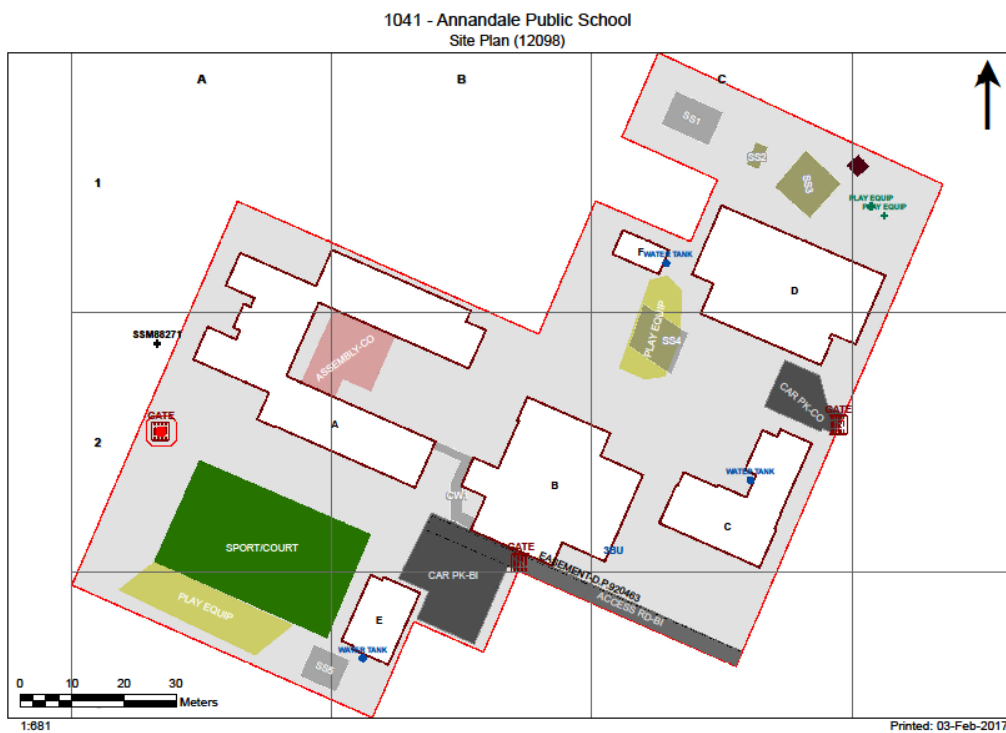

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - Administration/General Learning - 1886 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Extreme Access Issue - Obstructed by Cables.					
Eaves Linings	Flat AC Sheeting	100m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1041/B00B/R2015/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - Obstructed by Cables.					
Electrical Backing Board	Resinous Board	1Unit	Northwest	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - Movement (58.06 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1041/B00A/R0001/Ceiling Structures/Linings/S7					

B00A - R0002 - Home Base (52.9 m2)

No Asbestos

B00A - R0003 - Practical Activities - 1hb (17.48 m2)

Floor Coverings Res/Textile	Vinyl Tiles	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1041/B00A/R0020/Floor Coverings Res/Textile/S6			Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1041/B00A/R0001/Ceiling Structures/Linings/S7					

B00A - R0004 - Movement (1.96 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	East facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1041/B00A/R0009/Ceiling Structures/Linings/S8			Chrysotile (white asbestos)		

B00A - R0005 - Practical Activities - 1hb (15.62 m2)

Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1041/B00A/R0020/Floor Coverings Res/Textile/S6			Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1041/B00A/R0001/Ceiling Structures/Linings/S7					

B00A - R0006 - Home Base (47.26 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1041/B00A/R0001/Ceiling Structures/Linings/S7					

B00A - R0007 - Home Base (53.75 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1041/B00A/R0001/Ceiling Structures/Linings/S7					

B00A - R0008 - Practical Activities - 1hb (15.82 m2)

Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1041/B00A/R0020/Floor Coverings Res/Textile/S6			Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1041/B00A/R0001/Ceiling Structures/Linings/S7					

B00A - R0009 - Distribution Board (0.34 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1041/B00A/R0009/Ceiling Structures/Linings/S8			Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Door Lining	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
1041/B00A/R0022/Door Lining/S16					Chrysotile (white asbestos)	
B00A - R0010 - Movement (15.34 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
1041/B00A/R0001/Ceiling Structures/Linings/S7					No Asbestos Detected	
B00A - R0011 - Movement (1.69 m2)						
No Asbestos						
B00A - R0012 - Toilets - Girls (8.46 m2)						
No Asbestos						
B00A - R0013 - Toilets - Boys (10.63 m2)						
No Asbestos						
B00A - R0014 - Drinking Facilities (6.07 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
1041/B00A/R0001/Ceiling Structures/Linings/S7					No Asbestos Detected	
B00A - R0015 - Movement (3.27 m2)						
No Asbestos						
B00A - R0016 - Movement (12.75 m2)						
No Asbestos						
B00A - R0017 - Movement (41.98 m2)						
No Asbestos						
B00A - R0018 - Home Base (54.27 m2)						
No Asbestos						
B00A - R0019 - Practical Activities - 1hb (16.13 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1041/B00A/R0020/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
B00A - R0020 - Practical Activities - 1hb (15.59 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1041/B00A/R0020/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
B00A - R0021 - Home Base (52.9 m2)						
No Asbestos						
B00A - R0022 - Distribution Board (0.26 m2)						
Note: No inspection of live electrical installation.						
Door Lining	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
1041/B00A/R0022/Door Lining/S16					Chrysotile (white asbestos)	
Stored Sheet/Debris	Flat AC Sheeting	1m2	On Ground	Good Condition (1)	Low (1)	Low Priority (2-3)
1041/B00A/R0022/Stored Sheet/Debris/S17					Chrysotile (white asbestos)	
B00A - R0023 - Home Base (46.68 m2)						
No Asbestos						
B00A - R0024 - Practical Activities - 1hb (15.89 m2)						
No Asbestos						
B00A - R0025 - Toilets - Boys (10.93 m2)						
No Asbestos						
B00A - R0026 - Movement (18.93 m2)						
No Asbestos						
B00A - R0027 - Toilets - Girls (13.53 m2)						
No Asbestos						
B00A - R0028 - Duplicating Workroom (25.31 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1041/B00A/R0020/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
B00A - R0029 - Staff Toilet (3.9 m2)						
No Asbestos						
B00A - R0030 - Staff Toilet (4 m2)						
No Asbestos						
B00A - R0031 - Staff Room (57.33 m2)						
No Asbestos						
B00A - R0032 - Movement (19.25 m2)						
No Asbestos						
B00A - R0033 - Movement (5.74 m2)						
No Asbestos						
B00A - R0034 - Movement (12.96 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
1041/B00A/R0001/Ceiling Structures/Linings/S7					No Asbestos Detected	
B00A - R0035 - Principal (19.09 m2)						
No Asbestos						
B00A - R0036 - Clerical Office (15.61 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
1041/B00A/R0001/Ceiling Structures/Linings/S7					No Asbestos Detected	
B00A - R0037 - Movement (5.74 m2)						
No Asbestos						
B00A - R0038 - Interview (19.52 m2)						
No Asbestos						
B00A - R0039 - Deputy Principal (15.93 m2)						
No Asbestos						
B00A - R0040 - Interview (19.11 m2)						
No Asbestos						
B00A - R0041 - Clerical Office/Workroom (18.31 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1041/B00A/R0020/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
B00A - R0042 - Entry Vestibule (29.6 m2)						
No Asbestos						
B00A - R0043 - Main Switch Board (7.02 m2)						
Wall Linings Internal	Flat AC Sheeting	25m2	West & South	Good Condition (1)	Low (1)	Low Priority (2-3)
1041/B00A/R0043/Wall Linings Internal/S18					Chrysotile (white asbestos)	
Door Lining	Flat AC Sheeting	4m2	North	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1041/B00A/R0043/Door Lining/S19					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library/Communal Facilities - 1974 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1041/B00B/R2015/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable verge lining	Flat AC Sheeting	100m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1041/B00D/Gable verge lining/S20-Chrysotile (white asbestos)					
Ceiling Voids	No Asbestos Found					

Interior**B00B - R0001 - Movement (16.11 m2)**

No Asbestos

B00B - R0002 - Home Base (69.55 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1041/B00B/R1005/Ceiling Structures/Linings/S12					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0003 - Practical Activities - 1hb (21.37 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1041/B00B/R1005/Ceiling Structures/Linings/S12					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0004 - Movement (14.82 m2)

Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1041/B00B/R0004/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)

B00B - R0005 - Cleaning Distributed Store (0.86 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1041/B00B/R1005/Ceiling Structures/Linings/S12					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0006 - Movement (5.68 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	1041/B00B/R0006/Floor Coverings Res/Textile/S3					

B00B - R0007 - Toilets - Boys (11.49 m2)

No Asbestos

B00B - R0008 - Toilets - Girls (11.1 m2)

No Asbestos

B00B - R0009 - Movement (14.82 m2)

Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1041/B00B/R0004/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)

B00B - R0010 - Home Base (68.24 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1041/B00B/R1005/Ceiling Structures/Linings/S12					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0011 - Practical Activities - 1hb (21.27 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1041/B00B/R1005/Ceiling Structures/Linings/S12					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0012 - Movement (13.8 m2)

No Asbestos

B00B - R1001 - Communal Space (164.71 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R1002 - Hall Chair Store (7.11 m2)						
No Asbestos						
B00B - R1003 - Special Programs Room (70.54 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	1041/B00B/R0006/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00B - R1004 - Movement (32.23 m2)						
No Asbestos						
B00B - R1005 - Communal Space (92.64 m2)						
Ceiling Structures/Linings	Vermiculite					
	1041/B00B/R1005/Ceiling Structures/Linings/S12					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1006 - Canteen (26.68 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	1041/B00B/R0006/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00B - R1007 - Canteen Office/Store (9.04 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	1041/B00B/R0006/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00B - R1008 - Staff Toilet (2.82 m2)						
No Asbestos						
B00B - R1009 - Canteen Office/Store (2.8 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	1041/B00B/R0006/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00B - R1010 - Sports Store (19.67 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	1041/B00B/R0006/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00B - R1011 - Kiln Room (7.56 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	1041/B00B/R0006/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00B - R1012 - Distribution Board (0.84 m2)						
				Note: No inspection of live electrical installation.		
Floor Coverings Res/Textile	Vinyl Tiles					
	1041/B00B/R0006/Floor Coverings Res/Textile/S3					No Asbestos Detected
Wall & Door Lining	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1041/B00B/R1012/Wall & Door Lining/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R1013 - Toilets - Girls (9.58 m2)						
No Asbestos						
B00B - R1014 - Cleaning Supplies (9.43 m2)						
No Asbestos						
B00B - R1015 - Cleaning Supplies (8.32 m2)						
No Asbestos						
B00B - R1016 - Movement (43.83 m2)						
No Asbestos						
B00B - R1017 - Toilets - Boys (9.44 m2)						
No Asbestos						
B00B - R1018 - Stairs (15.82 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1041/B00B/R2015/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R1019 - Stairs (9.54 m2)						
No Asbestos						
B00B - R2001 - Reading Area (172.73 m2)						
No Asbestos						
B00B - R2002 - Library Office/Workroom (17.87 m2)						
No Asbestos						
B00B - R2003 - Communications Room (16.3 m2)						
No Asbestos						
B00B - R2004 - Library Office/Workroom (7.6 m2)						
No Asbestos						
B00B - R2005 - Cleaning Distributed Store (3.21 m2)						
No Asbestos						
B00B - R2006 - K.L.A. Store (9.67 m2)						
No Asbestos						
B00B - R2007 - K.L.A. Store (9.57 m2)						
No Asbestos						
B00B - R2008 - Movement (1.2 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1041/B00B/R2015/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R2009 - Home Base (73.09 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
1041/B00B/R0006/Floor Coverings Res/Textile/S3				No Asbestos Detected		
B00B - R2010 - Staff Room Annexe (65.53 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
1041/B00B/R0006/Floor Coverings Res/Textile/S3				No Asbestos Detected		
B00B - R2011 - Movement (3.93 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1041/B00B/R2015/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R2012 - Movement (24.1 m2)						
No Asbestos						
B00B - R2013 - Toilets - Boys (6.19 m2)						
No Asbestos						
B00B - R2014 - Toilets - Girls (5.95 m2)						
No Asbestos						
B00B - R2015 - Stairs (15.82 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1041/B00B/R2015/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R2016 - Stairs (13.33 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1041/B00B/R2015/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1886 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	90m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1041/B00D/Eaves Linings/S21-Chrysotile (white asbestos)- Amosite (brown asbestos)					
Gable verge lining	Flat AC Sheeting	20m	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1041/B00D/Gable verge lining/S20-Chrysotile (white asbestos)					
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00C - M0001 - Movement (37.96 m2)

No Asbestos

B00C - M0002 - Toilets - Boys (11.72 m2)

No Asbestos

B00C - M0003 - Toilets - Girls (12.12 m2)

No Asbestos

B00C - M0004 - Staff Room (20.53 m2)

Ceiling Structures/Linings	Vermiculite					
	1041/B00C/R0004/Ceiling Structures/Linings/S1					
	Limited Samples Taken					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00C - M0005 - Distribution Board (0.74 m2)

Note: No inspection of live electrical installation.

Wall & Door Lining	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1041/B00C/M0005/Wall & Door Lining/S14					
	Chrysotile (white asbestos)					

B00C - M0006 - Movement (9.64 m2)

No Asbestos

B00C - M0007 - Staff Toilet (3.07 m2)

No Asbestos

B00C - M0008 - Stairs (7.55 m2)

No Asbestos

B00C - R0001 - Movement (18.04 m2)

No Asbestos

B00C - R0002 - Community Clinic (17.53 m2)

Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1041/B00C/R0002/Floor Coverings Res/Textile/S13					
	Chrysotile (white asbestos)					
Ceiling Structures/Linings	Vermiculite					
	1041/B00C/R0004/Ceiling Structures/Linings/S1					
	Limited Samples Taken					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00C - R0003 - General Storeroom (11.54 m2)

Ceiling Structures/Linings	Vermiculite					
	1041/B00C/R0004/Ceiling Structures/Linings/S1					
	Limited Samples Taken					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00C - R0004 - Movement (16.39 m2)

Ceiling Structures/Linings	Vermiculite					
	1041/B00C/R0004/Ceiling Structures/Linings/S1					
	Limited Samples Taken					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00C - R0005 - Duplicating Workroom (13.72 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1041/B00C/R0005/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
1041/B00C/R0004/Ceiling Structures/Linings/S1					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0006 - Staff Toilet (3.63 m2)						
No Asbestos						
B00C - R0007 - Staff Toilet (2.75 m2)						
No Asbestos						
B00C - R0008 - Staff Room Annexe (11.98 m2)						
Ceiling Structures/Linings	Vermiculite					
1041/B00C/R0004/Ceiling Structures/Linings/S1					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0009 - Distribution Board (2.5 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00C - R0010 - Movement (44.6 m2)						
No Asbestos						
B00C - R0011 - Withdrawal Space - 1hb (9.79 m2)						
No Asbestos						
B00C - R0012 - Practical Activities - 1hb (19.77 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1041/B00C/R0005/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00C - R0013 - Home Base (55.47 m2)						
No Asbestos						
B00C - R0014 - Distribution Board (1.06 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00C - R0015 - Home Base (49.54 m2)						
No Asbestos						
B00C - R0016 - Practical Activities - 1hb (19.69 m2)						
No Asbestos						
B00C - R0017 - Movement (1.88 m2)						
No Asbestos						
B00C - R0018 - Stairs (2.16 m2)						
No Asbestos						
B00C - R0019 - Stairs (0.7 m2)						
No Asbestos						
B00C - R1002 - Home Base Store (6.63 m2)						
No Asbestos						
B00C - R1003 - Movement (4.9 m2)						
No Asbestos						
B00C - R1004 - Movement (22.31 m2)						
No Asbestos						
B00C - R1005 - Withdrawal Space - 1hb (12.89 m2)						
No Asbestos						
B00C - R1006 - Practical Activities - 1hb (21.61 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1041/B00C/R0005/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00C - R1007 - Home Base (53.36 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00C - R1008 - Home Base (49.23 m2)

No Asbestos

B00C - R1009 - Practical Activities - 1hb (18.98 m2)

Floor Coverings Res/Textile	Vinyl Tiles	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1041/B00C/R0005/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00C - R1010 - Withdrawal Space - 1hb (8.01 m2)

No Asbestos

B00C - R1011 - General Storeroom (9.39 m2)

Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1041/B00C/R0005/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00C - R1012 - Stairs (3.63 m2)

No Asbestos

B00C - R1013 - Stairs (2.64 m2)

No Asbestos

B00C - R1014 - Home Base (68.14 m2)

No Asbestos

B00C - R1015 - Practical Activities - 1hb (19.32 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pre-School Facilities - 1974 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 1041/B00D/Eaves Linings/S21	40m2	East facing, West facing	Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)
Gable verge lining	Flat AC Sheeting 1041/B00D/Gable verge lining/S20	50m	East facing, West facing	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00D - R0001 - Movement (88.22 m2)						
No Asbestos						
B00D - R0002 - Home Base - Pre (88.22 m2)						
No Asbestos						
B00D - R0003 - Toilets - Boys/Girls - Pre (10.14 m2)						
No Asbestos						
B00D - R0004 - Movement (2.49 m2)						
No Asbestos						
B00D - R0005 - Personal Effects - Pre (5.43 m2)						
No Asbestos						
B00D - R0006 - General Storeroom - Pre (4.16 m2)						
No Asbestos						
B00D - R0007 - Staff Room (16.47 m2)						
No Asbestos						
B00D - R0008 - Distribution Board (0.23 m2)					Note: No inspection of live electrical installation.	
Door Lining	Flat AC Sheeting 1041/B00D/R0008/Door Lining/S15	2m2	North	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)
B00D - R0009 - Laundry - Pre (7.61 m2)						
No Asbestos						
B00D - R0010 - Staff Kitchen (22.75 m2)						
No Asbestos						
B00D - R0011 - Movement (6.2 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1041/B00B/R2015/Ceiling Structures/Linings/S5	7m2	All surfaces	Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)
B00D - R0012 - Staff Room Annexe (14.26 m2)						
No Asbestos						
B00D - R0013 - Staff Room Annexe (16.93 m2)						
No Asbestos						
B00D - R0014 - Staff Room (18.12 m2)						
No Asbestos						
B00D - R0015 - Staff Toilet (2.19 m2)						
No Asbestos						
B00D - R0016 - Home Base - Pre (87.62 m2)						
No Asbestos						
B00D - R0017 - General Storeroom (5.64 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00D - R0018 - Toilets - Boys/Girls - Pre (10.71 m2)						
No Asbestos						
B00D - R0020 - Personal Effects - Pre (5.4 m2)						
No Asbestos						
B00D - R0021 - General Storeroom - Pre (4.12 m2)						
No Asbestos						
B00D - R0022 - General Storeroom - Pre (4.18 m2)						
No Asbestos						
B00D - R0023 - Personal Effects - Pre (5.45 m2)						
No Asbestos						
B00D - R0025 - Toilets - Boys/Girls - Pre (10.71 m2)						
No Asbestos						
B00D - R0026 - Home Base - Pre (86.01 m2)						
No Asbestos						
B00D - R0027 - Movement (37.36 m2)						
No Asbestos						
B00D - R0028 - Withdrawal Space - 1hb (7.94 m2)						
No Asbestos						
B00D - R0029 - Withdrawal Space - 1hb (6.46 m2)						
No Asbestos						
B00D - R0030 - Withdrawal Space - 1hb (6.2 m2)						
No Asbestos						
B00D - R0031 - Laundry - Pre (0.86 m2)						
Wall Linings Internal	Flat AC Sheeting					
			1041/B00D/R0031/Wall Linings Internal/S10			No Asbestos Detected
B00D - R0032 - Movement (1.73 m2)						
Wall Linings Internal	Flat AC Sheeting					
			1041/B00D/R0031/Wall Linings Internal/S10			No Asbestos Detected
B00D - R0033 - Movement (1.85 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Other-After School Care - 1965 - Timber (Timber)

Exterior

Ceiling Voids	Non Accessible Area - Height Restriction					
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00E - R0001 - Out Of School Hours Care Centre (53.8 m2)

No Asbestos

B00E - R0002 - Out Of School Hours Care Centre (53.8 m2)

No Asbestos

B00E - R0003 - Movement (25.93 m2)

No Asbestos

B00E - R0004 - Staff Toilet (2.56 m2)

Wall Linings Internal	Flat AC Sheeting 1041/B00E/R0004/Wall Linings Internal/S9					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00E - R0005 - Staff Toilet (2.58 m2)

Wall Linings Internal	Flat AC Sheeting 1041/B00E/R0004/Wall Linings Internal/S9					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning/Multi Purpose Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00F - R0001 - Special Programs Room (31.64 m2)

No Asbestos

B00F - R0002 - Special Programs Store (8.5 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017