


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Arcadia Public School (1048)
Region : Northern Sydney
State Electorate : Hornsby
Local Government Area : Hornsby

Initial Survey : Noel Arnold & Associates : 10 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 13 - Jul - 2016

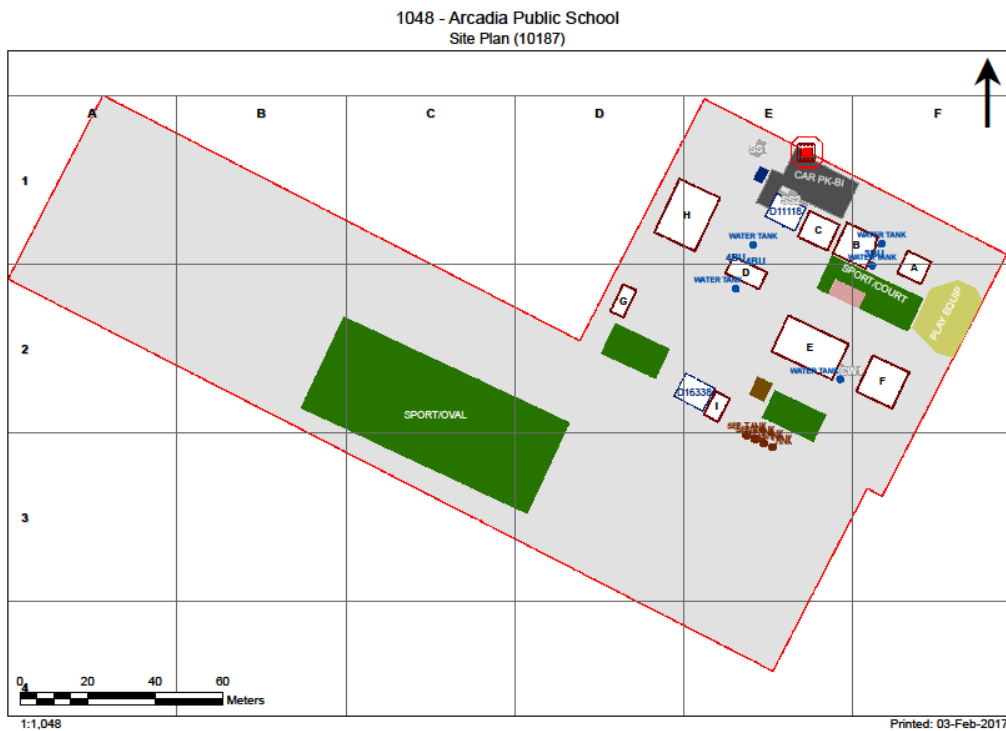

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1896 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Height Restriction
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction

Interior

B00A - R0001 - Staff Room

No Asbestos

B00A - R0003 - Staff Room Annexe

No Asbestos

B00A - R0004 - Entry Vestibule

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1955 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1048/B00B/R0002/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Height Restriction - Low clearance could not be accessed.					

Interior

B00B - R0001 - Practical Activities - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1048/B00B/R0002/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		

B00B - R0002 - Personal Effects Storage

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1048/B00B/R0002/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		

B00B - R0003 - Staff Room Annexe

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1048/B00B/R0002/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		

B00B - R0004 - Staff Room

No Asbestos

B00B - R0005 - Home Base Store

No Asbestos

B00B - R0007 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1954 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1048/B00C/Eaves Linings/S6					Chrysotile (white asbestos)
Verge Strip	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1048/B00C/Eaves Linings/S6					Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Height Restriction					

Interior

B00C - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1048/B00C/R0001/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Crocidolite (blue asbestos)

B00C - R0002 - Movement

No Asbestos

B00C - R0003 - General Storeroom

No Asbestos

B00C - R0005 - Home Base Store

No Asbestos

B00C - R0006 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00D - Pupil Facilities - 1960 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1048/B00D/Eaves Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00D - R0001 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1048/B00D/Eaves Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0002 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1048/B00D/Eaves Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0003 - Kiln Room

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1048/B00D/Eaves Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0004 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1048/B00D/Eaves Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0005 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1048/B00D/Eaves Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library - 1980 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling Non Accessible Area
 - Area inaccessible due to raked ceiling.

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00E - R0001 - Security Store

No Asbestos

B00E - R0002 - Library Office/Workroom

No Asbestos

B00E - R0003 - Reading Area

No Asbestos

B00E - R0004 - Distribution Board

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	2m2	South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
1048/B00E/R0004/Wall Linings Internal/S1					Chrysotile (white asbestos)	

B00E - R0005 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 1995 - Brick/Block (Brick/Block)

Exterior

Gable Ends	Flat AC Sheeting	2m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						

Ceiling Voids	No Asbestos Found
---------------	-------------------

Underfloor Voids - Slab on Ground	No Asbestos Found
-----------------------------------	-------------------

Interior

B00F - R0001 - Staff Toilet

No Asbestos

B00F - R0002 - Disabled Shower/Toilet

No Asbestos

B00F - R0003 - Staff Toilet

No Asbestos

B00F - R0004 - General Storeroom

No Asbestos

B00F - R0005 - Canteen

No Asbestos

B00F - R0006 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting				
	1048/B00F/R0006/Ceiling Structures/Linings/S2	No Asbestos Detected			

B00F - R0007 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Building Services - 1896 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00G - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

Interior

B00H - R0001 - Movement

No Asbestos

B00H - R0002 - Practical Activities - 1hb

No Asbestos

B00H - R0003 - Home Base Store

No Asbestos

B00H - R0004 - Home Base

No Asbestos

B00H - R0005 - Withdrawal Space - 2hb

No Asbestos

B00H - R0006 - Home Base

No Asbestos

B00H - R0007 - Home Base Store

No Asbestos

B00H - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Storage - 2006 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00I - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 505 - D11118 - Admin Staff/Principal/Secure Store : Placement Date - 13/10/2005

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2

R2 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos	16 m2
---------	---------------	------------------	-------

R3 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos	20 m2
---------	---------------	------------------	-------

R4 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2
---------	---------------	------------------	------

R5 - Clerical Office

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2

OS 806 - D16338 - Shelter/Store : Placement Date - 5/06/2003

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Covered Area

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017