


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Ardlethan Central School (1051)
Region : Riverina
State Electorate : Cootamundra
Local Government Area : Coolamon

Initial Survey : Noel Arnold & Associates : 08 - May - 2008
Reviewed By : AECOM : 28 - Nov - 2014

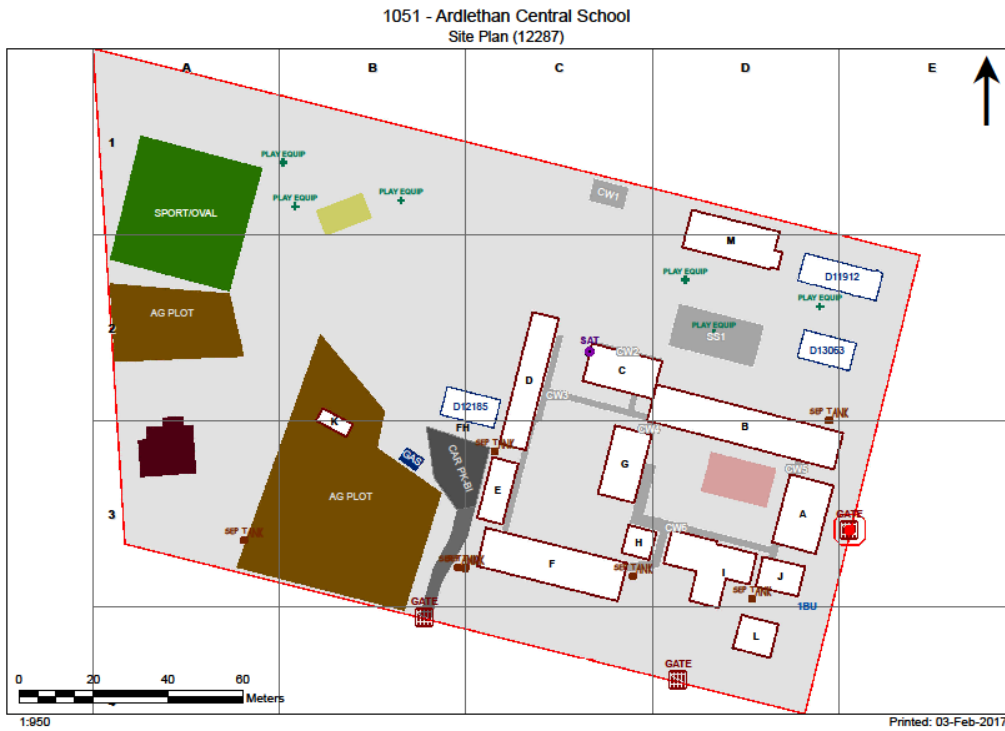

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1993 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00A - R0001 - Sick Bay**

No Asbestos

B00A - R0002 - Clerical Office

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0003 - Movement

No Asbestos

B00A - R0004 - Entry Vestibule

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0005 - Interview

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0006 - General Storeroom

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0007 - Cleaning Supplies

No Asbestos

B00A - R0008 - Disabled Toilet

No Asbestos

B00A - R0009 - Deputy Principal

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0010 - Movement

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0011 - Movement

No Asbestos

B00A - R0012 - Principal

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0013 - Duplicating Workroom

No Asbestos

B00A - R0014 - Seminar/Study

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0015 - Seminar/Study

No Asbestos

B00A - R0016 - Staff Toilet

No Asbestos

B00A - R0017 - Staff Shower/Change

No Asbestos

B00A - R0018 - Distribution Board

No Asbestos

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - Administration/Technological & Applied Studies - 1967 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 1051/B00B/Eaves Linings/S10	30m2	North facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	Remnant eave lining above BR0006. 1051/B00B/Ceiling Voids/S7	2m2	Ceiling cavity above BR0006.	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling void accessed via BR0010	Non Accessible Area - Area inaccessible - fixed benches and cabinetry below/around access hatch					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting 1051/B00B/Underfloor Voids - Packing to Floor Joists/S8	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	AC Fragments/Debris 1051/B00B/Underfloor Voids/S9	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Interior**B00B - R0001 - Interview**

No Asbestos

B00B - R0002 - Interview

No Asbestos

B00B - R0003 - General Storeroom

No Asbestos

B00B - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1051/B00F/R0001/Ceiling Structures/Linings/S1	102m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-------	--------------	--------------------	---------	--

B00B - R0005 - Distribution Board

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting 1051/B00B/R0005/Wall Linings Internal/S6	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 1051/B00B/R0005/Wall Linings Internal/S6	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0006 - Staff Room

No Asbestos

B00B - R0007 - Staff Room Annexe

No Asbestos

B00B - R0008 - Movement

No Asbestos

B00B - R0009 - General Storeroom

Floor Coverings Res/Textile	Vinyl Sheet 1051/B00B/R0010/Floor Coverings Res/Textile/S4					No Asbestos Detected
-----------------------------	---	--	--	--	--	-----------------------------

B00B - R0010 - Food Technology L.S.

Floor Coverings Res/Textile	Vinyl Sheet 1051/B00B/R0010/Floor Coverings Res/Textile/S4					No Asbestos Detected
-----------------------------	---	--	--	--	--	-----------------------------

B00B - R0011 - General Storeroom

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Sheet					
	1051/B00B/R0010/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00B - R0012 - Apparatus Store						
Floor Coverings Res/Textile	Vinyl Tiles					
	1051/B00B/R0012/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00B - R0013 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles					
	1051/B00B/R0012/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00B - R0014 - Art Learning Space						
No Asbestos						
B00B - R0015 - Kiln Room						
No Asbestos						
B00B - R0016 - General Storeroom						
No Asbestos						
B00B - R0017 - Chemical Store						
Floor Coverings Res/Textile	Vinyl Tiles					
	1051/B00B/R0017/Floor Coverings Res/Textile/S12					No Asbestos Detected
B00B - R0018 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1051/B00F/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
B00B - R0019 - General Storeroom						
Backing below vinyl floor sheeting	Paper					
	1051/B00B/R0019/Backing below vinyl floor sheeting/S11					No Asbestos Detected
B00B - R0020 - Staff Study						
No Asbestos						
B00B - R0021 - Staff Toilet						
Splashback lining	Flat AC Sheeting	6m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1051/B00F/R0019/Wall Linings Internal/S20					Chrysotile (white asbestos)
B00B - R0022 - Staff Toilet						
Splashback lining	Flat AC Sheeting	6m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1051/B00F/R0019/Wall Linings Internal/S20					Chrysotile (white asbestos)
Incinerator	Encapsulated Insulation material within unit	1Unit(s)	East facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible - access requires					
B00B - R0023 - Movement						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Library - 1972 - Brick/Veneer (Brick/Veneer)**Exterior**

Wall Cladding	Weatherboard type lining 1051/B00C/Wall Cladding/S18					No Asbestos Detected
Eaves Linings	Flat AC Sheeting 1051/B00C/Eaves Linings/S17	10m2	North facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
In-fill-panel below Window	Flat AC Sheeting 1051/B00C/In-fill-panel below Window/S13	10m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible - Clearance generally 60-70cm only. No asbestos identified in vicinity of access point.					

Interior**B00C - R0001 - Library Office/Workroom**

No Asbestos

B00C - R0002 - General Storeroom

No Asbestos

B00C - R0003 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1051/B00F/R0001/Ceiling Structures/Linings/S1	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00C - R0004 - Reading Area

Ceiling Structures/Linings	Flat AC Sheeting 1051/B00F/R0001/Ceiling Structures/Linings/S1	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00C - R0005 - Seminar/Study

No Asbestos

B00C - R0006 - Reading Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1993 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible - slab on ground
Ceiling Voids	No Asbestos Found

Interior

B00D - R0001 - Garden Store

No Asbestos

B00D - R0003 - Shower/Change

No Asbestos

B00D - R0004 - Cleaning Distributed Store

No Asbestos

B00D - R0005 - Toilets - Girls

No Asbestos

B00D - R0006 - Sports Store

No Asbestos

B00D - R0007 - Toilets - Boys

No Asbestos

B00D - R0008 - Shower/Change

No Asbestos

B00D - R0009 - Cleaning Distributed Store

No Asbestos

B00D - R0010 - Movement

No Asbestos

B00D - R0011 - Drinking Facilities

No Asbestos

B00D - R0012 - Movement

No Asbestos

B00D - R0013 - General Assistants

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1972 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible - slab on ground
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible - Flat klip-lok roof. Fixed ceilings where present. No keys available for ER0005.

Interior**B00E - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1051/B00F/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

B00E - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1051/B00F/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

B00E - R0003 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1051/B00F/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

B00E - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1051/B00F/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

B00E - R0005 - Uniform Shop

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1051/B00F/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

B00E - R0006 - Canteen

Ceiling Structures/Linings	Flat AC Sheeting	34m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1051/B00F/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1972 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	15m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1051/B00F/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
In-fill-panel below Window	Flat AC Sheeting	16m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1051/B00C/In-fill-panel below Window/S13				Chrysotile (white asbestos)	
Ceiling Voids	Flat AC Sheeting	8m2	Hardiflex gable lining	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	1051/B00F/Ceiling Voids/S14				Chrysotile (white asbestos)	
Ceiling Voids	AC Fragments/Debris	NA	Debris from Hardiflex gable lining	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	1051/B00F/Ceiling Voids/S14				Chrysotile (white asbestos)	
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	1051/B00F/Underfloor Voids - Packing to Floor Joists/S15				Chrysotile (white asbestos)	
Underfloor Voids	AC Fragments/Debris	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	1051/B00F/Underfloor Voids/S16				Chrysotile (white asbestos)	

Interior**B00F - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	76m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1051/B00F/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
In-fill-panel below Window	Flat AC Sheeting	13m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1051/B00C/In-fill-panel below Window/S13				Chrysotile (white asbestos)	

B00F - R0002 - Staff Toilet

No Asbestos

B00F - R0003 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0005 - Withdrawal Space - 2hb

No Asbestos

B00F - R0006 - General Storeroom

No Asbestos

B00F - R0007 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles					
	1051/B00F/R0007/Floor Coverings Res/Textile/S2				No Asbestos Detected	

B00F - R0008 - Home Base

No Asbestos

B00F - R0009 - Home Base

No Asbestos

B00F - R0010 - Toilets - Boys/Girls

No Asbestos

B00F - R0011 - Cleaning Supplies

Incinerette	Millboard	1Unit	Enclosed within unit	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible - access requires					
Window putty	Mastic	1Unit	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1051/B00F/R0011/Window putty/S19				Chrysotile (white asbestos)	

B00F - R0012 - Personal Effects Storage

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1051/B00F/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	9m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
1051/B00F/R0013/Partition Walls (Cubicles)/S21					Chrysotile (white asbestos)	
B00F - R0013 - Toilets - Boys						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
1051/B00F/R0013/Partition Walls (Cubicles)/S21					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1051/B00F/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00F - R0014 - Personal Effects Storage						
No Asbestos						
B00F - R0015 - General Storeroom						
No Asbestos						
B00F - R0016 - Personal Effects Storage						
No Asbestos						
B00F - R0017 - Staff Study						
No Asbestos						
B00F - R0018 - Movement						
No Asbestos						
B00F - R0019 - Cleaning Distributed Store						
Wall Linings Internal	Flat AC Sheeting	2m2	Below basin splashback, covered by ceramic tile	Minimal Damage (2)	Medium (2)	Low Priority (2-3)
1051/B00F/R0019/Wall Linings Internal/S20					Chrysotile (white asbestos)	
B00F - Room+1 - Cleaners Cupboard						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00G - Multi Purpose Facilities/Technological & Applied S - 1967 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	12m2	North facing, South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1051/B00F/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
In-fill-panel below Window	Flat AC Sheeting					No Asbestos Detected
	1051/B00G/In-fill-panel below Window/S22					
Ceiling Voids	Non Accessible Area - Area inaccessible - Limited access via GR0007 due airconditioning duct work. Likley no asbestos present.					
Underfloor Voids	AC Fragments/Debris	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	1051/B00G/Underfloor Voids/S28					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	Flat AC Sheeting	NA	Formwork to concrete slab at south entry	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1051/B00G/Underfloor Voids/S29					Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior**B00G - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	38m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1051/B00F/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B00G - R0002 - Distribution Board

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1051/B00B/R0005/Wall Linings Internal/S6					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1051/B00B/R0005/Wall Linings Internal/S6					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0004 - Welding Area

No Asbestos

B00G - R0006 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1051/B00F/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B00G - R0007 - General Storeroom

No Asbestos

B00G - R0008 - Computer Learning Space

No Asbestos

B00G - R0011 - Materials Technology L.S.

Flooring material	Fibre cement board	5m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	1051/B00G/R0011/Flooring material/S23					Chrysotile (white asbestos)
Window frame(s)	Putty	6Unit	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1051/B00G/R0011/Window frame(s)/S24					Chrysotile (white asbestos)
Window infill panel	Flat AC Sheeting					No Asbestos Detected
	1051/B00G/In-fill-panel below Window/S22					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1925 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 1051/B00I/Eaves Linings/S3					No Asbestos Detected
Underfloor Voids	Non Accessible Area - Area inaccessible - maximum clearance ~30cm.					
Ceiling Voids	Non Accessible Area - Height Restriction - heights generally 4m and ceilings fixed.					

Interior

B00H - R0001 - General Learning Space

Heater Surround	Flat AC Sheeting	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1051/B00H/R0001/Heater Surround/S25					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00H - R0002 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - General Learning/Darkroom - 1972 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 1051/B001/Eaves Linings/S3					No Asbestos Detected
Gable Ends	Flat AC Sheeting	4m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction - 4m						
Underfloor Voids	Non Accessible Area - Area inaccessible - clearance ~15cm.					
Ceiling Voids	Non Accessible Area - Area inaccessible - height 4m in IR0002. Occupation of IR0006 and location of services above access hatch in this area prevented further inspection.					

Interior

B001 - R0001 - General Storeroom

No Asbestos

B001 - R0002 - Computer Learning Space

Heater Surround	Flat AC Sheeting	1Unit(s)	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1051/B001/R0006/Heater Surround/S26			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0003 - Senior Study

No Asbestos

B001 - R0004 - Telematics

No Asbestos

B001 - R0005 - Telematics

No Asbestos

B001 - R0006 - General Learning Space

Heater Surround	Flat AC Sheeting	1Unit(s)	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1051/B001/R0006/Heater Surround/S26			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0007 - General Storeroom

No Asbestos

B001 - R0008 - General Storeroom

No Asbestos

B001 - R0009 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 1910 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 1051/B00I/Eaves Linings/S3					No Asbestos Detected
Underfloor Voids	Non Accessible Area - Area inaccessible - clearance ~20cm.					
Ceiling Voids	Non Accessible Area - Area inaccessible - access hatch is screwed shut, ~4m high, centre of room.					

Interior

B00J - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1051/B00J/R0001/Ceiling Structures/Linings/S27					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00J - R0002 - Home Base

Heater Surround	Flat AC Sheeting 1051/B00I/R0006/Heater Surround/S26	1Unit(s)	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
-----------------	---	----------	-------------	--------------------	---------	---

B00J - R0003 - Withdrawal Space - 1hb

Heater Surround	Flat AC Sheeting 1051/B00I/Eaves Linings/S3					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 1051/B00J/R0001/Ceiling Structures/Linings/S27					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 1051/B00I/Eaves Linings/S3					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Shed - 1950 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible - slab on ground

Interior

B00K - R0001 - Garden Store

No Asbestos

B00K - R0002 - General Storeroom

No Asbestos

B00K - R0003 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Administration - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

No Asbestos

Interior

B00L - R0001 - Home Base

No Asbestos

B00L - R0002 - Home Base Store

No Asbestos

B00L - R0003 - Practical Activities

No Asbestos

B00L - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - General Learning/Technological - 2015 - Steel (Steel)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00M - R0001 - Covered Area

No Asbestos

B00M - R0002 - Workshop Area

No Asbestos

B00M - R0003 - Welding Area

No Asbestos

B00M - R0004 - Distribution Board Cupboard

Note: No inspection of live electrical installation.

No Asbestos

B00M - R0005 - Seminar/Technology Space

No Asbestos

B00M - R0006 - Materials Store

No Asbestos

B00M - R0007 - Materials Store

No Asbestos

B00M - R0008 - Machine Storage

No Asbestos

B00M - R0009 - Covered Outdoor Space

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 810 - D11912 - FSU/Shelter/Stores : Placement Date - 10/01/2006

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Canteen

No Asbestos Found.

R2 - Covered Area

No Asbestos Found.

R3 - Store

No Asbestos Found.

R4 - Sports Store

No Asbestos Found.

R5 - Garden Store

No Asbestos Found.

R6 - Change Room

No Asbestos Found.

R7 - Store

No Asbestos Found.

OS 760 - D12185 - Woodwork/Store : Placement Date - 24/09/1996

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	17.28 m2

Interior

R1 - Woodwork

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	91 m2

R2 - Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2

OS 720 - D13063 - Science Laboratory/Prep Room : Placement Date - 18/07/2001

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	17.28 m2

Interior

R1 - Laboratory L.S.

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	90 m2

R2 - Preparation

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	19 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017