


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Ariah Park Central School (1055)  
**Region :** Riverina  
**State Electorate :** Cootamundra  
**Local Government Area :** Temora

**Initial Survey :** Noel Arnold & Associates : 08 - May - 2008  
**Reviewed By :** Greencap-NAA : 15 - Jun - 2016

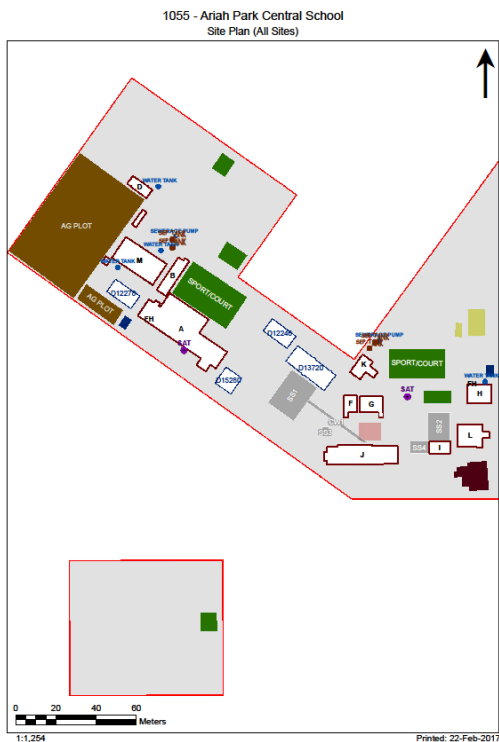

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/General Learning - 1965 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1055/B00K/Eaves Linings/S10					<b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b>
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

**Interior****B00A - R0001 - Clerical Office**

Floor Coverings Res/Textile	Vinyl sheet under carpet					
	1055/B00A/R0001/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>

**B00A - R0002 - Cleaning Supplies**

No Asbestos

**B00A - R0003 - Staff Toilet**

No Asbestos

**B00A - R0004 - General Storeroom**

No Asbestos

**B00A - R0005 - Staff Toilet**

No Asbestos

**B00A - R0007 - Clerical Office**

No Asbestos

**B00A - R0012 - External Movement**

Wall Linings Internal	Flat AC Sheeting					
	1055/B00I/R0001/Wall Linings Internal/S2					<b>No Asbestos Detected</b>

**B00A - R0014 - Seminar/Study**

No Asbestos

**B00A - R0015 - Seminar/Study**

No Asbestos

**B00A - R0016 - General Learning Space**

No Asbestos

**B00A - R0017 - General Storeroom**

No Asbestos

**B00A - R0018 - Pantry**

No Asbestos

**B00A - R0021 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1055/B00A/R0021/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00A - R0022 - Covered Outdoor Learning Area**

No Asbestos

**B00A - R0023 - Movement**

No Asbestos

**B00A - R0024 - Movement**

No Asbestos

**B00A - R0025 - Administration - Clerical**

Floor Coverings Res/Textile	Vinyl sheet under carpet					
	1055/B00A/R0001/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>

**B00A - R0026 - Duplicating Workroom**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	<b>Sample No</b>					<b>Test Result</b>

Floor Coverings Res/Textile Vinyl sheet under carpet  
 1055/B00A/R0001/Floor Coverings Res/Textile/S11 **No Asbestos Detected**

**B00A - R0027 - Movement**

No Asbestos

**B00A - R0028 - Administration - Clerical**

No Asbestos

**B00A - R0029 - Staff Room**

No Asbestos

**B00A - R0030 - Movement**

Recently Modified Space Requires Inspection

**B00A - R0031 - Laundry**

Recently Modified Space Requires Inspection

**B00A - R0032 - Change - Type 2**

Recently Modified Space Requires Inspection

**B00A - R0033 - Kitchen - Type 1**

Recently Modified Space Requires Inspection

**B00A - R0034 - Seminar/Technology Space**

Recently Modified Space Requires Inspection

**B00A - R0035 - Other**

Recently Modified Space Requires Inspection

**B00A - R0036 - Main Switch Board**

Recently Modified Space Requires Inspection

**B00A - R0037 - Movement**

Recently Modified Space Requires Inspection

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00B - Pupil Facilities - 1965 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1055/B00A/R0021/Ceiling Structures/Linings/S3			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**Interior****B00B - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	NA	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1055/B00C/R0007/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00B - R0002 - Sports Store**

Ceiling Structures/Linings	Flat AC Sheeting	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1055/B00A/R0021/Ceiling Structures/Linings/S3			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00B - R0003 - Toilets - Girls**

Ceiling Structures/Linings	Compressed AC Sheet	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1055/B00A/R0021/Ceiling Structures/Linings/S3			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00B - R0004 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1055/B00A/R0021/Ceiling Structures/Linings/S3			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00B - R0005 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1055/B00A/R0021/Ceiling Structures/Linings/S3			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Shed - 1965 - Steel (Steel)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

**Interior**

**B00D - R0001 - General Storeroom**

No Asbestos

**B00D - R0002 - Animal Space**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Shed - 1902 - Steel (Steel)**

**Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area  
 - Area inaccessible

Ceiling Voids      No Asbestos Found

**Interior**

**B00E - R0001 - Garden Store**

No Asbestos

**B00E - R0002 - General Assistant/Bulk Store**

No Asbestos

**B00E - R0003 - Garden Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Computer Learning - 1908 - Timber (Timber)**

**Exterior**

Ceiling Voids	Non Accessible Area - Height Restriction 4m height
Underfloor Voids	No Asbestos Found

**Interior**

**B00F - R0001 - Computer Learning Space**

No Asbestos

**B00F - R0002 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning - 1902 - Timber (Timber)**

**Exterior**

Ceiling Voids	Non Accessible Area - Height Restriction 4m height
Underfloor Voids	No Asbestos Found

**Interior**

**B00G - R0001 - General Learning Space**

Heater Surround	Low Density Board	2m2	West facing	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
1055/B00J/R0007/Heater Surround/S6				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00G - R0002 - Movement**

No Asbestos

**B00G - R0003 - Withdrawal Space - 1hb**

No Asbestos

**B00G - R0004 - Home Base Store**

No Asbestos

**B00G - R0005 - External Movement**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Music - 1930 - Timber (Timber)****Exterior**

Ceiling Voids	Non Accessible Area - Height Restriction 4m height
Underfloor Voids	No Asbestos Found

**Interior****B00H - R0001 - Music Learning Space**

Ceiling Structures/Linings	Flat AC Sheeting	78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1055/B00H/R0001/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00H - R0002 - Practice/Seminar**

No Asbestos

**B00H - R0003 - Practice/Seminar**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
1055/B00H/R0001/Wall Linings Internal/S2						

**B00H - R0004 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1055/B00H/R0001/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00H - R0005 - Music Store**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1055/B00H/R0001/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - Shed - 1965 - Timber (Timber)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible

**Interior**

**B00I - R0001 - Sports Store**

Wall Linings Internal	Flat AC Sheeting 1055/B00I/R0001/Wall Linings Internal/S2	<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting 1055/B00I/R0001/Wall Linings Internal/S2	<b>No Asbestos Detected</b>

**B00I - R0002 - Movement**

No Asbestos

**B00I - R0003 - General Storeroom**

Wall Linings Internal	Flat AC Sheeting 1055/B00I/R0001/Wall Linings Internal/S2	<b>No Asbestos Detected</b>
-----------------------	--------------------------------------------------------------	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00J - General Learning - 1992 - Timber (Timber)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00J - R0001 - External Movement**

No Asbestos

**B00J - R0002 - General Storeroom**

No Asbestos

**B00J - R0003 - Deputy Principal**

No Asbestos

**B00J - R0004 - Home Base**

Heater Surround	Low Density Board	1Unit(s)	West facing	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
	1055/B00J/R0007/Heater Surround/S6			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00J - R0005 - Home Base**

Heater Surround	Low Density Board	1Unit(s)	West facing	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
	1055/B00J/R0007/Heater Surround/S6			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00J - R0006 - Home Base**

Heater Surround	Low Density Board	1Unit(s)	West facing	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
	1055/B00J/R0007/Heater Surround/S6			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1055/B00J/R0006/Floor Coverings Res/Textile/S7			<b>Chrysotile (white asbestos)</b>		

Floor Coverings Res/Textile	Adhesive	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1055/B00J/R0006/Floor Coverings Res/Textile/S8			<b>Chrysotile (white asbestos)</b>		

**B00J - R0007 - Home Base**

Heater Surround	Low Density Board	1Unit(s)	West facing	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
	1055/B00J/R0007/Heater Surround/S6			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

Floor Coverings Res/Textile	Adhesive	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1055/B00J/R0006/Floor Coverings Res/Textile/S8			<b>Chrysotile (white asbestos)</b>		

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1055/B00J/R0006/Floor Coverings Res/Textile/S7			<b>Chrysotile (white asbestos)</b>		

**B00J - R0008 - General Storeroom**

Floor Coverings Res/Textile	Adhesive	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1055/B00J/R0006/Floor Coverings Res/Textile/S8			<b>Chrysotile (white asbestos)</b>		

Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1055/B00J/R0006/Floor Coverings Res/Textile/S7			<b>Chrysotile (white asbestos)</b>		

**B00J - R0009 - External Movement**

No Asbestos

**B00J - R0010 - Cleaning Supplies**

No Asbestos

**B00J - R0011 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	1055/B001/R0001/Wall Linings Internal/S2			<b>No Asbestos Detected</b>		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00J - R0012 - Practical Activity Area</b>						
No Asbestos						
<b>B00J - R0013 - External Movement</b>						
No Asbestos						
<b>B00J - R0014 - Withdrawal Space - 1hb</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00K - Pupil Facilities - 1965 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 1055/B00K/Eaves Linings/S10	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b>

**Interior****B00K - R0001 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting 1055/B00K/Eaves Linings/S10	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b>
----------------------------	-------------------------------------------------	------	------------	--------------------	---------	----------------------------------------------------------------------------------------

**B00K - R0002 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting 1055/B00K/Eaves Linings/S10	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b>
----------------------------	-------------------------------------------------	-----	------------	--------------------	---------	----------------------------------------------------------------------------------------

**B00K - R0003 - Plant**

Ceiling Structures/Linings	Flat AC Sheeting 1055/B00K/Eaves Linings/S10	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b>
----------------------------	-------------------------------------------------	-----	------------	--------------------	---------	----------------------------------------------------------------------------------------

**B00K - R0004 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting 1055/B00K/Eaves Linings/S10	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b>
----------------------------	-------------------------------------------------	-----	------------	--------------------	---------	----------------------------------------------------------------------------------------

**B00K - R0005 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting 1055/B00K/Eaves Linings/S10	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b>
----------------------------	-------------------------------------------------	------	------------	--------------------	---------	----------------------------------------------------------------------------------------

**B00K - R0006 - Toilets - Girls/Disabled Cubicle**

Ceiling Structures/Linings	Flat AC Sheeting 1055/B00K/Eaves Linings/S10	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b>
----------------------------	-------------------------------------------------	------	------------	--------------------	---------	----------------------------------------------------------------------------------------

**B00K - R0007 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 1055/B00K/Eaves Linings/S10	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b>
----------------------------	-------------------------------------------------	-----	------------	--------------------	---------	----------------------------------------------------------------------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Library - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00L - R0001 - Library Office/Workroom**

No Asbestos

**B00L - R0002 - K.L.A. Store**

No Asbestos

**B00L - R0003 - Plant**

No Asbestos

**B00L - R0004 - Communications Room**

No Asbestos

**B00L - R0005 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00L - R0006 - Reading Area**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Technological & Applied Studies - 2014 - Steel (Steel)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

**Interior**

**B00M - R0001 - Dust Extraction Space**

No Asbestos

**B00M - R0002 - Welding Area**

No Asbestos

**B00M - R0003 - Workshop Area**

No Asbestos

**B00M - R0004 - Workshop Area**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00N - Agricultural Science - 1965 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00N - R0001 - Class Tools Storage**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Build+1 - Old drinking facilities**

**Exterior**

Gable Ends	Flat AC Sheeting	4m2	North & South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1055/Build+1/Exterior/Gable Ends/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 700 - D12246 - Art Learning Space/Workshop/Store : Placement Date - 24/09/1996**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		17.28 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2

#### R2 - Art Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		91 m2

#### R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos		10 m2
---------	---------------	------------------	--	-------

**OS 720 - D12278 - Science Laboratory/Prep Room : Placement Date - 30/06/1995**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		17.28 m2

### Interior

#### R1 - Laboratory L.S.

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		90 m2

#### R2 - Preparation

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		19 m2

**NS 310 - D13720 - Shelter/FSU /Communal Area/Store/Toilet : Placement Date - 1/03/2004**

### Exterior

No Asbestos Found.

### Interior

#### R1 - Canteen

No Asbestos Found.

#### R2 - Bulk Store

No Asbestos Found.

#### R3 - Garden Store

No Asbestos Found.

#### R4 - Entry

No Asbestos Found.

#### R5 - Communal Space

No Asbestos Found.

#### R6 - Cleaning Supplies

No Asbestos Found.

#### R7 - Toilets-Boys/Girls

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>NS 010 - D15280 - Staff Commonroom/Staff Toilets : Placement Date - 30/06/1995</b>						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Commonroom</b>						
No Asbestos Found.						
<b>R2 - Entry</b>						
No Asbestos Found.						
<b>R3 - Staff Toilet</b>						
No Asbestos Found.						
<b>R4 - Staff Toilet</b>						
No Asbestos Found.						
<b>R5 - Entry</b>						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017