


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Armidale City Public School (1057)
Region : New England
State Electorate : Northern Tablelands
Local Government Area : Armidale Dumaresq

Initial Survey : Noel Arnold & Associates : 20 - May - 2008
Reviewed By : Greencap-NAA : 01 - Apr - 2015

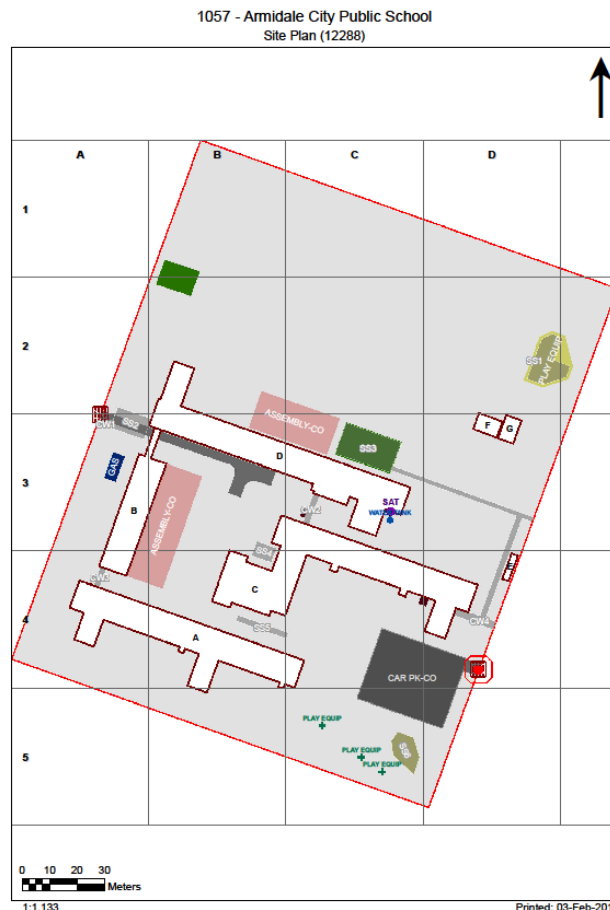

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - General Learning/Administration - 1962 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00A/R0022/Ceiling Structures/Linings/S22			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior**B00A - R0001 - Home Base (73.63 m2)**

Floor Coverings Res/Textile	Underlay					
	1057/B00A/R0013/Floor Coverings Res/Textile/S32			No Asbestos Detected		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1057/B00A/R0013/Floor Coverings Res/Textile/S31			No Asbestos Detected		

B00A - R0002 - Practical Activities - 1hb (13.03 m2)

No Asbestos

B00A - R0003 - Toilets - Boys/Girls (4.32 m2)

No Asbestos

B00A - R0004 - Movement (4.44 m2)

No Asbestos

B00A - R0005 - Movement (1.01 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00A/R0022/Ceiling Structures/Linings/S22			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0006 - External Movement (1.3 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00A/R0022/Ceiling Structures/Linings/S22			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0007 - Personal Effects Storage (23.4 m2)

No Asbestos

B00A - R0008 - Home Base (88.2 m2)

Floor Coverings Res/Textile	Underlay					
	1057/B00A/R0013/Floor Coverings Res/Textile/S32			No Asbestos Detected		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1057/B00A/R0013/Floor Coverings Res/Textile/S31			No Asbestos Detected		

B00A - R0009 - Movement (1.79 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00A/R0022/Ceiling Structures/Linings/S22			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0010 - External Movement (1.98 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00A/R0022/Ceiling Structures/Linings/S22			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0011 - Personal Effects Storage (4.51 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Red Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00A/R0040/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)	
B00A - R0012 - Home Base Store (10.38 m2)						
Floor Coverings Res/Textile	Red Vinyl Tiles					
1057/B00A/R0035/Floor Coverings Res/Textile/S21					No Asbestos Detected	
B00A - R0013 - Home Base (65.54 m2)						
Chalk Board	Resinous Board					
1057/B00A/R0029/Chalk Board/S20					No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
1057/B00A/R0013/Floor Coverings Res/Textile/S31					No Asbestos Detected	
Floor Coverings Res/Textile	Underlay					
1057/B00A/R0013/Floor Coverings Res/Textile/S32					No Asbestos Detected	
B00A - R0014 - Movement (2.13 m2)						
No Asbestos						
B00A - R0015 - Movement (12.16 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00A/R0022/Ceiling Structures/Linings/S22					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00A - R0016 - Toilets - Boys (33.25 m2)						
No Asbestos						
B00A - R0017 - Toilets - Girls (33.49 m2)						
No Asbestos						
B00A - R0018 - Home Base (65.45 m2)						
Floor Coverings Res/Textile	Underlay					
1057/B00A/R0013/Floor Coverings Res/Textile/S32					No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
1057/B00A/R0013/Floor Coverings Res/Textile/S31					No Asbestos Detected	
B00A - R0019 - Home Base Store (10.38 m2)						
Floor Coverings Res/Textile	Red Vinyl Tiles					
1057/B00A/R0035/Floor Coverings Res/Textile/S21					No Asbestos Detected	
B00A - R0020 - Personal Effects Storage (4.49 m2)						
Floor Coverings Res/Textile	Red Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00A/R0040/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)	
B00A - R0021 - Movement (1.05 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00A/R0022/Ceiling Structures/Linings/S22					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00A - R0022 - External Movement (1.3 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00A/R0022/Ceiling Structures/Linings/S22					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00A - R0023 - Home Base (62.14 m2)						
Floor Coverings Res/Textile	Underlay					
1057/B00A/R0013/Floor Coverings Res/Textile/S32					No Asbestos Detected	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1057/B00A/R0013/Floor Coverings Res/Textile/S31					No Asbestos Detected
B00A - R0024 - Practical Activities - 1hb (2.71 m2)						
Floor Coverings Res/Textile	Underlay					
	1057/B00A/R0013/Floor Coverings Res/Textile/S32					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1057/B00A/R0013/Floor Coverings Res/Textile/S31					No Asbestos Detected
B00A - R0025 - Home Base (65.38 m2)						
Floor Coverings Res/Textile	Underlay					
	1057/B00A/R0013/Floor Coverings Res/Textile/S32					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1057/B00A/R0013/Floor Coverings Res/Textile/S31					No Asbestos Detected
B00A - R0026 - Home Base Store (9.34 m2)						
Floor Coverings Res/Textile	Red Vinyl Tiles					
	1057/B00A/R0035/Floor Coverings Res/Textile/S21					No Asbestos Detected
B00A - R0027 - Personal Effects Storage (3.96 m2)						
Floor Coverings Res/Textile	Red Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00A/R0040/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)
B00A - R0028 - Home Base (66.01 m2)						
Floor Coverings Res/Textile	Underlay					
	1057/B00A/R0013/Floor Coverings Res/Textile/S32					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1057/B00A/R0013/Floor Coverings Res/Textile/S31					No Asbestos Detected
B00A - R0029 - Home Base (66.83 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	1057/B00C/R0049/Floor Coverings Res/Textile/S8					No Asbestos Detected
B00A - R0030 - External Movement (1.18 m2)						
No Asbestos						
B00A - R0031 - Movement (2.81 m2)						
No Asbestos						
B00A - R0032 - Deputy Principal (15.18 m2)						
Floor Coverings Res/Textile	Grey Vinyl tiles under carpet					
	1057/B00A/R0035/Floor Coverings Res/Textile/S21					No Asbestos Detected
B00A - R0033 - Special Programs Room (20.85 m2)						
Floor Coverings Res/Textile	Grey Vinyl tiles under carpet					
	1057/B00A/R0035/Floor Coverings Res/Textile/S21					No Asbestos Detected
B00A - R0034 - Staff Toilet (4.2 m2)						
No Asbestos						
B00A - R0035 - General Storeroom (3.74 m2)						
Floor Coverings Res/Textile	Grey Vinyl tiles					
	1057/B00A/R0035/Floor Coverings Res/Textile/S21					No Asbestos Detected
B00A - R0036 - Staff Toilet (8.07 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0037 - Staff Room (35.57 m2)						
Floor Coverings Res/Textile	Grey Vinyl tiles under carpet					
	1057/B00A/R0035/Floor Coverings Res/Textile/S21					No Asbestos Detected
B00A - R0038 - Distribution Board (0.55 m2)						
						Note: No inspection of live electrical installation.
No Asbestos						
B00A - R0039 - Cleaning Distributed Store (4.16 m2)						
No Asbestos						
B00A - R0040 - Movement (153.08 m2)						
Floor Coverings Res/Textile	Red Vinyl Tiles	154m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00A/R0040/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - General Learning/Pupil Facilities - 1965 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Panels Below first Floor Windows	Flat AC Sheeting	100m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00B/Panels Below first Floor Windows/S34				Chrysotile (white asbestos)		
Panel Below Window Ground Floor	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00B/Panel Below Window Ground Floor/S1				Chrysotile (white asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior**B00B - R0001 - Movement (8.8 m2)**

No Asbestos

B00B - R0002 - Movement (260.29 m2)

No Asbestos

B00B - R0003 - Toilets - Boys (39.85 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00B/R0005/Partition Walls (Cubicles)/S24				Chrysotile (white asbestos)		

B00B - R0004 - Plant (33.38 m2)

Electrical Backing Board	Resinous Board	1Unit	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
Gasket material to pipework	Flange gaskets	20Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00B/R0004/Gasket material to pipework/S29				Chrysotile (white asbestos)		

B00B - R0005 - Toilets - Girls (35.96 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00B/R0005/Partition Walls (Cubicles)/S24				Chrysotile (white asbestos)		

B00B - R0006 - Cleaning Distributed Store (0.54 m2)

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00B/R0006/Ceiling Structures/Linings/S30				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0007 - Plant (10.77 m2)

No Asbestos

B00B - R0008 - Movement (8.78 m2)

No Asbestos

B00B - R0009 - External Movement (24.58 m2)

No Asbestos

B00B - R0010 - Stairs (5.19 m2)

No Asbestos

B00B - R0011 - Stairs (5.4 m2)

No Asbestos

B00B - R1001 - Movement (14.05 m2)

Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00B/R1001/Floor Coverings Res/Textile/S14				Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R1002 - Main Switch Board (4.17 m2)						
Insulation to Pipework	Lagging					
	1057/B00B/R1002/Insulation to Pipework/S33					No Asbestos Detected
B00B - R1003 - Home Base (65.86 m2)						
Chalk Board	Resinous Board					
	1057/B00B/R1003/Chalk Board/S17					No Asbestos Detected
B00B - R1004 - Personal Effects Storage (3.8 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00B/R1001/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)
B00B - R1005 - Home Base Store (7.29 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	1057/B00B/R1005/Floor Coverings Res/Textile/S18					No Asbestos Detected
B00B - R1006 - Home Base (65.61 m2)						
Chalk Board	Resinous Board					
	1057/B00B/R1003/Chalk Board/S17					No Asbestos Detected
B00B - R1007 - Practical Activities - 1hb (3.61 m2)						
No Asbestos						
B00B - R1008 - Home Base (62.84 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1057/B00B/R1005/Floor Coverings Res/Textile/S18					No Asbestos Detected
B00B - R1009 - Home Base Store (9.38 m2)						
No Asbestos						
B00B - R1010 - Personal Effects Storage (3.99 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00B/R1001/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)
B00B - R1011 - Home Base (65.61 m2)						
No Asbestos						
B00B - R1012 - General Storeroom (4.17 m2)						
No Asbestos						
B00B - R1013 - Movement (5.13 m2)						
No Asbestos						
B00B - R1014 - Movement (73.38 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	74m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00B/R1001/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)
B00B - R1015 - Movement (20.65 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	1057/B00B/R1015/Floor Coverings Res/Textile/S13					No Asbestos Detected
B00B - R1016 - Stairs (10.4 m2)						
No Asbestos						
B00B - R1017 - Stairs (10.45 m2)						
No Asbestos						
B00B - Room+1 - Internal Walkway from Building B to A						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00B/R1001/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Administration/Communal Facilities - 1964 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	200m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00C/Eaves Linings/S34					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible					

Interior**B00C - R0001 - Deputy Principal (16.45 m2)**

Floor Coverings Res/Textile	Red Vinyl tiles under carpet	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00C/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00C - R0002 - Clerical Office (25.65 m2)

Panel Above Door	Resinous Board					No Asbestos Detected
	1057/B00C/R0003/Panel Above Door/S5					
Floor Coverings Res/Textile	Red Vinyl tiles under carpet	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00C/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00C - R0003 - Duplicating Workroom (11.23 m2)

Panel Above Door	Resinous Board					No Asbestos Detected
	1057/B00C/R0003/Panel Above Door/S5					
Floor Coverings Res/Textile	Red Vinyl tiles under carpet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00C/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00C - R0004 - Entry Vestibule (26.63 m2)

Panel Above Door	Flat AC Sheeting					No Asbestos Detected
	1057/B00C/R0003/Panel Above Door/S5					
Floor Coverings Res/Textile	Red Vinyl tiles under carpet	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00C/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00C - R0005 - General Storeroom (9.34 m2)

Floor Coverings Res/Textile	Red Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00C/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00C - R0006 - General Storeroom (4.08 m2)

Floor Coverings Res/Textile	Red Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00C/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00C - R0007 - External Movement (2.03 m2)

No Asbestos

B00C - R0008 - Movement (3.3 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00C/R0021/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0009 - Movement (23.47 m2)

Floor Coverings Res/Textile	Red Vinyl tiles under carpet	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00C/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00C - R0010 - Principal (31.37 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1057/B00D/R1008/Floor Coverings Res/Textile/S11					No Asbestos Detected
B00C - R0011 - Staff Toilet (3.25 m2)						
No Asbestos						
B00C - R0012 - Security Store (9.02 m2)						
Floor Coverings Res/Textile	Red Vinyl Tiles	10m2	North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00C/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00C - R0013 - Cleaning Distributed Store (1.11 m2)						
No Asbestos						
B00C - R0014 - Staff Toilet (4.15 m2)						
No Asbestos						
B00C - R0015 - Duplicating Workroom (5.36 m2)						
Floor Coverings Res/Textile	Red Vinyl Tiles	4m2	North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00C/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Green Vinyl Tiles					
	1057/B00C/R0015/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00C - R0016 - Movement (105.58 m2)						
Floor Coverings Res/Textile	Red Vinyl Tiles	106m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00C/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00C - R0017 - Home Base (65.94 m2)						
Floor Coverings Res/Textile	Red Vinyl tiles under carpet	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00C/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
Chalk Board	Resinous Board					
	1057/B00C/R0020/Chalk Board/S6					No Asbestos Detected
B00C - R0018 - Home Base Store (9.72 m2)						
Floor Coverings Res/Textile	Red Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00C/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00C - R0019 - Personal Effects Storage (4.56 m2)						
Floor Coverings Res/Textile	Red Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00C/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00C - R0020 - Home Base (66.11 m2)						
Chalk Board	Resinous Board					
	1057/B00C/R0020/Chalk Board/S6					No Asbestos Detected
Floor Coverings Res/Textile	Red Vinyl tiles under carpet	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00C/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00C - R0021 - Movement (3.05 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00C/R0021/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0022 - External Movement (1.74 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1057/B00C/R0021/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0023 - Home Base (66.11 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Red Vinyl tiles under carpet	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00C/R0015/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00C - R0024 - Home Base Store (9.38 m2)						
Floor Coverings Res/Textile	Red Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00C/R0015/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00C - R0025 - Personal Effects Storage (4.05 m2)						
Floor Coverings Res/Textile	Red Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00C/R0015/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00C - R0026 - Home Base (65.86 m2)						
Floor Coverings Res/Textile	Red Vinyl tiles under carpet	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00C/R0015/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00C - R0027 - Home Base (66.1 m2)						
Floor Coverings Res/Textile	Red Vinyl tiles under carpet	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00C/R0015/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00C - R0028 - Home Base Store (10.29 m2)						
Floor Coverings Res/Textile	Red Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00C/R0015/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00C - R0029 - Personal Effects Storage (4.48 m2)						
Floor Coverings Res/Textile	Red Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00C/R0015/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00C - R0030 - Home Base (66.11 m2)						
Floor Coverings Res/Textile	Red Vinyl tiles under carpet	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00C/R0015/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00C - R0031 - Movement (3.01 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00C/R0021/Ceiling Structures/Linings/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0032 - External Movement (1.73 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00C/R0021/Ceiling Structures/Linings/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0033 - Cleaning Distributed Store (7.95 m2)						
No Asbestos						
B00C - R0034 - Staff Toilet (10.43 m2)						
Floor Coverings Res/Textile	Red Vinyl Tiles	3m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00C/R0015/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00C - R0035 - Staff Toilet (10.48 m2)						
Floor Coverings Res/Textile	Red Vinyl Tiles	3m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00C/R0015/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00C - R0036 - Movement (13.01 m2)						
Floor Coverings Res/Textile	Red Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00C/R0015/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00C - R0037 - Staff Room (44.44 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0038 - Security Store (6.82 m2)						
No Asbestos						
B00C - R0039 - Home Base Store (6.64 m2)						
No Asbestos						
B00C - R0040 - Home Base (62.27 m2)						
No Asbestos						
B00C - R0041 - Practical Activities - 1hb (1.71 m2)						
No Asbestos						
B00C - R0042 - External Movement (11.09 m2)						
No Asbestos						
B00C - R0043 - Movement (35.19 m2)						
No Asbestos						
B00C - R0044 - Uniform Shop (13.14 m2)						
No Asbestos						
B00C - R0045 - Communal Space (218.42 m2)						
Panels Above Windows	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00C/R0052/In fill Window Panel/S9					Chrysotile (white asbestos)	
B00C - R0046 - Raised Platform (51.68 m2)						
No Asbestos						
B00C - R0047 - External Movement (7.03 m2)						
No Asbestos						
B00C - R0048 - Movement (6.39 m2)						
No Asbestos						
B00C - R0049 - Movement (15.19 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
1057/B00C/R0049/Floor Coverings Res/Textile/S8					No Asbestos Detected	
B00C - R0050 - Toilets - Girls (4.31 m2)						
In fill Window Panel	Flat AC Sheeting	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00C/R0052/In fill Window Panel/S9					Chrysotile (white asbestos)	
B00C - R0051 - Toilets - Boys (4.24 m2)						
In fill Window Panel	Flat AC Sheeting	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00C/R0052/In fill Window Panel/S9					Chrysotile (white asbestos)	
B00C - R0052 - Movement (15.13 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
1057/B00C/R0049/Floor Coverings Res/Textile/S8					No Asbestos Detected	
In fill Window Panel	Flat AC Sheeting	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00C/R0052/In fill Window Panel/S9					Chrysotile (white asbestos)	
B00C - R0053 - Movement (6.35 m2)						
No Asbestos						
B00C - R0054 - External Movement (7.66 m2)						
No Asbestos						
B00C - R9001 - Plant (49.92 m2)						
Electrical Backing Board	Resinous Board	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00C/R9001/Electrical Backing Board/S25					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Gasket material to pipework	Flange gaskets	20Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00B/R0004/Gasket material to pipework/S29					Chrysotile (white asbestos)	
B00C - Room+1 - Covered Walkway from BuildingC to D						
Floor Coverings Res/Textile	Red Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1057/B00C/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Library - 1962 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 1057/B00D/R0011/Ceiling Structures/Linings/S28					No Asbestos Detected
Panels Above windows	Flat AC Sheeting 1057/B00D/Panels Above windows/S2	200m2	South, West, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior**B00D - R0001 - General Assistant/Bulk Store (236.13 m2)**

No Asbestos

B00D - R0002 - Movement (41.26 m2)

Decorative Coating	Vermiculite 1057/B00D/R0008/Decorative Coating/S26					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
--------------------	---	--	--	--	--	---

B00D - R0003 - External Movement (1.99 m2)

No Asbestos

B00D - R0004 - Cleaning Distributed Store (2.51 m2)

No Asbestos

B00D - R0005 - Staff Toilet (9.27 m2)

Decorative Coating	Vermiculite 1057/B00D/R0008/Decorative Coating/S26					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
--------------------	---	--	--	--	--	---

B00D - R0006 - Home Base (75.16 m2)

Decorative Coating	Vermiculite 1057/B00D/R0008/Decorative Coating/S26					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
--------------------	---	--	--	--	--	---

Floor Coverings Res/Textile	Vinyl Tiles 1057/B00D/R1008/Floor Coverings Res/Textile/S11					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

Chalk Board	Resinous Board 1057/B00D/R1012/Chalk Board/S12					No Asbestos Detected
-------------	---	--	--	--	--	-----------------------------

B00D - R0007 - Staff Toilet (17.36 m2)

Decorative Coating	Vermiculite 1057/B00D/R0008/Decorative Coating/S26					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
--------------------	---	--	--	--	--	---

B00D - R0008 - Movement (286.88 m2)

Decorative Coating	Vermiculite 1057/B00D/R0008/Decorative Coating/S26					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
--------------------	---	--	--	--	--	---

B00D - R0009 - Toilets - Boys (58.44 m2)

Decorative Coating	Vermiculite 1057/B00D/R0008/Decorative Coating/S26					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
--------------------	---	--	--	--	--	---

Partition Walls (Cubicles)	Compressed AC Sheet 1057/B00D/R0009/Partition Walls (Cubicles)/S27	40m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	------	--------------------	--------------------	---------	--

B00D - R0010 - Cleaning Distributed Store (2.42 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Decorative Coating	Vermiculite 1057/B00D/R0008/Decorative Coating/S26					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0011 - External Movement (1.87 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1057/B00D/R0011/Ceiling Structures/Linings/S28					No Asbestos Detected
B00D - R0012 - Canteen Office/Store (8.79 m2)						
No Asbestos						
B00D - R0013 - Staff Toilet (4.37 m2)						
Decorative Coating	Vermiculite 1057/B00D/R0008/Decorative Coating/S26					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0014 - Canteen (24.6 m2)						
Electrical Backing Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B00D - R0015 - External Movement (1.84 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1057/B00D/R0011/Ceiling Structures/Linings/S28					No Asbestos Detected
B00D - R0016 - Toilets - Girls (61.43 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet 1057/B00D/R0009/Partition Walls (Cubicles)/S27	60m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Decorative Coating	Vermiculite 1057/B00D/R0008/Decorative Coating/S26					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0017 - General Storeroom (4.45 m2)						
Decorative Coating	Vermiculite 1057/B00D/R0008/Decorative Coating/S26					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0018 - P.E. Store (25.33 m2)						
No Asbestos						
B00D - R0019 - Movement (32.97 m2)						
Decorative Coating	Vermiculite 1057/B00D/R0008/Decorative Coating/S26					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0020 - Sports Store (6.34 m2)						
Decorative Coating	Vermiculite 1057/B00D/R0008/Decorative Coating/S26					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0021 - Home Base Store (6.34 m2)						
Decorative Coating	Vermiculite 1057/B00D/R0008/Decorative Coating/S26					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 1057/B00D/R1008/Floor Coverings Res/Textile/S11					No Asbestos Detected
B00D - R0022 - Home Base (79.12 m2)						
Decorative Coating	Vermiculite 1057/B00D/R0008/Decorative Coating/S26					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 1057/B00D/R1008/Floor Coverings Res/Textile/S11					No Asbestos Detected
B00D - R0023 - Home Base Store (2.72 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Decorative Coating	Vermiculite	1057/B00D/R0008/Decorative Coating/S26			Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles	1057/B00D/R1008/Floor Coverings Res/Textile/S11			No Asbestos Detected	
B00D - R0024 - Stairs (5.94 m2)						
No Asbestos						
B00D - R0025 - Stairs (7.72 m2)						
Decorative Coating	Vermiculite	1057/B00D/R0008/Decorative Coating/S26			Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00D - R0026 - Stairs (5.27 m2)						
No Asbestos						
B00D - R1001 - Movement (6.95 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	1057/B00D/R0011/Ceiling Structures/Linings/S28			No Asbestos Detected	
B00D - R1002 - K.L.A. Store (10.64 m2)						
No Asbestos						
B00D - R1003 - K.L.A. Store (17.72 m2)						
No Asbestos						
B00D - R1004 - Reading Area (234.6 m2)						
No Asbestos						
B00D - R1005 - K.L.A. Store (12.43 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	1057/B00D/R1005/Floor Coverings Res/Textile/S10			No Asbestos Detected	
B00D - R1006 - Library Office/Workroom (27.8 m2)						
No Asbestos						
B00D - R1007 - Personal Effects Storage (4.11 m2)						
No Asbestos						
B00D - R1008 - Home Base Store (9.43 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	1057/B00D/R1008/Floor Coverings Res/Textile/S11			No Asbestos Detected	
B00D - R1009 - Home Base (64.79 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	1057/B00D/R1008/Floor Coverings Res/Textile/S11			No Asbestos Detected	
B00D - R1010 - Movement (11.49 m2)						
No Asbestos						
B00D - R1011 - Movement (3.91 m2)						
No Asbestos						
B00D - R1012 - Home Base (65.12 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	1057/B00D/R1008/Floor Coverings Res/Textile/S11			No Asbestos Detected	
B00D - R1013 - Home Base Store (10.49 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	1057/B00D/R1008/Floor Coverings Res/Textile/S11			No Asbestos Detected	
B00D - R1014 - Personal Effects Storage (4.51 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R1015 - Home Base (65.62 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1057/B00D/R1008/Floor Coverings Res/Textile/S11					No Asbestos Detected
B00D - R1016 - Home Base Store (6.14 m2)						
No Asbestos						
B00D - R1017 - Movement (4.99 m2)						
No Asbestos						
B00D - R1018 - Home Base (65.61 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1057/B00D/R1008/Floor Coverings Res/Textile/S11					No Asbestos Detected
B00D - R1019 - Home Base Store (9.47 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	1057/B00D/R1008/Floor Coverings Res/Textile/S11					No Asbestos Detected
B00D - R1020 - Personal Effects Storage (4.08 m2)						
No Asbestos						
B00D - R1021 - Home Base (65.61 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1057/B00D/R1008/Floor Coverings Res/Textile/S11					No Asbestos Detected
B00D - R1022 - Home Base (65.45 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1057/B00D/R1008/Floor Coverings Res/Textile/S11					No Asbestos Detected
B00D - R1023 - Home Base Store (10.38 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	1057/B00D/R1008/Floor Coverings Res/Textile/S11					No Asbestos Detected
B00D - R1024 - Personal Effects Storage (4.55 m2)						
No Asbestos						
B00D - R1025 - Home Base - M (65.61 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1057/B00D/R1008/Floor Coverings Res/Textile/S11					No Asbestos Detected
B00D - R1026 - General Storeroom (3.16 m2)						
No Asbestos						
B00D - R1027 - General Storeroom (1.85 m2)						
No Asbestos						
B00D - R1030 - Cleaning Distributed Store (5.71 m2)						
No Asbestos						
B00D - R1031 - Home Base Store (6.34 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	1057/B00D/R1008/Floor Coverings Res/Textile/S11					No Asbestos Detected
B00D - R1032 - Home Base (79.21 m2)						
No Asbestos						
B00D - R1033 - Home Base Store (5.13 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	1057/B00D/R1008/Floor Coverings Res/Textile/S11					No Asbestos Detected
B00D - R1034 - Movement (158.68 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R1035 - Disabled Toilet (16.42 m2)						
No Asbestos						
B00D - R1036 - Stairs (13.98 m2)						
No Asbestos						
B00D - R1037 - Stairs (10.53 m2)						
No Asbestos						
B00D - R1038 - Stairs (8.18 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1962 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00E - R0001 - Canteen Covered Area (21.82 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Building Services - 2001 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - General Assistant/Bulk Store (55.81 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Building Services - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00G - R0001 - External Movement (17.79 m2)

No Asbestos

B00G - R0002 - General Assistant/Bulk Store (34.18 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017