


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Artarmon Public School (1061)
Region : Northern Sydney
State Electorate : Lane Cove
Local Government Area : Willoughby

Initial Survey : Noel Arnold & Associates : 30 - Jan - 2008
Reviewed By : Greencap-NAA : 13 - Aug - 2014

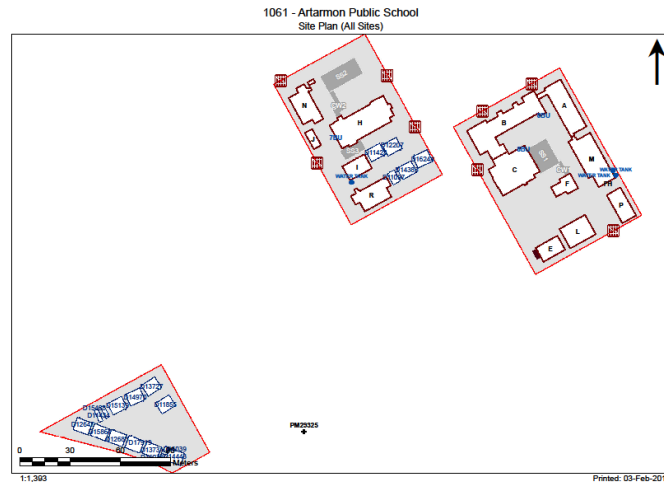

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1950 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1061/B00A/R1011/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)
Window Infill Panels	Flat AC Sheeting	40m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1061/B00A/R0019/Window Infill Panel/S11					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

Interior**B00A - R0002 - Clerical Office (13.73 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1061/B00A/R0004/Ceiling Structures/Linings/S21					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0003 - Clerical Office (11.85 m2)

No Asbestos

B00A - R0004 - Staff Toilet (2.43 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1061/B00A/R0004/Ceiling Structures/Linings/S21					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0005 - Principal (17.82 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1061/B00A/R0004/Ceiling Structures/Linings/S21					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0018 - Stairs (3.52 m2)

No Asbestos

B00A - R0020 - Other-Community Use (53.3 m2)

No Asbestos

B00A - R0021 - Sports Store (20.38 m2)

No Asbestos

B00A - R0022 - Movement (8.79 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1061/B00A/R0022/Floor Coverings Res/Textile/S20					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	1061/B00A/R0022/Floor Coverings Res/Textile/S22					

B00A - R0023 - Home Base (51.95 m2)

No Asbestos

B00A - R0024 - Practical Activities - 1hb (3.2 m2)

No Asbestos

B00A - R0025 - Home Base (53.23 m2)

No Asbestos

B00A - R0026 - Practical Activities - 1hb (1.52 m2)

No Asbestos

B00A - R0027 - Distribution Board (0.36 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0028 - General Assistant/Bulk Store (5.48 m2)

No Asbestos

B00A - R0029 - General Assistant/Bulk Store (5.48 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R0030 - External Movement (66.93 m2)

No Asbestos

B00A - R1001 - Garden Store (9.3 m2)

No Asbestos

B00A - R1002 - Garden Store (6.93 m2)

No Asbestos

B00A - R1003 - Special Programs Room (16.8 m2)

No Asbestos

B00A - R1004 - Movement (6.09 m2)

No Asbestos

B00A - R1005 - Distribution Board (0.66 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00A - R1006 - Staff Room Annexe (10.92 m2)

No Asbestos

B00A - R1007 - Staff Room Annexe (10.85 m2)

No Asbestos

B00A - R1008 - Movement (17.94 m2)

No Asbestos

B00A - R1009 - Home Base (73.95 m2)

No Asbestos

B00A - R1011 - Stairs (4.4 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	--------------	--------------------	---------	--------------------

1061/B00A/R1011/Ceiling Structures/Linings/S13

Chrysotile (white asbestos)

B00A - R1012 - Other-Community Use (53.62 m2)

No Asbestos

B00A - R1013 - Security Store (8.96 m2)

No Asbestos

B00A - R1014 - General Assistant/Bulk Store (11.35 m2)

No Asbestos

B00A - R1015 - Movement (85.77 m2)

Ceiling Structures/Linings	Flat AC Sheeting	86m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------

1061/B00A/R1011/Ceiling Structures/Linings/S13

Chrysotile (white asbestos)

B00A - R1016 - External Movement (2.56 m2)

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1928 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids Non Accessible Area
- Height Restriction

Underfloor Voids - Slab on Ground No Asbestos Found

Interior**B00B - R0002 - Staff Kitchen (5.02 m2)**

No Asbestos

B00B - R0004 - K.L.A. Store (3.97 m2)

No Asbestos

B00B - R0005 - Sports Store (5.23 m2)

No Asbestos

B00B - R0006 - External Movement (1.41 m2)

No Asbestos

B00B - R0007 - External Movement (6.29 m2)

No Asbestos

B00B - R0009 - Home Base (46.72 m2)

No Asbestos

B00B - R0014 - External Movement (5.94 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1061/B00B/R0014/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	

B00B - R0015 - External Movement (5.96 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1061/B00B/R0014/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	

B00B - R0016 - External Movement (7.92 m2)

No Asbestos

B00B - R0017 - Movement (10.13 m2)

Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1061/B00B/R0022/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	

B00B - R0018 - Cleaning Distributed Store (4.75 m2)

No Asbestos

B00B - R0019 - General Storeroom (9.72 m2)

No Asbestos

B00B - R0020 - Staff Room Annexe (10.26 m2)

No Asbestos

B00B - R0022 - Movement (29.36 m2)

Floor Coverings Res/Textile	Vinyl Tiles	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1061/B00B/R0022/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	

B00B - R0023 - External Movement (1.63 m2)

No Asbestos

B00B - R0024 - Distribution Board (0.48 m2)

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1061/B00B/R0022/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	

B00B - R0025 - Staff Room (46.89 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1061/B00B/R0026/Floor Coverings Res/Textile/S18	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 1061/B00B/R0026/Floor Coverings Res/Textile/S23					No Asbestos Detected
B00B - R0026 - Staff Room (51.92 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1061/B00B/R0026/Floor Coverings Res/Textile/S18	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 1061/B00B/R0026/Floor Coverings Res/Textile/S23					No Asbestos Detected
B00B - R0027 - Stairs (5.03 m2)						
No Asbestos						
B00B - R0028 - Stairs (7.76 m2)						
No Asbestos						
B00B - R0029 - External Movement (60.88 m2)						
No Asbestos						
B00B - R0030 - Movement (80.79 m2)						
No Asbestos						
B00B - R0031 - Duplicating Workroom (27.37 m2)						
No Asbestos						
B00B - R0032 - Clerical Office (19.21 m2)						
No Asbestos						
B00B - R0033 - Movement (17.7 m2)						
No Asbestos						
B00B - R0034 - Interview (11.82 m2)						
No Asbestos						
B00B - R0035 - Deputy Principal - Type 1 (11.5 m2)						
No Asbestos						
B00B - R0036 - Deputy Principal - Type 2 (11.82 m2)						
No Asbestos						
B00B - R0037 - Principal (15.77 m2)						
No Asbestos						
B00B - R0038 - Security Store (13.63 m2)						
No Asbestos						
B00B - R0039 - Sick Bay (9.78 m2)						
No Asbestos						
B00B - R0040 - Toilet - Lobby (0.76 m2)						
No Asbestos						
B00B - R0041 - Staff Toilet (1.69 m2)						
No Asbestos						
B00B - R0042 - Disabled Shower/Toilet (5.95 m2)						
No Asbestos						
B00B - R0043 - Staff Toilet (5.49 m2)						
No Asbestos						
B00B - R1001 - Special Programs Room (12.96 m2)						
No Asbestos						
B00B - R1002 - Staff Toilet (5.59 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00B - R1003 - Cleaning Distributed Store (1.36 m2)

No Asbestos

B00B - R1004 - Home Base (47.38 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1061/B00B/R1007/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)

Floor Coverings Res/Textile	Adhesive					
	1061/B00B/R1007/Floor Coverings Res/Textile/S24					No Asbestos Detected

B00B - R1005 - Home Base (47.29 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1061/B00B/R1007/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)

Floor Coverings Res/Textile	Adhesive					
	1061/B00B/R1007/Floor Coverings Res/Textile/S24					No Asbestos Detected

B00B - R1006 - Home Base (47.93 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1061/B00B/R1007/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)

Floor Coverings Res/Textile	Adhesive					
	1061/B00B/R1007/Floor Coverings Res/Textile/S24					No Asbestos Detected

B00B - R1007 - Home Base (47.94 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1061/B00B/R1007/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)

Floor Coverings Res/Textile	Adhesive					
	1061/B00B/R1007/Floor Coverings Res/Textile/S24					No Asbestos Detected

B00B - R1008 - Movement (105.01 m2)

No Asbestos

B00B - R1009 - Special Programs Room (27.24 m2)

No Asbestos

B00B - R1010 - General Storeroom (10.36 m2)

No Asbestos

B00B - R1011 - Sports Store (19.31 m2)

No Asbestos

B00B - R1012 - Home Base (55.77 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1061/B00B/R1007/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)

B00B - R1013 - Home Base (50.7 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1061/B00B/R1007/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)

B00B - R1014 - Stairs (11.79 m2)

No Asbestos

B00B - R1015 - Stairs (10.83 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Communal Facilities - 1970 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00C - M0001 - General Storeroom (10.05 m2)**

No Asbestos

B00C - M0002 - General Storeroom (3.85 m2)

No Asbestos

B00C - M0003 - Plant (6.1 m2)

No Asbestos

B00C - M0004 - Distribution Board (1.1 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00C - R0001 - Staff Kitchen (13.06 m2)

Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1061/B00C/R0001/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	

B00C - R0002 - External Movement (2.89 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1061/B00C/R0002/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00C - R0003 - Movement (10.43 m2)

Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1061/B00C/R0003/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	

B00C - R0004 - Movement (7.06 m2)

No Asbestos

B00C - R0005 - Staff Toilet (3.8 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1061/B00C/R0002/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00C - R0006 - Cleaning Distributed Store (1.89 m2)

No Asbestos

B00C - R0007 - Music Store (15.26 m2)

Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1061/B00C/R0002/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00C - R0008 - Music Store (10.92 m2)

Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1061/B00C/R0002/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00C - R0009 - Music Store (17.36 m2)

Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1061/B00C/R0002/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00C - R0010 - Staff Toilet (3.71 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1061/B00C/R0002/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00C - R0011 - Movement (7.06 m2)

No Asbestos

B00C - R0012 - External Movement (1.31 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1061/B00C/R0002/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	
B00C - R0013 - Raised Platform (68 m2)						
No Asbestos						
B00C - R0014 - Communal Space (223.61 m2)						
Window Infill Panel	Flat AC Sheeting	14m2	South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
1061/B00C/R0014/Window Infill Panel/S8					Chrysotile (white asbestos)	
B00C - R0015 - External Movement (54.16 m2)						
No Asbestos						
B00C - R0016 - External Movement (36.94 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1950 - Steel (Steel)

Exterior

Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	8m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Height Restriction

Interior

B00E - R0001 - External Movement (28.79 m2)

Wall Linings Internal	Flat AC Sheeting	1061/B00E/R0001/Wall Linings Internal/S15				No Asbestos Detected
-----------------------	------------------	---	--	--	--	-----------------------------

B00E - R0002 - Home Base (53.65 m2)

No Asbestos

B00E - R0003 - Home Base (53.65 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 1970 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 1061/B00F/Eaves Linings/S4					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00F - R0001 - Toilets - Boys (41.2 m2)

No Asbestos

B00F - R0002 - Toilets - Girls (40.93 m2)

No Asbestos

B00F - R0003 - External Movement (19.47 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning/Administration - 1928 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	--------------	--------------------	---------	--------------------

Assumed Asbestos - Height Restriction - Height

Ceiling Voids	Non Accessible Area - Height Restriction
---------------	---

Underfloor Voids	No Asbestos Found
------------------	-------------------

Interior**B00H - R0001 - External Movement (2.69 m2)**

No Asbestos

B00H - R0002 - Deputy Principal (11.43 m2)

No Asbestos

B00H - R0003 - Movement (17.14 m2)

No Asbestos

B00H - R0004 - External Movement (3.59 m2)

No Asbestos

B00H - R0005 - General Storeroom (5.06 m2)

No Asbestos

B00H - R0006 - Clerical Office (12.87 m2)

No Asbestos

B00H - R0007 - Movement (12.53 m2)

No Asbestos

B00H - R0008 - Home Base (46.75 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1061/B00H/R0011/Floor Coverings Res/Textile/S17	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-----------------------------	--	------	------------	--------------------	---------	--------------------	------------------------------------

Floor Coverings Res/Textile	Adhesive 1061/B00H/R0011/Floor Coverings Res/Textile/S25						No Asbestos Detected
-----------------------------	---	--	--	--	--	--	-----------------------------

B00H - R0009 - Home Base (46.76 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1061/B00H/R0011/Floor Coverings Res/Textile/S17	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-----------------------------	--	------	------------	--------------------	---------	--------------------	------------------------------------

Floor Coverings Res/Textile	Adhesive 1061/B00H/R0011/Floor Coverings Res/Textile/S25						No Asbestos Detected
-----------------------------	---	--	--	--	--	--	-----------------------------

B00H - R0010 - Home Base (46.75 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1061/B00H/R0011/Floor Coverings Res/Textile/S17	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-----------------------------	--	------	------------	--------------------	---------	--------------------	------------------------------------

Floor Coverings Res/Textile	Adhesive 1061/B00H/R0011/Floor Coverings Res/Textile/S25						No Asbestos Detected
-----------------------------	---	--	--	--	--	--	-----------------------------

B00H - R0011 - Home Base (47.45 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1061/B00H/R0011/Floor Coverings Res/Textile/S17	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-----------------------------	--	------	------------	--------------------	---------	--------------------	------------------------------------

Floor Coverings Res/Textile	Adhesive 1061/B00H/R0011/Floor Coverings Res/Textile/S25						No Asbestos Detected
-----------------------------	---	--	--	--	--	--	-----------------------------

B00H - R0012 - Communal Space (140.3 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
B00H - R0013 - Movement (12.71 m2)						
No Asbestos						
B00H - R0014 - General Storeroom (12.6 m2)						
No Asbestos						
B00H - R0015 - Movement (3.04 m2)						
No Asbestos						
B00H - R0016 - Movement (2.1 m2)						
No Asbestos						
B00H - R0017 - External Movement (2.83 m2)						
No Asbestos						
B00H - R0018 - External Movement (3.08 m2)						
No Asbestos						
B00H - R0019 - Movement (6.24 m2)						
No Asbestos						
B00H - R0020 - Staff Toilet (4.36 m2)						
Wall Linings Internal	Flat AC Sheeting	18m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
1061/B00H/R0020/Wall Linings Internal/S16						Chrysotile (white asbestos)
B00H - R0021 - Uniform Shop (11.59 m2)						
No Asbestos						
B00H - R0022 - Stairs (5.86 m2)						
No Asbestos						
B00H - R0023 - Stairs (4.55 m2)						
No Asbestos						
B00H - R0024 - External Stairs (14.34 m2)						
No Asbestos						
B00H - R1001 - Movement (4.46 m2)						
No Asbestos						
B00H - R1002 - Personal Effects Storage (13.21 m2)						
No Asbestos						
B00H - R1003 - Staff Toilet (3.02 m2)						
Wall Linings Internal	Flat AC Sheeting	20m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
1061/B00H/R0020/Wall Linings Internal/S16						Chrysotile (white asbestos)
B00H - R1004 - Movement (17.76 m2)						
No Asbestos						
B00H - R1005 - Staff Room (15.45 m2)						
No Asbestos						
B00H - R1006 - Home Base (47.74 m2)						
No Asbestos						
B00H - R1007 - Home Base (47.74 m2)						
No Asbestos						
B00H - R1008 - Home Base (47.74 m2)						
No Asbestos						
B00H - R1009 - Home Base (48.13 m2)						
No Asbestos						
B00H - R1010 - Special Programs Room (93.76 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00H - R1011 - Special Programs Room (16.48 m2)						
No Asbestos						
B00H - R1012 - Movement (21.37 m2)						
No Asbestos						
B00H - R1013 - Personal Effects Storage (12.97 m2)						
No Asbestos						
B00H - R1014 - Movement (1.68 m2)						
No Asbestos						
B00H - R1015 - Staff Toilet (2.31 m2)						
No Asbestos						
B00H - R1016 - Stairs (10.94 m2)						
No Asbestos						
B00H - R1017 - Stairs (11.27 m2)						
No Asbestos						
B00H - R9001 - General Storeroom (42.18 m2)						
No Asbestos						
B00H - R9002 - Canteen (45.97 m2)						
No Asbestos						
B00H - R9003 - External Movement (6 m2)						
No Asbestos						
B00H - R9004 - External Stairs (14.34 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Pupil Facilities - 1950 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B001 - R0001 - General Storeroom (4.83 m2)

No Asbestos

B001 - R0002 - External Movement (19.44 m2)

No Asbestos

B001 - R0003 - Home Base (53.44 m2)

No Asbestos

B001 - R0004 - Home Base (53.44 m2)

No Asbestos

B001 - R0005 - General Storeroom (4.85 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pupil Facilities - 1928 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00J - R0001 - Toilets - Girls (19.54 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1061/B00J/R0001/Ceiling Structures/Linings/S1	No Asbestos Detected
----------------------------	---	-----------------------------

B00J - R0002 - Toilets - Boys (26.5 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1061/B00J/R0001/Ceiling Structures/Linings/S1	No Asbestos Detected
----------------------------	---	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning - 2004 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00L - R0001 - External Movement (38.48 m2)

No Asbestos

B00L - R0002 - Practical Activities - 1hb (19.39 m2)

No Asbestos

B00L - R0003 - Home Base Store (6.02 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0004 - Home Base (59.2 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0005 - Withdrawal Space - 2hb (11.36 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0006 - Home Base (59.19 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0007 - Home Base Store (6.02 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0008 - Practical Activities - 1hb (19.41 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00M - Library/General Learning - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00M - R0001 - Reading Area (225.01 m2)**

No Asbestos

B00M - R0002 - Library Office/Workroom (26.88 m2)

No Asbestos

B00M - R0003 - K.L.A. Store (18.45 m2)

No Asbestos

B00M - R0004 - Movement (10.42 m2)

No Asbestos

B00M - R0005 - Communications Room (7.94 m2)

No Asbestos

B00M - R0006 - Staff Toilet (3.21 m2)

No Asbestos

B00M - R0007 - Toilet - Lobby (4.22 m2)

No Asbestos

B00M - R0008 - Cleaning Distributed Store (3.89 m2)

No Asbestos

B00M - R0009 - Distribution Board (0.62 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00M - R0010 - External Movement (81.43 m2)

No Asbestos

B00M - R1001 - Home Base (58.25 m2)

No Asbestos

B00M - R1002 - Home Base (60.13 m2)

No Asbestos

B00M - R1003 - Home Base (60.13 m2)

No Asbestos

B00M - R1004 - Practical Activities - 1hb (20.44 m2)

No Asbestos

B00M - R1005 - Practical Activities - 1hb (17.67 m2)

No Asbestos

B00M - R1006 - Practical Activities - 1hb (18.9 m2)

No Asbestos

B00M - R1007 - Withdrawal Space - 2hb (11.64 m2)

No Asbestos

B00M - R1008 - Withdrawal Space - 1hb (9.13 m2)

No Asbestos

B00M - R1009 - Home Base Store (5.91 m2)

No Asbestos

B00M - R1010 - Home Base Store (6.13 m2)

No Asbestos

B00M - R1011 - Home Base Store (6.13 m2)

No Asbestos

B00M - R1012 - Distribution Board (0.63 m2)

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00M - R1013 - External Movement (66.23 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00N - General Learning - 2011 - Fibre Cement Clad (Fibre Cement Clad)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00N - R0001 - External Movement (65.01 m2)**

No Asbestos

B00N - R0002 - Home Base (63.58 m2)

No Asbestos

B00N - R0003 - Practical Activities - 1hb (6.9 m2)

No Asbestos

B00N - R0004 - General Storeroom (4.71 m2)

No Asbestos

B00N - R0005 - Withdrawal Space - 2hb (11.16 m2)

No Asbestos

B00N - R0006 - General Storeroom (4.4 m2)

No Asbestos

B00N - R0007 - Home Base/Practical Activities (63.28 m2)

No Asbestos

B00N - R0008 - Practical Activities (6.9 m2)

No Asbestos

B00N - R0009 - External Stairs (5.5 m2)

No Asbestos

B00N - R0010 - External Stairs (5.08 m2)

No Asbestos

B00N - R0011 - Lift (1.96 m2)

No Asbestos

B00N - R1001 - External Movement (54.74 m2)

No Asbestos

B00N - R1002 - Home Base/Practical Activities (65.49 m2)

No Asbestos

B00N - R1003 - Practical Activities (6.74 m2)

No Asbestos

B00N - R1004 - General Storeroom (4.71 m2)

No Asbestos

B00N - R1005 - Withdrawal Space - 2hb (11.39 m2)

No Asbestos

B00N - R1006 - General Storeroom (4.36 m2)

No Asbestos

B00N - R1007 - Home Base/Practical Activities (64.78 m2)

No Asbestos

B00N - R1008 - Practical Activities (7 m2)

No Asbestos

B00N - R1009 - External Stairs (11.27 m2)

No Asbestos

B00N - R1010 - External Stairs (10.28 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Music - 2011 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00P - R0001 - Special Programs Store (34.88 m2)

No Asbestos

B00P - R0002 - Special Programs Room (106.58 m2)

No Asbestos

B00P - R0003 - External Movement (34.56 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - Pupil Facilities - 2013 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids No Asbestos Found

Underfloor Voids No Asbestos Found

Interior

B00Q - R0001 - Disabled Toilet (6.55 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00R - General Learning - 2014 - Fibre Cement Clad (Fibre Cement Clad)**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior**B00R - R0001 - Home Base (61.98 m2)**

No Asbestos

B00R - R0002 - Withdrawal Space - 2hb (11.19 m2)

No Asbestos

B00R - R0003 - Practical Activities - 2hb (19.47 m2)

No Asbestos

B00R - R0004 - Home Base (62.88 m2)

No Asbestos

B00R - R0005 - External Movement (57.87 m2)

No Asbestos

B00R - R0006 - External Stairs (6.55 m2)

No Asbestos

B00R - R0007 - External Stairs (6.91 m2)

No Asbestos

B00R - R0008 - Distribution Board (0.8 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00R - R0009 - Lift (1.68 m2)

No Asbestos

B00R - R1001 - Home Base (64.49 m2)

No Asbestos

B00R - R1002 - Withdrawal Space - 2hb (11.4 m2)

No Asbestos

B00R - R1003 - Practical Activities - 2hb (19.66 m2)

No Asbestos

B00R - R1004 - Home Base (65.02 m2)

No Asbestos

B00R - R1005 - External Movement (57.62 m2)

No Asbestos

B00R - R1006 - External Stairs (10.06 m2)

No Asbestos

B00R - R1007 - External Stairs (11.04 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 750 - D11097 - Learning Unit - ESL : Placement Date - 7/01/2010

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Esl

No Asbestos Found.

OS 603 - D11423 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 9/02/2009

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 841 - D11434 - Boys Toilet : Placement Date - 2/10/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Toilets-Boys

No Asbestos Found.

OS 602 - D11855 - Learning Unit - Standard With P.A.A. : Placement Date - 1/10/2015

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Interior

R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

OS 602 - D12207 - Learning Unit - Standard With P.A.A. : Placement Date - 7/01/2010

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D12647 - Learning Unit - Standard With P.A.A. : Placement Date - 2/10/2015

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 603 - D12683 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 30/09/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D13727 - Learning Unit - Standard With P.A.A. : Placement Date - 1/10/2015

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D13731 - Learning Unit - Standard With P.A.A. : Placement Date - 2/10/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D14383 - Learning Unit - Standard/Withdrawal : Placement Date - 16/07/2007

Exterior

Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 505 - D14443 - Admin Staff/Principal/Secure Store : Placement Date - 2/10/2015						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Entry						
No Asbestos Found.						
R2 - Principal						
No Asbestos Found.						
R3 - Staff Room						
No Asbestos Found.						
R4 - Security Store						
No Asbestos Found.						
R5 - Clerical Office						
No Asbestos Found.						
OS 602 - D14970 - Learning Unit - Standard With P.A.A. : Placement Date - 1/10/2015						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 602 - D15139 - Learning Unit - Standard With P.A.A. : Placement Date - 1/10/2015						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 840 - D15468 - Girls Toilet : Placement Date - 2/10/2015						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Toilets-Girls						
No Asbestos Found.						
OS 602 - D15867 - Learning Unit - Standard With P.A.A. : Placement Date - 30/09/2015						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 837 - D16038 - Hcap Shower/Change/Toilet : Placement Date - 2/10/2015						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Disabled Shower/Toilet						
No Asbestos Found.						
OS 837 - D16039 - Hcap Shower/Change/Toilet : Placement Date - 2/10/2015						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Disabled Shower/Toilet						
No Asbestos Found.						
OS 602 - D16244 - Learning Unit - Standard With P.A.A. : Placement Date - 23/04/2010						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 603 - D17919 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 2/10/2015						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017