


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Ashford Central School (1066)
Region : New England
State Electorate : Northern Tablelands
Local Government Area : Inverell

Initial Survey : Noel Arnold & Associates : 20 - May - 2008
Reviewed By : Greencap-NAA : 09 - Feb - 2017

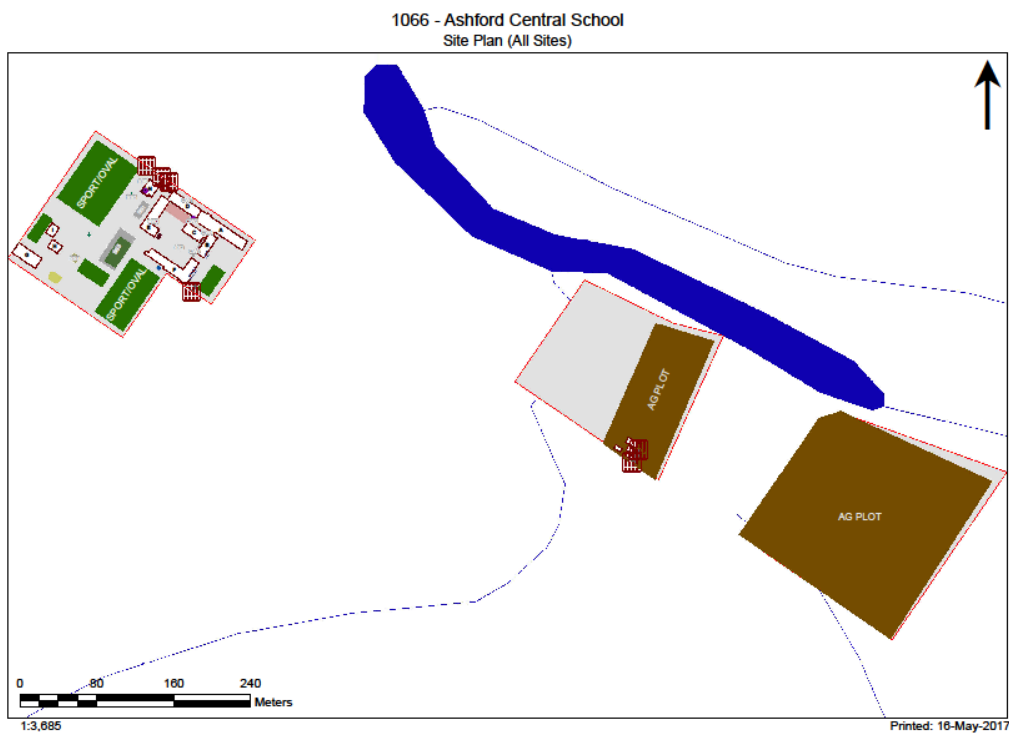

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Science - 1972 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	50m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00A/Eaves Linings/S12			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior**B00A - R0005 - Chemical Store (6.17 m2)**

No Asbestos

B00A - R0006 - Botany/Zoology (5.95 m2)

No Asbestos

B00A - R0007 - Staff Room Annexe (25.66 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	1066/B00A/R0007/Floor Coverings Res/Textile/S14					

B00A - R0008 - General Learning Space (52.2 m2)

No Asbestos

B00A - R0012 - General Storeroom (11.43 m2)

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00A - R0013 - Main Switch Board (0.87 m2)

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1066/B00A/R0013/Wall Linings Internal/S3					

B00A - R0015 - Clerical Office (12.48 m2)

No Asbestos

B00A - R0016 - Staff Kitchen (5.54 m2)

No Asbestos

B00A - R0017 - Toilets-Disabled (5.5 m2)

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1066/B00A/R0017/Wall Linings Internal/S13					

B00A - R0018 - Clinic (12.12 m2)

No Asbestos

B00A - R0019 - Principal Office (20.66 m2)

No Asbestos

B00A - R0020 - Deputy Principal (12.63 m2)

No Asbestos

B00A - R0021 - Movement (18.51 m2)

No Asbestos

B00A - R0022 - Administration - Clerical (51.09 m2)

No Asbestos

B00A - R0023 - Movement (22.05 m2)

No Asbestos

B00A - R0024 - External Movement (211.81 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1066/B00A/R0024/Ceiling Structures/Linings/S11					
Ceiling Structures/Linings	Flat AC Sheeting	110m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00A/Eaves Linings/S12			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Infill panel					
	1066/B00A/R0024/Ceiling Structures/Linings/S11					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting					
	1066/B00A/R0029/Wall Linings Internal/S15					No Asbestos Detected
B00A - R0025 - Main Switch Board (1.3 m2)						
No Asbestos						
B00A - R0026 - Staff - Toilet (6.23 m2)						
No Asbestos						
B00A - R0027 - Deputy Principal (19.77 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1066/B00A/R0007/Floor Coverings Res/Textile/S14					No Asbestos Detected
B00A - R0028 - Preparation - Science (25.74 m2)						
No Asbestos						
B00A - R0029 - Laboratory L.S. (93.88 m2)						
Wall Linings Internal	Flat AC Sheeting					
	1066/B00A/R0029/Wall Linings Internal/S15					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Technological & Applied Studies/Staff Facilities - 1972 - Timber (Timber)

Exterior

No Asbestos

Ceiling Voids No Asbestos Found

Underfloor Voids No Asbestos Found

Interior

B00B - R0001 - General Storeroom (8.85 m2)

No Asbestos

B00B - R0002 - Staff Room Annexe (7.01 m2)

No Asbestos

B00B - R0003 - Staff Room Annexe (10.35 m2)

In-fill-panel	Flat AC Sheeting					
	1066/B00B/R0012/In-fill-panel/S5					No Asbestos Detected

B00B - R0004 - Design L.S. (47.89 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	1066/B00B/R0004/Floor Coverings Res/Textile/S25					No Asbestos Detected

B00B - R0005 - Distribution Board (0.88 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0011 - Laundry (10.4 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00B/R0011/Ceiling Structures/Linings/S26					Chrysotile (white asbestos)

Upper infill panel above door	Flat AC Sheeting					
	1066/B00B/R0012/In-fill-panel/S5					No Asbestos Detected

B00B - R0012 - External Movement (35.96 m2)

In-fill-panel	Flat AC Sheeting					
	1066/B00B/R0012/In-fill-panel/S5					No Asbestos Detected

B00B - R0013 - Food Technology L.S. (67.87 m2)

No Asbestos

B00B - R0014 - Preparation - Materials (12.83 m2)

No Asbestos

B00B - R0015 - Store (13.24 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Library/General Learning - 1972 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 1066/B00C/Eaves Linings/S22	40m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Interior**B00C - R0001 - External Movement (47.84 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 1066/B00C/R0001/Ceiling Structures/Linings/S23	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting 1066/B00B/R0012/In-fill-panel/S5					No Asbestos Detected
Thermacon Heater	Encapsulated Insulation material within unit Assumed Asbestos - Sealed unit	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)

B00C - R0002 - Special Programs Room (16.29 m2)

Wall Linings Internal	Flat AC Sheeting 1066/B00E/R0002/In-fill-panel/S6	0.5m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1066/B00C/R0002/Floor Coverings Res/Textile/S24	16.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00C - R0003 - Interview (11.57 m2)

No Asbestos

B00C - R0005 - Reading Area (91.47 m2)

Thermacon Heater	Encapsulated Insulation material within unit Assumed Asbestos - Sealed unit	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
------------------	---	-------	--------------------	--------------------	---------	--------------------

B00C - R0006 - Seminar (13.39 m2)

No Asbestos

B00C - R0007 - Communications Room (7.89 m2)

No Asbestos

B00C - R0008 - Distribution Board (0.59 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00C - R0009 - Study Space (14.12 m2)

No Asbestos

B00C - R0010 - Computer Store (14.16 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - Staff Facilities/General Learning - 1968 - Brick/Block (Brick/Block)						
Exterior						
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	100m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00D/Eaves Linings/S18					Chrysotile (white asbestos)
Interior						
B00D - M0001 - General Storeroom (6.46 m2)						
No Asbestos						
B00D - M0002 - Movement (6.21 m2)						
No Asbestos						
B00D - M0003 - General Storeroom (6.46 m2)						
No Asbestos						
B00D - M0004 - Movement (6.11 m2)						
No Asbestos						
B00D - M0005 - Stairs (3.85 m2)						
No Asbestos						
B00D - M0006 - Stairs (3.9 m2)						
No Asbestos						
B00D - R0001 - Sports Store (12.96 m2)						
No Asbestos						
B00D - R0002 - Movement (6.62 m2)						
No Asbestos						
B00D - R0005 - Staff Toilet (4.37 m2)						
Ceiling Structures/Linings	Vermiculite					
	1066/B00D/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R0006 - Distribution Board (0.56 m2)						
No Asbestos						
B00D - R0007 - Staff Toilet (5.28 m2)						
Ceiling Structures/Linings	Vermiculite					
	1066/B00D/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R0010 - Staff Room (42.69 m2)						
Ceiling Structures/Linings	Vermiculite					
	1066/B00D/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Thermacon Heater	Encapsulated Insulation material within unit	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00D - R0011 - Home Base (84.11 m2)						
Ceiling Structures/Linings	Vermiculite					
	1066/B00D/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	84m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Thermacon Heater	Encapsulated Insulation material within unit	4Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00D - R0012 - Toilets - Boys/Girls (3.59 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1066/B00D/R0009/Ceiling Structures/Linings/S1					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R0013 - Home Base Store (3.32 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1066/B00D/R0009/Ceiling Structures/Linings/S1					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00D - R0014 - Personal Effects Storage (8.09 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1066/B00D/R0009/Ceiling Structures/Linings/S1					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R0015 - Cleaning Supplies (12.96 m2)						
No Asbestos						
B00D - R0016 - Movement (6.53 m2)						
No Asbestos						
B00D - R0017 - Personal Effects Storage (6.63 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00D - R0018 - Distribution Board (0.77 m2)						
Note: No inspection of live electrical installation.						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00D - R0019 - General Storeroom (5.68 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00D - R0020 - General Learning Space (57.41 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Thermacon Heater	Encapsulated Insulation material within unit	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00D - R0021 - Personal Effects Storage (6.67 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00D - R0022 - Music Store (6.67 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00D - R0023 - Music Learning Space (57.18 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Thermacon Heater	Encapsulated Insulation material within unit	3m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00D - R0024 - Personal Effects Storage (6.63 m2)						
No Asbestos						
B00D - R0025 - Home Base Store (6.63 m2)						
No Asbestos						
B00D - R0026 - Home Base (57.18 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1066/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
Thermacon Heater	Encapsulated Insulation material within unit	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00D - R0027 - External Movement (126.79 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	60m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
1066/B00D/R0027/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
B00D - R0028 - Staff Room (48.43 m2)						
Ceiling Structures/Linings	Vermiculite					
1066/B00D/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00D - R0029 - Movement (11.17 m2)						
No Asbestos						
B00D - R0030 - Stairs (3.89 m2)						
No Asbestos						
B00D - R0031 - Stairs (4.03 m2)						
No Asbestos						
B00D - R1003 - Home Base (57.18 m2)						
Thermacon Heater	Encapsulated Insulation material within unit	3Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard Area inaccessible						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1066/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00D - R1004 - Home Base Store (5.85 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1066/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00D - R1005 - Distribution Board (0.83 m2)						
Note: No inspection of live electrical installation.						
Floor Coverings Res/Textile	Vinyl Tiles	0.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1066/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00D - R1006 - Personal Effects Storage (13.77 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
1066/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00D - R1007 - Home Base Store (6.76 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1066/B00D/R0008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00D - R1008 - Home Base (57.1 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1066/B00D/R0008/Floor Coverings Res/Textile/S2	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Thermacon Heater	Encapsulated Insulation material within unit Assumed Asbestos - Electrical Hazard Area inaccessible	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
B00D - R1009 - Home Base (57.1 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1066/B00D/R0008/Floor Coverings Res/Textile/S2	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Thermacon Heater	Encapsulated Insulation material within unit Assumed Asbestos - Electrical Hazard	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
B00D - R1010 - Home Base Store (6.76 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 1066/B00D/R0008/Floor Coverings Res/Textile/S2	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B00D - R1011 - Personal Effects Storage (6.71 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 1066/B00D/R0008/Floor Coverings Res/Textile/S2	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B00D - R1014 - Movement (73.68 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1066/B00D/R1016/Ceiling Structures/Linings/S16	74m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B00D - R1015 - Stairs (0.98 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1066/B00D/R1016/Ceiling Structures/Linings/S16	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B00D - R1016 - Stairs (1 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1066/B00D/R1016/Ceiling Structures/Linings/S16	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1972 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00E/Eaves Linings/S19				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction 3.2m					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00E - R0001 - External Movement (30.41 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00E/R0001/Ceiling Structures/Linings/S20				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Verandah lower infill	Flat AC Sheeting 1066/B00E/R0001/Verandah lower infill/S21 No Asbestos Detected					

B00E - R0002 - General Learning Space (53.72 m2)

In-fill-panel	Flat AC Sheeting	1m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00E/R0002/In-fill-panel/S6				Chrysotile (white asbestos)	

B00E - R0003 - General Learning Space (53.58 m2)

In-fill-panel	Flat AC Sheeting	1m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00E/R0002/In-fill-panel/S6				Chrysotile (white asbestos)	

B00E - R0007 - Handwashing Facilities (21.55 m2)

No Asbestos

B00E - R0008 - Store (7.92 m2)

No Asbestos

B00E - R0009 - Kiln Room (13.14 m2)

Kiln	Encapsulated Insulation material within unit	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities/Technological & Applied Studies - 1968 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1066/B00F/R0020/Ceiling Structures/Linings/S9					No Asbestos Detected

Interior

B00F - R0005 - Distribution Board (0.63 m2) Note: No inspection of live electrical installation.

No Asbestos

B00F - R0006 - Canteen (36.09 m2)

No Asbestos

B00F - R0007 - Canteen Office/Store (3.85 m2)

No Asbestos

B00F - R0008 - Canteen Office/Store (3.42 m2)

No Asbestos

B00F - R0009 - Staff Toilet (1.74 m2)

No Asbestos

B00F - R0014 - Toilets - Boys (31.14 m2)

No Asbestos

B00F - R0015 - Plant (10.95 m2)

No Asbestos

B00F - R0016 - Toilets - Girls (27.36 m2)

No Asbestos

B00F - R0017 - Toilets - Girls (27.36 m2)

No Asbestos

B00F - R0018 - Toilets - Boys (30.89 m2)

No Asbestos

B00F - R0019 - Cleaning Distributed Store (9.31 m2)

No Asbestos

B00F - R0020 - External Movement (213.46 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1066/B00F/R0020/Ceiling Structures/Linings/S9					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00F - R0021 - Staff Toilet (2.57 m2)

No Asbestos

B00F - R0022 - Access Staff Shower/Toilet (6.08 m2)

No Asbestos

B00F - R0023 - Staff Toilet (6.16 m2)

No Asbestos

B00F - R0024 - Shower/Change (18.25 m2)

No Asbestos

B00F - R0025 - Shower/Change (16.06 m2)

No Asbestos

B00F - R0026 - Workshop Area (114.65 m2)

Electrical risers	Flat AC Sheeting 1066/B00F/R0026/Electrical risers/S10					No Asbestos Detected
-------------------	---	--	--	--	--	-----------------------------

B00F - R0027 - Welding Area (3.41 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - R0028 - Welding Area (3.41 m2)

No Asbestos

B00F - R0029 - Project Store - Type 1 (34.12 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Multi Purpose Facilities/Other-Community Use - 1938 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height restricted 3.5 metre					
Underfloor Voids	Non Accessible Area - Area inaccessible					
Infill panel	Flat AC Sheeting 1066/B00G/Infill panel/S30					No Asbestos Detected
Window frames	Putty 1066/B00G/Window frames/S31					No Asbestos Detected
Electrical Backing Board	Resinous Board 1066/B00G/Electrical Backing Board/S32					No Asbestos Detected

Interior**B00G - R0001 - Communal Space (218.72 m2)**

Ceiling Structures/Linings	Non Accessible Area - Height Restriction - 3.5m					
----------------------------	--	--	--	--	--	--

B00G - R0002 - Raised Platform (49.22 m2)

No Asbestos

B00G - R0003 - Movement (12.1 m2)

No Asbestos

B00G - R0004 - Communal/Performance Store (11.34 m2)

No Asbestos

B00G - R0005 - External Movement (9.22 m2)

No Asbestos

B00G - R0006 - Toilet - Lobby (2.39 m2)

Upper infill panel	Flat AC Sheeting 1066/B00G/R0009/Upper infill panel South/S28					No Asbestos Detected
--------------------	--	--	--	--	--	----------------------

B00G - R0007 - Toilets - Boys (11.09 m2)

Wall Linings Internal	Flat AC Sheeting 1066/B00G/R0008/Wall Linings Internal/S29					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00G - R0008 - Disabled Toilet (6.09 m2)

Wall Linings Internal	Flat AC Sheeting 1066/B00G/R0008/Wall Linings Internal/S29					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00G - R0009 - Toilet - Lobby (2.4 m2)

Upper infill panel South	Flat AC Sheeting 1066/B00G/R0009/Upper infill panel South/S28					No Asbestos Detected
--------------------------	--	--	--	--	--	----------------------

B00G - R0010 - Toilets - Girls (14.7 m2)

Wall Linings Internal	Flat AC Sheeting 1066/B00G/R0010/Wall Linings Internal/S27					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00G - R0011 - No Access (1.54 m2)

No Asbestos

B00G - R0012 - Stairs (0.8 m2)

No Asbestos

B00G - R0013 - Stairs (0.37 m2)

No Asbestos

B00G - R1001 - Communal/Performance Store (10.63 m2)

No Asbestos

B00G - R1002 - Stairs (2.07 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00G - R9001 - Servery Covered Area (54.73 m2)						
No Asbestos						
B00G - R9002 - Canteen (14.57 m2)						
No Asbestos						
B00G - R9003 - Stairs (3.94 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Physical Education - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00H - R0001 - Sports Store (107.13 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Mechanical Services - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B001 - R0001 - Garage/Carport (107.91 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Storage - 2005 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00J - R0001 - No Access (28.5 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Storage - 2002 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found				
Underfloor Voids	No Asbestos Found				
Electrical Backing Board	Resinous Board 1066/B00K/Electrical Backing Board/S33				No Asbestos Detected

Interior

B00K - R0001 - No Access (29.04 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Storage - 2010 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00L - R0001 - No Access (34.7 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Storage - 2005 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00M - R0001 - No Access (70.62 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017