


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Asquith Public School (1070)
Region : Northern Sydney
State Electorate : Hornsby
Local Government Area : Hornsby

Initial Survey : Noel Arnold & Associates : 12 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 13 - Sep - 2016

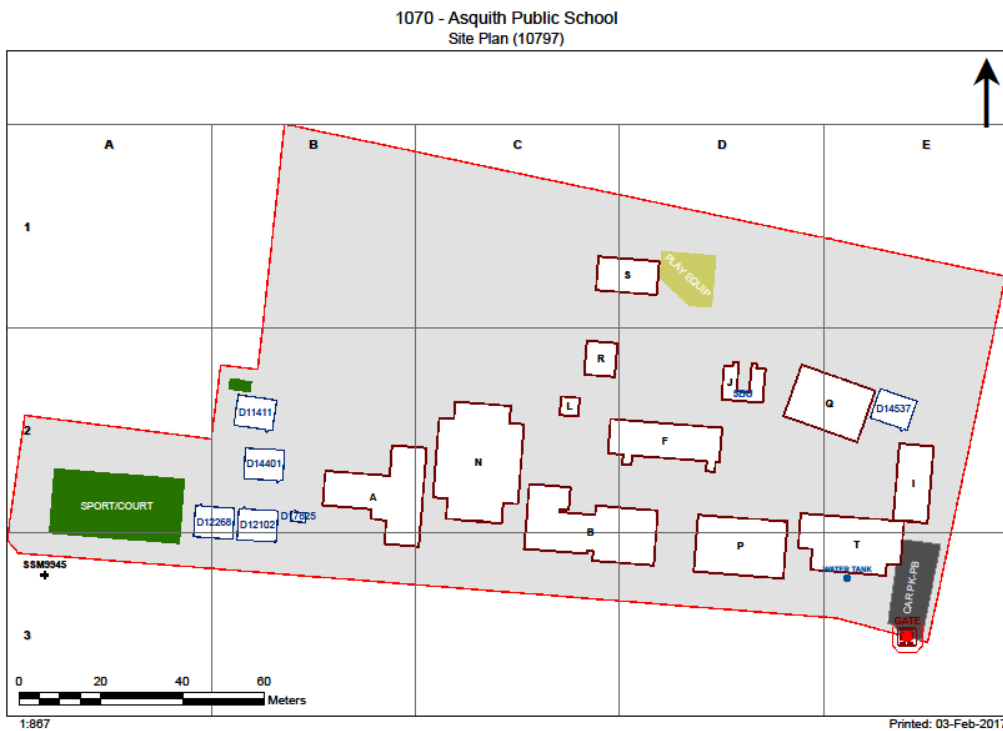

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - General Learning - 1961 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Height Restriction <0.3m.					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction >3m.					
Eaves Linings	Flat AC Sheeting	200m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction >3m.						
Gable Ends	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction >3m.						

Interior

B00A - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1070/B00F/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0002 - Movement

No Asbestos

B00A - R0003 - Home Base

No Asbestos

B00A - R0004 - Home Base Store

No Asbestos

B00A - R0005 - Personal Effects Storage

No Asbestos

B00A - R0006 - Main Switch Board

No Asbestos

B00A - R0008 - Home Base

No Asbestos

B00A - R0009 - Home Base Store

No Asbestos

B00A - R0010 - Personal Effects Storage

No Asbestos

B00A - R0011 - Toilets - Girls

Partition Walls (Cubicles)	Flat AC Sheeting	2m2	North facing, East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
1070/B00A/R0013/Partition Walls (Cubicles)/S6				Chrysotile (white asbestos)		

B00A - R0012 - Staff Toilet

Partition Walls (Cubicles)	Flat AC Sheeting	4m2	North facing, East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
1070/B00A/R0013/Partition Walls (Cubicles)/S6				Chrysotile (white asbestos)		

B00A - R0013 - Staff Toilet

Partition Walls (Cubicles)	Flat AC Sheeting	4m2	North facing, West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
1070/B00A/R0013/Partition Walls (Cubicles)/S6				Chrysotile (white asbestos)		

B00A - R0014 - Toilets - Boys

Partition Walls (Cubicles)	Flat AC Sheeting	2m2	North facing, West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
1070/B00A/R0013/Partition Walls (Cubicles)/S6				Chrysotile (white asbestos)		

B00A - R0015 - Cleaning Distributed Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R0016 - Personal Effects Storage

No Asbestos

B00A - R0017 - Home Base Store

No Asbestos

B00A - R0018 - Home Base

No Asbestos

B00A - R0019 - Staff Room

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1070/B00A/R0019/Floor Coverings Res/Textile/S9	No Asbestos Detected
-----------------------------	---	-----------------------------

B00A - R0020 - Staff Room

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1070/B00A/R0019/Floor Coverings Res/Textile/S9	No Asbestos Detected
-----------------------------	---	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Administration - 1930 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction >3m.					
Gable Ends	Flat AC Sheeting	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction >3m.						

Interior

B00B - R0001 - Movement

No Asbestos

B00B - R0002 - Entry Vestibule

No Asbestos

B00B - R0003 - Principal

No Asbestos

B00B - R0004 - Clerical Office

No Asbestos

B00B - R0005 - Security Store

No Asbestos

B00B - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Above Door Only	Good Condition (1)	Low (1)	Low Priority (2-3)
1070/B00F/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Partition Walls (Cubicles)	Flat AC Sheeting					No Asbestos Detected
1070/B00B/R0010/Partition Walls (Cubicles)/S7						

B00B - R0012 - Staff Room

No Asbestos

B00B - R0013 - Staff Room Annexe

No Asbestos

B00B - R0014 - Deputy Principal

No Asbestos

B00B - R0015 - Staff Room Annexe

No Asbestos

B00B - R0016 - General Assistant/Bulk Store

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1070/B00F/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0017 - Staff Toilet

No Asbestos

B00B - R0018 - Staff Toilet

No Asbestos

B00B - R0019 - Staff Toilet

No Asbestos

B00B - R0020 - Movement

No Asbestos

B00B - R0021 - Deputy Principal

No Asbestos

B00B - R0022 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0023 - Staff Shower/Change						
No Asbestos						
B00B - R0024 - Duplicating Workroom						
No Asbestos						
B00B - R0025 - Movement						
No Asbestos						
B00B - R0026 - Sick Bay						
No Asbestos						
B00B - R0027 - Clerical Office						
No Asbestos						
B00B - R0028 - Clerical Office						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1971 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction >3m.					
Eaves Linings	Flat AC Sheeting	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Height Restriction >3m.

Interior

B00F - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1070/B00F/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0002 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1070/B00F/R0002/Wall Linings Internal/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0003 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1070/B00F/R0003/Wall Linings Internal/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0004 - Cleaning Distributed Store

No Asbestos

B00F - R0005 - General Storeroom

No Asbestos

B00F - R0006 - Movement

No Asbestos

B00F - R0007 - Staff Room Annexe

No Asbestos

B00F - R0008 - Personal Effects Storage

No Asbestos

B00F - R0009 - Home Base Store

No Asbestos

B00F - R0010 - Home Base

No Asbestos

B00F - R0011 - Home Base

No Asbestos

B00F - R0012 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1070/B00F/R0012/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0013 - Movement

No Asbestos

B00F - R0014 - Withdrawal Space - 1hb

No Asbestos

B00F - R0015 - Home Base Store

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - General Learning - 1948 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction >3m.					
Eaves Linings	Flat AC Sheeting	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction >3m.						
Underfloor Voids	AC Fragments/Debris	NA	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	1070/B001/Underfloor Voids/S8					Chrysotile (white asbestos)

Interior

B001 - R0001 - Home Base

No Asbestos

B001 - R0002 - Personal Effects Storage

No Asbestos

B001 - R0003 - Toilets - Boys/Girls

No Asbestos

B001 - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1070/B00G/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)

B001 - R0008 - Special Programs Room

No Asbestos

B001 - R0009 - Entry Vestibule

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pupil Facilities - 1971 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	12m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1070/B00J/R0005/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior**B00J - R0002 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1070/B00J/R0005/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0003 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1070/B00J/R0005/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0004 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1070/B00J/R0005/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0005 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1070/B00J/R0005/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0006 - Movement

No Asbestos

B00J - R0007 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Pupil Facilities - 1930 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00L - R0001 - Drinking Facilities

No Asbestos

B00L - R0002 - Drinking Facilities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Communal Facilities - 1991 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00N - R0001 - Shower/Change

No Asbestos

B00N - R0002 - Movement

No Asbestos

B00N - R0003 - Toilets - Girls

No Asbestos

B00N - R0004 - Hall Chair Store

No Asbestos

B00N - R0005 - Uniform Shop

No Asbestos

B00N - R0006 - Sports Store

No Asbestos

B00N - R0007 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00N - R0008 - Movement

No Asbestos

B00N - R0009 - Canteen

No Asbestos

B00N - R0010 - Staff Kitchen

No Asbestos

B00N - R0011 - Canteen Office/Store

No Asbestos

B00N - R0012 - Communal Space

No Asbestos

B00N - R0013 - Raised Platform

No Asbestos

B00N - R0014 - Movement

No Asbestos

B00N - R0015 - Movement

No Asbestos

B00N - R0016 - Movement

No Asbestos

B00N - R0017 - Toilets - Boys

No Asbestos

B00N - R0018 - Toilets - Boys

No Asbestos

B00N - R0019 - General Assistant/Bulk Store

No Asbestos

B00N - R0020 - P.E. Store

No Asbestos

B00N - R0021 - Cleaning Supplies

No Asbestos

B00N - R0022 - Disabled Toilet

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00N - R0023 - Cleaning Distributed Store						
No Asbestos						
B00N - R0024 - Plant						
No Asbestos						
B00N - R0025 - General Storeroom						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Library - 1999 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00P - R0001 - Movement

No Asbestos

B00P - R0002 - Reading Area

No Asbestos

B00P - R0003 - Communications Room

No Asbestos

B00P - R0004 - Communications Cupboard

No Asbestos

B00P - R0005 - Library Office/Workroom

No Asbestos

B00P - R0006 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00P - R0007 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - General Learning - 1999 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00Q - R0001 - Home Base

No Asbestos

B00Q - R0002 - Home Base Store

No Asbestos

B00Q - R0003 - Practical Activities - 1hb

No Asbestos

B00Q - R0004 - Withdrawal Space - 1hb

No Asbestos

B00Q - R0005 - Home Base

No Asbestos

B00Q - R0006 - Home Base Store

No Asbestos

B00Q - R0007 - Practical Activities - 1hb

No Asbestos

B00Q - R0008 - Personal Effects Storage

No Asbestos

B00Q - R0009 - Personal Effects Storage

No Asbestos

B00Q - R0010 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00R - Other-After School Care - 1999 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists Non Accessible Area
 - Area inaccessible - Access Sealed.

Ceiling Voids No Asbestos Found

Interior

B00R - R0001 - Special Programs Room

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00R - R0002 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00S - General Learning - 1999 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists
 Non Accessible Area
 - Area inaccessible - Access Sealed.

Ceiling Voids
 No Asbestos Found

Interior

B00S - R0001 - Out Of School Hours Care Centre

No Asbestos

B00S - R0004 - Out Of School Hours Care Centre

No Asbestos

B00S - R0005 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00T - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00T - R0001 - External Movement

No Asbestos

B00T - R0002 - General Storeroom

No Asbestos

B00T - R0003 - Practical Activities

No Asbestos

B00T - R0004 - Home Base Store

No Asbestos

B00T - R0005 - Home Base

No Asbestos

B00T - R0006 - Withdrawal Space - 1hb

No Asbestos

B00T - R0007 - Home Base

No Asbestos

B00T - R0008 - Practical Activities

No Asbestos

B00T - R0009 - Home Base Store

No Asbestos

B00T - R0010 - General Storeroom

No Asbestos

B00T - R0011 - Stairs

No Asbestos

B00T - R0012 - Stairs

No Asbestos

B00T - R1001 - External Movement

No Asbestos

B00T - R1002 - Practical Activities

No Asbestos

B00T - R1003 - Home Base Store

No Asbestos

B00T - R1004 - Home Base

No Asbestos

B00T - R1005 - Withdrawal Space - 1hb

No Asbestos

B00T - R1006 - Home Base

No Asbestos

B00T - R1007 - Practical Activities

No Asbestos

B00T - R1008 - Home Base Store

No Asbestos

B00T - R1009 - External Stairs

No Asbestos

B00T - R1010 - External Stairs

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D11411 - Learning Unit - Standard With P.A.A. : Placement Date - 17/02/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D12102 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 602 - D12268 - Learning Unit - Standard With P.A.A. : Placement Date - 22/11/2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D14401 - Learning Unit - Standard With P.A.A. : Placement Date - 10/12/2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 603 - D14537 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 9/01/2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 837 - D17825 - Hcap Shower/Change/Toilet : Placement Date - 31/07/2012						
Exterior						
No Asbestos Found.						
Interior						
R1 - Disabled Shower/Toilet						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017