


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Auburn North Public School (1073)
Region : South Western Sydney
State Electorate : Auburn
Local Government Area : Auburn

Initial Survey : Noel Arnold & Associates : 21 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 08 - Jul - 2015

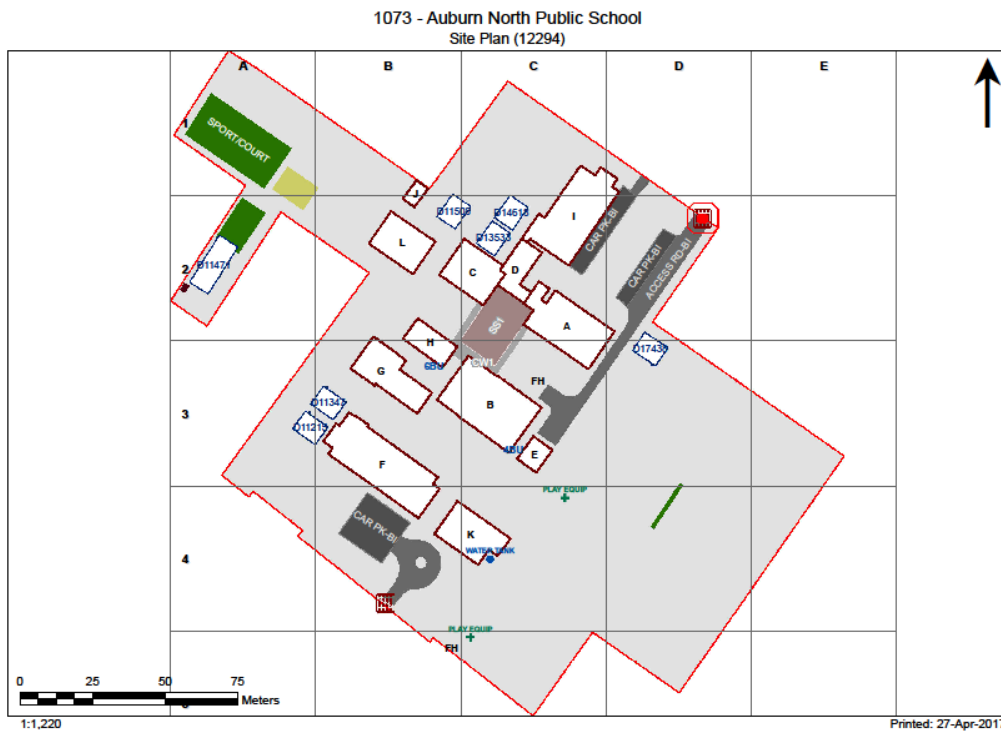

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Library - 1978 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00D/Eaves Linings/S25					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - Community Clinic (11.71 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1073/B00A/R0005/Ceiling Structures/Linings/S7					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0002 - Staff Kitchen (11.25 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1073/B00A/R0005/Ceiling Structures/Linings/S7					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0003 - Staff Room (77.12 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1073/B00A/R0005/Ceiling Structures/Linings/S7					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0004 - Movement (45.59 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1073/B00A/R0005/Ceiling Structures/Linings/S7					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0005 - Community Clinic (11.31 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1073/B00A/R0005/Ceiling Structures/Linings/S7					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0006 - Staff Toilet (4.39 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1073/B00A/R0005/Ceiling Structures/Linings/S7					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0007 - Cleaning Distributed Store (1.71 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1073/B00A/R0007/Ceiling Structures/Linings/S30					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	1073/B00A/R0007/Floor Coverings Res/Textile/S31					

B00A - R0008 - Staff Toilet (6.28 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1073/B00A/R0005/Ceiling Structures/Linings/S7					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0009 - Interview (11.78 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1073/B00A/R0005/Ceiling Structures/Linings/S7					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0010 - Interview (12.38 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1073/B00A/R0005/Ceiling Structures/Linings/S7					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0011 - Principal (25.16 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite					
	1073/B00A/R0005/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0012 - Deputy Principal (12.17 m2)						
Ceiling Structures/Linings	Vermiculite					
	1073/B00A/R0005/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0013 - Entry Vestibule (21.86 m2)						
Ceiling Structures/Linings	Vermiculite					
	1073/B00A/R0005/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0014 - Clerical Office (11.17 m2)						
Ceiling Structures/Linings	Vermiculite					
	1073/B00A/R0005/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0015 - Clerical Office/Workroom (12.63 m2)						
Ceiling Structures/Linings	Vermiculite					
	1073/B00A/R0005/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0016 - Distribution Board (1.32 m2)						
				Note: No inspection of live electrical installation.		
No Asbestos						
B00A - R0017 - Duplicating Workroom (11.45 m2)						
Ceiling Structures/Linings	Vermiculite					
	1073/B00A/R0005/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00A/R0017/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)
B00A - R0018 - Sick Bay (15.09 m2)						
Ceiling Structures/Linings	Vermiculite					
	1073/B00A/R0005/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0019 - Security Store (38.14 m2)						
Ceiling Structures/Linings	Vermiculite					
	1073/B00A/R0005/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	39m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00A/R0017/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)
B00A - R0020 - Movement (15.26 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00A/R0022/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)
B00A - R0021 - Cleaning Distributed Store (8.1 m2)						
No Asbestos						
B00A - R0022 - Movement (23.98 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00A/R0022/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)
B00A - R0023 - Stairs (8.48 m2)						
No Asbestos						
B00A - R1001 - Seminar/Study (14.82 m2)						
No Asbestos						
B00A - R1002 - Seminar/Study (14.43 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R1003 - Reading Area (252.98 m2)

No Asbestos

B00A - R1004 - Communications Room (13.03 m2)

No Asbestos

B00A - R1005 - Library Office/Workroom (11.39 m2)

No Asbestos

B00A - R1006 - Library Office/Workroom (21.48 m2)

No Asbestos

B00A - R1007 - Movement (14.52 m2)

No Asbestos

B00A - R1008 - Distribution Board (1.71 m2)

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------------	-------------	-----	--------------	--------------------	---------	--------------------

1073/B00A/R0017/Floor Coverings Res/Textile/S8

Chrysotile (white asbestos)

B00A - R1009 - Cleaning Distributed Store (1.66 m2)

No Asbestos

B00A - R1010 - Staff Toilet (4.03 m2)

No Asbestos

B00A - R1011 - Staff Toilet (3.97 m2)

No Asbestos

B00A - R1012 - Movement (15.26 m2)

Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------

1073/B00A/R0022/Ceiling Structures/Linings/S9

Chrysotile (white asbestos)

Upstand Panels	Flat AC Sheeting	2m2	Upper portion, Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
----------------	------------------	-----	-----------------------------------	--------------------	---------	--------------------

1073/B00A/R1012/Upstand Panels/S10

Chrysotile (white asbestos)

Wall Linings Internal	Flat AC Sheeting	2m2	South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	-----	-----------------------------	--------------------	---------	--------------------

1073/B00A/R1012/Upstand Panels/S10

Chrysotile (white asbestos)

B00A - R1013 - Stairs (18.12 m2)

Ceiling Structures/Linings	Flat AC Sheeting	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------

1073/B00A/R1013/Ceiling Structures/Linings/S29

Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Communal Facilities/Pupil Facilities - 1920 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00D/Eaves Linings/S25					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00B - R0001 - Communal Space (258.34 m2)**

No Asbestos

B00B - R0002 - Cleaning Distributed Store (8.39 m2)

Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00B/R0006/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)

B00B - R0003 - Hall Chair Store (6.54 m2)

No Asbestos

B00B - R0004 - Raised Platform (78.24 m2)

No Asbestos

B00B - R0005 - Music Store (15.24 m2)

No Asbestos

B00B - R0006 - Canteen (30.84 m2)

Floor Coverings Res/Textile	Vinyl Tiles	31m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00B/R0006/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)

B00B - R0007 - Canteen Office/Store (2.83 m2)

No Asbestos

B00B - R0008 - Staff Toilet (3.15 m2)

No Asbestos

B00B - R0009 - Canteen Office/Store (4.78 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00B/R0006/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)

B00B - R0010 - Movement (16.98 m2)

Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00B/R0013/Ceiling Structures/Linings/S28					Chrysotile (white asbestos)

B00B - R0011 - Distribution Board (0.59 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0012 - Disabled Toilet (2.67 m2)

No Asbestos

B00B - R0013 - Movement (12.63 m2)

Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00B/R0013/Ceiling Structures/Linings/S28					Chrysotile (white asbestos)

B00B - R0014 - Toilets - Boys (43.02 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00B/R0015/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)

B00B - R0015 - Toilets - Girls (43.93 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00B/R0015/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1891 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	18m2	South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00D/Eaves Linings/S25					Chrysotile (white asbestos)
Window Infill Panels	Flat AC Sheeting	4m2	South facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00C/Window Infill Panels/S12					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00C - R0001 - Movement (24.95 m2)

Ceiling Structures/Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00C/R0001/Ceiling Structures/Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0002 - Movement (37.21 m2)

Ceiling Structures/Linings	Flat AC Sheeting	38m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00C/R0001/Ceiling Structures/Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0003 - Home Base (75.3 m2)

Window Infill Panel	Flat AC Sheeting	2m2	South facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00C/Window Infill Panels/S12					Chrysotile (white asbestos)

B00C - R0004 - Practical Activities - 1hb (13.74 m2)

No Asbestos

B00C - R0005 - Toilets - Boys/Girls (2.77 m2)

No Asbestos

B00C - R0006 - Home Base (75.24 m2)

Window Infill Panel	Flat AC Sheeting	2m2	South facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00C/Window Infill Panels/S12					Chrysotile (white asbestos)

B00C - R0007 - Practical Activities - 1hb (13.87 m2)

No Asbestos

B00C - R0008 - Toilets - Boys/Girls (2.77 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1895 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	12m2	North facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00D/Eaves Linings/S25					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0001 - Toilets - Girls (39.25 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00D/R0002/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)

B00D - R0002 - Toilets - Boys (40.57 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00D/R0002/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)

B00D - R0003 - Movement (32.37 m2)

Ceiling Structures/Linings	Flat AC Sheeting	33m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00D/R0003/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)

B00D - R0004 - Cleaning Distributed Store (1.62 m2)

No Asbestos

B00D - R0005 - Movement (26.34 m2)

Ceiling Structures/Linings	Flat AC Sheeting	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00D/R0003/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Building Services - 1978 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00D/Eaves Linings/S25					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00E - R0001 - Sports Store (24.63 m2)

No Asbestos

B00E - R0002 - General Assistant/Bulk Store (19.07 m2)

No Asbestos

B00E - R0003 - Main Switch Board (9.12 m2)

No Asbestos

B00E - R0004 - Garden Store (12.89 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1924 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area - No access possible - No keys on site

Interior

B00F - R0001 - Movement (1.29 m2)

No Asbestos

B00F - R0002 - Movement (21.96 m2)

No Asbestos

B00F - R0003 - Home Base (46.73 m2)

No Asbestos

B00F - R0004 - Home Base (46.24 m2)

No Asbestos

B00F - R0005 - Home Base (45.59 m2)

No Asbestos

B00F - R0006 - Home Base (46.68 m2)

No Asbestos

B00F - R0007 - Home Base (46.24 m2)

No Asbestos

B00F - R0008 - Interview (16.26 m2)

No Asbestos

B00F - R0009 - Movement (2.05 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1073/B00F/R0012/Ceiling Structures/Linings/S26				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00F - R0010 - Movement (19.21 m2)

No Asbestos

B00F - R0011 - Staff Toilet (4.48 m2)

No Asbestos

B00F - R0012 - Security Store (8.3 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1073/B00F/R0012/Ceiling Structures/Linings/S26				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00F - R0013 - Staff Shower/Change (2.93 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1073/B00F/R0012/Ceiling Structures/Linings/S26				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00F - R0016 - Raised Platform (23.44 m2)

No Asbestos

B00F - R0017 - General Storeroom (12.34 m2)

No Asbestos

B00F - R0018 - Movement (4.23 m2)

No Asbestos

B00F - R0019 - Cleaning Distributed Store (3.08 m2)

No Asbestos

B00F - R0020 - Practical Activities - 1hb (104.78 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R0021 - Movement (63.68 m2)						
No Asbestos						
B00F - R0022 - Stairs (7.56 m2)						
No Asbestos						
B00F - R0023 - Stairs (8.52 m2)						
No Asbestos						
B00F - R1001 - Plant (13.56 m2)						
No Asbestos						
B00F - R1002 - Movement (92.76 m2)						
Wall Linings Internal	Flat AC Sheeting	3m2	North facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
1073/B00F/R1011/Wall Linings Internal/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00F - R1003 - Home Base (48.38 m2)						
No Asbestos						
B00F - R1004 - Home Base (48.56 m2)						
No Asbestos						
B00F - R1005 - Home Base (48.56 m2)						
No Asbestos						
B00F - R1006 - Home Base (48.48 m2)						
No Asbestos						
B00F - R1007 - Home Base (48.57 m2)						
No Asbestos						
B00F - R1008 - Withdrawal Space - 1hb (25.23 m2)						
No Asbestos						
B00F - R1009 - Home Base Store (8.46 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1073/B00F/R0012/Ceiling Structures/Linings/S26				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00F - R1010 - Interview (17.55 m2)						
No Asbestos						
B00F - R1011 - Practical Activities - 1hb (86.28 m2)						
Wall Linings Internal	Flat AC Sheeting	8m2	East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
1073/B00F/R1011/Wall Linings Internal/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00F - R1012 - Home Base Store (16.99 m2)						
Wall Linings Internal	Flat AC Sheeting	8m2	South facing, West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
1073/B00F/R1011/Wall Linings Internal/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00F - R1013 - Staff Room Annexe (12.34 m2)						
No Asbestos						
B00F - R1014 - Stairs (13.06 m2)						
No Asbestos						
B00F - R1015 - Stairs (14.01 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1978 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	45m2	North facing, South facing, East facing, Upper portion, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00D/Eaves Linings/S25					Chrysotile (white asbestos)
Gable Ends	Flat AC Sheeting	12m2	North facing, South facing, East facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1073/B00D/Eaves Linings/S25					Chrysotile (white asbestos)

Interior

B00G - R0001 - Home Base Store (7.61 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1073/B00G/R0001/Ceiling Structures/Linings/S27					

B00G - R0002 - Withdrawal Space - 2hb (37.68 m2)

No Asbestos

B00G - R0003 - Home Base (48.91 m2)

No Asbestos

B00G - R0004 - Home Base Store (8.83 m2)

No Asbestos

B00G - R0005 - Home Base (48.81 m2)

No Asbestos

B00G - R0006 - Home Base (45.38 m2)

Chalk Board	Flat AC Sheeting	12m2	North facing, West facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00G/R0006/Chalk Board/S22					Chrysotile (white asbestos)

B00G - R0007 - Staff Toilet (4.84 m2)

No Asbestos

B00G - R0008 - Movement (46 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1073/B00G/R0008/Ceiling Structures/Linings/S18					

B00G - R0009 - Movement (30.38 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1924 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00D/Eaves Linings/S25					Chrysotile (white asbestos)
Gable Ends	Flat AC Sheeting	8m2	East facing, West facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1073/B00D/Eaves Linings/S25					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00H - R0001 - Movement (11.61 m2)

Wall Linings Internal	Flat AC Sheeting	4m2	East facing, West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00H/R0001/Wall Linings Internal/S24					Chrysotile (white asbestos)

B00H - R0002 - Home Base (38.79 m2)

No Asbestos

B00H - R0003 - Home Base Store (22.1 m2)

Wall Linings Internal	Flat AC Sheeting	8m2	Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00H/R0001/Wall Linings Internal/S24					Chrysotile (white asbestos)

B00H - R0004 - Withdrawal Space - 1hb (24.18 m2)

No Asbestos

B00H - R0005 - Withdrawal Space - 1hb (24.14 m2)

No Asbestos

B00H - R0006 - Movement (5.78 m2)

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1073/B00H/R0006/Wall Linings Internal/S5					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - General Learning/Other-After School Care - 1919 - Brick/Block (Brick/Block)

Exterior

Gable Ends	Flat AC Sheeting	6m2	North facing, Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1073/B00D/Eaves Linings/S25					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00I - R0001 - Staff Room Annexe (20.35 m2)

No Asbestos

B00I - R0002 - Home Base (47.23 m2)

No Asbestos

B00I - R0003 - Home Base (46.83 m2)

No Asbestos

B00I - R0004 - Home Base (47.44 m2)

No Asbestos

B00I - R0005 - Home Base (47.31 m2)

No Asbestos

B00I - R0006 - Staff Toilet (5.35 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00F/R0012/Ceiling Structures/Linings/S26					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1073/B00I/R0006/Wall Linings Internal/S15					

B00I - R0007 - Craft Store (6.95 m2)

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1073/B00I/R0006/Wall Linings Internal/S15					

B00I - R0008 - Movement (3.75 m2)

No Asbestos

B00I - R0009 - Cleaning Distributed Store (5.4 m2)

No Asbestos

B00I - R0010 - Movement (82.71 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1073/B00I/R0011/Ceiling Structures/Linings/S14					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00I - R0011 - Practical Activities - 1hb (96.73 m2)

Floor Coverings Res/Textile	Vinyl Tiles	30m2	North facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00I/R0011/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1073/B00I/R0011/Ceiling Structures/Linings/S14					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00I - R0012 - Movement (3.39 m2)

No Asbestos

B00I - R0013 - Cleaning Distributed Store (6.23 m2)

No Asbestos

B00I - R0014 - Security Store (12.46 m2)

Floor Coverings Res/Textile	Vinyl Tiles	13m2	North facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1073/B00I/R0011/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00I - R0015 - Movement (24.71 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1073/B00I/R0015/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)	
B00I - R0016 - Stairs (8.21 m2)						
No Asbestos						
B00I - R0017 - Stairs (7.2 m2)						
No Asbestos						
B00I - R1001 - Home Base (49.55 m2)						
No Asbestos						
B00I - R1002 - Special Programs Room (48.66 m2)						
No Asbestos						
B00I - R1003 - Special Programs Room (49.13 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1073/B00F/R0012/Ceiling Structures/Linings/S26					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
B00I - R1004 - Home Base (49.2 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1073/B00F/R0012/Ceiling Structures/Linings/S26					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
B00I - R1005 - Movement (7.11 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1073/B00F/R0012/Ceiling Structures/Linings/S26					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
B00I - R1006 - Home Base Store (9.03 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
1073/B00I/R1006/Floor Coverings Res/Textile/S23					No Asbestos Detected	
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1073/B00F/R0012/Ceiling Structures/Linings/S26					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
B00I - R1007 - Movement (74.15 m2)						
No Asbestos						
B00I - R1008 - Practical Activities - 1hb (113.23 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	114m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1073/B00I/R0011/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)	
B00I - R1009 - Security Store (9.18 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1073/B00I/R1009/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B00I - R1010 - Movement (7.11 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
1073/B00I/R1009/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B00I - R1011 - Stairs (14.01 m2)						
No Asbestos						
B00I - R1012 - Stairs (12.15 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Other - 1978 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00J - R0001 - Other (36.62 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00K - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00K - R0001 - External Movement (59.28 m2)

No Asbestos

B00K - R0002 - Practical Activities/Movement - 1hb (18.34 m2)

No Asbestos

B00K - R0003 - Home Base Store (6.38 m2)

No Asbestos

B00K - R0004 - Home Base (60.05 m2)

No Asbestos

B00K - R0005 - Withdrawal Space - 2hb (11.82 m2)

No Asbestos

B00K - R0006 - Home Base (60.01 m2)

No Asbestos

B00K - R0007 - Home Base Store (6.42 m2)

No Asbestos

B00K - R0008 - Practical Activities/Movement - 1hb (19.32 m2)

No Asbestos

B00K - R0009 - No Access (0.62 m2)

No Asbestos

B00K - R0010 - Schools As Community Centres Program (14.64 m2)

No Asbestos

B00K - R1001 - External Movement (60.24 m2)

No Asbestos

B00K - R1002 - Practical Activities/Movement - 1hb (19.09 m2)

No Asbestos

B00K - R1003 - Home Base Store (6.09 m2)

No Asbestos

B00K - R1004 - Home Base (61.12 m2)

No Asbestos

B00K - R1005 - Withdrawal Space - 2hb (11.74 m2)

No Asbestos

B00K - R1006 - Home Base (61.23 m2)

No Asbestos

B00K - R1007 - Home Base Store (6.09 m2)


No Asbestos

B00K - R1008 - Practical Activities/Movement - 1hb (19.05 m2)

No Asbestos

B00K - R1009 - External Stairs (13.78 m2)

No Asbestos

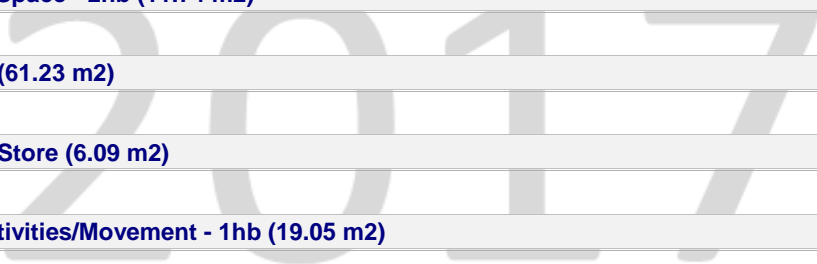

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00L - R0001 - External Movement (41.7 m2)

No Asbestos

B00L - R0002 - Practical Activities/Movement - 1hb (19.15 m2)

No Asbestos

B00L - R0003 - Home Base Store (6.09 m2)

No Asbestos

B00L - R0004 - Home Base (61.35 m2)

No Asbestos

B00L - R0005 - Withdrawal Space - 2hb (11.74 m2)

No Asbestos

B00L - R0006 - Home Base (61.28 m2)

No Asbestos

B00L - R0007 - Home Base Store (6.08 m2)

No Asbestos

B00L - R0008 - Practical Activities/Movement - 1hb (18.68 m2)

No Asbestos

B00L - R0009 - No Access (0.45 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D11215 - Learning Unit - Standard With P.A.A. : Placement Date - 16/01/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D11347 - Learning Unit - Standard With P.A.A. : Placement Date - 16/01/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 534 - D11471 - Library/Group Study/Office/A V Store : Placement Date - 25/07/2004

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	23.04 m2

Interior

R1 - Clerical Office

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos	36 m2
---------	---------------	------------------	-------

R3 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2
---------	---------------	------------------	------

R4 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos	16 m2
---------	---------------	------------------	-------

R5 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	5 m2

R6 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	5 m2

R7 - Reading Area

Ceiling	Flat AC Sheet	Assumed Asbestos	54 m2
---------	---------------	------------------	-------

R8 - Entry

Ceiling	Flat AC Sheet	Assumed Asbestos	14 m2
---------	---------------	------------------	-------

OS 602 - D11508 - Learning Unit - Standard With P.A.A. : Placement Date - 28/12/2006

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 601 - D13533 - Learning Unit - Standard/Withdrawal : Placement Date - 22/12/2006						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 601 - D14618 - Learning Unit - Standard/Withdrawal : Placement Date - 10/01/2014						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017