


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Awaba Public School (1084)
Region : Hunter/Central Coast
State Electorate : Lake Macquarie
Local Government Area : Lake Macquarie

Initial Survey : Noel Arnold & Associates : 22 - Apr - 2008
Reviewed By : AECOM : 27 - Jun - 2016

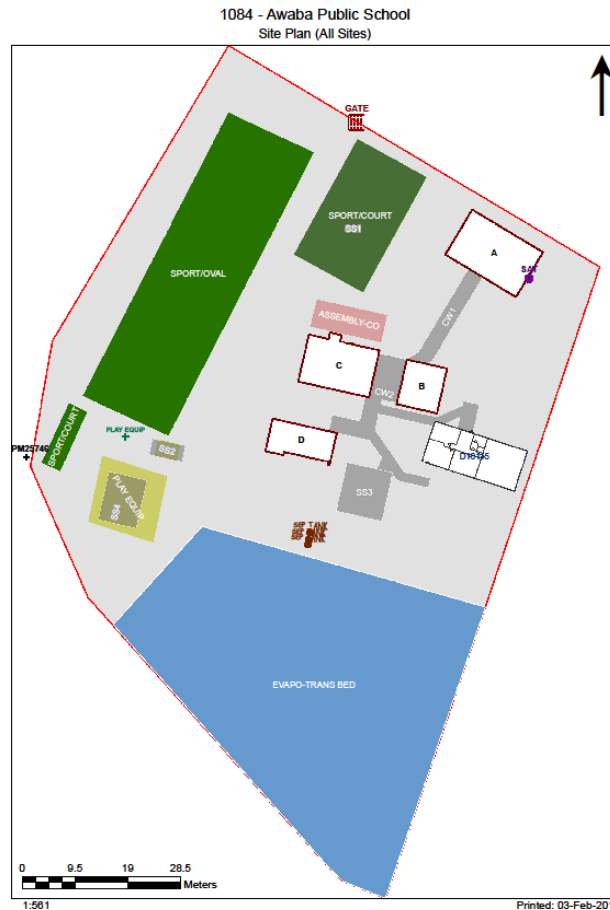

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1990 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1084/B00A/Eaves Linings/S1					No Asbestos Detected
Ceiling Voids	No Asbestos Found					

Interior

B00A - R0001 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00A - R0002 - Principal

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00A - R0003 - Clerical Office

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00A - R0004 - Movement

No Asbestos

B00A - R0005 - Staff Room

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00A - R0006 - General Storeroom

No Asbestos

B00A - R9001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library - 1913 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids - Flat Roof No Asbestos Found

Interior

B00B - R0001 - K.L.A. Store

No Asbestos

B00B - R0002 - Home Base

No Asbestos

B00B - R0003 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Pupil Facilities - 1891 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids - Flat Roof	Non Accessible Area - Height Restriction

Interior

B00C - R0001 - Staff Room Annexe

No Asbestos

B00C - R0002 - General Storeroom

No Asbestos

B00C - R0003 - Home Base

No Asbestos

B00C - R0004 - Cleaning Supplies

No Asbestos

B00C - R0005 - Canteen

No Asbestos

B00C - R0006 - Movement

No Asbestos

B00C - R0007 - Practical Activities - 1hb

No Asbestos

B00C - R0008 - Withdrawal Space - 1hb

No Asbestos

B00C - R0009 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities/Staff Facilities - 1990 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 1084/B00D/Eaves Linings/S2					No Asbestos Detected
Ceiling Voids	No Asbestos Found					

Interior**B00D - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1084/B00D/R0001/Ceiling Structures/Linings/S3					Chrysotile (white asbestos) , Crocidolite (blue asbestos)

B00D - R0002 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1084/B00D/R0004/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Crocidolite (blue asbestos)

B00D - R0003 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1084/B00D/R0004/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Crocidolite (blue asbestos)

B00D - R0004 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1084/B00D/R0004/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Crocidolite (blue asbestos)

B00D - R0005 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1084/B00D/R0004/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Crocidolite (blue asbestos)

B00D - R0006 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1084/B00D/R0004/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Crocidolite (blue asbestos)

B00D - R0007 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 500 - D18115 - Admin - Library : Placement Date - 18/04/2002

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				20.16 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				13 m2

R2 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos				18 m2
---------	---------------	------------------	--	--	--	-------

R3 - Staff Room/Kitchen

Ceiling	Flat AC Sheet	Assumed Asbestos				19 m2
---------	---------------	------------------	--	--	--	-------

R4 - Clerical Office

Ceiling	Flat AC Sheet	Assumed Asbestos				18 m2
---------	---------------	------------------	--	--	--	-------

R5 - Library

Ceiling	Flat AC Sheet	Assumed Asbestos				54 m2
---------	---------------	------------------	--	--	--	-------

R6 - Storeroom

Ceiling	Flat AC Sheet	Assumed Asbestos				0 m2
---------	---------------	------------------	--	--	--	------

R7 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				6 m2
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				4 m2

R8 - Entry to toilet

Ceiling	Flat AC Sheet	Assumed Asbestos				0 m2
---------	---------------	------------------	--	--	--	------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017