


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Athelstane Public School (3453)  
**Region :** Sydney  
**State Electorate :** Rockdale  
**Local Government Area :** Rockdale

**Initial Survey :** Noel Arnold & Associates : 29 - Mar - 2008  
**Reviewed By :** Parsons Brinckerhoff : 01 - Nov - 2016

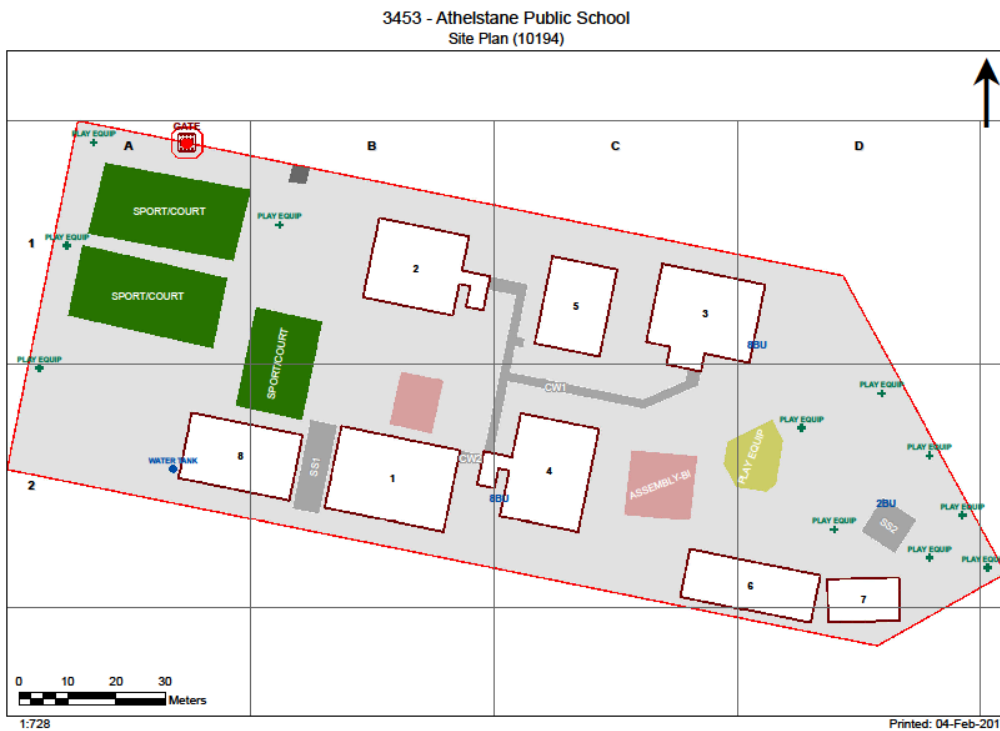

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Communal Facilities/Pupil Facilities - 1972 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	150m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B001/Eaves Linings/S27					<b>Chrysotile (white asbestos)</b>
Ceiling Void	No Asbestos Found					

**Interior****B001 - R0001 - Movement (49.16 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	3453/B001/R0001/Ceiling Structures/Linings/S10					

**B001 - R0002 - Communal Space (164.17 m2)**

No Asbestos

**B001 - R0003 - Hall Chair Store (3.6 m2)**

No Asbestos

**B001 - R0004 - Toilets - Girls (8.4 m2)**

No Asbestos

**B001 - R0005 - Movement (27.83 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B001/R0005/Floor Coverings Res/Textile/S11					<b>Chrysotile (white asbestos)</b>

**B001 - R0006 - General Assistant/Bulk Store (9.19 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	3453/B001/R0006/Floor Coverings Res/Textile/S37					

**B001 - R0007 - General Storeroom (10.5 m2)**

No Asbestos

**B001 - R0008 - Canteen (28.6 m2)**

No Asbestos

**B001 - R0009 - Canteen Office/Store (2.83 m2)**

No Asbestos

**B001 - R0010 - Canteen Office/Store (5.22 m2)**

No Asbestos

**B001 - R0011 - Movement (8.51 m2)**

No Asbestos

**B001 - R0012 - Cleaning Supplies (6.24 m2)**

No Asbestos

**B001 - R0013 - Staff Toilet (3.43 m2)**

No Asbestos

**B001 - R0014 - P.E. Store (11.42 m2)**

No Asbestos

**B001 - R0015 - Distribution Board (0.36 m2)**

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	2Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B001/R0015/Electrical Mounting Board/S33					<b>Chrysotile (white asbestos)</b>

**B001 - R0016 - Toilets - Boys (8.4 m2)**

No Asbestos

**B001 - R0017 - Hall Chair Store (3.6 m2)**

No Asbestos

**B001 - R0018 - Raised Platform (34.85 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B001/R0005/Floor Coverings Res/Textile/S11				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B002 - Administration/Library - 1972 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 3453/B001/Eaves Linings/S27	150m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Void	No Asbestos Found					

**Interior****B002 - R0001 - Duplicating Workroom (12.89 m2)**

Ceiling Structures/Linings	Vermiculite 3453/B002/R0011/Ceiling Structures/Linings/S2					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	--

Floor Coverings Res/Textile	Vinyl Tiles 3453/B002/R0014/Floor Coverings Res/Textile/S1	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
-----------------------------	---	------	--------------	--------------------	---------	--

**B002 - R0002 - Clerical Office (12.89 m2)**

Ceiling Structures/Linings	Vermiculite 3453/B002/R0011/Ceiling Structures/Linings/S2					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	--

**B002 - R0003 - Entry Vestibule (8.09 m2)**

Ceiling Structures/Linings	Vermiculite 3453/B002/R0011/Ceiling Structures/Linings/S2					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	--

**B002 - R0004 - Principal (21.76 m2)**

Ceiling Structures/Linings	Vermiculite 3453/B002/R0011/Ceiling Structures/Linings/S2					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	--

**B002 - R0005 - Staff Room Annexe (13.81 m2)**

Ceiling Structures/Linings	Vermiculite 3453/B002/R0011/Ceiling Structures/Linings/S2					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	--

**B002 - R0006 - Staff Room Annexe (13.77 m2)**

Ceiling Structures/Linings	Vermiculite 3453/B002/R0011/Ceiling Structures/Linings/S2					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	--

**B002 - R0007 - Staff Room Annexe (14.11 m2)**

Ceiling Structures/Linings	Vermiculite 3453/B002/R0011/Ceiling Structures/Linings/S2					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	--

**B002 - R0008 - Staff Toilet (5 m2)**

Ceiling Structures/Linings	Vermiculite 3453/B002/R0011/Ceiling Structures/Linings/S2					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	--

**B002 - R0009 - Staff Toilet (5 m2)**

Ceiling Structures/Linings	Vermiculite 3453/B002/R0011/Ceiling Structures/Linings/S2					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	--

**B002 - R0010 - Interview (16.08 m2)**

Ceiling Structures/Linings	Vermiculite 3453/B002/R0011/Ceiling Structures/Linings/S2					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	--

**B002 - R0012 - Distribution Board (3.25 m2)**

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Electrical Mounting Board	Resinous Board	2Unit	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
3453/B002/R1003/Electrical Mounting Board/S32					<b>Chrysotile (white asbestos)</b>	
<b>B002 - R0013 - Cleaning Distributed Store (2.44 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3453/B002/R0014/Floor Coverings Res/Textile/S1					<b>Chrysotile (white asbestos)</b>	
<b>B002 - R0014 - Security Store (13.29 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3453/B002/R0014/Floor Coverings Res/Textile/S1					<b>Chrysotile (white asbestos)</b>	
<b>B002 - R0015 - Clerical Office (10.76 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
3453/B002/R0011/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B002 - R0016 - Sick Bay (3.9 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
3453/B002/R0011/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B002 - R0017 - Movement (36.79 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
3453/B002/R0011/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B002 - R0018 - External Movement (15.08 m2)</b>						
No Asbestos						
<b>B002 - R0019 - Staff Room (51.31 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
3453/B002/R0019/Ceiling Structures/Linings/S35					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B002 - R0020 - Staff Kitchen (10.09 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
3453/B002/R0019/Ceiling Structures/Linings/S35					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B002 - R0021 - External Movement (4.65 m2)</b>						
No Asbestos						
<b>B002 - R0022 - External Stairs (16.02 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
3453/B002/R1014/Ceiling Structures/Linings/S30					<b>No Asbestos Detected</b>	
<b>B002 - R1001 - Toilets - Girls (8.33 m2)</b>						
Wall Linings Internal	Flat AC Sheeting	6m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
3453/B002/R1004/Wall Linings Internal/S9					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B002 - R1002 - Cleaning Distributed Store (0.88 m2)</b>						
No Asbestos						
<b>B002 - R1003 - Distribution Board (0.88 m2)</b>						
Note: No inspection of live electrical installation.						
Electrical Mounting Board	Resinous Board	2Unit	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
3453/B002/R1003/Electrical Mounting Board/S32					<b>Chrysotile (white asbestos)</b>	
<b>B002 - R1004 - Toilets - Boys (8.33 m2)</b>						
Wall Linings Internal	Flat AC Sheeting	6m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
3453/B002/R1004/Wall Linings Internal/S9					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B002 - R1005 - Movement (12.84 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B002 - R1006 - Movement (4.36 m2)</b>						
No Asbestos						
<b>B002 - R1007 - External Movement (10.61 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3453/B002/R1007/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>	
<b>B002 - R1008 - Library Office/Workroom (23.71 m2)</b>						
No Asbestos						
<b>B002 - R1009 - K.L.A. Store (9.13 m2)</b>						
No Asbestos						
<b>B002 - R1010 - Library Office/Workroom (9.88 m2)</b>						
No Asbestos						
<b>B002 - R1011 - Reading Area (173.27 m2)</b>						
No Asbestos						
<b>B002 - R1012 - Seminar/Study (25.78 m2)</b>						
No Asbestos						
<b>B002 - R1013 - Movement (2.02 m2)</b>						
No Asbestos						
<b>B002 - R1014 - External Stairs (20.95 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
3453/B002/R1014/Ceiling Structures/Linings/S30					<b>No Asbestos Detected</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B003 - General Learning/Pupil Facilities - 1972 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	150m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B001/Eaves Linings/S27					<b>Chrysotile (white asbestos)</b>
Ceiling Void	No Asbestos Found					

**Interior****B003 - R0001 - Practical Activities - 1hb (13.92 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3453/B003/R0006/Ceiling Structures/Linings/S16					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B003 - R0002 - Home Base (55.67 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3453/B003/R0006/Ceiling Structures/Linings/S16					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B003 - R0003 - Cleaning Distributed Store (1.97 m2)**

No Asbestos

**B003 - R0004 - Toilets - Boys (23.07 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3453/B003/R0006/Ceiling Structures/Linings/S16					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B003 - R0005 - Toilets - Girls (27.58 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3453/B003/R0006/Ceiling Structures/Linings/S16					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B003 - R0006 - Movement (51.63 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3453/B003/R0006/Ceiling Structures/Linings/S16					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Floor Coverings Res/Textile	Vinyl Tiles	52m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B003/R0006/Floor Coverings Res/Textile/S15					<b>Chrysotile (white asbestos)</b>

**B003 - R0007 - Movement (8.77 m2)**

No Asbestos

**B003 - R0008 - General Storeroom (7.53 m2)**

No Asbestos

**B003 - R0009 - Practical Activities - 1hb (13.92 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3453/B003/R0006/Ceiling Structures/Linings/S16					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B005/R0003/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>

**B003 - R0010 - Home Base (55.67 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3453/B003/R0006/Ceiling Structures/Linings/S16					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B003 - R0011 - Home Base (55.67 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3453/B003/R0006/Ceiling Structures/Linings/S16					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B003 - R0012 - Practical Activities - 1hb (13.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3453/B003/R0006/Ceiling Structures/Linings/S16					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B005/R0003/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
<b>B003 - R0013 - Sports Store (6.85 m2)</b>						
No Asbestos						
<b>B003 - R0014 - Distribution Board (0.7 m2)</b>						
No Asbestos						
					Note: No inspection of live electrical installation.	
<b>B003 - R1001 - Practical Activities - 1hb (10.73 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B005/R0003/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
<b>B003 - R1002 - Home Base (52.03 m2)</b>						
No Asbestos						
<b>B003 - R1003 - Home Base (55.68 m2)</b>						
No Asbestos						
<b>B003 - R1004 - Practical Activities - 1hb (13.92 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B005/R0003/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
<b>B003 - R1005 - Movement (35.72 m2)</b>						
No Asbestos						
<b>B003 - R1006 - Movement (4.88 m2)</b>						
Ceiling Structures/Linings	Corrugated AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B003/R1006/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)
<b>B003 - R1007 - Practical Activities - 1hb (13.92 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B005/R0003/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
<b>B003 - R1008 - Home Base (55.68 m2)</b>						
No Asbestos						
<b>B003 - R1009 - Home Base (55.68 m2)</b>						
No Asbestos						
<b>B003 - R1010 - Practical Activities - 1hb (13.92 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B005/R0003/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
<b>B003 - R1011 - Movement (1.19 m2)</b>						
No Asbestos						
<b>B003 - R1012 - General Storeroom (9.26 m2)</b>						
No Asbestos						
<b>B003 - R1013 - Distribution Board (0.58 m2)</b>						
					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B003/R1013/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B004 - General Learning/Pupil Facilities - 1972 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	150m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B001/Eaves Linings/S27					<b>Chrysotile (white asbestos)</b>
Ceiling Void	No Asbestos Found					

**Interior**

**B004 - R0001 - Practical Activities - 1hb (13.92 m2)**

Ceiling Structures/Linings	Vermiculite					
	3453/B004/R0009/Ceiling Structures/Linings/S13					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B004/R0009/Floor Coverings Res/Textile/S12					<b>Chrysotile (white asbestos)</b>

**B004 - R0002 - Home Base (55.67 m2)**

Ceiling Structures/Linings	Vermiculite					
	3453/B004/R0009/Ceiling Structures/Linings/S13					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B004 - R0003 - Cleaning Distributed Store (7.89 m2)**

No Asbestos

**B004 - R0004 - Distribution Board (0.61 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B004 - R0005 - Withdrawal Space - 1hb (13.64 m2)**

Ceiling Structures/Linings	Vermiculite					
	3453/B004/R0009/Ceiling Structures/Linings/S13					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B004 - R0006 - General Storeroom (16.02 m2)**

Ceiling Structures/Linings	Vermiculite					
	3453/B004/R0009/Ceiling Structures/Linings/S13					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Floor Coverings Res/Textile	Vinyl Tiles	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B004/R0009/Floor Coverings Res/Textile/S12					<b>Chrysotile (white asbestos)</b>

**B004 - R0007 - Staff Toilet (2.75 m2)**

Ceiling Structures/Linings	Vermiculite					
	3453/B004/R0009/Ceiling Structures/Linings/S13					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B004 - R0008 - Staff Toilet (2.75 m2)**

Ceiling Structures/Linings	Vermiculite					
	3453/B004/R0009/Ceiling Structures/Linings/S13					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B004 - R0009 - Movement (50.66 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	51m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B004/R0009/Floor Coverings Res/Textile/S12					<b>Chrysotile (white asbestos)</b>

Ceiling Structures/Linings	Vermiculite					
	3453/B004/R0009/Ceiling Structures/Linings/S13					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B004 - R0010 - Toilets - Boys (41.22 m2)**

Ceiling Structures/Linings	Vermiculite					
	3453/B004/R0009/Ceiling Structures/Linings/S13					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B004 - R0011 - Toilets - Girls (41.13 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3453/B004/R0009/Ceiling Structures/Linings/S13					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B004 - R0012 - Garden Store (6.59 m2)</b>						
No Asbestos						
<b>B004 - R0013 - Movement (14.79 m2)</b>						
No Asbestos						
<b>B004 - R0014 - Practical Activities - 1hb (13.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3453/B004/R0009/Ceiling Structures/Linings/S13					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B004/R0009/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
<b>B004 - R0015 - Home Base (55.67 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3453/B004/R0009/Ceiling Structures/Linings/S13					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B004/R0009/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
<b>B004 - R1001 - Practical Activities - 1hb (13.92 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B004/R0009/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
<b>B004 - R1002 - Home Base (55.67 m2)</b>						
No Asbestos						
<b>B004 - R1003 - Movement (1.08 m2)</b>						
No Asbestos						
<b>B004 - R1004 - General Storeroom (9.29 m2)</b>						
No Asbestos						
<b>B004 - R1005 - Distribution Board (0.62 m2)</b>						
						Note: No inspection of live electrical installation.
No Asbestos						
<b>B004 - R1006 - Practical Activities - 1hb (10.73 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B004/R0009/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
<b>B004 - R1007 - Home Base (51.71 m2)</b>						
No Asbestos						
<b>B004 - R1008 - Home Base (55.67 m2)</b>						
No Asbestos						
<b>B004 - R1009 - Practical Activities - 1hb (13.92 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B004/R0009/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
<b>B004 - R1010 - Movement (35.44 m2)</b>						
No Asbestos						
<b>B004 - R1011 - Movement (11 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B004/R1011/Ceiling Structures/Linings/S14					Chrysotile (white asbestos)
<b>B004 - R1012 - Practical Activities - 1hb (13.92 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B004/R0009/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B004 - R1013 - Home Base (55.67 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B005 - General Learning/Pupil Facilities - 1972 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	150m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B001/Eaves Linings/S27					<b>Chrysotile (white asbestos)</b>
Ceiling Void	No Asbestos Found					

**Interior****B005 - R0001 - Movement (90.67 m2)**

No Asbestos

**B005 - R0002 - Home Base (91.13 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3453/B005/R0002/Ceiling Structures/Linings/S4					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B005 - R0003 - Practical Activities - 1hb (11.37 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B005/R0003/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3453/B005/R0002/Ceiling Structures/Linings/S4					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B005 - R0004 - Toilets - Boys/Girls (3.09 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3453/B005/R0002/Ceiling Structures/Linings/S4					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B005 - R0005 - Home Base (91.55 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3453/B005/R0002/Ceiling Structures/Linings/S4					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B005 - R0006 - Practical Activities - 1hb (11.41 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3453/B005/R0002/Ceiling Structures/Linings/S4					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B005/R0003/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>

**B005 - R0007 - Toilets - Boys/Girls (3.09 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3453/B005/R0002/Ceiling Structures/Linings/S4					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B005 - R0008 - Main Switch Board (3.96 m2)**

Electrical Mounting Board	Resinous Board	1Unit	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B005/R0008/Electrical Mounting Board/S34					<b>Chrysotile (white asbestos)</b>

**B005 - R1001 - Practical Activities - 1hb (15.3 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3453/B005/R0002/Ceiling Structures/Linings/S4					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
	3453/B005/R1015/Floor Coverings Res/Textile/S7					

**B005 - R1002 - Home Base (56.64 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	3453/B005/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B005 - R1003 - Home Base (56.63 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3453/B005/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B005 - R1004 - Practical Activities - 1hb (15.3 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3453/B005/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet					
	3453/B005/R1015/Floor Coverings Res/Textile/S7					No Asbestos Detected
<b>B005 - R1005 - Movement (3.48 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	3453/B005/R1015/Floor Coverings Res/Textile/S7					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	3453/B005/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B005 - R1006 - Staff Room Annexe (9.98 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3453/B005/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B005 - R1007 - Craft Store (10.6 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3453/B005/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet					
	3453/B005/R1015/Floor Coverings Res/Textile/S7					No Asbestos Detected
<b>B005 - R1008 - Movement (12.24 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3453/B005/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B005 - R1010 - Distribution Board (0.68 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B005 - R1011 - Staff Toilet (4.08 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3453/B005/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B005/R1011/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)
<b>B005 - R1012 - Staff Toilet (4.08 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3453/B005/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B005 - R1013 - Cleaning Distributed Store (2.6 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3453/B005/R1013/Ceiling Structures/Linings/S36					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B005 - R1014 - General Storeroom (8.12 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	3453/B005/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Sheet					
	3453/B005/R1015/Floor Coverings Res/Textile/S7					No Asbestos Detected
<b>B005 - R1015 - Movement (4.6 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	3453/B005/R1015/Floor Coverings Res/Textile/S7					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	3453/B005/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B006 - General Learning/Support Unit - 1930 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	100m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B006/R0009/Ceiling Structures/Linings/S23				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Void	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	3453/B006/Underfloor Voids - Packing to Floor Joists/S28				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Underfloor Void	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	3453/B006/Underfloor Void/S29				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**Interior****B006 - R0001 - Toilet - M (6.44 m2)**

No Asbestos

**B006 - R0002 - Home Base - M (49.45 m2)**

Wall Linings Internal	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B006/R0002/Wall Linings Internal/S21				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B006/R0004/Ceiling Structures/Linings/S31				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

**B006 - R0003 - Practical Activities - M - 1hb (1.7 m2)**

No Asbestos

**B006 - R0004 - Home Base (51.34 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	52m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B006/R0004/Ceiling Structures/Linings/S31				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	30m2	South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B007/R0002/Wall Linings Internal/S20				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B006 - R0005 - General Storeroom (12.2 m2)**

No Asbestos

**B006 - R0006 - Movement (3.19 m2)**

No Asbestos

**B006 - R0007 - Staff Room Annexe (21.33 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	3453/B006/R0007/Floor Coverings Res/Textile/S24				<b>No Asbestos Detected</b>	

**B006 - R0008 - Home Base (52.92 m2)**

No Asbestos

**B006 - R0009 - Movement (22.24 m2)**

Internal Gable Ends	Flat AC Sheeting	4m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B006/R0009/Internal Gable Ends/S22				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3453/B006/R0009/Ceiling Structures/Linings/S23				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B006 - R0010 - Movement (27.54 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B007 - General Learning - 1930 - Timber (Timber)**

**Exterior**

Underfloor Void	No Asbestos Found
Ceiling Void	No Asbestos Found

**Interior**

**B007 - R0001 - General Storeroom (5.82 m2)**

No Asbestos

**B007 - R0002 - Home Base (44.33 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	45m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3453/B007/R0002/Ceiling Structures/Linings/S19				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

Wall Linings Internal	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3453/B007/R0002/Wall Linings Internal/S20				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B007 - R0003 - Home Base (44.59 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	45m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3453/B007/R0002/Ceiling Structures/Linings/S19				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

Wall Linings Internal	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3453/B007/R0002/Wall Linings Internal/S20				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B007 - R0004 - Movement (26.9 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B008 - General Learning - 2010 - Brick/Veneer (Brick/Veneer)****Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

**Interior****B008 - R0001 - Home Base (60.48 m2)**

No Asbestos

**B008 - R0002 - Home Base (60.73 m2)**

No Asbestos

**B008 - R0003 - Special Programs Room (30.28 m2)**

No Asbestos

**B008 - R0004 - Practical Activities - 1hb (19 m2)**

No Asbestos

**B008 - R0005 - Practical Activities - 1hb (19.07 m2)**

No Asbestos

**B008 - R0006 - Withdrawal Space - 2hb (13.19 m2)**

No Asbestos

**B008 - R0007 - Home Base Store (6.31 m2)**

No Asbestos

**B008 - R0008 - Home Base Store (6.22 m2)**

No Asbestos

**B008 - R0009 - Special Programs Store (6.61 m2)**

No Asbestos

**B008 - R0010 - Special Programs Store (5.66 m2)**

No Asbestos

**B008 - R0011 - Movement (6.39 m2)**

No Asbestos

**B008 - R0012 - External Movement (59.52 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017