


Asbestos Register

(Hazardous Materials and Risk Assessment)



School : Annangrove Public School (3719)
Region : Northern Sydney
State Electorate : Castle Hill
Local Government Area : The Hills

Initial Survey : Noel Arnold & Associates : 10 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 13 - Sep - 2016

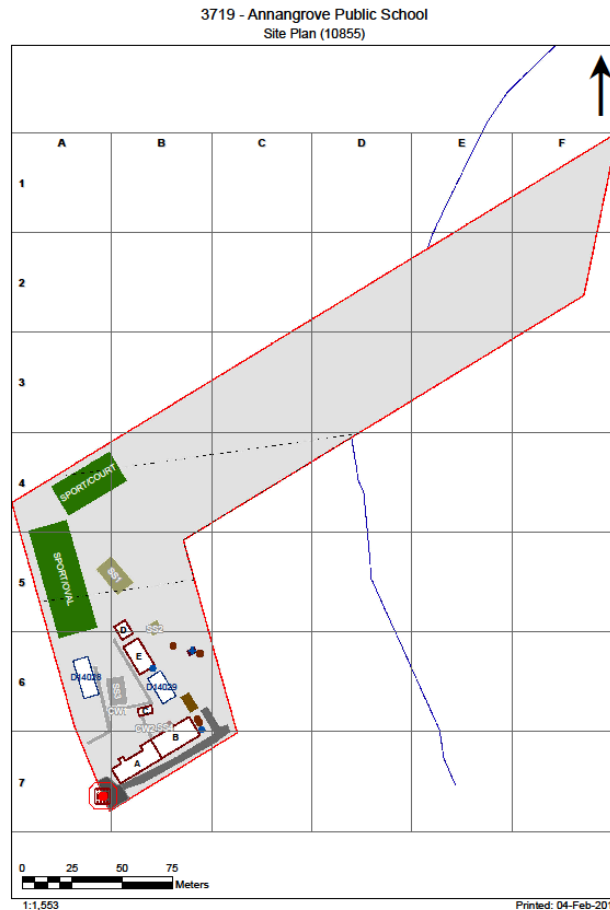

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Communal Facilities - 1969 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction >3m.					
Eaves Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3719/B00B/R1004/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)
Gable verge lining	Flat AC Sheeting	20m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Height Restriction >3m.					
Underfloor Voids	AC Fragments/Debris	NA	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	3719/B00A/Underfloor Voids/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior**B00A - R0001 - External Movement (4.41 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3719/B00B/R1004/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)

B00A - R0002 - Practical Activities - 1hb (10.8 m2)

No Asbestos

B00A - R0003 - General Storeroom (8.88 m2)

No Asbestos

B00A - R0004 - Raised Platform (24.32 m2)

No Asbestos

B00A - R0005 - Withdrawal Space - 2hb (69.36 m2)

No Asbestos

B00A - R0006 - External Movement (14.46 m2)

No Asbestos

B00A - R0007 - Home Base (57.35 m2)

No Asbestos

B00A - R0008 - Home Base Store (4.59 m2)

No Asbestos

B00A - R0009 - Personal Effects Storage (6.97 m2)

Wall Linings Internal	Flat AC Sheeting	1m2	Behind sink	Good Condition (1)	Low (1)	Low Priority (2-3)
	3719/B00A/R0009/Wall Linings Internal/S1					Chrysotile (white asbestos)

B00A - R9001 - Special Programs Room (51.56 m2)

Ceiling Structures/Linings	Flat AC Sheeting	52m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3719/B00A/R9003/Ceiling Structures/Linings/S6					Chrysotile (white asbestos) , Amosite (brown asbestos)

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	3719/B00A/R9001/Wall Linings Internal/S7					

B00A - R9002 - General Storeroom (11.31 m2)

No Asbestos

B00A - R9003 - Main Switch Board (3.42 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3719/B00A/R9003/Ceiling Structures/Linings/S6					Chrysotile (white asbestos) , Amosite (brown asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Pupil Facilities - 1969 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction >3m.					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3719/B00B/R1004/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)
Gable verge lining	Flat AC Sheeting	20m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Height Restriction >3m.					

Interior

B00B - R0001 - External Movement (20.81 m2)

No Asbestos

B00B - R0002 - Toilets - Boys (9.63 m2)

Ceiling Structures/Linings	Vermiculite 3719/B00B/R0002/Ceiling Structures/Linings/S8					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00B - R0003 - Toilets - Girls (12.04 m2)

Ceiling Structures/Linings	Vermiculite 3719/B00B/R0002/Ceiling Structures/Linings/S8					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00B - R0004 - Garden Store (15.3 m2)

Ceiling Structures/Linings	Vermiculite 3719/B00B/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00B - R0005 - P.E. Store (9.92 m2)

Ceiling Structures/Linings	Vermiculite 3719/B00B/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3719/B00B/R1003/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00B - R0006 - Toilets - Boys/Girls (3.31 m2)

Ceiling Structures/Linings	Vermiculite 3719/B00B/R0002/Ceiling Structures/Linings/S8					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00B - R0007 - Practical Activities - 1hb (15.18 m2)

Ceiling Structures/Linings	Vermiculite 3719/B00B/R0002/Ceiling Structures/Linings/S8					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3719/B00B/R1003/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00B - R0008 - Home Base Store (1.09 m2)

No Asbestos

B00B - R0009 - Home Base (81.2 m2)

Ceiling Structures/Linings	Vermiculite 3719/B00B/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00B - R0010 - External Movement (39.35 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R1001 - Staff Toilet (5.14 m2)						
No Asbestos						
B00B - R1002 - Staff Toilet (7.08 m2)						
No Asbestos						
B00B - R1003 - Craft Store (11.93 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3719/B00B/R1003/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00B - R1004 - External Movement (20.81 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3719/B00B/R1004/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
B00B - R1005 - Home Base Store (10.77 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3719/B00B/R1003/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00B - R1006 - Practical Activities - 1hb (20.51 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3719/B00B/R1003/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00B - R1007 - Home Base (58.22 m2)						
No Asbestos						
B00B - R1008 - Movement (6.4 m2)						
No Asbestos						
B00B - R1009 - Special Programs Room (15.56 m2)						
No Asbestos						
B00B - R1010 - Staff Toilet (4.09 m2)						
No Asbestos						
B00B - R1011 - Staff Toilet (3.28 m2)						
No Asbestos						
B00B - R1012 - Cleaning Distributed Store (8.11 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
3719/B00B/R1012/Floor Coverings Res/Textile/S9					No Asbestos Detected	
B00B - R1013 - External Movement (39.34 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3719/B00B/R1004/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1969 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3719/B00C/Eaves Linings/S10			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior

B00C - R0001 - Canteen Office/Store (6.37 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3719/B00C/R0001/Ceiling Structures/Linings/S5			Chrysotile (white asbestos)		

B00C - R0002 - Canteen (8.47 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3719/B00C/R0001/Ceiling Structures/Linings/S5			Chrysotile (white asbestos)		

B00C - R0003 - External Movement (8.4 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Other-Community Use - 2006 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00D - R0001 - Other-Community Use (26.42 m2)

No Asbestos

B00D - R0002 - External Movement (17.64 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library - 2009 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00E - R0001 - Reading Area (95.61 m2)

No Asbestos

B00E - R0002 - Library Office/Workroom (20.44 m2)

No Asbestos

B00E - R0003 - Communications Room (7.4 m2)

No Asbestos

B00E - R0004 - K.L.A. Store (7.7 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 502 - D14028 - Admin Staff/Principal/Clerk/Dup/Clinic : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		23.04 m2

Interior

R1 - Clerical Office

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		16 m2

R10 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos		12 m2
---------	---------------	------------------	--	-------

R2 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos		1 m2
---------	---------------	------------------	--	------

R3 - Duplicating Wookroom

Ceiling	Flat AC Sheet	Assumed Asbestos		12 m2
---------	---------------	------------------	--	-------

R4 - Clinic-Waiting

Ceiling	Flat AC Sheet	Assumed Asbestos		16 m2
---------	---------------	------------------	--	-------

R5 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos		36 m2
---------	---------------	------------------	--	-------

R6 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos		16 m2
---------	---------------	------------------	--	-------

R7 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos		2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		5 m2

R8 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos		2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		5 m2

R9 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		27 m2

OS 532 - D14029 - Library : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		17.28 m2

Interior

R1 - Reading Area

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		90 m2

R2 - Library Office/Workroom

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		10 m2

R3 - Communications Room

Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2
---------	---------------	------------------	--	------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017