


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Avalon Public School (3792)
Region : Northern Sydney
State Electorate : Pittwater
Local Government Area : Pittwater

Initial Survey : Noel Arnold & Associates : 10 - Mar - 2008
Reviewed By : AECOM : 14 - Oct - 2014

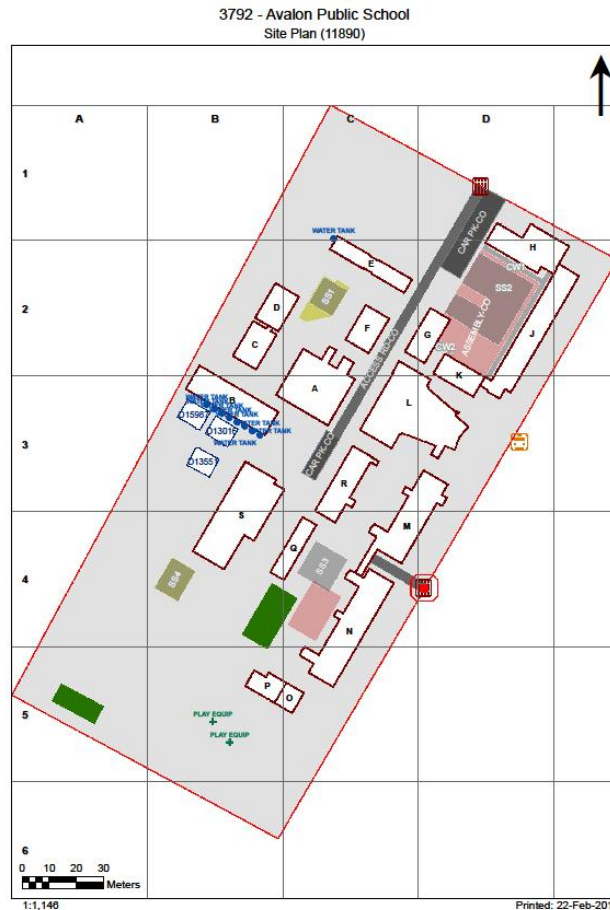

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Library - 1950 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (6-8m)						
Gable Verge Lining	Flat AC Sheeting	50m	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (6-8m)						
Underfloor Voids - Slab on Ground	Non Accessible Area - No underfloor voids identified. Building constructed slab on ground.					
Ceiling Voids	Non Accessible Area - Ceiling void generally inaccessible due to fixed ceilings and absence of designated entry points.					

Interior**B00A - R0001 - Staff Room (102.15 m2)**

Ceiling Structures/Linings	Vermiculite 3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 3792/B00A/R0006/Floor Coverings Res/Textile/S11	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0002 - Movement (2.36 m2)

No Asbestos

B00A - R0003 - Interview (12.62 m2)

Ceiling Structures/Linings	Vermiculite 3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	--

B00A - R0004 - Staff Toilet (6.56 m2)

Ceiling Structures/Linings	Vermiculite 3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	--

B00A - R0005 - Staff Toilet (9.67 m2)

Ceiling Structures/Linings	Vermiculite 3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	--

B00A - R0006 - Duplicating Workroom (12.37 m2)

Ceiling Structures/Linings	Vermiculite 3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 3792/B00A/R0006/Floor Coverings Res/Textile/S11	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0007 - Movement (3.88 m2)

No Asbestos

B00A - R0008 - Clerical Office (12.81 m2)

Ceiling Structures/Linings	Vermiculite 3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	--

B00A - R0009 - Clerical Office (12.81 m2)

Ceiling Structures/Linings	Vermiculite 3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	--

B00A - R0010 - Principal (20.73 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0011 - Sick Bay (10.98 m2)						
Ceiling Structures/Linings	Vermiculite 3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 3792/B00A/R0006/Floor Coverings Res/Textile/S11	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0012 - Deputy Principal (14.73 m2)						
Ceiling Structures/Linings	Vermiculite 3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0013 - Clerical Office (12.73 m2)						
Ceiling Structures/Linings	Vermiculite 3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0014 - Cleaning Supplies (11.44 m2)						
Ceiling Structures/Linings	Vermiculite 3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0015 - Cleaning Distributed Store (2.88 m2)						
Ceiling Structures/Linings	Vermiculite 3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0016 - Cleaning Supplies (9.18 m2)						
No Asbestos						
B00A - R0017 - General Storeroom (18.58 m2)						
No Asbestos						
B00A - R0018 - Movement (61.53 m2)						
Ceiling Structures/Linings	Vermiculite 3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 3792/B00A/R0006/Floor Coverings Res/Textile/S11	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0019 - External Movement (39.43 m2)						
Ceiling Structures/Linings	Vermiculite 3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0020 - Garden Store (7.09 m2)						
No Asbestos						
B00A - R0021 - External Stairs (5.8 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 3792/B00A/R1001/Ceiling Structures/Linings/S13	6m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0022 - Movement (3.45 m2)						
No Asbestos						
B00A - R0023 - Movement (4.11 m2)						
No Asbestos						
B00A - R0024 - Lift (2.24 m2)						
No Asbestos						
B00A - R0025 - No Access (1.11 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Non Accessible						
B00A - R1002 - Library Office/Workroom (19.45 m2)						
Ceiling Structures/Linings	Vermiculite					
	3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1003 - Security Store (13.84 m2)						
Ceiling Structures/Linings	Vermiculite					
	3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1004 - Library Office/Workroom (8.59 m2)						
Ceiling Structures/Linings	Vermiculite					
	3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1005 - K.L.A. Store (13.06 m2)						
Ceiling Structures/Linings	Vermiculite					
	3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1006 - K.L.A. Store (13.09 m2)						
Ceiling Structures/Linings	Vermiculite					
	3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1007 - Reading Area (255.07 m2)						
Ceiling Structures/Linings	Vermiculite					
	3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1008 - Cleaning Distributed Store (1.75 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3792/B00A/R1012/Wall Linings Internal/S14					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R1009 - Toilets - Girls (3.73 m2)						
Ceiling Structures/Linings	Vermiculite	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3792/B00A/R1009/Partition Walls (Cubicles)/S15					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Partition Walls (Cubicles)	Compressed AC Sheet					
	3792/B00A/R0001/Ceiling Structures/Linings/S10					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3792/B00A/R1009/Partition Walls (Cubicles)/S15					Chrysotile (white asbestos)
B00A - R1010 - Movement (10.9 m2)						
Ceiling Structures/Linings	Vermiculite					
	3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1011 - Toilets - Boys (3.9 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3792/B00A/R1009/Partition Walls (Cubicles)/S15					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet					
	3792/B00A/R0001/Ceiling Structures/Linings/S10					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	3792/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3792/B00A/R1009/Partition Walls (Cubicles)/S15					Chrysotile (white asbestos)	
B00A - R1012 - Distribution Board (1.83 m2)				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	15m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3792/B00A/R1012/Wall Linings Internal/S14					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3792/B00A/R1012/Wall Linings Internal/S14					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00A - R1013 - External Stairs (19.79 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3792/B00A/R1001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	
B00A - R1014 - External Movement (14.33 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3792/B00A/R1001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	
B00A - R1015 - Movement (16.35 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3792/B00A/R1001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	
B00A - R1016 - Special Programs Room (13.25 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3792/B00A/R1001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	
B00A - R1017 - Movement (4.09 m2)						
No Asbestos						
B00A - Room+1 - stairs						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3792/B00A/Room+1/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1950 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3792/B00B/Eaves Linings/S6					Chrysotile (white asbestos)
Underfloor Voids	AC Fragments/Debris	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	3792/B00B/Underfloor Voids/S21					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					

Interior

B00B - R0001 - Home Base (73.72 m2)

Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3792/B00B/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0002 - Withdrawal Space - 1hb (9.18 m2)

No Asbestos

B00B - R0003 - Movement (4.22 m2)

No Asbestos

B00B - R0004 - Home Base Store (10.08 m2)

No Asbestos

B00B - R0006 - Cleaning Distributed Store (2.19 m2)

No Asbestos

B00B - R0007 - Craft Store (10.4 m2)

No Asbestos

B00B - R0008 - Special Programs Room (66.64 m2)

No Asbestos

B00B - R0009 - Kiln Room (8.03 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3792/B00B/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0010 - Craft Store (8.03 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3792/B00B/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0011 - Movement (40.95 m2)

Ceiling Structures/Linings	Flat AC Sheeting	41m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3792/B00B/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

Wall Linings Internal	Flat AC Sheeting	6m2	South facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3792/B00B/R0011/Wall Linings Internal/S8					Chrysotile (white asbestos)

B00B - R0012 - Special Programs Room (40.57 m2)

No Asbestos

B00B - R0013 - Special Programs Room (39.95 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1950 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	Flat AC Sheeting	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
3792/B00B/Underfloor Voids/S21					Chrysotile (white asbestos)	

Interior

B00C - R0001 - Movement (2.34 m2)

No Asbestos

B00C - R0002 - Home Base (53.58 m2)

No Asbestos

B00C - R0003 - Home Base (53.22 m2)

No Asbestos

B00C - R0004 - Home Base Store (5.93 m2)

No Asbestos

B00C - R0005 - Movement (22.94 m2)

No Asbestos

B00C - R0006 - Home Base Store (5.91 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1950 - Steel (Steel)

Exterior

Underfloor Voids	Flat AC Sheeting	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	3792/B00B/Underfloor Voids/S21				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					

Interior

B00D - R0001 - Home Base (53.44 m2)

No Asbestos

B00D - R0002 - Home Base (53.36 m2)

No Asbestos

B00D - R0003 - Home Base Store (5.91 m2)

No Asbestos

B00D - R0004 - Movement (22.99 m2)

Infill Panel	Flat AC Sheeting	5m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled/analysed due to minimal						

B00D - R0005 - Home Base Store (5.91 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1950 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - No underfloor voids identified. Building constructed slab on ground.
Ceiling Voids	Non Accessible Area - No ceiling or ceiling void, roof only.

Interior

B00E - R0001 - Toilets - Boys (37.17 m2)

No Asbestos

B00E - R0002 - Handwashing Facilities (12.39 m2)

No Asbestos

B00E - R0003 - Drinking Facilities (18.56 m2)

No Asbestos

B00E - R0004 - Cleaning Distributed Store (7.79 m2)

No Asbestos

B00E - R0005 - Sports Store (7.75 m2)

No Asbestos

B00E - R0006 - Drinking Facilities (18.46 m2)

No Asbestos

B00E - R0007 - Handwashing Facilities (12.34 m2)

No Asbestos

B00E - R0008 - Toilets - Girls (31.3 m2)

No Asbestos

B00E - R0009 - Sports Store (5.45 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1950 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - Home Base (53.15 m2)

No Asbestos

B00F - R0002 - Home Base (53 m2)

No Asbestos

B00F - R0003 - Home Base Store (5.88 m2)

No Asbestos

B00F - R0004 - Movement (22.83 m2)

Infill Panel	Flat AC Sheeting	5m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------	------------------	-----	-------------------------------	--------------------	---------	--------------------

Assumed Asbestos - Minimal extent

B00F - R0005 - Home Base Store (5.83 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1950 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (~3m)						
Gable Verge Linings	Flat AC Sheeting	5m	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (~3m)						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - No access due limited clearance (<0.5m)					

Interior

B00G - R0001 - Home Base (57.24 m2)
No Asbestos
B00G - R0002 - Home Base Store (3.63 m2)
No Asbestos
B00G - R0003 - Personal Effects Storage (7.89 m2)
No Asbestos
B00G - R0004 - Movement (4.62 m2)
No Asbestos
B00G - R0005 - Personal Effects Storage (7.89 m2)
No Asbestos
B00G - R0006 - Home Base Store (3.63 m2)
No Asbestos
B00G - R0007 - Home Base (57.24 m2)
No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1950 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	25m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (~3m)						
Gable Verge Linings	Flat AC Sheeting	5m	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (~3m)						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - No access due low clearance (<0.5m)					

Interior

B00H - R0001 - Personal Effects Storage (9.33 m2)

No Asbestos

B00H - R0002 - Home Base Store (3.19 m2)

No Asbestos

B00H - R0003 - Home Base (58.03 m2)

No Asbestos

B00H - R0004 - Home Base (86.49 m2)

No Asbestos

B00H - R0005 - Home Base Store (3.53 m2)

No Asbestos

B00H - R0006 - Personal Effects Storage (9.76 m2)

No Asbestos

B00H - R0007 - Personal Effects Storage (4.42 m2)

No Asbestos

B00H - R0008 - Movement (8.43 m2)

No Asbestos

B00H - R0009 - Toilets - Boys/Girls (3.92 m2)

No Asbestos

B00H - R0010 - Movement (106.12 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 1950 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (~3m)						
Gable Verge Linings	Flat AC Sheeting	10m	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (~3m)						
Underfloor Voids	Non Accessible Area - No access due low clearance (<0.5m)					
Ceiling Voids	No Asbestos Found					

Interior**B00J - R0001 - Personal Effects Storage (12.22 m2)**

No Asbestos

B00J - R0002 - Home Base Store (4.14 m2)

No Asbestos

B00J - R0003 - Home Base (67.58 m2)

No Asbestos

B00J - R0004 - Home Base (57.24 m2)

No Asbestos

B00J - R0005 - Home Base Store (3.63 m2)

No Asbestos

B00J - R0006 - Personal Effects Storage (7.89 m2)

No Asbestos

B00J - R0007 - Movement (4.61 m2)

No Asbestos

B00J - R0008 - Personal Effects Storage (7.89 m2)

No Asbestos

B00J - R0009 - Home Base Store (3.63 m2)

No Asbestos

B00J - R0010 - Home Base (57.24 m2)

No Asbestos

B00J - R0011 - Home Base (57.24 m2)

No Asbestos

B00J - R0012 - Home Base Store (3.63 m2)

No Asbestos

B00J - R0013 - Personal Effects Storage (7.89 m2)

No Asbestos

B00J - R0014 - Movement (4.61 m2)

No Asbestos

B00J - R0015 - Personal Effects Storage (7.89 m2)

No Asbestos

B00J - R0016 - Home Base Store (3.63 m2)

No Asbestos

B00J - R0017 - Home Base (57.01 m2)

No Asbestos

B00J - R0018 - Sports Store (12.42 m2)

No Asbestos

B00J - R0019 - Movement (17.81 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning - 1950 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (~3m)						
Gable Verge Linings	Flat AC Sheeting	5m	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (~3m)						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00K - R0001 - Interview (20.73 m2)

No Asbestos

B00K - R0002 - Staff Toilet (4.17 m2)

No Asbestos

B00K - R0003 - Distribution Board (0.88 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3792/B00K/R0003/Ceiling Structures/Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00K - R0004 - Cleaning Distributed Store (1.97 m2)

No Asbestos

B00K - R0005 - General Storeroom (7.64 m2)

No Asbestos

B00K - R0006 - Duplicating Workroom (21.37 m2)

No Asbestos

B00K - R0007 - General Storeroom (2.6 m2)

No Asbestos

B00K - R0008 - Staff Room Annexe (24.44 m2)

No Asbestos

B00K - R0009 - Staff Toilet (3.91 m2)

No Asbestos

B00K - R0010 - Movement (37.62 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00L - Pupil Facilities - 1950 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (6-8m)						
Ceiling Voids	Remnant insulation material	NA	Structural steel framework above ceiling of LR0017.	Minimal Damage (2)	Medium (2)	Medium Priority (4-5)
	3792/B00L/Ceiling Voids/S19					Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids - Packing to Floor Joists	Packing	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	3792/B00R/Underfloor Voids - Packing to Floor Joists/S20					Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	AC Fragments/Debris	NA	Identified in areas of exposed ground surfaces (soil)	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	3792/B00B/Underfloor Voids/S21					Chrysotile (white asbestos)

Interior

B00L - M0001 - Plant (7.94 m2)

No Asbestos

B00L - R0001 - Canteen (39.87 m2)

No Asbestos

B00L - R0002 - Canteen Office/Store (6.43 m2)

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3792/B00L/R0002/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)

B00L - R0003 - Movement (3 m2)

No Asbestos

B00L - R0004 - Cleaning Distributed Store (0.72 m2)

No Asbestos

B00L - R0005 - Staff Toilet (1.37 m2)

No Asbestos

B00L - R0006 - Canteen Office/Store (4.24 m2)

No Asbestos

B00L - R0007 - Movement (3.84 m2)

No Asbestos

B00L - R0008 - Communal/Performance Store (12.37 m2)

No Asbestos

B00L - R0009 - Toilets - Girls (5.46 m2)

No Asbestos

B00L - R0010 - Toilets - Boys (5.42 m2)

No Asbestos

B00L - R0011 - Communal/Performance Store (12.47 m2)

No Asbestos

B00L - R0012 - Cleaning Distributed Store (39.46 m2)

No Asbestos

B00L - R0013 - Raised Platform (115.17 m2)

No Asbestos

B00L - R0014 - Plant (7.94 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
B00L - R0015 - Cleaning Supplies (5.66 m2)						
No Asbestos						
B00L - R0016 - Music Store (5.71 m2)						
No Asbestos						
B00L - R0017 - Communal Space (257.56 m2)						
No Asbestos						
B00L - R0018 - Movement (24.74 m2)						
No Asbestos						
B00L - R0019 - Toilets - Boys (4.77 m2)						
No Asbestos						
B00L - R0020 - Toilets - Girls (4.77 m2)						
No Asbestos						
B00L - R0021 - Movement (15.18 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3792/B00L/R0021/Ceiling Structures/Linings/S17						Chrysotile (white asbestos)
B00L - R0022 - Movement (9.59 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3792/B00L/R0021/Ceiling Structures/Linings/S17						Chrysotile (white asbestos)
B00L - R0023 - Movement (26.68 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3792/B00L/R0021/Ceiling Structures/Linings/S17						Chrysotile (white asbestos)
B00L - R0024 - Movement (1.87 m2)						
No Asbestos						
B00L - R0025 - Disabled Toilet (3.74 m2)						
No Asbestos						
B00L - R0026 - Cleaning Distributed Store (7.5 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - General Learning - 1950 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	-----------------------------	--------------------	---------	--------------------

Assumed Asbestos - Height Restriction (6-8m)

Underfloor Voids - Slab on Ground	Non Accessible Area - No underfloor voids identified. Building constructed slab on ground.
-----------------------------------	---

Ceiling Voids	No Asbestos Found
---------------	-------------------

Interior**B00M - R0001 - Deputy Principal (19.99 m2)**

No Asbestos

B00M - R0002 - Staff Toilet (3.22 m2)

No Asbestos

B00M - R0003 - Movement (7.93 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	--------------	--------------------	---------	--------------------

3792/B00M/R0009/Ceiling Structures/Linings/S1

Chrysotile (white asbestos)**B00M - R0004 - No Access (19.95 m2)**

No Asbestos

B00M - R0006 - General Storeroom (4.25 m2)

No Asbestos

B00M - R0007 - Cleaning Distributed Store (3.56 m2)

No Asbestos

B00M - R0008 - Garden Store (4.44 m2)

No Asbestos

B00M - R0009 - Movement (5.76 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	--------------	--------------------	---------	--------------------

3792/B00M/R0009/Ceiling Structures/Linings/S1

Chrysotile (white asbestos)**B00M - R0010 - Home Base (57.22 m2)**

No Asbestos

B00M - R0011 - Home Base Store (9.88 m2)

No Asbestos

B00M - R0012 - Personal Effects Storage (3.67 m2)

No Asbestos

B00M - R0013 - Personal Effects Storage (3.65 m2)

No Asbestos

B00M - R0014 - Home Base Store (9.82 m2)

No Asbestos

B00M - R0015 - Home Base (57.46 m2)

No Asbestos

B00M - R0016 - Home Base (57.22 m2)

No Asbestos

B00M - R0017 - Home Base Store (6.57 m2)

No Asbestos

B00M - R0018 - Personal Effects Storage (2.97 m2)

No Asbestos

B00M - R0019 - Movement (43.08 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
B00M - R0020 - Movement (9.25 m2)						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	3792/B00M/R0020/Wall Linings Internal/S2					
B00M - R0021 - Movement (36.76 m2)						
No Asbestos						
B00M - R0022 - Movement (2.28 m2)						
Floor Coverings Res/Textile	Backing paper/material					No Asbestos Detected
	3792/B00M/R0022/Floor Coverings Res/Textile/S22					
B00M - R0023 - Plant (0.68 m2)						
No Asbestos						
B00M - R0024 - Stairs (3.73 m2)						
No Asbestos						
B00M - R0025 - Sports Store (3.21 m2)						
No Asbestos						
B00M - R0026 - Stairs (4.62 m2)						
Wall Linings Internal	Spandrel panel(s) below window(s)	3m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3792/B00M/R1018/Wall Linings Internal/S3					Chrysotile (white asbestos)
B00M - R1001 - Cleaning Distributed Store (21.04 m2)						
No Asbestos						
B00M - R1002 - Staff Toilet (3.35 m2)						
No Asbestos						
B00M - R1003 - Other-Vacant (10.19 m2)						
No Asbestos						
B00M - R1004 - Movement (6.49 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	3792/B00M/R1017/Floor Coverings Res/Textile/S4					
B00M - R1005 - Cleaning Distributed Store (2.9 m2)						
No Asbestos						
B00M - R1006 - General Storeroom (7.25 m2)						
No Asbestos						
B00M - R1007 - Home Base (57.61 m2)						
No Asbestos						
B00M - R1008 - Home Base Store (9.83 m2)						
No Asbestos						
B00M - R1009 - Personal Effects Storage (3.62 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	3792/B00M/R1017/Floor Coverings Res/Textile/S4					
B00M - R1010 - Personal Effects Storage (3.62 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	3792/B00M/R1017/Floor Coverings Res/Textile/S4					
B00M - R1011 - Home Base Store (9.83 m2)						
No Asbestos						
B00M - R1012 - Home Base (57.61 m2)						
No Asbestos						
B00M - R1013 - Home Base (57.85 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00M - R1014 - Home Base Store (6.57 m2)

No Asbestos

B00M - R1015 - Personal Effects Storage (2.93 m2)

Floor Coverings
Res/Textile

Vinyl Tiles

3792/B00M/R1017/Floor Coverings Res/Textile/S4

No Asbestos Detected

B00M - R1016 - Movement (6.34 m2)

Wall Linings Internal

Flat AC Sheeting

3m2

North facing,
Lower portion

Good Condition (1)

Low (1) Low Priority (2-3)

3792/B00M/R1018/Wall Linings Internal/S3

Chrysotile (white asbestos)

B00M - R1017 - Movement (46.95 m2)

Floor Coverings
Res/Textile

Vinyl Tiles

3792/B00M/R1017/Floor Coverings Res/Textile/S4

No Asbestos Detected

B00M - R1018 - Movement (36.76 m2)

Wall Linings Internal

Flat AC Sheeting

12m2

East facing,
West facing,
Lower portion

Good Condition (1)

Low (1) Low Priority (2-3)

3792/B00M/R1018/Wall Linings Internal/S3

Chrysotile (white asbestos)

B00M - R1019 - Stairs (11.79 m2)

Wall Linings Internal

Spandrel panel(s) below
window(s)

2m2

Throughout

Minimal Damage (2)

Low (1) Low Priority (2-3)

3792/B00M/R1018/Wall Linings Internal/S3

Chrysotile (white asbestos)

B00M - R1020 - Stairs (11.6 m2)

Wall Linings Internal

Spandrel panel(s) below
window(s)

8m2

Throughout

Minimal Damage (2)

Low (1) Low Priority (2-3)

3792/B00M/R1018/Wall Linings Internal/S3

Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - General Learning - 1950 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (6-8m)						
Ceiling Voids - Raked Ceiling	Non Accessible Area - Ceiling void generally inaccessible due to fixed ceilings and absence of designated entry points.					
Underfloor Voids - Slab on Ground	Non Accessible Area - No underfloor voids identified. Building constructed slab on ground.					

Interior

B00N - R0001 - Uniform Shop (15.74 m2)

Floor Coverings Res/Textile	Vinyl Tiles	3792/B00M/R1017/Floor Coverings Res/Textile/S4				No Asbestos Detected	
-----------------------------	-------------	--	--	--	--	-----------------------------	--

B00N - R0002 - Withdrawal Space - 1hb (14.09 m2)

No Asbestos

B00N - R0003 - Toilets - Boys (4.13 m2)

No Asbestos

B00N - R0004 - Toilets - Girls (4.13 m2)

No Asbestos

B00N - R0005 - Movement (11.1 m2)

No Asbestos

B00N - R0006 - General Storeroom (5.2 m2)

No Asbestos

B00N - R0007 - Distribution Board (0.85 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	2Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------------------	----------------	-------	--------------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

B00N - R0008 - Cleaning Distributed Store (2.77 m2)

No Asbestos

B00N - R0009 - Movement (11.16 m2)

Wall Linings Internal	Flat AC Sheeting	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	-----	--------------	--------------------	---------	--------------------

3792/B00N/R0009/Wall Linings Internal/S5

Chrysotile (white asbestos)

B00N - R0010 - Home Base (57.62 m2)

No Asbestos

B00N - R0011 - Home Base Store (8.07 m2)

No Asbestos

B00N - R0012 - Personal Effects Storage (5.2 m2)

No Asbestos

B00N - R0013 - Home Base (57.62 m2)

No Asbestos

B00N - R0014 - Home Base Store (8.07 m2)

No Asbestos

B00N - R0015 - Personal Effects Storage (10.79 m2)

No Asbestos

B00N - R0016 - Home Base Store (8.07 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00N - R0017 - Home Base (57.62 m2)						
No Asbestos						
B00N - R0018 - Home Base (57.62 m2)						
No Asbestos						
B00N - R0019 - Home Base Store (8.18 m2)						
No Asbestos						
B00N - R0020 - Personal Effects Storage (5.29 m2)						
No Asbestos						
B00N - R0021 - Movement (72.93 m2)						
No Asbestos						
B00N - R0022 - Movement (11.14 m2)						
Wall Linings Internal	Flat AC Sheeting	4m2	North facing, South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3792/B00N/R0009/Wall Linings Internal/S5					Chrysotile (white asbestos)	
B00N - R0023 - Movement (5.86 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due limited extent. Likely						
B00N - R0024 - Garden Store (3.05 m2)						
No Asbestos						
B00N - R0025 - Stairs (3.43 m2)						
Wall Linings Internal	Flat AC Sheeting	2m2	Spandrel panels below windows	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3792/B00M/R1018/Wall Linings Internal/S3					Chrysotile (white asbestos)	
B00N - R0026 - Sports Store (5.05 m2)						
No Asbestos						
B00N - R0027 - Sports Store (5.24 m2)						
No Asbestos						
B00N - R0028 - Stairs (3.37 m2)						
Wall Linings Internal	Flat AC Sheeting	2m2	Spandrel panels below windows	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3792/B00M/R1018/Wall Linings Internal/S3					Chrysotile (white asbestos)	
B00N - R1001 - Staff Room (23.76 m2)						
No Asbestos						
B00N - R1002 - Staff Toilet (4.23 m2)						
No Asbestos						
B00N - R1003 - Cleaning Distributed Store (2.93 m2)						
No Asbestos						
B00N - R1004 - General Storeroom (1.06 m2)						
No Asbestos						
B00N - R1005 - Sick Bay (6.7 m2)						
No Asbestos						
B00N - R1006 - General Storeroom (12.55 m2)						
No Asbestos						
B00N - R1007 - Home Base (57.62 m2)						
No Asbestos						
B00N - R1008 - Home Base Store (8.29 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00N - R1009 - Personal Effects Storage (5.13 m2)						
No Asbestos						
B00N - R1010 - Home Base (57.62 m2)						
No Asbestos						
B00N - R1011 - Home Base Store (8.29 m2)						
No Asbestos						
B00N - R1012 - Personal Effects Storage (5.13 m2)						
No Asbestos						
B00N - R1013 - Home Base (57.62 m2)						
No Asbestos						
B00N - R1014 - Home Base Store (8.29 m2)						
No Asbestos						
B00N - R1015 - Personal Effects Storage (5.13 m2)						
No Asbestos						
B00N - R1016 - Home Base (57.62 m2)						
No Asbestos						
B00N - R1017 - Home Base Store (8.29 m2)						
No Asbestos						
B00N - R1018 - Personal Effects Storage (5.13 m2)						
No Asbestos						
B00N - R1019 - Movement (6.95 m2)						
Wall Linings Internal	Flat AC Sheeting	4m2	North facing, South facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3792/B00N/R0009/Wall Linings Internal/S5					Chrysotile (white asbestos)	
B00N - R1020 - Movement (81.25 m2)						
No Asbestos						
B00N - R1021 - Distribution Board (0.74 m2)						
Note: No inspection of live electrical installation.						
Electrical Mounting Board	Resinous Board	1Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00N - R1022 - Stairs (10.78 m2)						
Wall Linings Internal	Flat AC Sheeting	5m2	Spandrel panels below windows	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3792/B00M/R1018/Wall Linings Internal/S3					Chrysotile (white asbestos)	
B00N - R1023 - Stairs (12.23 m2)						
Wall Linings Internal	Flat AC Sheeting	6m2	Spandrel panels below windows	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3792/B00M/R1018/Wall Linings Internal/S3					Chrysotile (white asbestos)	
B00N - R1024 - Movement (4.89 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - General Learning - 1950 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area - Limited access due low clearance (<0.5m) however no asbestos identified.

Interior

B000 - R0001 - Practical Activities - 1hb (47.14 m2)

No Asbestos

B000 - R0002 - Movement (14.83 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Building Services - 1950 - Timber (Timber)

Exterior

Ceiling Voids	Non Accessible Area - No safe access due height (3-4m).					
Underfloor Voids	Non Accessible Area - Limited access due low clearance (<0.5m) however no asbestos identified.					
Eaves Linings	Flat AC Sheeting	10m2	North facing, south facing, west facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (~3m)						

Interior

B00P - R0001 - General Assistant/Bulk Store (47.14 m2)

No Asbestos

B00P - R0002 - Movement (14.82 m2)

No Asbestos

B00P - R0003 - Movement (32.12 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - Pupil Facilities - 1950 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - No ceiling or ceiling void, roof only.
Underfloor Voids - Slab on Ground	Non Accessible Area - No underfloor voids identified. Building constructed slab on ground.

Interior

B00Q - R0001 - Toilets - Boys (32.64 m2)

No Asbestos

B00Q - R0002 - Handwashing Facilities (12.34 m2)

No Asbestos

B00Q - R0003 - Drinking Facilities (12.34 m2)

No Asbestos

B00Q - R0004 - Drinking Facilities (12.34 m2)

No Asbestos

B00Q - R0005 - Handwashing Facilities (12.34 m2)

No Asbestos

B00Q - R0006 - Toilets - Girls (31.78 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00R - General Learning - 1942 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	50m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (~3m)						
Underfloor Voids - Packing to Floor Joists	Packing	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
3792/B00R/Underfloor Voids - Packing to Floor Joists/S20				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Non Accessible Area - Ceiling void generally inaccessible due to fixed ceilings and absence of designated entry points.					

Interior

B00R - R0001 - Movement (3.83 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3792/B00R/R0001/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)		

B00R - R0002 - Personal Effects Storage (5.88 m2)

No Asbestos

B00R - R0003 - Distribution Board (0.92 m2)

Note: No inspection of live electrical installation.

Non Accessible

B00R - R0004 - Home Base Store (6.22 m2)

No Asbestos

B00R - R0005 - Home Base (57.54 m2)

No Asbestos

B00R - R0006 - Home Base (57.54 m2)

No Asbestos

B00R - R0007 - Movement (5.93 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3792/B00R/R0001/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)		

B00R - R0008 - Movement (5.32 m2)

No Asbestos

B00R - R0009 - Personal Effects Storage (8.84 m2)

No Asbestos

B00R - R0010 - Home Base Store (6.5 m2)

No Asbestos

B00R - R0011 - Home Base Store (6.5 m2)

No Asbestos

B00R - R0012 - Home Base (56.98 m2)

No Asbestos

B00R - R9001 - General Storeroom (69.3 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00S - Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids	Non Accessible Area - No designated access point identified / slab on ground.
Ceiling Voids - Raked Ceiling	Non Accessible Area - Generally no access above fixed raked ceilings to SR0002. No asbestos identified in ceiling cavity of adjoining store.

Interior**B00S - R0001 - Covered Outdoor Learning Area (195.6 m2)**

No Asbestos

B00S - R0002 - Communal Space (293.07 m2)

No Asbestos

B00S - R0003 - P.E. Store (16.89 m2)

No Asbestos

B00S - R0004 - Communal/Performance Store (10.95 m2)

No Asbestos

B00S - R0005 - Chair Storeroom (11.16 m2)

No Asbestos

B00S - R0006 - Main Switch Board (3.23 m2)

No Asbestos

B00S - R0007 - Disabled Toilet (6.87 m2)

No Asbestos

B00S - R0008 - Cleaning Distributed Store (3.51 m2)

No Asbestos

B00S - R0009 - General Storeroom (1.6 m2)

No Asbestos

B00S - R0010 - Toilet - Lobby (3.3 m2)

No Asbestos

B00S - R0011 - Sound Cupboard (2.06 m2)

No Asbestos

B00S - R0012 - Toilets - Boys (5.71 m2)

No Asbestos

B00S - R0013 - Toilet - Lobby (2.37 m2)

No Asbestos

B00S - R0014 - Toilets - Girls (7.31 m2)

No Asbestos

B00S - R0015 - External Movement (7.6 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D13016 - Learning Unit - Standard With P.A.A. : Placement Date - 18/12/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D13551 - Learning Unit - Standard With P.A.A. : Placement Date - 4/10/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D15987 - Learning Unit - Standard With P.A.A. : Placement Date - 12/03/2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

3792_ASB_010313_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017