

Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Argenton Public School (3904)
Region : Hunter/Central Coast
State Electorate : Lake Macquarie
Local Government Area : Lake Macquarie

Initial Survey : Noel Arnold & Associates : 23 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 13 - Jun - 2015



2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Building Services - 1951 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 3904/B00C/Eaves Linings/S9					No Asbestos Detected
Electrical Backing Board	Resinous Board	1Unit	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard -Unable to sample					
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - Cleaning Distributed Store

Floor Coverings Res/Textile	Vinyl Tiles 3904/B00A/R0004/Floor Coverings Res/Textile/S1					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00A/R0004/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00A - R0002 - General Storeroom

No Asbestos

B00A - R0003 - General Storeroom

No Asbestos

B00A - R0004 - Movement

Floor Coverings Res/Textile	Vinyl Tiles 3904/B00A/R0004/Floor Coverings Res/Textile/S1					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00A/R0004/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00A - R0005 - Practical Activities - 1hb


Floor Coverings Res/Textile	Vinyl Tiles 3904/B00A/R0004/Floor Coverings Res/Textile/S1					No Asbestos Detected
-----------------------------	---	--	--	--	--	-----------------------------

B00A - R0006 - Home Base

No Asbestos

B00A - R0007 - Withdrawal Space - 1hb

Floor Coverings Res/Textile	Vinyl Tiles 3904/B00A/R0004/Floor Coverings Res/Textile/S1					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00A/R0004/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

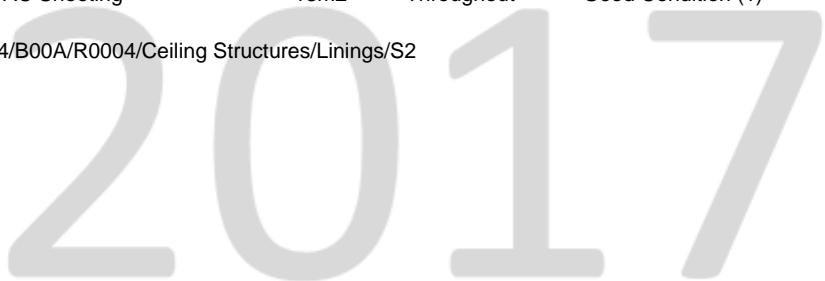

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - Administration/Library - 1951 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 3904/B00C/Eaves Linings/S9					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00B - R0002 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles 3904/B00A/R0004/Floor Coverings Res/Textile/S1					No Asbestos Detected
-----------------------------	---	--	--	--	--	-----------------------------

B00B - R0004 - Movement

Floor Coverings Res/Textile	Vinyl Tiles 3904/B00B/R0004/Floor Coverings Res/Textile/S4	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 3904/B00C/R0010/Ceiling Structures/Linings/S14	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 3904/B00B/R0007/Wall Linings Internal/S3	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0005 - Reading Area

Wall Linings Internal	Flat AC Sheeting 3904/B00B/R0005/Wall Linings Internal/S5	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 3904/B00B/R0005/Ceiling Structures/Linings/S12	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)

B00B - R0006 - Reading Area

Wall Linings Internal	Flat AC Sheeting 3904/B00B/R0005/Wall Linings Internal/S5	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 3904/B00B/R0005/Ceiling Structures/Linings/S12	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)

B00B - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3904/B00A/R0004/Ceiling Structures/Linings/S2	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 3904/B00B/R0007/Wall Linings Internal/S3	10m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0008 - Home Base

Wall Linings Internal	Flat AC Sheeting 3904/B00B/R0005/Wall Linings Internal/S5	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 3904/B00B/R0005/Ceiling Structures/Linings/S12	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)

B00B - R0009 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3904/B00A/R0004/Ceiling Structures/Linings/S2	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	------	------------	--------------------	---------	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	30m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
3904/B00B/R0007/Wall Linings Internal/S3					Chrysotile (white asbestos)	
B00B - R0010 - Sick Bay						
No Asbestos						
B00B - R0011 - General Storeroom						
No Asbestos						
B00B - R0012 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3904/B00B/R0012/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B00B - R0013 - Principal						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3904/B00C/R0010/Ceiling Structures/Linings/S14					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	9m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3904/B00B/R0012/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Staff Facilities - 1951 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 3904/B00C/Eaves Linings/S9					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00C - R0005 - Staff Room**

No Asbestos

B00C - R0006 - Staff Toilet

No Asbestos

B00C - R0007 - Staff Toilet

No Asbestos

B00C - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00A/R0004/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00C - R0009 - Movement

No Asbestos

B00C - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00C/R0010/Ceiling Structures/Linings/S14					Chrysotile (white asbestos)

B00C - R0011 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00C/R0010/Ceiling Structures/Linings/S14					Chrysotile (white asbestos)

B00C - R0012 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting	20m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00C/R0016/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)

Wall Linings Internal	Flat AC Sheeting	6m2	South-West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00C/R0016/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0013 - Home Base Store

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00C/R0016/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)

Wall Linings Internal	Flat AC Sheeting	8m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00C/R0016/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0014 - Home Base Store

Ceiling Structures/Linings	Flat AC Sheeting	5m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00C/R0016/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0015 - Practical Activities - 2hb

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00C/R0016/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0016 - Home Base

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00C/R0016/Ceiling Structures/Linings/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	90m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00C/R0016/Ceiling Structures/Linings/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00D - General Learning/Pupil Facilities - 1970 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00D/Eaves Linings/S10					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	16m2	East, West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00D/In-fill-panel/S8					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00D/R0005/Ceiling Structures/Linings/S15					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00D - R0002 - Movement

Electrical Backing Board	Resinous Board	0.5m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00D/R0002/Electrical Backing Board/S18					Chrysotile (white asbestos)

B00D - R0003 - Home Base Store

No Asbestos

B00D - R0004 - Home Base

No Asbestos

B00D - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00D/R0005/Ceiling Structures/Linings/S15					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00D - R0006 - Canteen Office/Store

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00D/R0008/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00D/R0005/Ceiling Structures/Linings/S15					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00D - R0007 - Canteen Office/Store

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00D/R0008/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00D/R0005/Ceiling Structures/Linings/S15					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00D - R0008 - Canteen

Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00D/R0008/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00D/R0005/Ceiling Structures/Linings/S15					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00D - R9001 - General Storeroom

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1960 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00E/Eaves Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00E - R0001 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00E/R0001/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00E/R0001/Partition Walls (Cubicles)/S6				Chrysotile (white asbestos)	

B00E - R0002 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00E/R0001/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3904/B00E/R0001/Partition Walls (Cubicles)/S6				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Storage - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017