


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Albury North Public School (3922)  
**Region :** Riverina  
**State Electorate :** Albury  
**Local Government Area :** Albury

**Initial Survey :** Noel Arnold & Associates : 11 - Mar - 2008  
**Reviewed By :** AECOM : 28 - Oct - 2014

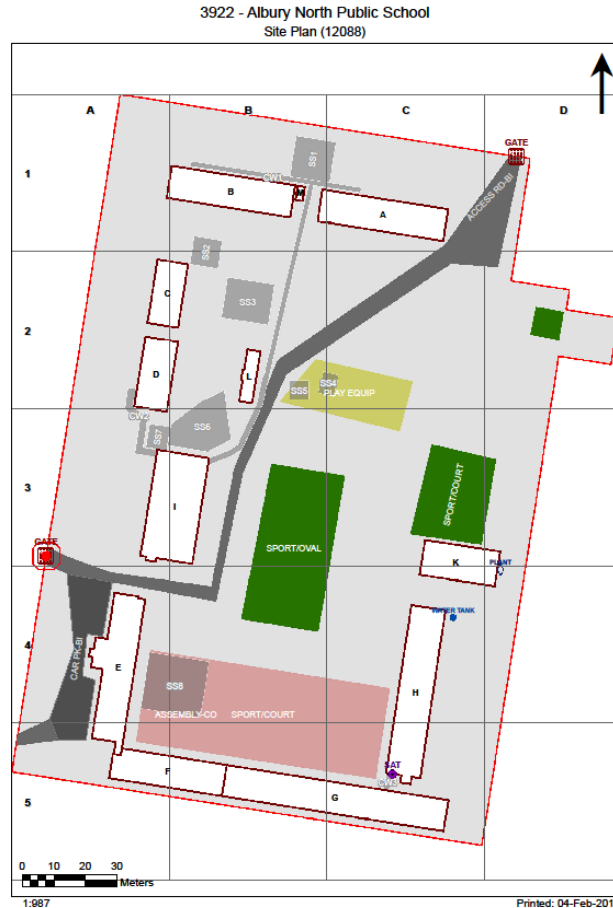

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning - 1950 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting	45m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00A/Eaves Linings/S24				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids	Non Accessible Area - Area inaccessible - no access due height (3 - 3.5 m) and size/location of manhole.					
Underfloor Voids	Non Accessible Area - Area inaccessible - clearance approximately 20 cm, no designated access point identified.					
Underfloor Voids	Kickboards to verandah					<b>No Asbestos Detected</b>
	3922/B00G/Underfloor Voids/S26					

**Interior****B00A - R0001 - Home Base**

No Asbestos

**B00A - R0002 - Home Base**

No Asbestos

**B00A - R0003 - Home Base**

No Asbestos

**B00A - R0004 - Home Base**

No Asbestos

**B00A - R0005 - Practical Activities - 1hb**

No Asbestos

**B00A - R0006 - Toilets - Boys/Girls**

Wall Linings Internal	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00A/R0006/Wall Linings Internal/S14				<b>Chrysotile (white asbestos)</b>	

**B00A - R0007 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting	2.07m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00A/Eaves Linings/S24				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00A - R0008 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	78m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Ceiling Structures/Linings/S11				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

Wall Linings Internal	Flat AC Sheeting	4m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Wall Linings Internal/S12				<b>Chrysotile (white asbestos)</b>	

Floor Coverings Res/Textile	Compressed AC Sheet					
	3922/B00A/R0008/Floor Coverings Res/Textile/S13				<b>No Asbestos Detected</b>	

**B00A - R0009 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting	4.32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00A/Eaves Linings/S24				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00B - General Learning - 1950 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	45m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Ceiling Structures/Linings/S11			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids	Non Accessible Area - Area inaccessible - no access due height (3 - 3.5 m) and size/location of manhole.					
Underfloor Voids	Non Accessible Area - Area inaccessible - clearance approximately 20 cm.					

**Interior**

**B00B - R0001 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Wall Linings Internal/S12			<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Ceiling Structures/Linings/S11			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00B - R0002 - Staff Room**

Wall Linings Internal	Flat AC Sheeting	35m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Wall Linings Internal/S12			<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Ceiling Structures/Linings/S11			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00B - R0003 - Home Base**

Wall Linings Internal	Flat AC Sheeting	50m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Wall Linings Internal/S12			<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Ceiling Structures/Linings/S11			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00B - R0004 - Home Base**

Ceiling Structures/Linings	Flat AC Sheeting	54m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Ceiling Structures/Linings/S11			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Wall Linings Internal	Flat AC Sheeting	55m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Wall Linings Internal/S12			<b>Chrysotile (white asbestos)</b>		

**B00B - R0005 - Staff Room Annexe**

Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Ceiling Structures/Linings/S11			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Wall Linings Internal	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Wall Linings Internal/S12			<b>Chrysotile (white asbestos)</b>		

**B00B - R0006 - Sports Store**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Ceiling Structures/Linings/S11			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Wall Linings Internal	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Wall Linings Internal/S12			<b>Chrysotile (white asbestos)</b>		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
<b>B00B - R0007 - Home Base</b>						
Ceiling Structures/Linings	Flat AC Sheeting	54m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Ceiling Structures/Linings/S11			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Wall Linings Internal	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Wall Linings Internal/S12			<b>Chrysotile (white asbestos)</b>		
<b>B00B - R0008 - Home Base</b>						
Ceiling Structures/Linings	Flat AC Sheeting	54m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Ceiling Structures/Linings/S11			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Wall Linings Internal	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Wall Linings Internal/S12			<b>Chrysotile (white asbestos)</b>		
<b>B00B - R0009 - General Storeroom</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Ceiling Structures/Linings/S11			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Wall Linings Internal	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Wall Linings Internal/S12			<b>Chrysotile (white asbestos)</b>		
<b>B00B - R0010 - General Storeroom</b>						
Ceiling Structures/Linings	Flat AC Sheeting	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Ceiling Structures/Linings/S11			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Wall Linings Internal	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Wall Linings Internal/S12			<b>Chrysotile (white asbestos)</b>		
<b>B00B - R0011 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	81m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Ceiling Structures/Linings/S11			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Wall Linings Internal	Flat AC Sheeting	50m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Wall Linings Internal/S12			<b>Chrysotile (white asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Other-After School Care - 1927 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	Non Accessible Area - Area inaccessible - height approximately 6 m.
Underfloor Voids	Non Accessible Area - Area inaccessible - clearance approximately 20 - 30 cm.

**Interior**

**B00C - R0001 - No Access**

No Asbestos

**B00C - R0004 - Out Of School Hours Care Centre**

Bag rack lining	Flat AC Sheeting 3922/B00C/R0004/Bag rack lining/S10	<b>No Asbestos Detected</b>
-----------------	---	-----------------------------

**B00C - R0005 - No Access**

No Asbestos

**B00C - R0009 - Out Of School Hours Care Centre**

No Asbestos

**B00C - R0010 - Clerical Office/Workroom**

No Asbestos

**B00C - R0011 - Movement**

No Asbestos

**B00C - R0012 - Special Programs Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning - 1970 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00E/R0001/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>
Underfloor Voids	Non Accessible Area - Area inaccessible - access point bolted shut with metal sheet. Clearance approximately 30 - 40 cm.					
Ceiling Voids	Flat AC Sheeting	1m2	Ceiling access hatch in DR0008.	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3922/B00D/Ceiling Voids/S21					<b>Chrysotile (white asbestos)</b>

**Interior****B00D - R0001 - General Storeroom**

Window sealant	Mastic					<b>No Asbestos Detected</b>
	3922/B00D/R0001/Window sealant/S22					
Sound damping to base of sink	Mastic	1Unit	Base of sink	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Inaccessible due to fixed cabinetry.</b>					
Black adhesive to masonite below blue vinyl floor sheeting.	Flooring adhesive					<b>No Asbestos Detected</b>
	3922/B00D/R0011/Black adhesive layer to masonite below blue vinyl floor sheeting./S23					

**B00D - R0002 - Home Base Store**

No Asbestos

**B00D - R0003 - Home Base**

No Asbestos

**B00D - R0004 - Home Base**

No Asbestos

**B00D - R0005 - Home Base Store**

No Asbestos

**B00D - R0006 - Personal Effects Storage**

No Asbestos

**B00D - R0007 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	41m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00E/R0001/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>
Infill panels below and above window	Flat AC Sheeting	26m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00D/R0007/Infill panels below and above window/S9					<b>Chrysotile (white asbestos)</b>

**B00D - R0008 - Personal Effects Storage**

No Asbestos

**B00D - R0009 - Cleaning Supplies**

Window putty/sealant	Mastic					<b>No Asbestos Detected</b>
	3922/B00D/R0001/Window sealant/S22					

**B00D - R0010 - No Access**

No Asbestos

**B00D - R0011 - Movement**

Black adhesive layer to masonite below blue vinyl floor sheeting.	Flooring adhesive					<b>No Asbestos Detected</b>
	3922/B00D/R0011/Black adhesive layer to masonite below blue vinyl floor sheeting./S23					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Administration - 1956 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00E/R0001/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	Non Accessible Area - Area inaccessible - height 3m and restricted space to set up ladder safely in ER0024.					
Underfloor Voids	Non Accessible Area - Area inaccessible - 30-40 cm clearance.					
Underfloor Voids	Verge treads to verandah					<b>No Asbestos Detected</b>
	3922/B00F/Underfloor Voids/S27					
Underfloor Voids	Kickboards to verandah					<b>No Asbestos Detected</b>
	3922/B00G/Underfloor Voids/S26					

**Interior**

**B00E - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	124m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00E/R0001/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>
Wall Linings Internal	Flat AC Sheeting	3m2	South facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3922/B00E/R0002/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Compressed AC Sheet					
	3922/B00A/R0008/Floor Coverings Res/Textile/S13					<b>No Asbestos Detected</b>

**B00E - R0002 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00E/R0002/Partition Walls (Cubicles)/S2					<b>Chrysotile (white asbestos)</b>
Wall Linings Internal	Flat AC Sheeting	4m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00E/R0002/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>

**B00E - R0003 - Cleaning Supplies**

No Asbestos

**B00E - R0004 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00E/R0002/Partition Walls (Cubicles)/S2					<b>Chrysotile (white asbestos)</b>
Wall Linings Internal	Flat AC Sheeting	4m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00E/R0002/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>

**B00E - R0005 - Staff Room**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	3922/B00E/R0007/Wall Linings Internal/S1					

**B00E - R0006 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	3922/B00E/R0007/Wall Linings Internal/S1					

**B00E - R0007 - Staff Shower/Change**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	3922/B00E/R0007/Wall Linings Internal/S1					

**B00E - R0008 - Sick Bay**

No Asbestos

**B00E - R0009 - Interview**

No Asbestos

**B00E - R0010 - Distribution Board**

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3922/B00E/R0002/Wall Linings Internal/S3					Chrysotile (white asbestos)	
<b>B00E - R0011 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3922/B00E/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	
<b>B00E - R0012 - General Storeroom</b>						
No Asbestos						
<b>B00E - R0014 - Cleaning Supplies</b>						
No Asbestos						
<b>B00E - R0015 - Security Store</b>						
No Asbestos						
<b>B00E - R0016 - Staff Room Annexe</b>						
No Asbestos						
<b>B00E - R0017 - Movement</b>						
No Asbestos						
<b>B00E - R0018 - Principal</b>						
No Asbestos						
<b>B00E - R0019 - Staff Room Annexe</b>						
No Asbestos						
<b>B00E - R0020 - Clerical Office</b>						
No Asbestos						
<b>B00E - R0022 - Movement</b>						
No Asbestos						
<b>B00E - R0023 - Duplicating Workroom</b>						
No Asbestos						
<b>B00E - R0024 - No Access</b>						
No Asbestos						
<b>B00E - R0025 - External Movement</b>						
No Asbestos						
<b>B00E - R0026 - General Storeroom</b>						
No Asbestos						
<b>B00E - R0027 - Staff Toilet</b>						
No Asbestos						
<b>B00E - R0028 - Entry Vestibule</b>						
No Asbestos						
<b>B00E - R0029 - Clerical Office</b>						
No Asbestos						

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Special Purpose - 1956 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00F/R0002/Ceiling Structures/Linings/S19			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids	Ceiling access hatch in FR0011					<b>No Asbestos Detected</b>
	3922/B00F/Ceiling Voids/S25					
Underfloor Voids	Kickboards to verandah					<b>No Asbestos Detected</b>
	3922/B00G/Underfloor Voids/S26					
Underfloor Voids	Verge treads to verandah					<b>No Asbestos Detected</b>
	3922/B00F/Underfloor Voids/S27					
Underfloor Voids	Non Accessible Area					
	- Area inaccessible - clearance approximately 20 cm.					

**Interior**

**B00F - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	18m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00B/R0011/Ceiling Structures/Linings/S11			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00F - R0002 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	76m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00F/R0002/Ceiling Structures/Linings/S19			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	3922/B00F/R0002/Wall Linings Internal/S20					

**B00F - R0003 - Entry Vestibule**

No Asbestos

**B00F - R0004 - Clerical Office**

No Asbestos

**B00F - R0005 - General Storeroom**

No Asbestos

**B00F - R0006 - Staff Toilet**

No Asbestos

**B00F - R0007 - Home Base**

No Asbestos

**B00F - R0008 - Home Base**

No Asbestos

**B00F - R0009 - Garden Store**

Expansion gap material to concrete floor	Mastic					<b>No Asbestos Detected</b>
	3922/B00F/R0009/Expansion gap material to concrete floor/S28					

**B00F - R0010 - Staff Room Annexe**

No Asbestos

**B00F - R0011 - Movement**

No Asbestos

**B00F - R0012 - Staff Room Annexe**

No Asbestos

**B00F - R0013 - Staff Room Annexe**

No Asbestos

**B00F - R0014 - Staff Room Annexe**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning/Library - 1962 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting 3922/B00J/Eaves Linings/S16	45m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Underfloor Voids	Kickboards to verandah 3922/B00F/Underfloor Voids/S27					<b>No Asbestos Detected</b>
Underfloor Voids	Verge treads to verandah 3922/B00A/R0008/Floor Coverings Res/Textile/S13					<b>No Asbestos Detected</b>
Underfloor Voids	Non Accessible Area - Area inaccessible - clearance approximately 20 cm.					
Ceiling Voids	Non Accessible Area - Area inaccessible - approximately 3.5 m height in GR0011.					

**Interior****B00G - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting 3922/B00B/R0011/Ceiling Structures/Linings/S11	166m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Floor Coverings	Compressed AC Sheet 3922/B00A/R0008/Floor Coverings Res/Textile/S13					<b>No Asbestos Detected</b>

**B00G - R0002 - Home Base**

No Asbestos

**B00G - R0003 - Sports Store**

No Asbestos

**B00G - R0004 - General Storeroom**

No Asbestos

**B00G - R0005 - Special Programs Room**

No Asbestos

**B00G - R0006 - Plant**

No Asbestos

**B00G - R0007 - Communications Room**

No Asbestos

**B00G - R0008 - Reading Area**

No Asbestos

**B00G - R0009 - Library Office/Workroom**

No Asbestos

**B00G - R0010 - General Storeroom**

Wall Linings Internal	Flat AC Sheeting 3922/B00G/R0010/Wall Linings Internal/S17	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
-----------------------	---	-----	--------------	--------------------	---------	--

**B00G - R0011 - Home Base**

No Asbestos

**B00G - R0012 - Home Base Store**

No Asbestos

**B00G - R0013 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles 3922/B00G/R0013/Floor Coverings Res/Textile/S18					<b>No Asbestos Detected</b>
-----------------------------	--	--	--	--	--	-----------------------------

**B00G - R0014 - General Storeroom**

No Asbestos

**B00G - R0015 - Home Base**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00G - R0016 - General Storeroom</b>						
No Asbestos						
<b>B00G - R0017 - Deputy Principal</b>						
No Asbestos						
<b>B00G - R0018 - Entry Vestibule</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - General Learning/Pupil Facilities - 1966 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00J/Eaves Linings/S16				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
In-fill panels above windows	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00D/R0007/Infill panels below and above window/S9				<b>Chrysotile (white asbestos)</b>	
Underfloor Voids	Non Accessible Area - Area inaccessible - 30-40cm clearance.					
Ceiling Voids	No Asbestos Found					

**Interior**

**B00H - R0001 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00E/R0002/Partition Walls (Cubicles)/S2				<b>Chrysotile (white asbestos)</b>	

**B00H - R0002 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3922/B00E/R0002/Partition Walls (Cubicles)/S2				<b>Chrysotile (white asbestos)</b>	

**B00H - R0003 - Home Base**

No Asbestos

**B00H - R0004 - Withdrawal Space - 1hb**

No Asbestos

**B00H - R0005 - Home Base Store**

No Asbestos

**B00H - R0006 - Home Base Store**

No Asbestos

**B00H - R0007 - Home Base**

No Asbestos

**B00H - R0008 - Home Base**

No Asbestos

**B00H - R0009 - Withdrawal Space - 1hb**

No Asbestos

**B00H - R0010 - Home Base Store**

No Asbestos

**B00H - R0011 - Home Base Store**

No Asbestos

**B00H - R0012 - Home Base**

No Asbestos

**B00H - R0013 - Movement**

No Asbestos

**B00H - R0014 - Staff Room Annexe**

No Asbestos

**B00H - R0015 - Distribution Board**

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting					
	3922/B00I/R0010/Wall Linings Internal/S5				<b>No Asbestos Detected</b>	

**B00H - R0016 - Cleaning Supplies**

No Asbestos

**B00H - R0017 - Toilets - Boys/Girls**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3922/B00H/R0017/Partition Walls (Cubicles)/S29					<b>Chrysotile (white asbestos)</b>	
Incinerette	Millboard	1Unit	Enclosed within unit	Minimal Damage (2)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Area inaccessible - material enclosed</b>						

**B00H - R0018 - Toilets - Boys/Girls**

Non Accessible

**B00H - R0019 - General Assistant/Bulk Store**

No Asbestos

**B00H - R0020 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	127m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3922/B00B/R0011/Ceiling Structures/Linings/S11					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00H - R0021 - Toilets - Boys/Girls**

Non Accessible

**B00H - R0022 - Kiln Room**

Non Accessible

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - Communal Facilities - 1983 - Brick/Veneer (Brick/Veneer)****Exterior**

Wall Cladding	Flat AC Sheeting 3922/B00I/R0022/Wall Linings Internal/S7					No Asbestos Detected
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible - generally fixed and/or raked ceilings.					
Underfloor Voids - Slab on Ground						

**Interior****B00I - R0001 - Movement**

Wall Linings Internal	Flat AC Sheeting 3922/B00I/R0022/Wall Linings Internal/S7					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

**B00I - R0002 - Toilets - Girls**

Wall Linings Internal	Flat AC Sheeting 3922/B00I/R0010/Wall Linings Internal/S5					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 3922/B00I/R0010/Ceiling Structures/Linings/S6					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 3922/B00I/R0002/Partition Walls (Cubicles)/S8	9m2	All surfaces	Good Condition (1)	Low (1) Low Priority (2-3)	Chrysotile (white asbestos)

**B00I - R0003 - Hall Chair Store**

No Asbestos

**B00I - R0004 - Shower/Change**

Wall Linings Internal	Flat AC Sheeting 3922/B00I/R0010/Wall Linings Internal/S5					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 3922/B00I/R0010/Ceiling Structures/Linings/S6					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 3922/B00I/R0002/Partition Walls (Cubicles)/S8	2m2	All surfaces	Good Condition (1)	Low (1) Low Priority (2-3)	Chrysotile (white asbestos)

**B00I - R0005 - Plant**

Wall Linings Internal	Flat AC Sheeting 3922/B00I/R0010/Wall Linings Internal/S5					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 3922/B00I/R0010/Ceiling Structures/Linings/S6					No Asbestos Detected

**B00I - R0006 - Cleaning Supplies**

Ceiling Structures/Linings	Flat AC Sheeting 3922/B00I/R0010/Ceiling Structures/Linings/S6					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 3922/B00I/R0010/Wall Linings Internal/S5					No Asbestos Detected

**B00I - R0007 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 3922/B00I/R0010/Ceiling Structures/Linings/S6					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 3922/B00I/R0010/Wall Linings Internal/S5					No Asbestos Detected

**B00I - R0008 - Movement**

Wall Linings Internal	Flat AC Sheeting 3922/B00I/R0022/Wall Linings Internal/S7					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

**B00I - R0009 - Movement**

Wall Linings Internal	Flat AC Sheeting 3922/B00I/R0010/Wall Linings Internal/S5					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 3922/B00I/R0010/Ceiling Structures/Linings/S6					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00I - R0010 - Distribution Board</b>						
Note: No inspection of live electrical installation.						
Wall Linings Internal	Flat AC Sheeting 3922/B00I/R0010/Wall Linings Internal/S5					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 3922/B00I/R0010/Ceiling Structures/Linings/S6					No Asbestos Detected
<b>B00I - R0011 - Shower/Change</b>						
Wall Linings Internal	Flat AC Sheeting 3922/B00I/R0010/Wall Linings Internal/S5					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 3922/B00I/R0010/Ceiling Structures/Linings/S6					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 3922/B00I/R0002/Partition Walls (Cubicles)/S8	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00I - R0012 - Toilets - Boys</b>						
Wall Linings Internal	Flat AC Sheeting 3922/B00I/R0010/Wall Linings Internal/S5					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 3922/B00I/R0010/Ceiling Structures/Linings/S6					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 3922/B00I/R0002/Partition Walls (Cubicles)/S8	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00I - R0013 - Hall Chair Store</b>						
No Asbestos						
<b>B00I - R0014 - Raised Platform</b>						
No Asbestos						
<b>B00I - R0015 - Communal Space</b>						
No Asbestos						
<b>B00I - R0016 - P.E. Store</b>						
Ceiling Structures/Linings	Flat AC Sheeting 3922/B00I/R0010/Ceiling Structures/Linings/S6					No Asbestos Detected
<b>B00I - R0017 - Sports Store</b>						
Ceiling Structures/Linings	Flat AC Sheeting 3922/B00I/R0010/Ceiling Structures/Linings/S6					No Asbestos Detected
<b>B00I - R0018 - Uniform Shop</b>						
Ceiling Structures/Linings	Flat AC Sheeting 3922/B00I/R0010/Ceiling Structures/Linings/S6					No Asbestos Detected
<b>B00I - R0019 - General Storeroom</b>						
Ceiling Structures/Linings	Flat AC Sheeting 3922/B00I/R0010/Ceiling Structures/Linings/S6					No Asbestos Detected
<b>B00I - R0020 - Canteen</b>						
Ceiling Structures/Linings	Flat AC Sheeting 3922/B00I/R0010/Ceiling Structures/Linings/S6					No Asbestos Detected
<b>B00I - R0021 - Disabled Toilet</b>						
Ceiling Structures/Linings	Flat AC Sheeting 3922/B00I/R0010/Ceiling Structures/Linings/S6					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 3922/B00I/R0010/Wall Linings Internal/S5					No Asbestos Detected
<b>B00I - R0022 - Movement</b>						
Wall Linings Internal	Flat AC Sheeting 3922/B00I/R0022/Wall Linings Internal/S7					No Asbestos Detected
<b>B00I - R0023 - Main Switch Board</b>						
Electrical Backing Board	Resinous Board	1Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos - Live electrical board - electrical risk</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Library - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

No Asbestos

**Interior**

**B00K - R0001 - Reading Area**

No Asbestos

**B00K - R0002 - Library Office/Workroom**

No Asbestos

**B00K - R0003 - Communications Room**

No Asbestos

**B00K - R0004 - K.L.A. Store**

No Asbestos

**B00K - R0005 - External Movement**

No Asbestos

**B00K - R0006 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00K - R0007 - Toilet - Lobby**

No Asbestos

**B00K - R0008 - Cleaning Distributed Store**

No Asbestos

**B00K - R0009 - Staff Toilet**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

No Asbestos

**Interior**

**B00L - R0001 - Toilets - Girls**

No Asbestos

**B00L - R0002 - External Movement**

No Asbestos

**B00L - R0003 - Access Shower/Toilet/Change**

No Asbestos

**B00L - R0004 - Plant**

No Asbestos

**B00L - R0005 - Toilets - Boys**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Pupil Facilities - 1950 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B00M - R0001 - Drinking Facilities**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017