


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Albion Park Rail Public School (4121)
Region : Illawarra and South East
State Electorate : Kiama
Local Government Area : Shellharbour

Initial Survey : Noel Arnold & Associates : 04 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 15 - Feb - 2017

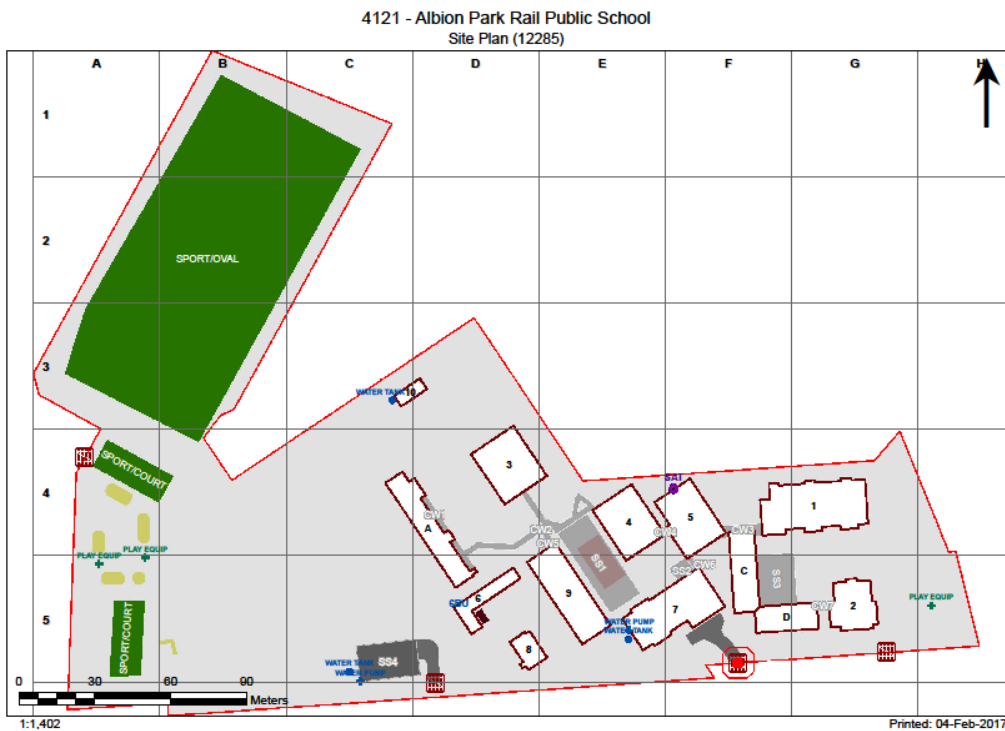

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - General Learning/Tiered Learning - 1978 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 4121/B004/R0013/Ceiling Structures/Linings/S11					No Asbestos Detected
Gable Verge Lining	Flat AC Sheeting	44m2	East, West, Upper portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Not sampled due to height					
Wall Cladding	Flat AC Sheeting 4121/B004/Wall Cladding/S13					No Asbestos Detected

Interior

B001 - R0001 - External Movement (8.12 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4121/B004/R0013/Ceiling Structures/Linings/S11					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B001 - R0002 - Home Base (60 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4121/B007/R0010/Floor Coverings Res/Textile/S14					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B001 - R0003 - Withdrawal Space - 1hb (12.74 m2)

No Asbestos

B001 - R0004 - Home Base Store (5.85 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4121/B007/R0010/Floor Coverings Res/Textile/S14					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B001 - R0005 - Sports Store (6.97 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4121/B007/R0010/Floor Coverings Res/Textile/S14					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B001 - R0006 - Kiln Room (3.18 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4121/B007/R0010/Floor Coverings Res/Textile/S14					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B001 - R0007 - Practical Activities - 1hb (24.73 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4121/B007/R0010/Floor Coverings Res/Textile/S14					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B001 - R0008 - Personal Effects Storage (2.12 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4121/B007/R0010/Floor Coverings Res/Textile/S14					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B001 - R0009 - Toilets - Boys (8.67 m2)

Partition Walls (Cubicles)	Flat AC Sheeting	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4121/B004/R0008/Partition Walls (Cubicles)/S12 Chrysotile (white asbestos)					

B001 - R0010 - Toilets - Girls (8.63 m2)

Partition Walls (Cubicles)	Flat AC Sheeting	10m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4121/B004/R0008/Partition Walls (Cubicles)/S12 Chrysotile (white asbestos)					

B001 - R0011 - Practical Activities - 1hb (19.54 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	4121/B007/R0010/Floor Coverings Res/Textile/S14				No Asbestos Detected	
B001 - R0012 - General Storeroom (18 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	4121/B007/R0010/Floor Coverings Res/Textile/S14				No Asbestos Detected	
B001 - R0013 - Practical Activities - 1hb (25.08 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	4121/B007/R0010/Floor Coverings Res/Textile/S14				No Asbestos Detected	
B001 - R0014 - General Storeroom (5.64 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	4121/B007/R0010/Floor Coverings Res/Textile/S14				No Asbestos Detected	
B001 - R0015 - Special Programs Room (41.05 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	4121/B007/R0010/Floor Coverings Res/Textile/S14				No Asbestos Detected	
B001 - R0016 - General Storeroom (5 m2)						
No Asbestos						
B001 - R0017 - Withdrawal Space - 1hb (8.88 m2)						
No Asbestos						
B001 - R0018 - Home Base (61.87 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	4121/B007/R0010/Floor Coverings Res/Textile/S14				No Asbestos Detected	
B001 - R0019 - Home Base Store (5.71 m2)						
No Asbestos						
B001 - R0020 - External Movement (15.65 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	4121/B004/R0013/Ceiling Structures/Linings/S11				No Asbestos Detected	
B001 - R0021 - Personal Effects Storage (1.78 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	4121/B007/R0010/Floor Coverings Res/Textile/S14				No Asbestos Detected	
B001 - R0022 - Cleaning Distributed Store (1.18 m2)						
No Asbestos						
B001 - R0023 - Personal Effects Storage (1.75 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	4121/B007/R0010/Floor Coverings Res/Textile/S14				No Asbestos Detected	
B001 - R0024 - Home Base Store (5.71 m2)						
No Asbestos						
B001 - R0025 - Home Base (60.84 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	4121/B007/R0010/Floor Coverings Res/Textile/S14				No Asbestos Detected	
B001 - R0026 - Withdrawal Space - 1hb (12.74 m2)						
No Asbestos						
B001 - R0027 - Home Base (60.77 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	4121/B007/R0010/Floor Coverings Res/Textile/S14				No Asbestos Detected	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B001 - R0028 - Home Base Store (5.71 m2)						
No Asbestos						
B001 - R0029 - External Movement (15.65 m2)						
Ceiling Structures/Linings	Flat AC Sheeting		4121/B004/R0013/Ceiling Structures/Linings/S11			No Asbestos Detected
B001 - R0030 - Personal Effects Storage (1.76 m2)						
Floor Coverings Res/Textile	Vinyl Tiles		4121/B007/R0010/Floor Coverings Res/Textile/S14			No Asbestos Detected
B001 - R0031 - Distribution Board (1.18 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B001 - R0032 - Personal Effects Storage (1.75 m2)						
Floor Coverings Res/Textile	Vinyl Tiles		4121/B007/R0010/Floor Coverings Res/Textile/S14			No Asbestos Detected
B001 - R0033 - Home Base (59.38 m2)						
Floor Coverings Res/Textile	Vinyl Tiles		4121/B007/R0010/Floor Coverings Res/Textile/S14			No Asbestos Detected
B001 - R0034 - Home Base Store (5.61 m2)						
Floor Coverings Res/Textile	Vinyl Tiles		4121/B007/R0010/Floor Coverings Res/Textile/S14			No Asbestos Detected
B001 - R0035 - External Movement (10.7 m2)						
Ceiling Structures/Linings	Flat AC Sheeting		4121/B004/R0013/Ceiling Structures/Linings/S11			No Asbestos Detected
B001 - R0036 - External Movement (10.67 m2)						
Ceiling Structures/Linings	Flat AC Sheeting		4121/B004/R0013/Ceiling Structures/Linings/S11			No Asbestos Detected
B001 - R0037 - External Movement (16.22 m2)						
Ceiling Structures/Linings	Flat AC Sheeting		4121/B004/R0013/Ceiling Structures/Linings/S11			No Asbestos Detected
B001 - R0038 - Movement (85.46 m2)						
Floor Coverings Res/Textile	Vinyl Tiles		4121/B007/R0010/Floor Coverings Res/Textile/S14			No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B002 - General Learning - 1978 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting					No Asbestos Detected
	4121/B004/R0013/Ceiling Structures/Linings/S11					
Gable Verge Lining	Flat AC Sheeting	40m2	East, West, Upper portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Not sampled due to height					
Wall Cladding	Flat AC Sheeting					No Asbestos Detected
	4121/B004/Wall Cladding/S13					

Interior

B002 - R0001 - External Movement (8.14 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	4121/B004/R0013/Ceiling Structures/Linings/S11					
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	4121/B004/Wall Cladding/S13					

B002 - R0002 - Home Base (60.22 m2)

No Asbestos

B002 - R0003 - Withdrawal Space - 1hb (12.53 m2)

No Asbestos

B002 - R0004 - Home Base Store (5.76 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	4121/B007/R0010/Floor Coverings Res/Textile/S14					

B002 - R0005 - General Storeroom (6.72 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	4121/B007/R0010/Floor Coverings Res/Textile/S14					

B002 - R0006 - Personal Effects Storage (3.63 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	4121/B007/R0010/Floor Coverings Res/Textile/S14					

B002 - R0007 - Movement (43.11 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	4121/B007/R0010/Floor Coverings Res/Textile/S14					

B002 - R0008 - Practical Activities - 1hb (29.8 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	4121/B007/R0010/Floor Coverings Res/Textile/S14					

B002 - R0009 - Withdrawal Space - 1hb (8.87 m2)

No Asbestos

B002 - R0010 - Toilets - Girls (3.43 m2)

Partition Walls (Cubicles)	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4121/B004/R0008/Partition Walls (Cubicles)/S12					Chrysotile (white asbestos)

B002 - R0011 - Distribution Board (0.92 m2)

Note: No inspection of live electrical installation.

No Asbestos

B002 - R0012 - Toilets - Boys (3.81 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
4121/B004/R0008/Partition Walls (Cubicles)/S12					Chrysotile (white asbestos)	

B002 - R0013 - Personal Effects Storage (3.56 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
4121/B007/R0010/Floor Coverings Res/Textile/S14					No Asbestos Detected	

B002 - R0014 - Home Base (60.18 m2)

No Asbestos

B002 - R0015 - Home Base Store (5.81 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
4121/B007/R0010/Floor Coverings Res/Textile/S14					No Asbestos Detected	

B002 - R0016 - External Movement (8.05 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
4121/B004/R0013/Ceiling Structures/Linings/S11					No Asbestos Detected	

Wall Linings Internal	Flat AC Sheeting					
4121/B004/Wall Cladding/S13					No Asbestos Detected	

B002 - R0017 - External Movement (19.5 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
4121/B004/R0013/Ceiling Structures/Linings/S11					No Asbestos Detected	

B002 - R0018 - External Movement (4.41 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
4121/B004/R0013/Ceiling Structures/Linings/S11					No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B003 - General Learning - 1974 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	36m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Not sampled due to height

Interior

B003 - R0001 - External Movement (43.78 m2)

Ceiling Structures/Linings	Flat AC Sheeting	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4121/B003/R0018/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	

B003 - R0002 - Toilets - Boys (8.23 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	North	Minimal Damage (2)	Low (1)	Low Priority (2-3)
4121/B003/R0013/Partition Walls (Cubicles)/S9					Chrysotile (white asbestos)	

B003 - R0003 - Toilets - Girls (8.34 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	North	Minimal Damage (2)	Low (1)	Low Priority (2-3)
4121/B003/R0013/Partition Walls (Cubicles)/S9					Chrysotile (white asbestos)	

B003 - R0004 - Staff Room Annexe (5.96 m2)

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4121/B003/R0004/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)	

B003 - R0005 - Movement (14.41 m2)

Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4121/B003/R0004/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)	

B003 - R0006 - Practical Activities - 1hb (18.23 m2)

No Asbestos

B003 - R0007 - Home Base (52.5 m2)

No Asbestos

B003 - R0008 - Home Base (52.42 m2)

No Asbestos

B003 - R0009 - Practical Activities - 1hb (18.07 m2)

No Asbestos

B003 - R0011 - Distribution Board (0.29 m2)

Note: No inspection of live electrical installation.

No Asbestos

B003 - R0012 - Toilets - Girls (8.35 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
4121/B003/R0013/Partition Walls (Cubicles)/S9					Chrysotile (white asbestos)	

B003 - R0014 - Practical Activities - 1hb (18.58 m2)

No Asbestos

B003 - R0015 - Home Base (52.41 m2)

No Asbestos

B003 - R0016 - Home Base (52.41 m2)

No Asbestos

B003 - R0017 - Practical Activities - 1hb (18.17 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B003 - R0018 - External Movement (43.3 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4121/B003/R0018/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B003 - R0019 - Movement (9.47 m2)						
No Asbestos						
B003 - R0020 - Movement (4.93 m2)						
No Asbestos						
B003 - R0021 - Disabled Shower/Toilet (12.94 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B004 - Library - 1978 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting					No Asbestos Detected
	4121/B004/R0013/Ceiling Structures/Linings/S11					
Gable Verge Lining	Flat AC Sheeting	40m2	North, South, Upper portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Not sampled due to height					
Wall Cladding	Flat AC Sheeting					No Asbestos Detected
	4121/B004/Wall Cladding/S13					

Interior

B004 - R0001 - Reading Area (164.06 m2)						
No Asbestos						
B004 - R0002 - Security Store (12.63 m2)						
No Asbestos						
B004 - R0003 - Library Office/Workroom (21.68 m2)						
No Asbestos						
B004 - R0004 - Library Office/Workroom (9.07 m2)						
No Asbestos						
B004 - R0005 - Cleaning Distributed Store (1.33 m2)						
No Asbestos						
B004 - R0006 - Distribution Board (1.29 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B004 - R0007 - Movement (12.98 m2)						
No Asbestos						
B004 - R0008 - Toilets - Girls (3.1 m2)						
Partition Walls (Cubicles)	Flat AC Sheeting	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4121/B004/R0008/Partition Walls (Cubicles)/S12					Chrysotile (white asbestos)
B004 - R0009 - Toilets - Boys (3.11 m2)						
Partition Walls (Cubicles)	Flat AC Sheeting	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4121/B004/R0008/Partition Walls (Cubicles)/S12					Chrysotile (white asbestos)
B004 - R0010 - Reading Area (88.03 m2)						
No Asbestos						
B004 - R0011 - Seminar/Study (14.29 m2)						
No Asbestos						
B004 - R0012 - Seminar/Study (14.11 m2)						
No Asbestos						
B004 - R0013 - External Movement (69.32 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	4121/B004/R0013/Ceiling Structures/Linings/S11					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B005 - Administration - 1978 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 4121/B004/R0013/Ceiling Structures/Linings/S11					No Asbestos Detected
Gable Verge Lining	Flat AC Sheeting	26m2	North, South, Upper portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to height						
Wall Cladding	Flat AC Sheeting 4121/B004/Wall Cladding/S13					No Asbestos Detected

Interior

B005 - R0001 - External Movement (99.44 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4121/B004/R0013/Ceiling Structures/Linings/S11					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B005 - R0002 - Deputy Principal (12.89 m2)

No Asbestos

B005 - R0003 - Entry Vestibule (22.9 m2)

No Asbestos

B005 - R0004 - Deputy Principal (12.89 m2)

No Asbestos

B005 - R0005 - Interview (12.17 m2)

No Asbestos

B005 - R0006 - Sick Bay (15.72 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4121/B007/R0010/Floor Coverings Res/Textile/S14					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B005 - R0007 - Staff Toilet (2.36 m2)

No Asbestos

B005 - R0008 - Uniform Shop (6.76 m2)

No Asbestos

B005 - R0009 - Movement (26.22 m2)

No Asbestos

B005 - R0010 - Security Store (11.35 m2)

No Asbestos

B005 - R0011 - Staff Room (62.81 m2)

No Asbestos

B005 - R0012 - Movement (16.21 m2)

No Asbestos

B005 - R0013 - Staff Toilet (5.57 m2)

Partition Walls (Cubicles)	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
4121/B004/R0008/Partition Walls (Cubicles)/S12						Chrysotile (white asbestos)

B005 - R0014 - Disabled Toilet (2.7 m2)

Partition Walls (Cubicles)	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
4121/B004/R0008/Partition Walls (Cubicles)/S12						Chrysotile (white asbestos)

B005 - R0015 - Staff Toilet (6.21 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
4121/B004/R0008/Partition Walls (Cubicles)/S12					Chrysotile (white asbestos)	

B005 - R0016 - Movement (6.48 m2)

No Asbestos

B005 - R0017 - Clerical Office/Workroom (32.07 m2)

No Asbestos

B005 - R0018 - Clerical Office (15.91 m2)

No Asbestos

B005 - R0019 - Clerical Office (8.52 m2)

No Asbestos

B005 - R0020 - Principal (19.82 m2)

No Asbestos

B005 - R0021 - Cleaning Supplies (7.66 m2)

No Asbestos

B005 - R0022 - Main Switch Board (9.87 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B006 - Pupil Facilities - 1962 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	28m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4121/B006/Eaves Linings/S2					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	30m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Not sampled due to height					

Interior

B006 - R0001 - General Storeroom (1.58 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4121/B006/R0010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B006 - R0002 - General Storeroom (20.02 m2)

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4121/B006/R0010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B006 - R0003 - Garden Store (9.42 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4121/B006/R0010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B006 - R0004 - General Assistant/Bulk Store (18.8 m2)

Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4121/B006/R0010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B006 - R0005 - General Storeroom (6.74 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4121/B006/R0010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B006 - R0006 - Toilets - Girls (12.24 m2)

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4121/B006/R0010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B006 - R0007 - Toilets - Boys (19.55 m2)

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4121/B006/R0010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B006 - R0008 - Toilets - Girls (32.64 m2)

Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4121/B006/R0010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

Wall Linings Internal	Flat AC Sheeting	4m2	Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4121/B006/R0010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B006 - R0009 - Staff Toilet (3.1 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4121/B006/R0010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B006 - R0010 - Toilets - Boys (29.82 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4121/B006/R0010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	4m2	Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4121/B006/R0010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B006 - R0011 - Staff Toilet (2.99 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4121/B006/R0010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	2m2	Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4121/B006/R0010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B007 - Pupil Facilities/Communal Facilities - 1978 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	28m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to height						
Wall Cladding	Flat AC Sheeting 4121/B004/Wall Cladding/S13	No Asbestos Detected				

Interior

B007 - R0001 - External Movement (83.41 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4121/B004/R0013/Ceiling Structures/Linings/S11	No Asbestos Detected				
----------------------------	--	-----------------------------	--	--	--	--

B007 - R0002 - Toilets - Girls (8.7 m2)

Partition Walls (Cubicles)	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
4121/B004/R0008/Partition Walls (Cubicles)/S12 Chrysotile (white asbestos)						

B007 - R0003 - Canteen (45.74 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4121/B007/R0010/Floor Coverings Res/Textile/S14	No Asbestos Detected				
-----------------------------	--	-----------------------------	--	--	--	--

B007 - R0004 - Canteen Office/Store (4.86 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4121/B007/R0010/Floor Coverings Res/Textile/S14	No Asbestos Detected				
-----------------------------	--	-----------------------------	--	--	--	--

B007 - R0005 - Canteen Office/Store (9.76 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4121/B007/R0010/Floor Coverings Res/Textile/S14	No Asbestos Detected				
-----------------------------	--	-----------------------------	--	--	--	--

B007 - R0006 - Staff Toilet (3.75 m2)

No Asbestos

B007 - R0007 - Toilets - Boys (7.82 m2)

Partition Walls (Cubicles)	Flat AC Sheeting	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
4121/B004/R0008/Partition Walls (Cubicles)/S12 Chrysotile (white asbestos)						

B007 - R0008 - General Storeroom (11.6 m2)

No Asbestos

B007 - R0009 - Movement (14.02 m2)

No Asbestos

B007 - R0010 - General Storeroom (28.9 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4121/B007/R0010/Floor Coverings Res/Textile/S14	No Asbestos Detected				
-----------------------------	--	-----------------------------	--	--	--	--

B007 - R0011 - Cleaning Distributed Store (1.68 m2)

No Asbestos

B007 - R0012 - Distribution Board (1.2 m2)

Note: No inspection of live electrical installation.

No Asbestos

B007 - R0013 - General Storeroom (10.08 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4121/B007/R0010/Floor Coverings Res/Textile/S14	No Asbestos Detected				
-----------------------------	--	-----------------------------	--	--	--	--

B007 - R0014 - Raised Platform (53.94 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B007 - R0015 - Hall Chair Store (9.06 m2)

No Asbestos

B007 - R0016 - P.E. Store (13.03 m2)

No Asbestos

B007 - R0017 - Communal Space (243.24 m2)

No Asbestos

B007 - R0018 - Cleaning Supplies (8.58 m2)

No Asbestos

B007 - R0019 - External Movement (8.4 m2)

Ceiling Structures/Linings Flat AC Sheeting
4121/B004/R0013/Ceiling Structures/Linings/S11

No Asbestos Detected

B007 - R0020 - External Movement (8.37 m2)

Ceiling Structures/Linings Flat AC Sheeting
4121/B004/R0013/Ceiling Structures/Linings/S11

No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B008 - Other-Community Use - 2006 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B008 - R0001 - Schools As Community Centres Program (43.37 m2)

No Asbestos

B008 - R0002 - Schools As Community Centres Program (9.95 m2)

No Asbestos

B008 - R0003 - Schools As Community Centres Program (6.37 m2)

No Asbestos

B008 - R0004 - Schools As Community Centres Program (8.8 m2)

No Asbestos

B008 - R0005 - Schools As Community Centres Program (5.08 m2)

No Asbestos

B008 - R0006 - Schools As Community Centres Program (3.04 m2)

No Asbestos

B008 - R0007 - Movement (3.66 m2)

No Asbestos

B008 - R0008 - Disabled Toilet (5.15 m2)

No Asbestos

B008 - R0009 - External Movement (22.07 m2)

No Asbestos

B008 - R0010 - External Movement (3.23 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B009 - General Learning/Pupil Facilities - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B009 - R0001 - External Movement (105.67 m2)

No Asbestos

B009 - R0002 - Practical Activities - 1hb (19.27 m2)

No Asbestos

B009 - R0003 - Home Base Store (6.29 m2)

No Asbestos

B009 - R0004 - Home Base (61.19 m2)

No Asbestos

B009 - R0005 - Withdrawal Space - 2hb (11.78 m2)

No Asbestos

B009 - R0006 - Practical Activities - 1hb (19.15 m2)

No Asbestos

B009 - R0007 - Home Base (60.9 m2)

No Asbestos

B009 - R0008 - Home Base Store (6.28 m2)

No Asbestos

B009 - R0009 - Home Base Store (6.29 m2)

No Asbestos

B009 - R0010 - Practical Activities - 1hb (19.18 m2)

No Asbestos

B009 - R0011 - Home Base (61.04 m2)

No Asbestos

B009 - R0012 - Withdrawal Space - 2hb (11.78 m2)

No Asbestos

B009 - R0013 - Practical Activities - 1hb (19.26 m2)

No Asbestos

B009 - R0014 - Home Base (61.17 m2)


No Asbestos

B009 - R0015 - Home Base Store (6.32 m2)

No Asbestos

B009 - R0016 - Access Shower/Toilet/Change (20.3 m2)

No Asbestos

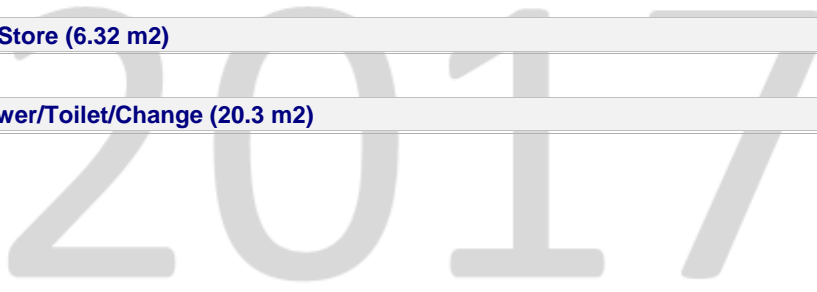

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1959 - Timber (Timber)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	60m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to height						
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to height						

Interior**B00A - R0001 - Home Base (61.85 m2)**

No Asbestos

B00A - R0002 - Practical Activities - 1hb (14.32 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4121/B00A/R0017/Floor Coverings Res/Textile/S3					No Asbestos Detected

B00A - R0003 - Movement (5.53 m2)

No Asbestos

B00A - R0006 - Practical Activities - 1hb (14.89 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4121/B00A/R0017/Floor Coverings Res/Textile/S3					No Asbestos Detected

B00A - R0007 - Home Base (57.65 m2)

No Asbestos

B00A - R0008 - Home Base (44.82 m2)

No Asbestos

B00A - R0009 - Practical Activities - 1hb (13.3 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4121/B00A/R0017/Floor Coverings Res/Textile/S3					No Asbestos Detected

B00A - R0010 - Home Base Store (6.05 m2)

No Asbestos

B00A - R0011 - Movement (6.64 m2)

Wall Linings Internal	Flat AC Sheeting					
	4121/B00A/R0011/Wall Linings Internal/S4					No Asbestos Detected

B00A - R0012 - General Storeroom (9.2 m2)

Wall Linings Internal	Flat AC Sheeting					
	4121/B00A/R0011/Wall Linings Internal/S4					No Asbestos Detected

B00A - R0013 - Practical Activities - 1hb (14.28 m2)

No Asbestos

B00A - R0014 - Home Base Store (5.71 m2)

No Asbestos

B00A - R0015 - Home Base (42.9 m2)

No Asbestos

B00A - R0018 - Home Base Store (7.07 m2)

No Asbestos

B00A - R0019 - Movement (3.32 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0021 - External Movement (3.6 m2)						
No Asbestos						
B00A - R0022 - External Movement (9.2 m2)						
No Asbestos						
B00A - R0023 - External Movement (17.41 m2)						
No Asbestos						
B00A - R0024 - Communications Cupboard (1.94 m2)						
No Asbestos						
B00A - R0025 - Distribution Board (0.8 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00A - R0026 - Special Programs Room (57.25 m2)						
No Asbestos						
B00A - R0027 - Home Base Store (4.29 m2)						
No Asbestos						
B00A - R0028 - Withdrawal Space - 2hb (8.61 m2)						
No Asbestos						
B00A - R0029 - Home Base Store (4.29 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1974 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to height						
In-fill-panel	Flat AC Sheeting	12m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
4121/B00C/In-fill-panel/S16					Chrysotile (white asbestos)	

Interior

B00C - R0001 - External Movement (90.01 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4121/B003/R0018/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	

B00C - R0002 - Toilets - Girls (10.69 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
4121/B00C/R0002/Partition Walls (Cubicles)/S15					Chrysotile (white asbestos)	

B00C - R0003 - Toilets - Boys (0.78 m2)						
No Asbestos						

B00C - R0004 - Cleaning Distributed Store (12.38 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
4121/B00C/R0002/Partition Walls (Cubicles)/S15					Chrysotile (white asbestos)	

B00C - R0005 - Practical Activities - 1hb (14.18 m2)						
No Asbestos						

B00C - R0006 - Toilets - Boys/Girls (2.97 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4121/B003/R0004/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)	

B00C - R0007 - Home Base (75.55 m2)						
No Asbestos						

B00C - R0008 - Home Base (51.51 m2)						
No Asbestos						

B00C - R0009 - Practical Activities - 1hb (18.33 m2)						
No Asbestos						

B00C - R0010 - Staff Room Annexe (8.86 m2)						
No Asbestos						

B00C - R0011 - Distribution Board (0.17 m2)				Note: No inspection of live electrical installation.		
No Asbestos						

B00C - R0012 - Withdrawal Space - 1hb (13.76 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1968 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	24m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to height						
Underfloor Voids	Flat AC Sheeting	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4121/B00D/Underfloor Voids/S19					Chrysotile (white asbestos)
Debris beside building D	AC Fragments/Debris	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4121/B00D/Debris beside building D/S20					Chrysotile (white asbestos)

Interior

B00D - R0001 - External Movement (59.75 m2)

Ceiling Structures/Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4121/B00D/R0001/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

B00D - R0002 - Home Base (57.25 m2)

Ceiling Structures/Linings	Vermiculite	58m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to students and staff						

B00D - R0003 - Home Base Store (4.78 m2)

No Asbestos

B00D - R0004 - Distribution Board (1.04 m2)

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	6m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4121/B00D/R0004/Wall Linings Internal/S17					Chrysotile (white asbestos)

B00D - R0005 - Personal Effects Storage (4.05 m2)

No Asbestos

B00D - R0006 - Movement (7.12 m2)

Ceiling Structures/Linings	Vermiculite	8m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to staff and students						

B00D - R0007 - General Storeroom (3.91 m2)

No Asbestos

B00D - R0008 - Home Base (57.33 m2)

Ceiling Structures/Linings	Vermiculite	58m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to staff and students						

B00D - R0009 - Home Base Store (5.97 m2)

No Asbestos

B00D - R0010 - Toilets - Girls (8.57 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4121/B00C/R0002/Partition Walls (Cubicles)/S15					Chrysotile (white asbestos)

B00D - R0011 - Staff Toilet (2.61 m2)

No Asbestos

B00D - R0012 - Toilets - Boys (11.85 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4121/B00C/R0002/Partition Walls (Cubicles)/S15					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - R0013 - Cleaning Distributed Store (0.8 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B010 - Storage - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B010 - R0001 - Sports Store (13.03 m2)

No Asbestos

B010 - R0002 - General Assistant/Bulk Store (16.26 m2)

No Asbestos

B010 - R0003 - Garden Store (12.92 m2)

No Asbestos

B010 - R0004 - External Movement (13.62 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017