


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Armidale High School (8102)
Region : New England
State Electorate : Northern Tablelands
Local Government Area : Armidale Dumaresq

Initial Survey : Noel Arnold & Associates : 16 - Dec - 2009
Reviewed By : Greencap-NAA : 01 - Apr - 2015

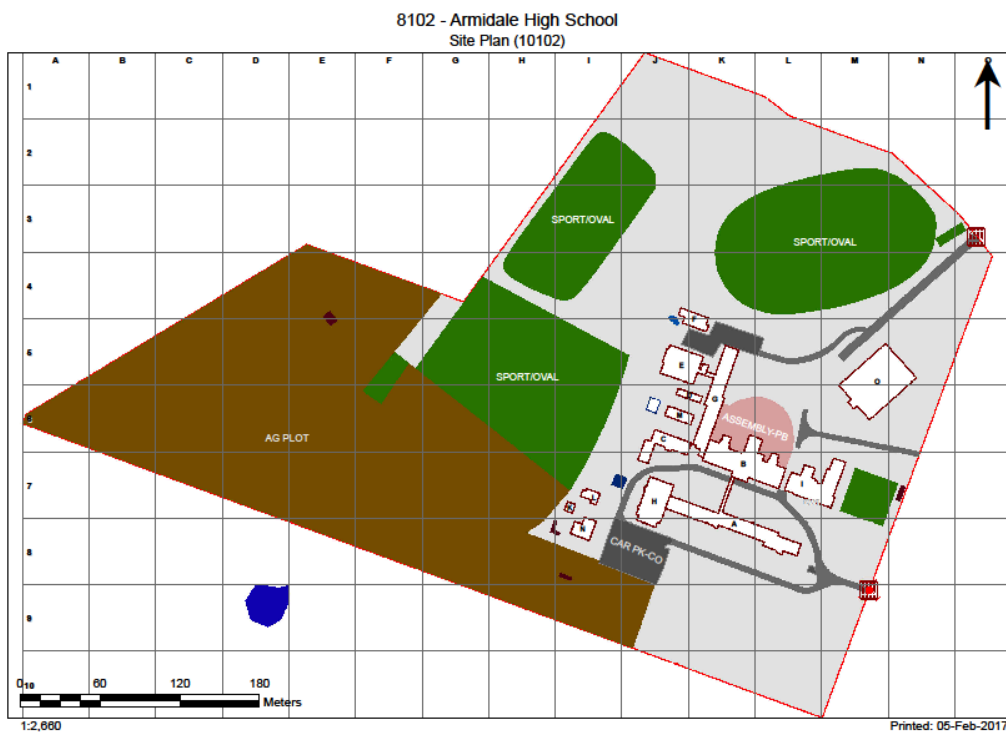

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1922 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Extreme Access Issue - No Access Point into ceiling void identified					
Wall Cladding	Flat AC Sheeting	120m2	throughout R0042 walkway	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8102/B00A/Wall Cladding/S44				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - No Access Point into ceiling void identified					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00A - R0003 - Interview/Office - Type 1 (7.68 m2)

No Asbestos

B00A - R0004 - Staff - Toilet (7.39 m2)

No Asbestos

B00A - R0005 - Staff Study (10.21 m2)

No Asbestos

B00A - R0006 - Pupil Entry (11.05 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8102/B00A/R0041/Floor Coverings Res/Textile/S12				No Asbestos Detected
-----------------------------	---	---	--	--	--	-----------------------------

B00A - R0008 - Clinic - Boys (10.09 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8102/B00A/R0008/Floor Coverings Res/Textile/S14				No Asbestos Detected
-----------------------------	-------------	---	--	--	--	-----------------------------

B00A - R0009 - Movement (5.55 m2)

No Asbestos

B00A - R0010 - Administration - Clerical (20.8 m2)

No Asbestos

B00A - R0011 - Administration - Clerical (19.15 m2)

No Asbestos

B00A - R0012 - Staff - Toilet (4.58 m2)

No Asbestos

B00A - R0013 - General Storeroom (2.18 m2)

No Asbestos

B00A - R0014 - Main Switchroom (2.68 m2)

Electrical Backing Board	Resinous Board	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B00A - R0017 - General Learning Space (52.99 m2)

Ceiling Structures/Linings	Vermiculite	8102/B00A/R0030/Decorative Coating/S9				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0018 - General Learning Space (52.19 m2)

Ceiling Structures/Linings	Vermiculite	8102/B00A/R0030/Decorative Coating/S9				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0019 - Ancillary Staff (25.84 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8102/B00A/R0030/Decorative Coating/S9				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00A - R0020 - Duplicating Workroom (25.88 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00A/R0030/Decorative Coating/S9				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8102/B00A/R0041/Floor Coverings Res/Textile/S12				No Asbestos Detected	
B00A - R0021 - General Learning Space (64.44 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00A/R0030/Decorative Coating/S9				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00A - R0022 - Cleaning Store - Distributed (0.66 m2)						
No Asbestos						
B00A - R0023 - Pupil Entry (8.1 m2)						
No Asbestos						
B00A - R0024 - Staff Study (13.28 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00A/R0030/Decorative Coating/S9				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00A - R0025 - Staff Study (12.81 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00A/R0030/Decorative Coating/S9				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00A - R0026 - Stage (25.51 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00A/R0030/Decorative Coating/S9				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00A - R0027 - Performance Workspace (105.57 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00A/R0030/Decorative Coating/S9				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00A - R0028 - Staff Study (19.31 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00A/R0030/Decorative Coating/S9				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8102/B00A/R0042/Floor Coverings Res/Textile/S13				No Asbestos Detected	
B00A - R0029 - Cleaning Store - Distributed (5.95 m2)						
No Asbestos						
B00A - R0031 - Toilets-Girls (25.33 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet 8102/B00A/R0031/Partition Walls (Cubicles)/S8	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0032 - Movement (1.94 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8102/B00A/Wall Cladding/S44	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0034 - General Learning Space (51.18 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00A/R0030/Decorative Coating/S9				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0035 - Deputy Principal Office (26.25 m2)						
Ceiling Structures/Linings	Vermiculite					
	8102/B00A/R0030/Decorative Coating/S9					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0036 - Commonroom (9.55 m2)						
No Asbestos						
B00A - R0037 - Clinic - Girls (11.91 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8102/B00A/R0041/Floor Coverings Res/Textile/S12					No Asbestos Detected
B00A - R0038 - Principal Office (27.82 m2)						
No Asbestos						
B00A - R0039 - Staff Kitchen (3.57 m2)						
No Asbestos						
B00A - R0040 - Staff - Toilet (1.64 m2)						
No Asbestos						
B00A - R0041 - Movement (255.27 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8102/B00A/R0041/Floor Coverings Res/Textile/S12					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8102/B00A/R0030/Decorative Coating/S9					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Electrical Backing Board	Resinous Board	1Unit	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00A - R0042 - Movement (56.14 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8102/B00A/R0042/Floor Coverings Res/Textile/S13					No Asbestos Detected
B00A - R0043 - Toilets-Boys (19.24 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00A/R0031/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8102/B00A/R0030/Decorative Coating/S9					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0044 - Toilets-Disabled (4.24 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00A/R0031/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8102/B00A/R0030/Decorative Coating/S9					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0045 - Store (1.45 m2)						
No Asbestos						
B00A - R0046 - Other (4.12 m2)						
No Asbestos						
B00A - R0047 - Stairs (9.15 m2)						
No Asbestos						
B00A - R1001 - General Storeroom (5.81 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8102/B00A/R1007/Floor Coverings Res/Textile/S15					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1002 - Cleaning Store - Distributed (5.86 m2)						
No Asbestos						
B00A - R1003 - General Learning Space (67.09 m2)						
Floor Coverings Res/Textile	Vinyl Sheet under carpet					
		8102/B00A/R1018/Floor Coverings Res/Textile/S56				No Asbestos Detected
B00A - R1004 - General Learning Space (52.98 m2)						
Floor Coverings Res/Textile	Vinyl Sheet under carpet					
		8102/B00A/R1018/Floor Coverings Res/Textile/S56				No Asbestos Detected
B00A - R1005 - General Learning Space (53.06 m2)						
Floor Coverings Res/Textile	Vinyl Sheet under carpet					
		8102/B00A/R1018/Floor Coverings Res/Textile/S56				No Asbestos Detected
B00A - R1006 - General Storeroom (6.59 m2)						
No Asbestos						
B00A - R1007 - General Storeroom (6.53 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
		8102/B00A/R1007/Floor Coverings Res/Textile/S15				No Asbestos Detected
B00A - R1008 - General Learning Space (65.53 m2)						
Floor Coverings Res/Textile	Vinyl Sheet under carpet					
		8102/B00A/R1018/Floor Coverings Res/Textile/S56				No Asbestos Detected
B00A - R1010 - General Storeroom (0.87 m2)						
No Asbestos						
B00A - R1011 - Staff - Toilet (5.49 m2)						
No Asbestos						
B00A - R1015 - Music Learning Space (67.16 m2)						
Floor Coverings Res/Textile	Vinyl Sheet under carpet					
		8102/B00A/R1018/Floor Coverings Res/Textile/S56				No Asbestos Detected
B00A - R1016 - Music Store (11.04 m2)						
No Asbestos						
B00A - R1017 - Staff Study (10.95 m2)						
No Asbestos						
B00A - R1018 - Music Learning Space (136.2 m2)						
Floor Coverings Res/Textile	Vinyl Sheet under carpet					
		8102/B00A/R1018/Floor Coverings Res/Textile/S56				No Asbestos Detected
B00A - R1019 - Music Store (11.27 m2)						
No Asbestos						
B00A - R1020 - Movement (32.15 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
		8102/B00A/R1007/Floor Coverings Res/Textile/S15				No Asbestos Detected
B00A - R1021 - Staff Study (44.18 m2)						
Floor Coverings Res/Textile	Vinyl Sheet under carpet					
		8102/B00A/R1018/Floor Coverings Res/Textile/S56				No Asbestos Detected
B00A - R1022 - Staff Study (2.77 m2)						
Floor Coverings Res/Textile	Vinyl Sheet under carpet					
		8102/B00A/R1018/Floor Coverings Res/Textile/S56				No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1023 - Movement (120.28 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)		8102/B00A/R0008/Floor Coverings Res/Textile/S14			No Asbestos Detected
B00A - R1024 - Other (14.16 m2)						
No Asbestos						
B00A - R1025 - Stairs (13.23 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Computer Learning/General Learning - 1968 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	North and South Ground Floor Entrance	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00B/R0002/Ceiling Structures/Linings/S39				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	8m2	External walls to Building R 002	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00B/In-fill-panel/S38				Chrysotile (white asbestos) , Amosite (brown asbestos)	
In-fill-panel	Flat AC Sheeting	10m2	North Entrance under Window	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00B/Panels Under Windows/S41				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	8m2	To building R0026	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00B/In-fill-panel/S38				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor Voids	No Asbestos Found					
Ceiling Voids	Lagging	50m	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
	Assumed Asbestos - No access to ceiling space height					

Interior

B00B - R0001 - Student Drinking Facilities (11.46 m2)

No Asbestos

B00B - R0002 - Sport Equipment Store (12.32 m2)

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00B/R0002/Ceiling Structures/Linings/S39				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	8m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00B/R0002/Wall Linings Internal/S40				Chrysotile (white asbestos)	

B00B - R0004 - Cleaning Supplies Store (17.16 m2)

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Height Restriction					

B00B - R0005 - Movement (23.35 m2)

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Height Restriction					

B00B - R0006 - Special Learning Space (41.37 m2)

Chalk Board	Flat AC Sheeting	8102/B00B/R0008/Chalk Board/S37				No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8102/B00B/R1014/Floor Coverings Res/Textile/S18				No Asbestos Detected	

B00B - R0007 - General Learning Space (55.3 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8102/B00B/R1014/Floor Coverings Res/Textile/S18				No Asbestos Detected	
-----------------------------	---	---	--	--	--	-----------------------------	--

B00B - R0008 - General Learning Space (55.22 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8102/B00B/R1014/Floor Coverings Res/Textile/S18				No Asbestos Detected	
-----------------------------	---	---	--	--	--	-----------------------------	--

B00B - R0009 - Security Store (12.5 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0010 - Deputy Principal Office (19.64 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8102/B00B/R1014/Floor Coverings Res/Textile/S18					No Asbestos Detected
B00B - R0011 - Staff Study (24.31 m2)						
No Asbestos						
B00B - R0012 - Administration - Clerical (15.68 m2)						
No Asbestos						
B00B - R0013 - Movement (18.11 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00B/R0002/Ceiling Structures/Linings/S39					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	3m2	West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00B/R0013/Wall Linings Internal/S36					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0014 - General Learning Space (55.07 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8102/B00B/R1014/Floor Coverings Res/Textile/S18					No Asbestos Detected
B00B - R0015 - Movement (268.25 m2)						
No Asbestos						
B00B - R0016 - Special Learning Space (55.37 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8102/B00B/R1014/Floor Coverings Res/Textile/S18					No Asbestos Detected
B00B - R0017 - Special Learning Space (39.28 m2)						
No Asbestos						
B00B - R0018 - Student Laundry - Type 2 (6.1 m2)						
No Asbestos						
B00B - R0019 - Access Student Shower/Toilet - Type 2 (8.51 m2)						
No Asbestos						
B00B - R0020 - Toilets-Disabled (4.31 m2)						
No Asbestos						
B00B - R0021 - Staff - Toilet (3.24 m2)						
No Asbestos						
B00B - R0022 - General Storeroom (3.78 m2)						
No Asbestos						
B00B - R0023 - Staff Study (8.99 m2)						
No Asbestos						
B00B - R0026 - Sport Equipment Store (12.05 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00B/R0002/Ceiling Structures/Linings/S39					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	8m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00B/R0002/Wall Linings Internal/S40					Chrysotile (white asbestos)
B00B - R0027 - Student Drinking Facilities (11.43 m2)						
No Asbestos						
B00B - R0028 - Student Canteen (55.27 m2)						
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0029 - General Storeroom (3.16 m2)						
No Asbestos						
B00B - R0030 - Administration - Clerical (2.98 m2)						
No Asbestos						
B00B - R0031 - Staff - Toilet (1.79 m2)						
No Asbestos						
B00B - R0032 - Pantry (5.05 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
8102/B00B/R0032/Floor Coverings Res/Textile/S51					No Asbestos Detected	
B00B - R0034 - Lift (1.37 m2)						
No Asbestos						
B00B - R0035 - Movement (8.18 m2)						
No Asbestos						
B00B - R0036 - Movement (17.62 m2)						
In-fill-panel above Door	Flat AC Sheeting					
8102/B00B/R0036/Panel above office Door/S42					No Asbestos Detected	
B00B - R0037 - Pantry (21.09 m2)						
Wall Linings Internal	Flat AC Sheeting					
8102/B00B/R0037/Wall Linings Internal/S52					No Asbestos Detected	
Ceiling Structures/Linings	Flat AC Sheeting					
8102/B00B/R0037/Ceiling Structures/Linings/S53					No Asbestos Detected	
B00B - R0038 - Sport Equipment Store (7.47 m2)						
No Asbestos						
B00B - R0039 - Movement (6.73 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8102/B00B/R0002/Ceiling Structures/Linings/S39					Chrysotile (white asbestos)	
B00B - R0040 - Movement (33.84 m2)						
In-fill-panel	Flat AC Sheeting	1m	West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8102/B00B/R0040/Panel Below Window/S43					Chrysotile (white asbestos)	
B00B - R0041 - Movement (21.46 m2)						
No Asbestos						
B00B - R0042 - Movement (57.81 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	57.81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8102/B00B/R0002/Ceiling Structures/Linings/S39					Chrysotile (white asbestos)	
B00B - R0043 - Movement (16.72 m2)						
No Asbestos						
B00B - R0044 - Movement (22.2 m2)						
No Asbestos						
B00B - R0047 - Stairs (5.05 m2)						
No Asbestos						
B00B - R0048 - Stairs (4.11 m2)						
No Asbestos						
B00B - R0049 - Movement (30.34 m2)						
No Asbestos						
B00B - R1001 - General Storeroom (8.14 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
8102/B00B/R1014/Floor Coverings Res/Textile/S18					No Asbestos Detected	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R1002 - General Storeroom (12.02 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8102/B00B/R1014/Floor Coverings Res/Textile/S18					No Asbestos Detected
B00B - R1003 - Staff Study (65.75 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8102/B00B/R1014/Floor Coverings Res/Textile/S18					No Asbestos Detected
B00B - R1004 - General Learning Space (56.69 m2)						
No Asbestos						
B00B - R1005 - General Learning Space (56.44 m2)						
No Asbestos						
B00B - R1006 - General Learning Space (62.02 m2)						
No Asbestos						
B00B - R1007 - Movement (33.99 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8102/B00B/R1021/Floor Coverings Res/Textile/S16					No Asbestos Detected
B00B - R1008 - Commonroom (90.55 m2)						
No Asbestos						
B00B - R1009 - Staff Kitchen (24.68 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8102/B00A/R1007/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R1010 - Staff Study (47.89 m2)						
In-fill-panel	Flat AC Sheeting					
	8102/B00B/R1010/Panel to old Door opening/S19					No Asbestos Detected
B00B - R1011 - General Storeroom (11.06 m2)						
No Asbestos						
B00B - R1015 - Computer Learning Space (72.28 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8102/B00B/R1014/Floor Coverings Res/Textile/S18					No Asbestos Detected
B00B - R1016 - Movement (18.82 m2)						
Ceiling Structures/Linings	Vermiculite					
	8102/B00B/R1016/Decorative Coating/S20					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet					
	8102/B00B/R1016/Floor Coverings Res/Textile/S22					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Sheet					
	8102/B00B/R1016/Floor Coverings Res/Textile/S23					No Asbestos Detected
B00B - R1017 - General Storeroom (6.55 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8102/B00B/R1014/Floor Coverings Res/Textile/S18					No Asbestos Detected
B00B - R1019 - Movement (18.37 m2)						
No Asbestos						
B00B - R1020 - Movement (6.25 m2)						
No Asbestos						
B00B - R1021 - Movement (5.85 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

Floor Coverings
Res/Textile

Vinyl Sheet

8102/B00B/R1021/Floor Coverings Res/Textile/S16

No Asbestos Detected

B00B - R1022 - Stairs (24.2 m2)

No Asbestos

B00B - R1023 - Stairs (23.86 m2)

No Asbestos

B00B - R1024 - Movement (162.98 m2)

No Asbestos

B00B - R1025 - Computer Learning Space (43.08 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Technological & Applied Studies - 1930 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00C - R0001 - Materials Technology L.S. (72.6 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8102/B00C/R0012/Ceiling Structures/Linings/S34					Chrysotile (white asbestos)	

B00C - R0002 - Staff Study (13.21 m2)

Sheet Vinyl under carpet	Vinyl Sheet	8102/B00C/R0009/Sheet Vinyl under carpet/S59				No Asbestos Detected
--------------------------	-------------	--	--	--	--	-----------------------------

B00C - R0004 - Movement (16.53 m2)

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8102/B00C/R0012/Ceiling Structures/Linings/S34					Chrysotile (white asbestos)	

B00C - R0005 - Movement (10.52 m2)

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8102/B00C/R0012/Ceiling Structures/Linings/S34					Chrysotile (white asbestos)	

B00C - R0006 - Food Technology L.S. (105.65 m2)

Ceiling Structures/Linings	Flat AC Sheeting	106m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8102/B00C/R0012/Ceiling Structures/Linings/S34					Chrysotile (white asbestos)	

B00C - R0007 - Laundry (14.74 m2)

No Asbestos

B00C - R0008 - Staff - Toilet (5.18 m2)

Incinerette	Fibre Cement Pipe	4m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						

B00C - R0009 - Staff Study (11.02 m2)

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8102/B00C/R0012/Ceiling Structures/Linings/S34					Chrysotile (white asbestos)	

Sheet Vinyl under carpet	Vinyl Sheet	8102/B00C/R0009/Sheet Vinyl under carpet/S59				No Asbestos Detected
--------------------------	-------------	--	--	--	--	-----------------------------

Underlay	Paper	8102/B00C/R0009/Underlay/S60				No Asbestos Detected
----------	-------	------------------------------	--	--	--	-----------------------------

B00C - R0010 - Movement (4.56 m2)

No Asbestos

B00C - R0011 - Plant Growing Space (0.86 m2)

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8102/B00C/R0012/Ceiling Structures/Linings/S34					Chrysotile (white asbestos)	

B00C - R0012 - Preparation (10.34 m2)

No Asbestos

B00C - R0013 - Food Technology L.S. (81.25 m2)

No Asbestos

B00C - R0014 - Pantry (12.06 m2)

No Asbestos

B00C - R0015 - Movement (1.83 m2)

No Asbestos

B00C - R0016 - Movement (13.65 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00C - R9001 - General Storeroom (4.73 m2)

No Asbestos

B00C - R9002 - General Storeroom (7.94 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1922 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior**B00D - R0001 - Toilets-Girls (36.24 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet 8102/B00D/R0001/Partition Walls (Cubicles)/S1					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00D/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00D - R0002 - Cleaning Store - Distributed (7.07 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00D/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00D - R0003 - Toilets-Boys (25.48 m2)

Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00D/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

Partition Walls (Cubicles)	Compressed AC Sheet 8102/B00D/R0001/Partition Walls (Cubicles)/S1					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00D - R0004 - General Storeroom (8.37 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00D/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library/Science Learning - 1972 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00E - M1001 - Plant (63.95 m2)

No Asbestos

B00E - M1002 - Plant (5.25 m2)

No Asbestos

B00E - M1003 - Seminar (38.71 m2)

Ceiling Structures/Linings	Vermiculite 8102/B00E/R0003/Decorative Coating/S3	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

Wall Linings Internal	Flat AC Sheeting 8102/B00E/M1003/Wall Linings Internal/S33	No Asbestos Detected
-----------------------	---	----------------------

B00E - M1004 - Seminar (67.57 m2)

No Asbestos

B00E - M1005 - Plant (26.73 m2)

No Asbestos

B00E - M1006 - Seminar (15.24 m2)

No Asbestos

B00E - M1007 - Plant (26.73 m2)

No Asbestos

B00E - M1008 - Stairs (3.69 m2)

No Asbestos

B00E - M1009 - Stairs (3.49 m2)

No Asbestos

B00E - R0001 - Laboratory L.S. (91.3 m2)

Ceiling Structures/Linings	Vermiculite 8102/B00E/R0003/Decorative Coating/S3	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00E - R0002 - Movement (3.17 m2)

No Asbestos

B00E - R0003 - Laboratory L.S. (91.2 m2)

Ceiling Structures/Linings	Vermiculite 8102/B00E/R0003/Decorative Coating/S3	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00E - R0006 - Laboratory L.S. (90.82 m2)

Ceiling Structures/Linings	Vermiculite 8102/B00E/R0003/Decorative Coating/S3	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00E - R0007 - Chemical Store (17.04 m2)

Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8102/B00E/R0003/Floor Coverings Res/Textile/S4						Chrysotile (white asbestos)

B00E - R0008 - Laboratory L.S. (90.93 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8102/B00E/R0003/Decorative Coating/S3				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00E - R0009 - Preparation (44.47 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00E/R0003/Decorative Coating/S3				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8102/B00E/R0003/Floor Coverings Res/Textile/S4	45m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0010 - General Storeroom (3.34 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8102/B00E/R0003/Floor Coverings Res/Textile/S4	4m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8102/B00E/R0003/Decorative Coating/S3				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00E - R0011 - Movement (40.12 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8102/B00E/R0003/Floor Coverings Res/Textile/S4	41m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0012 - Distribution Board Cupboard (0.51 m2) Note: No inspection of live electrical installation.						
Floor Coverings Res/Textile	Vinyl Tiles 8102/B00E/R0003/Floor Coverings Res/Textile/S4	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0013 - Main Switchroom (1.75 m2)						
No Asbestos						
B00E - R0014 - Plant Growing Space (8.76 m2)						
Pipework Gaskets	Fibre Gasket Material 8102/B00E/R0014/Pipework Gaskets/S67	12Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0015 - Movement (14.34 m2)						
No Asbestos						
B00E - R0016 - Cleaning Store - Distributed (3.78 m2)						
No Asbestos						
B00E - R0017 - Stairs (13.47 m2)						
No Asbestos						
B00E - R0018 - Preparation - Science (48.73 m2)						
No Asbestos						
B00E - R1001 - General Storeroom (12.88 m2)						
No Asbestos						
B00E - R1002 - Workroom (17.66 m2)						
No Asbestos						
B00E - R1003 - Librarian (11.26 m2)						
No Asbestos						
B00E - R1004 - Audio Visual Workroom (28.86 m2)						
No Asbestos						
B00E - R1005 - Toilets-Girls (3 m2)						
No Asbestos						
B00E - R1006 - Movement (1.76 m2)						
No Asbestos						
B00E - R1007 - Toilets-Boys (3.01 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00E - R1008 - Seminar (71.37 m2)

Ceiling Structures/Linings Vermiculite
8102/B00E/R0003/Decorative Coating/S3

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R1010 - Seminar (12.64 m2)

No Asbestos

B00E - R1011 - Seminar (11.97 m2)

No Asbestos

B00E - R1012 - No Access (5.18 m2)

No Asbestos

B00E - R1013 - No Access (5.85 m2)

No Asbestos

B00E - R1014 - Movement (6.71 m2)

No Asbestos

B00E - R1015 - Cleaning Store - Distributed (0.35 m2)

No Asbestos

B00E - R1016 - Movement (4.43 m2)

Electrical Mounting Board Resinous Board 1Unit North Good Condition (1) Low (1) Low Priority (2-3)

8102/B00E/R1016/Electrical Mounting Board/S31

Chrysotile (white asbestos)

B00E - R1017 - Distribution Board Cupboard (0.32 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board Resinous Board 1Unit North Good Condition (1) Low (1) Low Priority (2-3)

8102/B00E/R1016/Electrical Mounting Board/S31

Chrysotile (white asbestos)

B00E - R1018 - Seminar (11.91 m2)

No Asbestos

B00E - R1019 - Duplicating Workroom (12.67 m2)

No Asbestos

B00E - R1020 - Movement (14.34 m2)

No Asbestos

B00E - R1021 - Stairs (0.29 m2)

No Asbestos

B00E - R1022 - Stairs (0.29 m2)

No Asbestos

B00E - R1023 - Main Area (326.32 m2)

Ceiling Structures/Linings Vermiculite
8102/B00E/R0003/Decorative Coating/S3

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R1024 - Stairs (20.07 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 1962 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00F - R0001 - Movement (5.08 m2)

No Asbestos

B00F - R0002 - Staff Shower (9.84 m2)

No Asbestos

B00F - R0003 - Shower/Change (34.79 m2)

No Asbestos

B00F - R0004 - Toilets-Girls (2.84 m2)

No Asbestos

B00F - R0005 - Movement (6.24 m2)

No Asbestos

B00F - R0006 - Garden Store Room (17.99 m2)

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

8102/B00F/R0006/Ceiling Structures/Linings/S46

Chrysotile (white asbestos)

B00F - R0007 - Movement (6.26 m2)

No Asbestos

B00F - R0008 - Shower/Change (47.07 m2)

No Asbestos

B00F - R0009 - Toilets-Boys (2.94 m2)

No Asbestos

B00F - R0010 - Staff Shower (9.8 m2)

No Asbestos

B00F - R0011 - Movement (11.61 m2)

No Asbestos

B00F - R0012 - Sport Equipment Store (27.63 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Science/Physical Education - 1962 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00G/Eaves Linings/S63					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior**B00G - R0001 - Staff - Toilet (3.69 m2)**

Incinerette	Encapsulated Insulation material within unit	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Area inaccessible

B00G - R0002 - Cleaning Store - Distributed (1.62 m2)

Ceiling Structures/Linings	Vermiculite					
	8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00G - R0003 - Movement (6.57 m2)

Ceiling Structures/Linings	Vermiculite					
	8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00G - R0004 - Apparatus Store (13.29 m2)

Ceiling Structures/Linings	Vermiculite					
	8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Window Ledges	Compressed AC Sheet	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00G/R1025/Window Ledges/S64					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0005 - Laboratory L.S. (92.85 m2)

Ceiling Structures/Linings	Vermiculite					
	8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Sheet					
	8102/B00G/R0005/Floor Coverings Res/Textile/S26					No Asbestos Detected

Fume Cupboard	Flat AC Sheeting	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00G/R0005/Fume Cupboard/S28					Chrysotile (white asbestos) , Amosite (brown asbestos)

Window Ledges	Compressed AC Sheet	5Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00G/R1025/Window Ledges/S64					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0006 - Preparation (28.62 m2)

Ceiling Structures/Linings	Vermiculite					
	8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles					
	8102/B00G/R0005/Floor Coverings Res/Textile/S27					No Asbestos Detected

B00G - R0007 - General Storeroom (9.41 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8102/B00G/R0005/Floor Coverings Res/Textile/S27					No Asbestos Detected
Window Ledges	Compressed AC Sheet 8102/B00G/R1025/Window Ledges/S64	2Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R0008 - Laboratory L.S. (92.34 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Chalk Board	Flat AC Sheeting 8102/B00G/R1014/Chalk Board/S24					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Sheet 8102/B00G/R0005/Floor Coverings Res/Textile/S26					No Asbestos Detected
Fume Cupboard	Flat AC Sheeting 8102/B00G/R0005/Fume Cupboard/S28	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Window Ledges	Compressed AC Sheet 8102/B00G/R1025/Window Ledges/S64	4Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R0009 - Staff Study (24.17 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8102/B00G/R0005/Floor Coverings Res/Textile/S27					No Asbestos Detected
Window Ledges	Compressed AC Sheet 8102/B00G/R1025/Window Ledges/S64	1Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R0010 - General Learning Space (52.71 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet 8102/B00G/R0005/Floor Coverings Res/Textile/S26					No Asbestos Detected
Window Ledges	Compressed AC Sheet 8102/B00G/R1025/Window Ledges/S64	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R0011 - General Learning Space (51.98 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet 8102/B00G/R0005/Floor Coverings Res/Textile/S26					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Window Ledges	Compressed AC Sheet	3Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00G/R1025/Window Ledges/S64					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R0012 - Materials Store (6.28 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8102/B00G/R1001/Decorative Coating/S21					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00G - R0013 - Materials Store (6.23 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8102/B00G/R1001/Decorative Coating/S21					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00G - R0014 - Materials Technology L.S. (65.48 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8102/B00G/R1001/Decorative Coating/S21					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
	8102/B00G/R0005/Floor Coverings Res/Textile/S26					
Window Ledges	Compressed AC Sheet	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00G/R1025/Window Ledges/S64					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R0015 - Seminar (27.08 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8102/B00G/R1001/Decorative Coating/S21					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
	8102/B00G/R0005/Floor Coverings Res/Textile/S26					
Window Ledges	Compressed AC Sheet	3Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00G/R1025/Window Ledges/S64					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R0016 - Movement (6.55 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8102/B00G/R1001/Decorative Coating/S21					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00G - R0017 - Staff - Toilet (3.45 m2)						
No Asbestos						
B00G - R0018 - Cleaning Store - Distributed (1.83 m2)						
No Asbestos						
B00G - R0019 - General Storeroom (6.55 m2)						
No Asbestos						
B00G - R0020 - Movement (4.48 m2)						
Decorative Coating	Vermiculite					Limited Samples Taken
	8102/B00G/R1001/Decorative Coating/S21					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00G - R0021 - Cleaning Store - Distributed (2.83 m2)						
No Asbestos						
B00G - R0022 - General Storeroom (2.99 m2)						
No Asbestos						
B00G - R0023 - Distribution Board Cupboard (1.04 m2)						
Note: No inspection of live electrical installation.						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Electrical Hazard

B00G - R0025 - Movement (4.78 m2)

Ceiling Structures/Linings	Vermiculite					
	8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00G - R0026 - Movement (17.61 m2)

No Asbestos

B00G - R0027 - Stairs (4.31 m2)

No Asbestos

B00G - R0028 - Stairs (1.94 m2)

No Asbestos

B00G - R0029 - Stairs (4.73 m2)

No Asbestos

B00G - R0030 - Stairs (2.18 m2)

No Asbestos

B00G - R0031 - Stairs (1.19 m2)

No Asbestos

B00G - R0032 - Movement (198.93 m2)

Ceiling Structures/Linings	Vermiculite					
	8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8102/B00G/R0005/Floor Coverings Res/Textile/S27					No Asbestos Detected

B00G - R1001 - Staff - Toilet (3.69 m2)

Ceiling Structures/Linings	Vermiculite					
	8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00G - R1002 - Cleaning Store - Distributed (1.62 m2)

Ceiling Structures/Linings	Vermiculite					
	8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00G - R1003 - Movement (6.75 m2)

Ceiling Structures/Linings	Vermiculite					
	8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00G - R1004 - Staff Study (26.8 m2)

Ceiling Structures/Linings	Vermiculite					
	8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Window Ledges	Compressed AC Sheet	2Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00G/R1025/Window Ledges/S64					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R1005 - General Learning Space (50.96 m2)

Ceiling Structures/Linings	Vermiculite					
	8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Window Ledges	Compressed AC Sheet	2Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00G/R1025/Window Ledges/S64					Chrysotile (white asbestos) , Amosite (brown asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00G - R1006 - Bulk Store (12.67 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Window Ledges	Compressed AC Sheet 8102/B00G/R1025/Window Ledges/S64	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R1007 - Art Learning Space (59.57 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8102/B00G/R0005/Floor Coverings Res/Textile/S27					No Asbestos Detected
Window Ledges	Compressed AC Sheet 8102/B00G/R1025/Window Ledges/S64	2Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R1008 - Art Learning Space (51.98 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Window Ledges	Compressed AC Sheet 8102/B00G/R1025/Window Ledges/S64	2Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R1009 - Kiln Space (21.61 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Window Ledges	Compressed AC Sheet 8102/B00G/R1025/Window Ledges/S64	2Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R1010 - Bulk Store (10.97 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R1011 - General Learning Space (49.64 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Window Ledges	Compressed AC Sheet 8102/B00G/R1025/Window Ledges/S64	2Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R1012 - General Storeroom (6.23 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R1013 - General Storeroom (6.22 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R1014 - General Learning Space (52.85 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Window Ledges	Compressed AC Sheet 8102/B00G/R1025/Window Ledges/S64	2Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R1015 - Staff Study (12.5 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00G - R1016 - Resources Space (12.49 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00G - R1017 - General Learning Space (65.49 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Window Ledges	Compressed AC Sheet 8102/B00G/R1025/Window Ledges/S64	2Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R1018 - Seminar (13.39 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Window Ledges	Compressed AC Sheet 8102/B00G/R1025/Window Ledges/S64	2Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R1019 - Seminar (13.32 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00G - R1020 - Staff - Toilet (3.45 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Cinerette	Encapsulated Insulation material within unit Assumed Asbestos - Area inaccessible	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
B00G - R1021 - Cleaning Store - Distributed (1.83 m2)						
Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00G - R1022 - Cleaning Store - Distributed (2.84 m2)						
No Asbestos						
B00G - R1023 - General Storeroom (3.03 m2)						
No Asbestos						
B00G - R1024 - Distribution Board Cupboard (1.05 m2)				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting 8102/B00G/Eaves Linings/S63	2m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Electrical Backing Board	Resinous Board	3Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Electrical Hazard

B00G - R1025 - Movement (194.22 m2)

Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8102/B00G/R0005/Floor Coverings Res/Textile/S27					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

Window Ledges	Compressed AC Sheet	9Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00G/R1025/Window Ledges/S64					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R1026 - Stairs (14.92 m2)

No Asbestos

B00G - R1027 - Stairs (7.33 m2)

No Asbestos

B00G - R1028 - Stairs (7.33 m2)

No Asbestos

B00G - R9001 - Movement (4.8 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8102/B00G/R9001/Ceiling Structures/Linings/S30					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00G - R9002 - General Storeroom (3.38 m2)

No Asbestos

B00G - R9003 - Movement (21.54 m2)

Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

In-fill-panel	Compressed AC Sheet	2m	East, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00G/R9003/In. Fill Panel To windows/S25					Chrysotile (white asbestos)

B00G - R9004 - Multi-Purpose Space (298.14 m2)

Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Electrical Backing Board	Resinous Board	2Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B00G - R9005 - Movement (2.52 m2)

Ceiling Structures/Linings	Vermiculite 8102/B00G/R1001/Decorative Coating/S21					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00G - R9006 - Movement (29.95 m2)

Ceiling Structures/Linings	Vermiculite 8102/B00G/R9011/Decorative Coating/S7					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00G - R9007 - General Storeroom (3.91 m2)

No Asbestos

B00G - R9008 - Shower/Change (57.55 m2)

Ceiling Structures/Linings	Vermiculite 8102/B00G/R9011/Decorative Coating/S7					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8102/B00G/R9011/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)	
B00G - R9009 - Distribution Board Cupboard (1.05 m2)				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	3Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00G - R9010 - Cleaning Store - Distributed (3.11 m2)						
Ceiling Structures/Linings	Vermiculite	8102/B00G/R9011/Decorative Coating/S7			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00G - R9011 - Shower/Change (43.99 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
8102/B00G/R9011/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite	8102/B00G/R9011/Decorative Coating/S7			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00G - R9012 - Stairs (2.22 m2)						
No Asbestos						
B00G - R9013 - Stairs (2.41 m2)						
No Asbestos						
B00G - R9014 - External Movement (6.94 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Multi Purpose Facilities - 1930 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting					
	8102/B00H/Underfloor Voids - Packing to Floor Joists/S57					No Asbestos Detected
Ceiling Voids	Encapsulated Insulation material within unit					
	8102/B00H/Ceiling Voids/S65					No Asbestos Detected

Interior

B00H - M0001 - Control Room (16.02 m2)

No Asbestos

B00H - M0002 - General Storeroom (16.02 m2)

No Asbestos

B00H - M0003 - Plant (14.38 m2)

Ductwork Insulation	Mastic	60m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						

B00H - M0004 - Plant (29.91 m2)

Ductwork Insulation	Mastic	60m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						

B00H - R0001 - Movement (3.05 m2)

No Asbestos

B00H - R0002 - Stage (108.57 m2)

No Asbestos

B00H - R0003 - Movement (3.04 m2)

No Asbestos

B00H - R0004 - Multi-Purpose Space (399.18 m2)

No Asbestos

B00H - R0005 - Public Entry (20.74 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	8102/B00H/R0007/Floor Coverings Res/Textile/S11					No Asbestos Detected

B00H - R0006 - Chair Store (14.96 m2)

Fire Door	Encapsulated Insulation material within unit					
	8102/B00H/R0006/Fire Door/S66					No Asbestos Detected

B00H - R0007 - Staff Kitchen (12.19 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	8102/B00H/R0007/Floor Coverings Res/Textile/S11					No Asbestos Detected

B00H - R0008 - Movement (3.44 m2)

No Asbestos

B00H - R0009 - Movement (1.78 m2)

No Asbestos

B00H - R0010 - Movement (1.82 m2)

No Asbestos

B00H - R0011 - Stairs (6.36 m2)

No Asbestos

B00H - R0012 - Stairs (6.32 m2)

No Asbestos

B00H - R9001 - Movement (5.12 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
					No Asbestos	
	B00H - R9002 - Toilets-Girls (4.4 m2)				No Asbestos	
	B00H - R9003 - Shower/Change (21.83 m2)				No Asbestos	
	B00H - R9004 - General Storeroom (17.18 m2)				No Asbestos	
	B00H - R9005 - General Storeroom (32.36 m2)				No Asbestos	
	B00H - R9006 - Shower/Change (21.74 m2)				No Asbestos	
	B00H - R9007 - Toilets-Boys (4.43 m2)				No Asbestos	
	B00H - R9008 - Movement (5.66 m2)				No Asbestos	
	B00H - R9009 - Stairs (4.19 m2)				No Asbestos	
	B00H - R9010 - Stairs (4.69 m2)				No Asbestos	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Technological & Applied Studies - 1963 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 8102/B001/Eaves Linings/S54					No Asbestos Detected
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

Interior**B001 - R0004 - Materials Technology L.S. (100.54 m2)**

No Asbestos

B001 - R0005 - Materials Store (16.35 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8102/B001/R0005/Ceiling Structures/Linings/S55					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B001 - R0006 - General Storeroom (5.26 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8102/B001/R0005/Ceiling Structures/Linings/S55					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B001 - R0007 - Design L.S. (58.92 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8102/B001/R0005/Ceiling Structures/Linings/S55					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B001 - R0008 - Staff Study (31.03 m2)

No Asbestos

B001 - R0009 - Movement (2.08 m2)

No Asbestos

B001 - R0010 - Materials Technology L.S. (103.63 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8102/B001/R0005/Ceiling Structures/Linings/S55					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B001 - R0011 - Materials Store (16.85 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8102/B001/R0005/Ceiling Structures/Linings/S55					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B001 - R0012 - Dust Extraction Space (8.35 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8102/B001/R0005/Ceiling Structures/Linings/S55					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B001 - R0013 - Materials Technology L.S. (92.24 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8102/B001/R0005/Ceiling Structures/Linings/S55					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B001 - R0014 - Materials Store (7.48 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8102/B001/R0005/Ceiling Structures/Linings/S55					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B001 - R0015 - Staff - Toilet (5 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8102/B001/R0005/Ceiling Structures/Linings/S55					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B001 - R0016 - Movement (40.85 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8102/B001/R0005/Ceiling Structures/Linings/S55					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B001 - R0017 - Movement (4.97 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8102/B001/R0005/Ceiling Structures/Linings/S55					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B001 - R0018 - Movement (25.73 m2)

No Asbestos

B001 - R0019 - Movement (3.22 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8102/B001/R0005/Ceiling Structures/Linings/S55					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00I - R0020 - Lift (1.3 m2)						
No Asbestos						
B00I - R0021 - Covered Outdoor Space (96.38 m2)						
No Asbestos						
B00I - R0022 - Materials Technology L.S. (131 m2)						
No Asbestos						
B00I - R0023 - Welding Area (3.74 m2)						
No Asbestos						
B00I - R0024 - Welding Area (3.74 m2)						
No Asbestos						
B00I - R0025 - Welding Area (3.74 m2)						
No Asbestos						
B00I - R9001 - Computer Learning Space (65.02 m2)						
Ceiling Structures/Linings	Vermiculite					
	8102/B00I/R9001/Decorative Coating/S47					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Sheet					
	8102/B00I/R9001/Floor Coverings Res/Textile/S50					No Asbestos Detected
B00I - R9002 - Materials Store (22.99 m2)						
Ceiling Structures/Linings	Vermiculite					
	8102/B00I/R9001/Decorative Coating/S47					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles					
	8102/B00I/R9002/Floor Coverings Res/Textile/S49					No Asbestos Detected
B00I - R9006 - Maintenance Bulk Store (23.71 m2)						
No Asbestos						
B00I - R9007 - Movement (3 m2)						
No Asbestos						
B00I - R9008 - Materials Store (21.99 m2)						
In-fill-panel	Compressed AC Sheet	10m	Stored Panel next to Entrance Gate	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8102/B00I/R9008/Loose Panels on floor/S48					Chrysotile (white asbestos)
B00I - R9009 - Gymnasium (45.47 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Agricultural Science - 1960 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00K - R0001 - General Storeroom (21.9 m2)

No Asbestos

B00K - R0002 - Animal Space (18.79 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Agricultural Science - 1922 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00L - R0001 - Plant Space (9.18 m2)

No Asbestos

B00L - R0002 - Movement (23.65 m2)

No Asbestos

B00L - R0003 - General Storeroom (9.42 m2)

No Asbestos

B00L - R0004 - Staff Study (9.14 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8102/B00L/R0004/Ceiling Structures/Linings/S58					Chrysotile (white asbestos)	

B00L - R0005 - General Learning Space (36.21 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - General Learning - 1999 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	4m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00M/Eaves Linings/S61			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Cladding	Flat AC Sheeting	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8102/B00M/Wall Cladding/S62			Chrysotile (white asbestos)		

Interior

B00M - R0001 - Staff Study (36.98 m2)						
No Asbestos						
B00M - R0002 - Staff Study (24.8 m2)						
No Asbestos						
B00M - R0003 - Movement (12.44 m2)						
No Asbestos						
B00M - R0004 - General Learning Space (75.02 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Agricultural Science - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00N - R0001 - Machine Storage (137.2 m2)

No Asbestos

B00N - R0002 - Agriculture Covered Area (52.98 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Multi Purpose Facilities - 2001 - Concrete (Concrete)

Exterior

Ceiling Voids	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B000 - M0001 - Multi-Purpose Space (225.98 m2)

No Asbestos

B000 - M0002 - Stairs (4.6 m2)

No Asbestos

B000 - M0003 - Stairs (4.58 m2)

No Asbestos

B000 - R0001 - Multi-Purpose Space (1362.45 m2)

No Asbestos

B000 - R0002 - Movement (15.28 m2)

No Asbestos

B000 - R0003 - First Aid (5.81 m2)

No Asbestos

B000 - R0004 - Toilets-Unisex (5.88 m2)

No Asbestos

B000 - R0005 - Toilet - Lobby (4.61 m2)

No Asbestos

B000 - R0006 - Toilet - Lobby (2.65 m2)

No Asbestos

B000 - R0007 - Toilets-Girls (33.48 m2)

No Asbestos

B000 - R0008 - Cleaning Store - Distributed (3.35 m2)

No Asbestos

B000 - R0009 - Shower (24.59 m2)

No Asbestos

B000 - R0010 - Sport Equipment Store (17.12 m2)

No Asbestos

B000 - R0011 - Stairs (1.88 m2)

No Asbestos

B000 - R0012 - Office/Store (12.24 m2)

No Asbestos

B000 - R0013 - Toilet - Lobby (1.7 m2)

No Asbestos

B000 - R0014 - Staff - Toilet (2 m2)

No Asbestos

B000 - R0015 - Toilet - Lobby (3.21 m2)

No Asbestos

B000 - R0016 - Toilets-Boys (24.77 m2)

No Asbestos

B000 - R0017 - Cleaning Store - Distributed (3.36 m2)

No Asbestos

B000 - R0018 - Shower (24.67 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B000 - R0019 - Sport Equipment Store (26.53 m2)

No Asbestos

B000 - R0020 - Stairs (1.89 m2)

No Asbestos

B000 - R0021 - Distribution Board Cupboard (1.76 m2)

Note: No inspection of live electrical installation.

No Asbestos

B000 - R0022 - Plant (1.38 m2)

No Asbestos

B000 - R0023 - External Movement (31.69 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+1 - BBQ Shelter Area in Front of Building B

Exterior

No Asbestos

Interior

Build+1 - R0001 - BBQ Space

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D10638 - Learning Unit - Standard/Withdrawal : Placement Date - 14/01/2014

Exterior

No Asbestos Found.

Interior

R1 - Entry

No Asbestos Found.

R2 - General Learning Space

No Asbestos Found.

R3 - Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

8102_ASB_100913_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017