


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Asquith Girls High School (8222)
Region : Northern Sydney
State Electorate : Hornsby
Local Government Area : Hornsby

Initial Survey : Noel Arnold & Associates : 11 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 10 - Apr - 2015

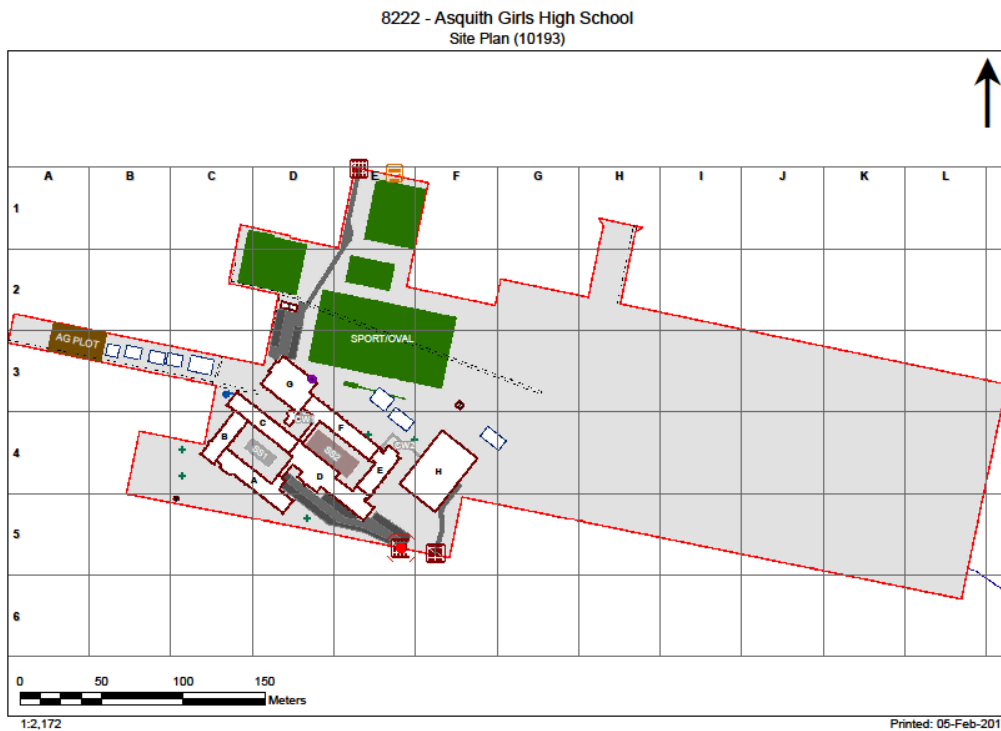

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning/Music - 1959 - Concrete Framed (Concrete Framed)

Exterior

Eaves Linings	Flat AC Sheeting	22m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8222/B00A/Eaves Linings/S14					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0002 - Music Store (6.05 m2)						
No Asbestos						
B00A - R0003 - Archive Store (6.11 m2)						
No Asbestos						
B00A - R0004 - Cleaning Store - Distributed (1.61 m2)						
No Asbestos						
B00A - R0010 - Printing/Photocopying (15.88 m2)						
No Asbestos						
B00A - R0012 - Principal Office (23.85 m2)						
No Asbestos						
B00A - R0013 - General Storeroom (7.79 m2)						
No Asbestos						
B00A - R0019 - Leading Teacher (10.44 m2)						
No Asbestos						
B00A - R0020 - Staff - Toilet (11.9 m2)						
No Asbestos						
B00A - R0022 - Interview/Office - Type 1 (10.47 m2)						
No Asbestos						
B00A - R0023 - General Storeroom (5.04 m2)						
No Asbestos						
B00A - R0024 - Main Switchroom (5 m2)						
No Asbestos						
B00A - R0027 - Movement (35.16 m2)						
No Asbestos						
B00A - R0028 - Movement (2.89 m2)						
No Asbestos						
B00A - R0029 - Movement (17.27 m2)						
No Asbestos						
B00A - R0030 - Stairs (4.67 m2)						
No Asbestos						
B00A - R0032 - External Movement (25.1 m2)						
No Asbestos						
B00A - R0033 - Public Reception (35.98 m2)						
No Asbestos						
B00A - R0034 - External Movement (5.31 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8222/B00A/R0043/Ceiling Structures/Linings/S21					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0035 - Movement (30.68 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
B00A - R0036 - Deputy Principal Office (15.47 m2)						
No Asbestos						
B00A - R0037 - Interview/Office - Type 1 (10.35 m2)						
No Asbestos						
B00A - R0038 - General Storeroom (5.04 m2)						
No Asbestos						
B00A - R0039 - Clinic - Girls (11.27 m2)						
No Asbestos						
B00A - R0040 - Archive Store (8.11 m2)						
No Asbestos						
B00A - R0041 - External Movement (24.02 m2)						
No Asbestos						
B00A - R0042 - Access Staff Shower/Toilet (10.4 m2)						
No Asbestos						
B00A - R0043 - External Movement (5.27 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00A/R0043/Ceiling Structures/Linings/S21				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0044 - Ancillary Staff (12.67 m2)						
No Asbestos						
B00A - R0045 - Tea Room (3 m2)						
No Asbestos						
B00A - R0046 - Administration - Clerical (41.49 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
8222/B00A/R0046/Floor Coverings Res/Textile/S28				No Asbestos Detected		
B00A - R0047 - Toilet - Lobby (1.82 m2)						
No Asbestos						
B00A - R0048 - Staff - Toilet (2.98 m2)						
No Asbestos						
B00A - R0049 - Student Reception (6.09 m2)						
No Asbestos						
B00A - R0050 - Music Learning Space (79.75 m2)						
No Asbestos						
B00A - R0051 - Handwashing Facilities (0.46 m2)						
No Asbestos						
B00A - R1002 - Music Store (3.15 m2)						
No Asbestos						
B00A - R1003 - Special Learning Space (20.59 m2)						
No Asbestos						
B00A - R1004 - Tea Room (1.08 m2)						
No Asbestos						
B00A - R1005 - Cleaning Store - Distributed (1.75 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1009/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B00A - R1006 - General Learning Space (55.59 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	56m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00A - R1007 - General Learning Space (55.52 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	56m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00A - R1008 - General Learning Space (55.73 m2)						
No Asbestos						
B00A - R1009 - Computer Learning Space (69.83 m2)						
No Asbestos						
B00A - R1010 - Resources Store (8.18 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1009/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R1011 - Resources Store (3.2 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1009/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R1012 - Movement (81.75 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	83m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1009/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R1013 - Stairs (14.09 m2)						
No Asbestos						
B00A - R1014 - Movement (6.56 m2)						
No Asbestos						
B00A - R1015 - Movement (21.72 m2)						
No Asbestos						
B00A - R1016 - Music Learning Space (68.36 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00A/R1016/Floor Coverings Res/Textile/S32					Chrysotile (white asbestos)	
B00A - R1017 - Handwashing Facilities (0.3 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Performance Learning - 1959 - Concrete Framed (Concrete Framed)**Exterior**

Eaves Linings	Flat AC Sheeting	22m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8222/B00B/Eaves Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00B - R0001 - Staff - Toilet (5.95 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet					
	8222/B00B/R0001/Partition Walls (Cubicles)/S1				No Asbestos Detected	

B00B - R0003 - General Learning Space (51.12 m2)

No Asbestos

B00B - R0004 - Movement Studio (65.07 m2)

No Asbestos

B00B - R0005 - Performance Workshop (64.13 m2)

No Asbestos

B00B - R0007 - Stairs (4.42 m2)

No Asbestos

B00B - R0008 - Movement (3.43 m2)

No Asbestos

B00B - R0010 - Distribution Board Cupboard (1.78 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0011 - External Movement (2.22 m2)

No Asbestos

B00B - R0013 - Movement (55.63 m2)

No Asbestos

B00B - R0014 - Cleaning Store - Distributed (0.97 m2)

No Asbestos

B00B - R0015 - Movement (21.47 m2)

No Asbestos

B00B - R0016 - Performance Store (8.71 m2)

No Asbestos

B00B - R0017 - External Movement (5.28 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8222/B00B/R0018/Ceiling Structures/Linings/S20				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00B - R0018 - External Movement (5.27 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8222/B00B/R0018/Ceiling Structures/Linings/S20				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00B - R1001 - Cleaning Store - Distributed (1.96 m2)

Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8222/B00B/R1009/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8222/B00E/R1011/Ceiling Structures/Linings/S24				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R1002 - General Learning Space (54.67 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	55m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00B - R1003 - General Learning Space (55.59 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	55m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00B - R1004 - Cleaning Store - Distributed (5.15 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00B - R1005 - Staff Study (33.62 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	34m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00B - R1006 - Staff Study (34.39 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	34m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00B - R1007 - Resources Store (5.07 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00B - R1008 - Movement (64.94 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	66m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1009/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00B - R1009 - Stairs (12.83 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1009/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00B - R1010 - Stairs (2.7 m2)						
No Asbestos						
B00B - R1011 - Movement (3.58 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Staff Facilities - 1959 - Concrete Framed (Concrete Framed)**Exterior**

Eaves Linings	Flat AC Sheeting	22m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8222/B00C/Eaves Linings/S15				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00C - R0002 - Other-Vacant (3.9 m2)**

No Asbestos

B00C - R0003 - Deputy Principal Office (18.96 m2)

No Asbestos

B00C - R0004 - General Learning Space (38.65 m2)

No Asbestos

B00C - R0005 - General Learning Space (38.92 m2)

No Asbestos

B00C - R0006 - Careers Advisers Office (25.49 m2)

No Asbestos

B00C - R0007 - Staff Study (38.81 m2)

No Asbestos

B00C - R0010 - Leading Teacher (9.99 m2)

No Asbestos

B00C - R0011 - General Storeroom (7.2 m2)

No Asbestos

B00C - R0012 - Resources Store (10.34 m2)

No Asbestos

B00C - R0014 - Staff Kitchen (11.03 m2)Floor Coverings
Res/Textile

Vinyl Sheet

8222/B00C/R0014/Floor Coverings Res/Textile/S4

No Asbestos Detected**B00C - R0015 - Commonroom (121.22 m2)**

No Asbestos

B00C - R0016 - Movement (55.73 m2)

No Asbestos

B00C - R0017 - Cleaning Store - Distributed (2.92 m2)

No Asbestos

B00C - R0018 - Movement (9.41 m2)

No Asbestos

B00C - R0019 - Toilets-Girls (20.89 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	15m2	South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8222/B00C/R0019/Partition Walls (Cubicles)/S27				Chrysotile (white asbestos)	

B00C - R1001 - Resources Store (3.05 m2)Floor Coverings
Res/Textile

Vinyl Tiles

4m2

All surfaces

Good Condition (1)

Low (1) Low Priority (2-3)

8222/B00B/R1002/Floor Coverings Res/Textile/S3

Chrysotile (white asbestos)**B00C - R1002 - Handwashing Facilities (1 m2)**

No Asbestos

B00C - R1003 - Leading Teacher (19.17 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00C - R1004 - General Learning Space (69.45 m2)

Floor Coverings Res/Textile	Vinyl Tiles	70m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	

B00C - R1005 - General Learning Space (69.7 m2)

No Asbestos

B00C - R1006 - General Learning Space (69.78 m2)

No Asbestos

B00C - R1007 - General Learning Space (69.63 m2)

No Asbestos

B00C - R1008 - Staff Study (68.69 m2)

Floor Coverings Res/Textile	Vinyl Tiles	68m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	

B00C - R1009 - Movement (71.88 m2)

Floor Coverings Res/Textile	Vinyl Tiles	73m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	

B00C - R9001 - Cleaning Supplies Store (19.12 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities/Science Learning/Art - 1959 - Concrete Framed (Concrete Framed)**Exterior**

Wall Cladding	Flat AC Sheeting 8222/B00D/R0015/Wall Linings Internal/S8					No Asbestos Detected
Eaves Linings	Flat AC Sheeting 8222/B00D/Eaves Linings/S16	22m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00D - R0001 - Laboratory L.S. (96.47 m2)**

No Asbestos

B00D - R0002 - Resources Store (19.34 m2)

No Asbestos

B00D - R0003 - Apparatus Storage (25.87 m2)

Floor Coverings Res/Textile	Vinyl Sheet 8222/B00C/R0014/Floor Coverings Res/Textile/S4					No Asbestos Detected
--------------------------------	---	--	--	--	--	-----------------------------

B00D - R0004 - Laboratory L.S. (87.48 m2)

No Asbestos

B00D - R0005 - Movement (27.63 m2)

No Asbestos

B00D - R0006 - Covered Area (196.69 m2)

No Asbestos

B00D - R0007 - Cleaning Store - Distributed (4.23 m2)

No Asbestos

B00D - R0008 - Staff - Toilet (1.57 m2)

No Asbestos

B00D - R0009 - General Storeroom (4.3 m2)

No Asbestos

B00D - R0010 - Student Canteen (39.03 m2)

No Asbestos

B00D - R0011 - Staff - Toilet (4.52 m2)

No Asbestos

B00D - R0012 - Pantry (2.96 m2)

No Asbestos

B00D - R0013 - Toilets-Girls (30.96 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 8222/B00B/R0001/Partition Walls (Cubicles)/S1					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00D - R0014 - Cleaning Supplies Store (4.34 m2)

No Asbestos

B00D - R0015 - Movement (1.62 m2)

Wall Linings Internal	Flat AC Sheeting 8222/B00D/R0015/Wall Linings Internal/S8					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00D - R0016 - External Movement (35.79 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8222/B00D/R0016/Ceiling Structures/Linings/S19	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	--	------	------------	--------------------	---------	---

B00D - R0018 - Distribution Board Cupboard (1.01 m2)

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00D - R0020 - Movement (17.25 m2)						
No Asbestos						
B00D - R0021 - Uniform Shop (11.99 m2)						
No Asbestos						
B00D - R0022 - External Movement (2.99 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00D/R0016/Ceiling Structures/Linings/S19				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0023 - External Movement (5.5 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00D/R0016/Ceiling Structures/Linings/S19				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0024 - External Movement (160.17 m2)						
No Asbestos						
B00D - R1001 - Art Learning Space (86.33 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	87m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00D - R1002 - Resources Store (14.03 m2)						
No Asbestos						
B00D - R1003 - Kiln Space (12.88 m2)						
No Asbestos						
B00D - R1004 - Art Learning Space (84.1 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	84m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00D - R1005 - Multi Media Workshop (69.45 m2)						
No Asbestos						
B00D - R1006 - General Learning Space (69.63 m2)						
No Asbestos						
B00D - R1007 - Computer Learning Space (69.78 m2)						
No Asbestos						
B00D - R1008 - Resources Store (2.92 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00D - R1009 - Office/Store (20.85 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	East facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00D/R1009/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)		
B00D - R1010 - Movement (79.75 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00D - R1011 - Stairs (12.03 m2)						
No Asbestos						
B00D - R1012 - Movement (63.31 m2)						
No Asbestos						
B00D - R1013 - Movement (6.15 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - R9001 - General Storeroom (9.01 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Technological & Applied Studies/Science Learning - 1959 - Concrete Framed (Concrete Framed)**Exterior**

Eaves Linings	Flat AC Sheeting	22m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8222/B00E/Eaves Linings/S17				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00E - R0001 - Laboratory L.S. (90.36 m2)**

No Asbestos

B00E - R0002 - Resources Store (0.48 m2)

No Asbestos

B00E - R0004 - Staff Study (25.96 m2)

Floor Coverings Res/Textile	Vinyl Tiles	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	

B00E - R0005 - Staff Study (41.69 m2)

No Asbestos

B00E - R0006 - Resources Store (3.18 m2)

Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	

B00E - R0007 - Cleaning Store - Distributed (2.94 m2)

Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	

B00E - R0008 - General Storeroom (17.95 m2)

No Asbestos

B00E - R0009 - Staff - Toilet (6.2 m2)

No Asbestos

B00E - R0010 - Distribution Board Cupboard (1.82 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00E - R0011 - Movement (46.02 m2)

Floor Coverings Res/Textile	Vinyl Tiles	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	

B00E - R0012 - Stairs (4.06 m2)

No Asbestos

B00E - R0013 - Resources Store (10.46 m2)

No Asbestos

B00E - R0014 - Movement (18.51 m2)

No Asbestos

B00E - R0015 - Resources Store (6.88 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8222/B00E/R0015/Floor Coverings Res/Textile/S31				Chrysotile (white asbestos)	

B00E - R0016 - Tea Room (4.13 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8222/B00E/R0015/Floor Coverings Res/Textile/S31				Chrysotile (white asbestos)	

B00E - R0017 - External Movement (2.76 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00E/R0017/Ceiling Structures/Linings/S25				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0018 - External Movement (2.95 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00E/R0017/Ceiling Structures/Linings/S25				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R1001 - Design L.S. (68.88 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	69m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00E - R1002 - Resources Store (6.51 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00E - R1003 - Change (13.06 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00E - R1004 - Resources Store (0.82 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00E - R1005 - Design L.S. (69.29 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	70m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00E - R1006 - Resources Store (5.62 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00E - R1007 - Resources Store (6.6 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00E - R1008 - Resources Store (8.61 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00E - R1009 - Cleaning Store - Distributed (2.18 m2)						
Floor Coverings Res/Textile	Vinyl tiles under vinyl sheet					
8222/B00E/R1009/Floor Coverings Res/Textile/S6				No Asbestos Detected		
B00E - R1010 - Resources Store (21.57 m2)						
No Asbestos						
B00E - R1011 - General Storeroom (1.94 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00E/R1011/Ceiling Structures/Linings/S24				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R1012 - Movement (48.29 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00E - R1013 - Stairs (12.54 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00E - R1014 - Stairs (6.35 m2)

Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	

B00E - R9001 - External Movement (9.1 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00E/R9001/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00E - R9003 - Change (26.13 m2)

No Asbestos

B00E - R9004 - General Storeroom (29.67 m2)

No Asbestos

B00E - R9005 - Resources Store (30.88 m2)

No Asbestos

B00E - R9006 - General Storeroom (30.65 m2)

No Asbestos

B00E - R9007 - Student Drinking Facilities (5.38 m2)

No Asbestos

B00E - R9008 - Movement (5.5 m2)

No Asbestos

B00E - R9009 - Toilets-Girls (96.56 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Technological & Applied Studies/General Learning - 1959 - Concrete Framed (Concrete Framed)

Exterior

Eaves Linings	Flat AC Sheeting	22m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8222/B00F/Eaves Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00F - R0001 - Resources Store (18.24 m2)

No Asbestos

B00F - R0002 - Cleaning Supplies Store (2.94 m2)

No Asbestos

B00F - R0003 - Food Technology L.S. (64.78 m2)

No Asbestos

B00F - R0006 - Food Technology L.S. (64.71 m2)

No Asbestos

B00F - R0007 - Food Technology L.S. (65.09 m2)

No Asbestos

B00F - R0008 - Resources Store (6.11 m2)

No Asbestos

B00F - R0009 - Resources Store (6.11 m2)

No Asbestos

B00F - R0010 - Wood Technology Bay (19.01 m2)

No Asbestos

B00F - R0011 - Class Tools Storage (2.27 m2)

No Asbestos

B00F - R0012 - Cleaning Store - Distributed (1.87 m2)

No Asbestos

B00F - R0013 - Distribution Board Cupboard (1.92 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0014 - Staff - Toilet (6 m2)

No Asbestos

B00F - R0015 - Workshop (31.64 m2)

No Asbestos

B00F - R0016 - General Storeroom (18.92 m2)

No Asbestos

B00F - R0017 - Laundry (4.49 m2)

No Asbestos

B00F - R0018 - Staff Kitchen (7.32 m2)

No Asbestos

B00F - R0019 - Movement (89.2 m2)

Floor Coverings Res/Textile	Vinyl Tiles	20m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	

B00F - R0020 - Stairs (4.48 m2)

No Asbestos

B00F - R0021 - External Movement (14.03 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00F/R0021/Ceiling Structures/Linings/S22				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00F - R0022 - External Movement (37.35 m2)						
No Asbestos						
B00F - R0023 - Preparation - Materials (25.38 m2)						
No Asbestos						
B00F - R1001 - Computer Learning Space (69.78 m2)						
No Asbestos						
B00F - R1002 - Resources Store (5.02 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00F - R1003 - General Storeroom (5.98 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00F - R1007 - Resources Store (18.83 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00F - R1008 - Staff Study (55.73 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	56m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00F - R1009 - Cleaning Store - Distributed (2.03 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00F - R1010 - General Learning Space (56.4 m2)						
No Asbestos						
B00F - R1011 - Movement (97.76 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	99m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00F - R1012 - Stairs (13.77 m2)						
No Asbestos						
B00F - R1013 - Movement (47.89 m2)						
No Asbestos						
B00F - R1014 - Project Store - Type 1 (11.59 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00F/R1014/Floor Coverings Res/Textile/S30				Chrysotile (white asbestos)		
B00F - R1015 - Handwashing Facilities (0.6 m2)						
No Asbestos						
B00F - R1016 - Senior Study (23.15 m2)						
No Asbestos						
B00F - R1017 - General Learning Space (54.44 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00F/R1017/Floor Coverings Res/Textile/S29				Chrysotile (white asbestos)		
B00F - R1018 - Handwashing Facilities (0.93 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R1019 - General Learning Space (55.75 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8222/B00F/R1017/Floor Coverings Res/Textile/S29	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00F - R1020 - Handwashing Facilities (0.53 m2)						
No Asbestos						
B00F - R9001 - Dark Room (14.5 m2)						
No Asbestos						
B00F - R9003 - General Storeroom (73.5 m2)						
No Asbestos						
B00F - R9004 - Sport Equipment Store (64.93 m2)						
No Asbestos						
B00F - R9005 - Movement (2.14 m2)						
No Asbestos						
B00F - R9006 - Darkroom Space (0.97 m2)						
No Asbestos						
B00F - R9007 - Dark Room (13.32 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Library/Science Learning - 1977 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00G - M1002 - Seminar (17.75 m2)**

Ceiling Structures/Linings	Vermiculite					
	8222/B00G/R1004/Ceiling Structures/Linings/S11					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00G - M1003 - Seminar (18.05 m2)

Ceiling Structures/Linings	Vermiculite					
	8222/B00G/R1004/Ceiling Structures/Linings/S11					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00G - M1004 - Stairs (3.91 m2)

No Asbestos

B00G - M1005 - Stairs (4.04 m2)

No Asbestos

B00G - M1007 - Computer Learning Space (57.74 m2)

Decorative Coating	Vermiculite					
	8222/B00G/R0019/Decorative Coating/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00G - M1008 - Senior Study (81.24 m2)

No Asbestos

B00G - R0001 - Laboratory L.S. (90.86 m2)

Floor Coverings Res/Textile	Vinyl Tiles	91m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8222/B00G/R1001/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8222/B00G/R1004/Ceiling Structures/Linings/S11					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00G - R0002 - Preparation - Science (48.6 m2)

Floor Coverings Res/Textile	Vinyl Tiles	49m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8222/B00G/R1001/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8222/B00G/R1004/Ceiling Structures/Linings/S11					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00G - R0003 - Staff - Toilet (4.01 m2)

Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8222/B00G/R1001/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

B00G - R0004 - Staff Study (41.59 m2)

Floor Coverings Res/Textile	Vinyl Tiles	42m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8222/B00G/R1001/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8222/B00G/R1004/Ceiling Structures/Linings/S11					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00G - R0005 - Resources Store (24.57 m2)

Floor Coverings Res/Textile	Vinyl Tiles	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8222/B00G/R1001/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

B00G - R0006 - Cleaning Store - Distributed (0.83 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00G/R1001/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00G - R0007 - Chemical Store (10.65 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00G/R1001/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00G - R0008 - Distribution Board Cupboard (0.92 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00G - R0009 - Laboratory L.S. (91.67 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	92m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00G/R1001/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
8222/B00G/R1004/Ceiling Structures/Linings/S11				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00G - R0010 - Preparation - Science (48.69 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	49m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00G/R1001/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
8222/B00G/R1004/Ceiling Structures/Linings/S11				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00G - R0011 - Laboratory L.S. (90.57 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	91m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00G/R1001/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
8222/B00G/R1004/Ceiling Structures/Linings/S11				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00G - R0013 - External Movement (3.28 m2)						
No Asbestos						
B00G - R0014 - Plant (16.09 m2)						
No Asbestos						
B00G - R0015 - External Movement (65.64 m2)						
No Asbestos						
B00G - R0016 - Stairs (11.77 m2)						
No Asbestos						
B00G - R0017 - Cleaning Store - Distributed (4.46 m2)						
No Asbestos						
B00G - R0018 - Movement (39.32 m2)						
Decorative Coating	Vermiculite					
8222/B00G/R0019/Decorative Coating/S33				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00G - R0019 - General Storeroom (15.15 m2)						
Decorative Coating	Vermiculite					
8222/B00G/R0019/Decorative Coating/S33				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00G - R0020 - Movement (3.97 m2)						
No Asbestos						
B00G - R1001 - General Storeroom (7.46 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00G/R1001/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00G - R1002 - Library Administration (19.83 m2)						
Ceiling Structures/Linings	Vermiculite		8222/B00G/R1004/Ceiling Structures/Linings/S11			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R1003 - Staff - Toilet (3.24 m2)						
No Asbestos						
B00G - R1004 - Main Entry (33.58 m2)						
Ceiling Structures/Linings	Vermiculite		8222/B00G/R1004/Ceiling Structures/Linings/S11			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R1005 - Movement (2.37 m2)						
No Asbestos						
B00G - R1006 - Staff - Toilet (3.25 m2)						
No Asbestos						
B00G - R1008 - Seminar (13.48 m2)						
Ceiling Structures/Linings	Vermiculite		8222/B00G/R1004/Ceiling Structures/Linings/S11			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R1009 - Seminar (11.51 m2)						
Ceiling Structures/Linings	Vermiculite		8222/B00G/R1004/Ceiling Structures/Linings/S11			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R1010 - Distribution Board Cupboard (0.54 m2)						
Ceiling Structures/Linings	Vermiculite		8222/B00G/R1004/Ceiling Structures/Linings/S11			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R1011 - Cleaning Store - Distributed (1.76 m2)						
Ceiling Structures/Linings	Vermiculite		8222/B00G/R1004/Ceiling Structures/Linings/S11			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R1012 - Independent Learning Space (7.12 m2)						
Ceiling Structures/Linings	Vermiculite		8222/B00G/R1004/Ceiling Structures/Linings/S11			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R1013 - Plant (0.53 m2)						
Ceiling Structures/Linings	Vermiculite		8222/B00G/R1004/Ceiling Structures/Linings/S11			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R1014 - Movement (4 m2)						
Ceiling Structures/Linings	Vermiculite		8222/B00G/R1004/Ceiling Structures/Linings/S11			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R1016 - Audio Visual Workroom (29.67 m2)						
Ceiling Structures/Linings	Vermiculite		8222/B00G/R1004/Ceiling Structures/Linings/S11			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R1017 - Librarian (10.11 m2)						
Ceiling Structures/Linings	Vermiculite		8222/B00G/R1004/Ceiling Structures/Linings/S11			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R1019 - External Movement (43.18 m2)						
No Asbestos						
B00G - R1020 - External Stairs (16.78 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00G - R1021 - Stairs (0.48 m2)

No Asbestos

B00G - R1022 - Stairs (0.48 m2)

No Asbestos

B00G - R1023 - Main Area (354.79 m2)

Ceiling Structures/Linings Vermiculite
8222/B00G/R1004/Ceiling Structures/Linings/S11

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00G - R1024 - Seminar (13.64 m2)

Decorative Coating Vermiculite
8222/B00G/R0019/Decorative Coating/S33

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00G - R1025 - Seminar (9.21 m2)

Decorative Coating Vermiculite
8222/B00G/R0019/Decorative Coating/S33

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00G - R1026 - Movement (18.73 m2)

No Asbestos

B00G - R1027 - General Storeroom (2.38 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Multi Purpose Facilities - 1984 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00H - M0001 - Performance Store (5.34 m2)**

No Asbestos

B00H - M0002 - Performance Store (5.34 m2)

No Asbestos

B00H - R0001 - Change (33.95 m2)

Partition Walls (Cubicles)	Flat AC Sheeting	12m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00H/R0012/Partition Walls (Cubicles)/S9					Chrysotile (white asbestos)	

Wall Linings Internal	Flat AC Sheeting					
8222/B00H/R0001/Wall Linings Internal/S10					No Asbestos Detected	

B00H - R0003 - Cleaning Store - Distributed (3.48 m2)

No Asbestos

B00H - R0005 - Staff Kitchen (15.89 m2)

Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	

B00H - R0006 - Music Store (9.11 m2)

Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	

B00H - R0007 - General Storeroom (9.15 m2)

Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00B/R1002/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	

B00H - R0008 - Chair Store (21.01 m2)

No Asbestos

B00H - R0011 - Distribution Board Cupboard (3.7 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00H - R0013 - Sport Equipment Store (34.02 m2)

Partition Walls (Cubicles)	Flat AC Sheeting	12m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8222/B00H/R0012/Partition Walls (Cubicles)/S9					Chrysotile (white asbestos)	

B00H - R0014 - General Storeroom (66.32 m2)

No Asbestos

B00H - R0015 - Stage (69.34 m2)

No Asbestos

B00H - R0017 - Sport Equipment Store (56.81 m2)

No Asbestos

B00H - R0018 - Multi-Purpose Space (483.91 m2)

No Asbestos

B00H - R0019 - Movement (15.46 m2)

No Asbestos

B00H - R0020 - Movement (15.61 m2)

No Asbestos

B00H - R0021 - Toilet - Lobby (3.07 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00H - R0022 - Toilets-Girls (15.07 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8222/B00H/R0025/Partition Walls (Cubicles)/S26					Chrysotile (white asbestos)	
B00H - R0023 - Control Room (6 m2)						
No Asbestos						
B00H - R0024 - Toilet - Lobby (2.62 m2)						
No Asbestos						
B00H - R0025 - Toilets-Boys (15.17 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	North	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8222/B00H/R0025/Partition Walls (Cubicles)/S26					Chrysotile (white asbestos)	
B00H - R0026 - External Movement (220.38 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Building Services - 2000 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids No Asbestos Found

Underfloor Voids No Asbestos Found

Interior

B001 - R0001 - General Assistants (13.93 m2)

No Asbestos

B001 - R0002 - Staff - Toilet (5.41 m2)

No Asbestos

B001 - R0003 - Machine Storage (12.23 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Y - Building Services - 2000 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00Y - R0001 - Plant (2.49 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Z - Storage - 2000 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00Z - R0001 - Chair Store (9.79 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

NS 200 - D10907 - Art Learning Space/Workshop/Bulk Store : Placement Date - 24/02/2012

Exterior

No Asbestos Found.

Interior

R1 - Art Learning Space

No Asbestos Found.

R2 - Workshop

No Asbestos Found.

R3 - Bulk Store

No Asbestos Found.

OS 600 - D11715 - Learning Unit - Small : Placement Date - 17/01/2013

Exterior

No Asbestos Found.

Interior

R1 - General Learning Space

No Asbestos Found.

OS 760 - D11745 - Woodwork/Store : Placement Date - 31/07/1997

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	17.28 m2

Interior

R1 - Woodwork

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	91 m2

R2 - Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2

NS 110 - D13168 - Learning Unit - Single Secondary/Secure : Placement Date - 25/02/2012

Exterior

No Asbestos Found.

Interior

R1 - General Learning Space

No Asbestos Found.

R2 - Entry

No Asbestos Found.

R3 - Secure Storeroom

No Asbestos Found.

NS 111 - D13171 - Learning Unit - Double Secondary/Secure : Placement Date - 12/01/2000

Exterior

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Interior**R1 - General Learning Space**

No Asbestos Found.

R2 - General Learning Space

No Asbestos Found.

R3 - Entry

No Asbestos Found.

R4 - Secure Storeroom

No Asbestos Found.

R5 - Secure Storeroom

No Asbestos Found.

R6 - Entry

No Asbestos Found.

OS 700 - D13262 - Art Learning Space/Workshop/Store : Placement Date - 5/02/1998**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	17.28 m2

Interior**R1 - Entry**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - Art Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	91 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

NS 110 - D15077 - Learning Unit - Single Secondary/Secure : Placement Date - 25/02/2012**Exterior**

No Asbestos Found.

Interior**R1 - General Learning Space**

No Asbestos Found.

R2 - Entry

No Asbestos Found.

R3 - Secure Storeroom

No Asbestos Found.

OS 710 - D15508 - Home Science/Pantry/Laundry : Placement Date - 28/02/2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Entry						
No Asbestos Found.						
R2 - Food Technology L.S.						
No Asbestos Found.						
R3 - Laundry						
No Asbestos Found.						
NS 110 - D15755 - Learning Unit - Single Secondary/Secure : Placement Date - 1/02/2011						
Exterior						
No Asbestos Found.						
Interior						
R1 - General Learning Space						
No Asbestos Found.						
R2 - Entry						
No Asbestos Found.						
R3 - Secure Storeroom						
No Asbestos Found.						
NS 260 - D16257 - Wood Technics/Storage : Placement Date - 26/10/2013						
Exterior						
No Asbestos Found.						
Interior						
R1 - Materials Technology L.S.						
No Asbestos Found.						
R2 - Store						
No Asbestos Found.						
R3 - Entry						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017