

# Asbestos Register


(Hazardous Materials and Risk Assessment)



**School :** Asquith Boys High School (8245)  
**Region :** Northern Sydney  
**State Electorate :** Hornsby  
**Local Government Area :** Hornsby

**Initial Survey :** Noel Arnold & Associates : 11 - Mar - 2008  
**Reviewed By :** Greencap-NAA : 14 - Jul - 2014

8245 - Asquith Boys High School  
Site Plan (11361)

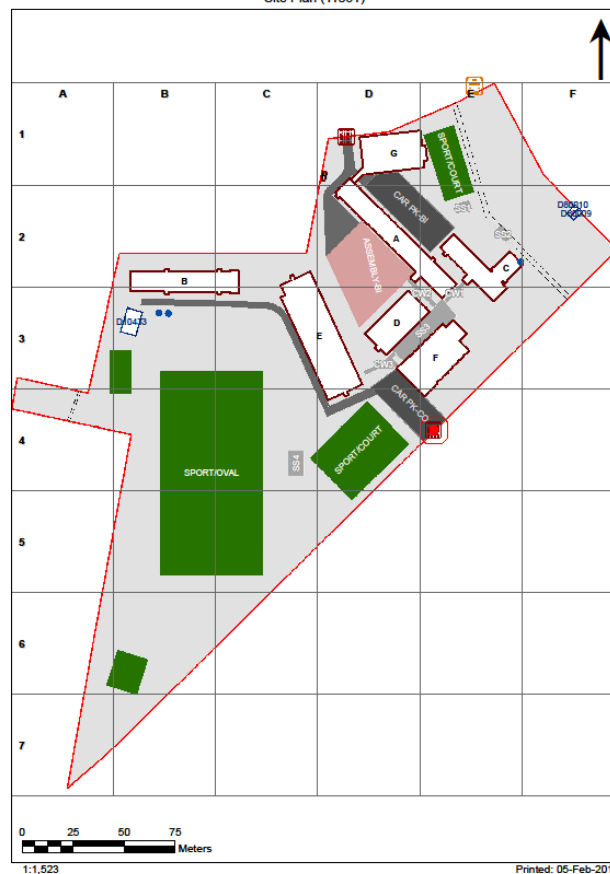

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00A - General Learning/Science Learning - 1963 - Concrete Framed (Concrete Framed)**

**Exterior**

Gable verge lining	Flat AC Sheeting	25m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00A/R0017/Ceiling Structures/Linings/S24			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Eaves Linings	Flat AC Sheeting	10m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00A/R0017/Ceiling Structures/Linings/S24			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00A - M0001 - Movement (7.75 m2)**

No Asbestos

**B00A - R0001 - Laboratory L.S. (93.53 m2)**

Fume Cupboard Exhaust Pipe	Fibre Cement Pipe	8m	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00A/R0008/Fume Cupboard Exhaust Pipe/S12			<b>Chrysotile (white asbestos)</b>		

Floor Coverings Res/Textile	Adhesive					
	8245/B00A/R0002/Floor Coverings Res/Textile/S23			<b>No Asbestos Detected</b>		

**B00A - R0002 - Preparation - Science (21.19 m2)**

Floor Coverings Res/Textile	Adhesive					
	8245/B00A/R0002/Floor Coverings Res/Textile/S23			<b>No Asbestos Detected</b>		

**B00A - R0003 - General Storeroom (6.14 m2)**

Floor Coverings Res/Textile	Adhesive					
	8245/B00A/R0002/Floor Coverings Res/Textile/S23			<b>No Asbestos Detected</b>		

**B00A - R0004 - Distribution Board Cupboard (0.88 m2)**

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	2m2	Fibre-cement sheeting under electrical box	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8245/B00A/R0017/Ceiling Structures/Linings/S24			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00A/R0017/Ceiling Structures/Linings/S24			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		

**B00A - R0005 - Tiered Learning Area (55.65 m2)**

Fume Cupboard Exhaust Pipe	Fibre Cement Pipe	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00A/R0008/Fume Cupboard Exhaust Pipe/S12			<b>Chrysotile (white asbestos)</b>		

**B00A - R0006 - Preparation - Science (9.11 m2)**

Floor Coverings Res/Textile	Adhesive					
	8245/B00A/R0002/Floor Coverings Res/Textile/S23			<b>No Asbestos Detected</b>		

**B00A - R0007 - General Storeroom (15.64 m2)**

No Asbestos

**B00A - R0008 - Laboratory L.S. (87.39 m2)**

Fume Cupboard Exhaust Pipe	Fibre Cement Pipe	8m	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00A/R0008/Fume Cupboard Exhaust Pipe/S12			<b>Chrysotile (white asbestos)</b>		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
Floor Coverings Res/Textile	Adhesive					
	8245/B00A/R0002/Floor Coverings Res/Textile/S23					<b>No Asbestos Detected</b>
<b>B00A - R0009 - Laboratory L.S. (89.4 m2)</b>						
Fume Cupboard Exhaust Pipe	Fibre Cement Pipe	8m	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00A/R0008/Fume Cupboard Exhaust Pipe/S12					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					
	8245/B00A/R0002/Floor Coverings Res/Textile/S23					<b>No Asbestos Detected</b>
<b>B00A - R0010 - Preparation - Science (24.86 m2)</b>						
Floor Coverings Res/Textile	Adhesive					
	8245/B00A/R0002/Floor Coverings Res/Textile/S23					<b>No Asbestos Detected</b>
<b>B00A - R0011 - Staff Study (51.98 m2)</b>						
Floor Coverings Res/Textile	Adhesivr					
	8245/B00A/R0002/Floor Coverings Res/Textile/S23					<b>No Asbestos Detected</b>
<b>B00A - R0012 - Chemical Store (18.97 m2)</b>						
No Asbestos						
<b>B00A - R0013 - Main Switchroom (4.02 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00A/R0017/Ceiling Structures/Linings/S24					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
<b>B00A - R0014 - Cleaning Store - Distributed (0.81 m2)</b>						
No Asbestos						
<b>B00A - R0015 - Staff - Toilet (9.9 m2)</b>						
No Asbestos						
<b>B00A - R0016 - Movement (129.9 m2)</b>						
No Asbestos						
<b>B00A - R0017 - Cleaning Store - Distributed (0.99 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00A/R0017/Ceiling Structures/Linings/S24					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
<b>B00A - R0018 - External Movement (13.75 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00A/R0017/Ceiling Structures/Linings/S24					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
<b>B00A - R0019 - Stairs (5.95 m2)</b>						
No Asbestos						
<b>B00A - R0020 - External Movement (2.66 m2)</b>						
No Asbestos						
<b>B00A - R0021 - Stairs (5.8 m2)</b>						
No Asbestos						
<b>B00A - R0022 - External Movement (2.66 m2)</b>						
No Asbestos						
<b>B00A - R1001 - General Learning Space (69.07 m2)</b>						
No Asbestos						
<b>B00A - R1002 - General Learning Space (55.81 m2)</b>						
No Asbestos						
<b>B00A - R1003 - Cleaning Store - Distributed (4.7 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles					
	8245/B00A/R1018/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>
<b>B00A - R1004 - Distribution Board Cupboard (0.89 m2)</b>				Note: No inspection of live electrical installation.		
Floor Coverings Res/Textile	Vinyl Tiles					
	8245/B00A/R1018/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>
Wall Linings Internal	Flat AC Sheeting	1m2	Fibre-cement sheeting under electrical box	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8245/B00A/R0017/Ceiling Structures/Linings/S24					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00A/R0017/Ceiling Structures/Linings/S24					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
<b>B00A - R1005 - General Storeroom (0.92 m2)</b>						
No Asbestos						
<b>B00A - R1006 - General Storeroom (0.73 m2)</b>						
No Asbestos						
<b>B00A - R1007 - Staff - Toilet (3.13 m2)</b>						
No Asbestos						
<b>B00A - R1008 - General Storeroom (3.04 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8245/B00A/R1018/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>
<b>B00A - R1009 - Computer Learning Space (55.5 m2)</b>						
No Asbestos						
<b>B00A - R1010 - Computer Store (9.98 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8245/B00A/R1018/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>
<b>B00A - R1011 - General Learning Space (55.96 m2)</b>						
No Asbestos						
<b>B00A - R1013 - General Learning Space (79.95 m2)</b>						
No Asbestos						
<b>B00A - R1014 - General Learning Space (55.97 m2)</b>						
No Asbestos						
<b>B00A - R1015 - Computer Learning Space (55.71 m2)</b>						
No Asbestos						
<b>B00A - R1017 - Distribution Board Cupboard (1.19 m2)</b>				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	2m2	Fibre-cement sheeting under electrical box	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8245/B00A/R0017/Ceiling Structures/Linings/S24					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00A/R0017/Ceiling Structures/Linings/S24					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
<b>B00A - R1018 - General Storeroom (7.42 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8245/B00A/R1018/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>
<b>B00A - R1019 - Movement (122.84 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	<b>Sample No</b>					<b>Test Result</b>

No Asbestos

**B00A - R1020 - Staff Study (27.04 m2)**

No Asbestos

**B00A - R1021 - Tea Room (3.82 m2)**

No Asbestos

**B00A - R1022 - Staff Study (23.04 m2)**

No Asbestos

**B00A - R1023 - Tea Room (2.97 m2)**

Floor Coverings  
Res/Textile

Adhesive

8245/B00A/R0002/Floor Coverings Res/Textile/S23

**No Asbestos Detected**

**B00A - R1024 - Stairs (1.93 m2)**

No Asbestos

**B00A - R1025 - Stairs (15.63 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Materials Learning/Technological & Applied Studies - 1963 - Concrete Framed (Concrete****Exterior**

Eaves Linings	Flat AC Sheeting	15m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction - Approx 8m</b>						
In-fill panels	Flat AC Sheeting 8245/B00B/R1015/Infill panels below windows/S21					<b>No Asbestos Detected</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00B - R0004 - Distribution Board Cupboard (0.92 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00B - R0005 - General Storeroom (11.42 m2)**

No Asbestos

**B00B - R0006 - Metal Technology L.S. (75.67 m2)**

Floor Coverings Res/Textile	Adhesive  8245/B00B/R0018/Floor Coverings Res/Textile/S25
--------------------------------	---

**No Asbestos Detected****B00B - R0007 - Materials Store (10.93 m2)**

No Asbestos

**B00B - R0008 - Materials Store (14.64 m2)**

No Asbestos

**B00B - R0010 - Materials Store (10.96 m2)**

No Asbestos

**B00B - R0011 - General Storeroom (12.61 m2)**

No Asbestos

**B00B - R0015 - Movement (10.12 m2)**

No Asbestos

**B00B - R0016 - Movement (10.96 m2)**

No Asbestos

**B00B - R0017 - Workshop (37.76 m2)**

No Asbestos

**B00B - R0018 - Staff Kitchen (5.51 m2)**

Floor Coverings Res/Textile	Adhesive  8245/B00B/R0018/Floor Coverings Res/Textile/S25
--------------------------------	---

**No Asbestos Detected****B00B - R0019 - Staff Study (24.89 m2)**

No Asbestos

**B00B - R0020 - Stairs (5.88 m2)**

No Asbestos

**B00B - R0021 - Metal Technology L.S. (75.05 m2)**

Floor Coverings Res/Textile	Adhesive  8245/B00B/R0018/Floor Coverings Res/Textile/S25
--------------------------------	---

**No Asbestos Detected****B00B - R0022 - Welding Area (7.19 m2)**

No Asbestos

**B00B - R0023 - Stairs (5.84 m2)**

No Asbestos

**B00B - R0024 - Food Technology L.S. (80.39 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R0025 - Preparation - Materials (11.76 m2)</b>						
No Asbestos						
<b>B00B - R0026 - Pantry (3.58 m2)</b>						
No Asbestos						
<b>B00B - R0027 - Seminar (32.14 m2)</b>						
No Asbestos						
<b>B00B - R0028 - Laundry (8.31 m2)</b>						
No Asbestos						
<b>B00B - R0029 - External Movement (2.67 m2)</b>						
No Asbestos						
<b>B00B - R0030 - External Movement (2.62 m2)</b>						
No Asbestos						
<b>B00B - R0031 - External Movement (2.65 m2)</b>						
No Asbestos						
<b>B00B - R0032 - External Movement (2.69 m2)</b>						
No Asbestos						
<b>B00B - R1001 - Change (38.7 m2)</b>						
No Asbestos						
<b>B00B - R1002 - Materials Store (22.99 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	28m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8245/B00B/R1008/Floor Coverings Res/Textile/S22					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1003 - Staff - Toilet (6.24 m2)</b>						
No Asbestos						
<b>B00B - R1004 - Cleaning Store - Distributed (1.13 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8245/B00B/R1008/Floor Coverings Res/Textile/S22					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1005 - Distribution Board Cupboard (1.04 m2)</b>						
Note: No inspection of live electrical installation.						
Wall Linings Internal	Flat AC Sheeting	2m2	Fibre-cement sheeting under electrical box	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8245/B00B/R1005/Wall Linings Internal/S26					<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8245/B00B/R1008/Floor Coverings Res/Textile/S22					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1006 - Wood Technology L.S. (86.11 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	East facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8245/B00B/R1008/Floor Coverings Res/Textile/S22					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1007 - Materials Store (10.1 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8245/B00B/R1008/Floor Coverings Res/Textile/S22					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1008 - Plant (4.35 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8245/B00B/R1008/Floor Coverings Res/Textile/S22					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1011 - General Storeroom (1.08 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8245/B00B/R1012/Floor Coverings Res/Textile/S20					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1012 - Materials Store (17.21 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	17m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8245/B00B/R1012/Floor Coverings Res/Textile/S20					Chrysotile (white asbestos)	
<b>B00B - R1013 - Metal Technology L.S. (83.13 m2)</b>						
No Asbestos						
<b>B00B - R1014 - Materials Store (41.2 m2)</b>						
No Asbestos						
<b>B00B - R1016 - Movement (10.92 m2)</b>						
Infill panels below windows	Flat AC Sheeting					
8245/B00B/R1015/Infill panels below windows/S21					No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive					
8245/B00B/R0018/Floor Coverings Res/Textile/S25					No Asbestos Detected	
Ceiling Structures/Linings	Flat AC Sheeting					
8245/B00B/R1016/Ceiling Structures/Linings/S27					No Asbestos Detected	
<b>B00B - R1017 - Wood Technology L.S. (85.43 m2)</b>						
Floor Coverings Res/Textile	Adhesive					
8245/B00B/R0018/Floor Coverings Res/Textile/S25					No Asbestos Detected	
<b>B00B - R1018 - Movement (17.73 m2)</b>						
Floor Coverings Res/Textile	Adhesive					
8245/B00B/R0018/Floor Coverings Res/Textile/S25					No Asbestos Detected	
Ceiling Structures/Linings	Flat AC Sheeting					
8245/B00B/R1016/Ceiling Structures/Linings/S27					No Asbestos Detected	
Infill panels	Flat AC Sheeting					
8245/B00B/R1015/Infill panels below windows/S21					No Asbestos Detected	
<b>B00B - R1019 - Materials Store (11.66 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8245/B00B/R1012/Floor Coverings Res/Textile/S20					Chrysotile (white asbestos)	
<b>B00B - R1020 - Plant (3.79 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8245/B00B/R1008/Floor Coverings Res/Textile/S22					Chrysotile (white asbestos)	
<b>B00B - R1021 - Stairs (17.64 m2)</b>						
Floor Coverings Res/Textile	Adhesive					
8245/B00A/R1018/Floor Coverings Res/Textile/S11					No Asbestos Detected	
Ceiling Structures/Linings	Flat AC Sheeting					
8245/B00B/R1016/Ceiling Structures/Linings/S27					No Asbestos Detected	
<b>B00B - R1022 - Stairs (17.64 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
8245/B00B/R1016/Ceiling Structures/Linings/S27					No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive					
8245/B00B/R0018/Floor Coverings Res/Textile/S25					No Asbestos Detected	
<b>B00B - R9001 - General Storeroom (27.35 m2)</b>						
No Asbestos						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Administration/Computer Learning - 1963 - Concrete Framed (Concrete Framed)****Exterior**

Eaves Linings	Flat AC Sheeting	100m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00C/Eaves Linings/S35					<b>Chrysotile (white asbestos)</b>
Gable verge lining	Flat AC Sheeting	40m	North facing, South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00C/Gable verge lining/S34					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00C - R0001 - Tea Room (15.1 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00C/R0027/Floor Coverings Res/Textile/S32					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	8245/B00C/R0027/Floor Coverings Res/Textile/S42					

**B00C - R0002 - Interview/Office - Type 1 (14.45 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00C/R0027/Floor Coverings Res/Textile/S32					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	8245/B00C/R0027/Floor Coverings Res/Textile/S42					

**B00C - R0003 - Principal Office (20.57 m2)**

No Asbestos

**B00C - R0004 - General Storeroom (3.08 m2)**

No Asbestos

**B00C - R0005 - Staff - Toilet (1.42 m2)**

No Asbestos

**B00C - R0006 - Bulk Store (16.09 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	8245/B00C/R0006/Floor Coverings Res/Textile/S33					

**B00C - R0007 - Administration - Clerical (18.29 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00C/R0027/Floor Coverings Res/Textile/S32					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	8245/B00C/R0027/Floor Coverings Res/Textile/S42					

**B00C - R0008 - Distribution Board Cupboard (0.62 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00C/R0008/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Wall Linings Internal	Flat AC Sheeting	1m2	Fibre-cement sheeting under electrical box	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8245/B00C/R0008/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00C - R0009 - Cleaning Store - Distributed (1.92 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00C - R0010 - Staff - Toilet (5.04 m2)</b>						
No Asbestos						
<b>B00C - R0011 - Staff - Toilet (4.79 m2)</b>						
No Asbestos						
<b>B00C - R0012 - Printing/Photocopying (65.11 m2)</b>						
No Asbestos						
<b>B00C - R0013 - Movement (12.09 m2)</b>						
Floor Coverings Res/Textile	Adhesive					
	8245/B00C/R0013/Floor Coverings Res/Textile/S31					<b>No Asbestos Detected</b>
<b>B00C - R0014 - Computer Learning Space (51.05 m2)</b>						
No Asbestos						
<b>B00C - R0015 - Administration - Clerical (14.32 m2)</b>						
No Asbestos						
<b>B00C - R0016 - Deputy Principal Office (14.78 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00C/R0027/Floor Coverings Res/Textile/S32					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					
	8245/B00C/R0027/Floor Coverings Res/Textile/S42					<b>No Asbestos Detected</b>
<b>B00C - R0017 - Clinic - Boys (14.62 m2)</b>						
No Asbestos						
<b>B00C - R0020 - Administration - Executive (20.21 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00C/R0027/Floor Coverings Res/Textile/S32					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					
	8245/B00C/R0027/Floor Coverings Res/Textile/S42					<b>No Asbestos Detected</b>
<b>B00C - R0021 - Administration - Clerical (26.82 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00C/R0027/Floor Coverings Res/Textile/S32					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					
	8245/B00C/R0027/Floor Coverings Res/Textile/S42					<b>No Asbestos Detected</b>
<b>B00C - R0023 - External Movement (4.88 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	8245/B00C/R0025/Ceiling Structures/Linings/S4					<b>No Asbestos Detected</b>
<b>B00C - R0024 - External Movement (5.12 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	8245/B00C/R0025/Ceiling Structures/Linings/S4					<b>No Asbestos Detected</b>
<b>B00C - R0025 - External Movement (12.39 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	8245/B00C/R0025/Ceiling Structures/Linings/S4					<b>No Asbestos Detected</b>
<b>B00C - R0026 - Administration - Clerical (14.41 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00C/R0027/Floor Coverings Res/Textile/S32					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					
	8245/B00C/R0027/Floor Coverings Res/Textile/S42					<b>No Asbestos Detected</b>
<b>B00C - R0027 - Public Reception (76.38 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8245/B00C/R0027/Floor Coverings Res/Textile/S32	77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive 8245/B00C/R0027/Floor Coverings Res/Textile/S42					<b>No Asbestos Detected</b>

**B00C - R0028 - External Movement (2.64 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Pupil Facilities/Building Services - 1963 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting 8245/B00D/Awnings/S2					No Asbestos Detected
In-fill panels	Flat AC Sheeting 8245/B00D/In-fill panels/S3					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00D - R0001 - Staff - Toilet (4.66 m2)**

Overhead urinal cistern	Fibre Cement Casting (Monocrete) 8245/B00D/R0001/Overhead urinal cistern/S1					No Asbestos Detected
-------------------------	--	--	--	--	--	----------------------

**B00D - R0002 - Staff - Toilet (6.73 m2)**

No Asbestos

**B00D - R0003 - General Storeroom (6.48 m2)**

No Asbestos

**B00D - R0004 - Student Canteen (49.81 m2)**

Floor Coverings Res/Textile	Adhesive 8245/B00D/R0004/Floor Coverings Res/Textile/S38					No Asbestos Detected
-----------------------------	---	--	--	--	--	----------------------

**B00D - R0005 - General Storeroom (4.07 m2)**

No Asbestos

**B00D - R0006 - Staff - Toilet (1.31 m2)**

No Asbestos

**B00D - R0009 - Toilets-Boys (53.71 m2)**

No Asbestos

**B00D - R0010 - Cleaning Store - Distributed (11.73 m2)**

No Asbestos

**B00D - R0011 - Sport Equipment Store (7.02 m2)**

No Asbestos

**B00D - R0012 - Toilets-Boys (30.01 m2)**

No Asbestos

**B00D - R0013 - Machine Storage (12.67 m2)**

No Asbestos

**B00D - R0015 - General Assistants (6.84 m2)**

No Asbestos

**B00D - R0017 - General Storeroom (19.23 m2)**

No Asbestos

**B00D - R0018 - General Storeroom (12.47 m2)**

No Asbestos

**B00D - R0019 - Student Drinking Facilities (185.92 m2)**

No Asbestos

**B00D - R0020 - External Movement (4.33 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 8245/B00D/Awnings/S2					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Library/General Learning - 1963 - Concrete Framed (Concrete Framed)****Exterior**

Gable verge lining	Flat AC Sheeting 8245/B00E/R0030/Ceiling Structures/Linings/S29	40m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Eaves Linings	Flat AC Sheeting 8245/B00E/R0030/Ceiling Structures/Linings/S29	50m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
In-fill panels	Flat AC Sheeting 8245/B00E/In-fill panels/S36					<b>No Asbestos Detected</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00E - R0001 - Cleaning Store - Distributed (1.29 m2)**

No Asbestos

**B00E - R0002 - Toilets-Boys (9.24 m2)**

No Asbestos

**B00E - R0003 - Staff Study (25.36 m2)**

No Asbestos

**B00E - R0004 - General Learning Space (52.85 m2)**

No Asbestos

**B00E - R0005 - General Storeroom (5.98 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 8245/B00E/R0005/Floor Coverings Res/Textile/S16	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		

**B00E - R0006 - General Learning Space (52.78 m2)**

No Asbestos

**B00E - R0007 - Sport Equipment Store (6.08 m2)**

No Asbestos

**B00E - R0008 - Fitness Laboratory (52.56 m2)**

No Asbestos

**B00E - R0009 - Fitness Laboratory (5.93 m2)**

No Asbestos

**B00E - R0010 - Main Area (294.12 m2)**

Ceiling Structures/Linings	Vermiculite 8245/B00E/R0029/Ceiling Structures/Linings/S15					<b>Limited Samples Taken</b>
				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		

**B00E - R0011 - Distribution Board Cupboard (0.27 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00E - R0012 - Sport Equipment Store (18.94 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 8245/B00E/R0014/Floor Coverings Res/Textile/S17	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		

**B00E - R0013 - General Storeroom (3.54 m2)**

No Asbestos

**B00E - R0014 - Movement (23.9 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 8245/B00E/R0014/Floor Coverings Res/Textile/S17	27m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		

**B00E - R0015 - Library Administration (26.11 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00E - R0016 - Librarian (17.37 m2)</b>						
No Asbestos						
<b>B00E - R0017 - Interview/Meeting (34.94 m2)</b>						
No Asbestos						
<b>B00E - R0018 - Cleaning Store - Distributed (3.55 m2)</b>						
No Asbestos						
<b>B00E - R0019 - General Storeroom (1.29 m2)</b>						
No Asbestos						
<b>B00E - R0020 - Staff - Toilet (9.94 m2)</b>						
No Asbestos						
<b>B00E - R0021 - Special Education Support Centre (26.33 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8245/B00E/R0014/Floor Coverings Res/Textile/S17	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R0022 - Movement (26.67 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8245/B00E/R0014/Floor Coverings Res/Textile/S17	28m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8245/B00E/R0029/Ceiling Structures/Linings/S15					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00E - R0024 - Computer Learning Space (39.42 m2)</b>						
No Asbestos						
<b>B00E - R0027 - Craft Store (15.41 m2)</b>						
Floor Coverings Res/Textile	Adhesive 8245/B00E/R0029/Floor Coverings Res/Textile/S28					<b>No Asbestos Detected</b>
<b>B00E - R0028 - General Storeroom (3.69 m2)</b>						
No Asbestos						
<b>B00E - R0029 - Movement (81.48 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8245/B00E/R0029/Ceiling Structures/Linings/S15					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Adhesive 8245/B00E/R0029/Floor Coverings Res/Textile/S28					<b>No Asbestos Detected</b>
<b>B00E - R0030 - External Movement (52.68 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 8245/B00E/R0030/Ceiling Structures/Linings/S29	36m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00E - R0031 - Computer Store (12.35 m2)</b>						
No Asbestos						
<b>B00E - R0032 - Careers Advisers Office (12.53 m2)</b>						
No Asbestos						
<b>B00E - R0033 - Art Learning Space (63.63 m2)</b>						
Floor Coverings Res/Textile	Adhesive 8245/B00E/R0029/Floor Coverings Res/Textile/S28					<b>No Asbestos Detected</b>
<b>B00E - R0034 - Resources Store (9.33 m2)</b>						
No Asbestos						
<b>B00E - R0035 - Stairs (10.27 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00E - R0036 - Stairs (9.54 m2)</b>						
No Asbestos						
<b>B00E - R0037 - Stairs (9.81 m2)</b>						
No Asbestos						
<b>B00E - R0038 - External Movement (3.49 m2)</b>						
No Asbestos						
<b>B00E - R0039 - External Movement (3.96 m2)</b>						
No Asbestos						
<b>B00E - R1001 - Staff Study (38.64 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
			8245/B00E/R1012/Floor Coverings Res/Textile/S18			<b>No Asbestos Detected</b>
<b>B00E - R1002 - General Learning Space (39.27 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
			8245/B00E/R1012/Floor Coverings Res/Textile/S18			<b>No Asbestos Detected</b>
<b>B00E - R1003 - General Learning Space (52.78 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
			8245/B00E/R1012/Floor Coverings Res/Textile/S18			<b>No Asbestos Detected</b>
<b>B00E - R1004 - General Learning Space (51.91 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
			8245/B00E/R1012/Floor Coverings Res/Textile/S18			<b>No Asbestos Detected</b>
<b>B00E - R1005 - General Learning Space (52.48 m2)</b>						
No Asbestos						
<b>B00E - R1006 - Distribution Board Cupboard (0.32 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00E - R1007 - General Storeroom (13.21 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
			8245/B00E/R1012/Floor Coverings Res/Textile/S18			<b>No Asbestos Detected</b>
<b>B00E - R1008 - General Learning Space (52.56 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
			8245/B00E/R1012/Floor Coverings Res/Textile/S18			<b>No Asbestos Detected</b>
<b>B00E - R1009 - General Learning Space (65.35 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
			8245/B00E/R1012/Floor Coverings Res/Textile/S18			<b>No Asbestos Detected</b>
<b>B00E - R1010 - General Storeroom (8.82 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
			8245/B00E/R1012/Floor Coverings Res/Textile/S18			<b>No Asbestos Detected</b>
<b>B00E - R1011 - General Storeroom (3.35 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
			8245/B00E/R1012/Floor Coverings Res/Textile/S18			<b>No Asbestos Detected</b>
<b>B00E - R1012 - Cleaning Store - Distributed (3.62 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
			8245/B00E/R1012/Floor Coverings Res/Textile/S18			<b>No Asbestos Detected</b>
<b>B00E - R1013 - Staff - Toilet (9.61 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
No Asbestos						
<b>B00E - R1014 - Special Education Support Centre (25.49 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8245/B00E/R1012/Floor Coverings Res/Textile/S18					No Asbestos Detected
<b>B00E - R1015 - General Learning Space (52.78 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8245/B00E/R1012/Floor Coverings Res/Textile/S18					No Asbestos Detected
<b>B00E - R1016 - General Learning Space (51.97 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8245/B00E/R1012/Floor Coverings Res/Textile/S18					No Asbestos Detected
<b>B00E - R1017 - General Storeroom (13.19 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8245/B00E/R1012/Floor Coverings Res/Textile/S18					No Asbestos Detected
<b>B00E - R1018 - Staff Study (52.63 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8245/B00E/R1012/Floor Coverings Res/Textile/S18					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting					
	8245/B00E/R1018/Wall Linings Internal/S30					No Asbestos Detected
<b>B00E - R1019 - General Storeroom (8.42 m2)</b>						
No Asbestos						
<b>B00E - R1020 - General Storeroom (3.55 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8245/B00E/R1012/Floor Coverings Res/Textile/S18					No Asbestos Detected
<b>B00E - R1021 - General Learning Space (52.71 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8245/B00E/R1012/Floor Coverings Res/Textile/S18					No Asbestos Detected
<b>B00E - R1022 - General Learning Space (53.14 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8245/B00E/R1012/Floor Coverings Res/Textile/S18					No Asbestos Detected
<b>B00E - R1023 - General Learning Space (65.72 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8245/B00E/R1012/Floor Coverings Res/Textile/S18					No Asbestos Detected
<b>B00E - R1024 - General Storeroom (8.45 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8245/B00E/R1024/Floor Coverings Res/Textile/S19					No Asbestos Detected
<b>B00E - R1025 - Movement (187.76 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8245/B00E/R1012/Floor Coverings Res/Textile/S18					No Asbestos Detected
<b>B00E - R1026 - Stairs (14.44 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	West	Good Condition (1)	Medium (2)	Low Priority (2-3)
	8245/B00E/R0014/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)
<b>B00E - R1027 - Stairs (14.34 m2)</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8245/B00E/R0014/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
<b>B00E - R1028 - Stairs (14.07 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8245/B00E/R0014/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Multi Purpose Facilities - 1967 - Brick/Block (Brick/Block)**

**Exterior**

In-fill Panel	Flat AC Sheeting 8245/B00F/In-fill Panel/S10					<b>No Asbestos Detected</b>
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

**Interior**

**B00F - M0002 - Performing Arts Store (21.69 m2)**

No Asbestos

**B00F - M0003 - Performing Arts Store (22.33 m2)**

No Asbestos

**B00F - M0004 - Movement (0.86 m2)**

No Asbestos

**B00F - M0005 - Control Room (4.27 m2)**

No Asbestos

**B00F - M0006 - Control Room (4.27 m2)**

No Asbestos

**B00F - M0007 - Movement (7.5 m2)**

No Asbestos

**B00F - R0001 - Entry (7.23 m2)**

No Asbestos

**B00F - R0002 - Staff Kitchen (9.85 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00F/R0002/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

Floor Coverings Res/Textile

Adhesive  
8245/B00F/R0002/Floor Coverings Res/Textile/S37

**No Asbestos Detected**

**B00F - R0003 - Multi-Purpose Space (379.39 m2)**

No Asbestos

**B00F - R0004 - Stage (122.5 m2)**

No Asbestos

**B00F - R0005 - External Movement (34.96 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	36m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8245/B00F/R0005/Ceiling Structures/Linings/S6					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00F - R0006 - Stairs (1.02 m2)**

No Asbestos

**B00F - R0007 - Stairs (0.95 m2)**

No Asbestos

**B00F - R0008 - Stairs (0.98 m2)**

No Asbestos

**B00F - R0009 - Stairs (7.13 m2)**

No Asbestos

**B00F - R0010 - Stairs (7.08 m2)**

No Asbestos

**B00F - R9001 - Movement (2.25 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8245/B00F/R9009/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00F - R9002 - Cleaning Store - Distributed (1.65 m2)</b>						
No Asbestos						
<b>B00F - R9005 - Movement (3.56 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8245/B00F/R9009/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00F - R9006 - Shower (9.12 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8245/B00F/R9009/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00F - R9007 - Cleaning Store - Distributed (1.64 m2)</b>						
No Asbestos						
<b>B00F - R9008 - General Storeroom (18 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8245/B00F/R9009/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00F - R9009 - Toilets-Boys (1.44 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8245/B00F/R9009/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00F - R9010 - Chair Store (27.83 m2)</b>						
No Asbestos						
<b>B00F - R9011 - Toilets-Boys (9.31 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8245/B00F/R9009/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00F - R9012 - Plant (1.85 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8245/B00F/R9009/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Hot Water System	Encapsulated Insulation material within unit	2Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Assumed asbestos insulation incased</b>						
<b>B00F - R9013 - Shower (10.37 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8245/B00F/R9009/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00F - R9014 - Change (28.07 m2)</b>						
No Asbestos						
<b>B00F - R9015 - Stairs (4.78 m2)</b>						
No Asbestos						
<b>B00F - R9016 - Stairs (4.77 m2)</b>						
No Asbestos						
<b>B00F - R9017 - External Movement (27.13 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00G - Music/Science Learning - 1965 - Brick/Block (Brick/Block)****Exterior**

In-fill Panel	Flat AC Sheeting 8245/B00G/In-fill Panel/S40	130m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Gasket material	2Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Not sampled - Live</b>						

**Interior****B00G - M0001 - Movement (30.26 m2)**

No Asbestos

**B00G - M0002 - Distribution Board Cupboard (1.18 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00G - R0001 - Laboratory L.S. (86.42 m2)**

Ceiling Structures/Linings	Vermiculite 8245/B00G/R0014/Ceiling Structures/Linings/S13	<b>Limited Samples Taken</b>				
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Adhesive 8245/B00G/R1015/Floor Coverings Res/Textile/S39	<b>No Asbestos Detected</b>				

**B00G - R0002 - Preparation - Science (28.68 m2)**

Fume Cupboard	Flat AC Sheeting 8245/B00G/R0002/Fume Cupboard/S14	2Unit	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Fume Cupboard Exhaust Pipe	Fibre Cement Pipe 8245/B00A/R0008/Fume Cupboard Exhaust Pipe/S12	8m	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Vermiculite 8245/B00G/R0014/Ceiling Structures/Linings/S13	<b>Limited Samples Taken</b>				
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Adhesive 8245/B00G/R1015/Floor Coverings Res/Textile/S39	<b>No Asbestos Detected</b>				

**B00G - R0003 - General Storeroom (9.15 m2)**

Ceiling Structures/Linings	Vermiculite 8245/B00G/R0014/Ceiling Structures/Linings/S13	<b>Limited Samples Taken</b>				
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Adhesive 8245/B00G/R1015/Floor Coverings Res/Textile/S39	<b>No Asbestos Detected</b>				

**B00G - R0004 - Laboratory L.S. (85.86 m2)**

Ceiling Structures/Linings	Vermiculite 8245/B00G/R0014/Ceiling Structures/Linings/S13	<b>Limited Samples Taken</b>				
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Adhesive 8245/B00G/R1015/Floor Coverings Res/Textile/S39	<b>No Asbestos Detected</b>				

**B00G - R0005 - General Storeroom (4.44 m2)**

No Asbestos

**B00G - R0006 - Performance Workspace (53.88 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite		8245/B00G/R0014/Ceiling Structures/Linings/S13			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R0007 - General Storeroom (5.88 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8245/B00G/R0014/Ceiling Structures/Linings/S13			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R0008 - Chemical Store (6.12 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8245/B00G/R0014/Ceiling Structures/Linings/S13			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R0009 - Commonroom (66.28 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8245/B00G/R0014/Ceiling Structures/Linings/S13			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R0010 - Staff Kitchen (12.78 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8245/B00G/R0014/Ceiling Structures/Linings/S13			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Adhesive		8245/B00G/R1015/Floor Coverings Res/Textile/S39			No Asbestos Detected
<b>B00G - R0011 - Resources Store (12.81 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8245/B00G/R0014/Ceiling Structures/Linings/S13			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R0015 - Movement (3.88 m2)</b>						
No Asbestos						
<b>B00G - R0017 - Stairs (0.3 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8245/B00G/R0014/Ceiling Structures/Linings/S13			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R0018 - Distribution Board Cupboard (0.83 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00G - R0019 - Movement (8.56 m2)</b>						
No Asbestos						
<b>B00G - R0020 - Stairs (4.46 m2)</b>						
No Asbestos						
<b>B00G - R0021 - Staff Study (25.62 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8245/B00G/R0014/Ceiling Structures/Linings/S13			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R0022 - Movement (75.24 m2)</b>						
Floor Coverings Res/Textile	Adhesive		8245/B00G/R1015/Floor Coverings Res/Textile/S39			No Asbestos Detected
Ceiling Structures/Linings	Vermiculite		8245/B00G/R0014/Ceiling Structures/Linings/S13			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R0023 - External Movement (16.6 m2)</b>						
No Asbestos						
<b>B00G - R1001 - Music Learning Space (65.44 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8245/B00G/R0014/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00G - R1002 - Music Store (12.46 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8245/B00G/R0014/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00G - R1003 - Art Learning Space (66.26 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8245/B00G/R0014/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Adhesive 8245/B00G/R1015/Floor Coverings Res/Textile/S39					No Asbestos Detected
<b>B00G - R1004 - Resources Store (6.07 m2)</b>						
Floor Coverings Res/Textile	Adhesive 8245/B00G/R1015/Floor Coverings Res/Textile/S39					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 8245/B00G/R0014/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Flue	Fibre Cement Pipe	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)  <i>Assumed Asbestos - Unable to sample without excess</i>
<b>B00G - R1005 - Visual Arts Workshop (25.13 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8245/B00G/R0014/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Adhesive 8245/B00G/R1015/Floor Coverings Res/Textile/S39					No Asbestos Detected
<b>B00G - R1007 - Dark Room (6.15 m2)</b>						
Ceiling Structures/Linings	Textile 8245/B00G/R0014/Ceiling Structures/Linings/S13					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 8245/B00G/R1015/Floor Coverings Res/Textile/S39					No Asbestos Detected
<b>B00G - R1009 - Cleaning Store - Distributed (2.86 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8245/B00G/R0014/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00G - R1011 - Kiln Space (3.33 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8245/B00G/R0014/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Adhesive 8245/B00G/R1015/Floor Coverings Res/Textile/S39					No Asbestos Detected
Kiln	Encapsulated Insulation material within unit	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Assumed Asbestos - Assumed asbestos insulation</i>
<b>B00G - R1012 - Craft Store (6.02 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8245/B00G/R0014/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive					
	8245/B00G/R1015/Floor Coverings Res/Textile/S39					No Asbestos Detected
<b>B00G - R1014 - Resources Store (8.74 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8245/B00G/R0014/Ceiling Structures/Linings/S13					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Adhesive					
	8245/B00G/R1015/Floor Coverings Res/Textile/S39					No Asbestos Detected
<b>B00G - R1015 - Movement (77.22 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8245/B00G/R0014/Ceiling Structures/Linings/S13					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Adhesive					
	8245/B00G/R1015/Floor Coverings Res/Textile/S39					No Asbestos Detected
<b>B00G - R1018 - Stairs (4.38 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8245/B00G/R0014/Ceiling Structures/Linings/S13					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
<b>B00G - R1019 - Darkroom Space (3.4 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8245/B00G/R0014/Ceiling Structures/Linings/S13					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Adhesive					
	8245/B00G/R1015/Floor Coverings Res/Textile/S39					No Asbestos Detected
<b>B00G - R1020 - Photographic Studio (22.76 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8245/B00G/R0014/Ceiling Structures/Linings/S13					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Adhesive					
	8245/B00G/R1015/Floor Coverings Res/Textile/S39					No Asbestos Detected
<b>B00G - R1021 - Art Learning Space (104.32 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8245/B00G/R0014/Ceiling Structures/Linings/S13					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Adhesive					
	8245/B00G/R1015/Floor Coverings Res/Textile/S39					No Asbestos Detected
<b>B00G - R1022 - Kiln Space (4.96 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8245/B00G/R0014/Ceiling Structures/Linings/S13					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Adhesive					
	8245/B00G/R1015/Floor Coverings Res/Textile/S39					No Asbestos Detected
Kiln	Encapsulated Insulation material within unit	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	<i>Assumed Asbestos - Assumed asbestos insulation</i>					
<b>B00G - R1023 - Performance Workshop (25.8 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Vermiculite  
 8245/B00G/R0014/Ceiling Structures/Linings/S13 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00G - R1024 - Seminar (26.83 m2)**

Ceiling Structures/Linings Vermiculite  
 8245/B00G/R0014/Ceiling Structures/Linings/S13 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00G - R1025 - External Movement (3.05 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Building Services - 2009 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00H - R0001 - Plant (5.4 m2)**

Debris	Gasket material	3Unit	Central	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	8245/B00H/R0001/Debris/S41					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Build+1 - Walkway between buildings A & G**

**Exterior**

In-fill panels	Flat AC Sheeting 8245/B00D/In-fill panels/S3					<b>No Asbestos Detected</b>
----------------	---	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 710 - D10433 - Home Science/Pantry/Laundry : Placement Date - 14/01/2011**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Entry**

No Asbestos Found.

**R2 - Food Technology L.S.**

No Asbestos Found.

**R3 - Laundry**

No Asbestos Found.

**OS 971 - D80009 - Shed - Container (Garden/Sports/Bulk) : Placement Date - 30/06/1995**

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Garden Store**

No Asbestos Found.

**OS 971 - D80010 - Shed - Container (Garden/Sports/Bulk) : Placement Date - 30/06/1995**

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Garden Store**

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017