


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Ashfield Boys High School (8832)
Region : Sydney
State Electorate : Summer Hill
Local Government Area : Ashfield

Initial Survey : Noel Arnold & Associates : 05 - May - 2008
Reviewed By : Parsons Brinckerhoff : 01 - Nov - 2016

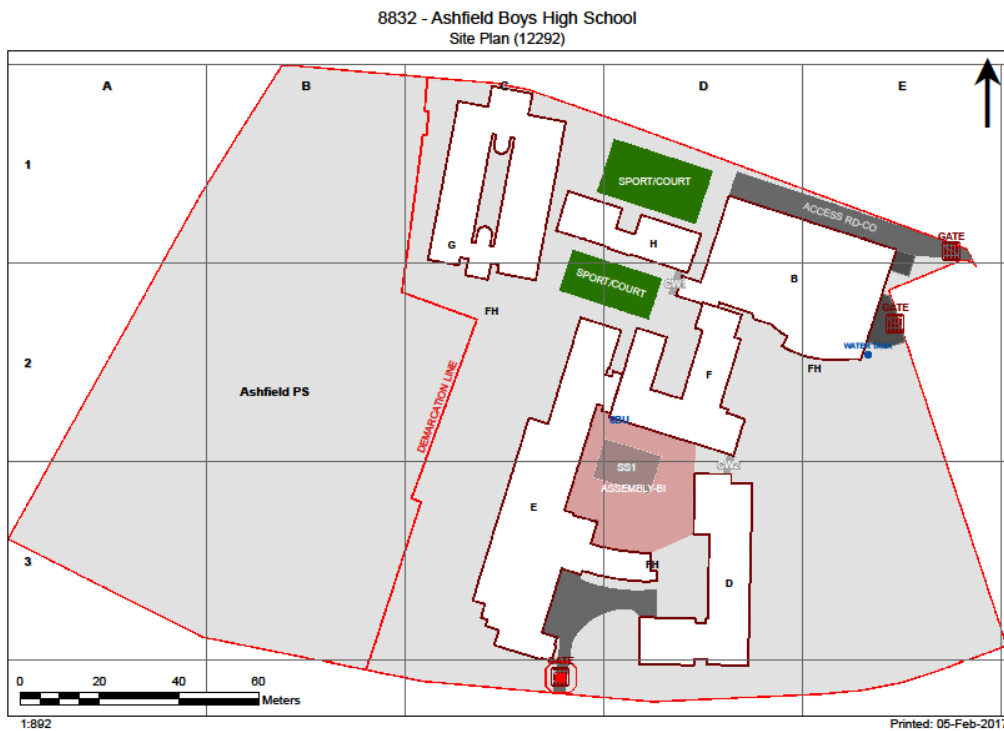

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Multi Purpose Facilities - 2002 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00B - R0001 - Shower/Change (64.82 m2)**

No Asbestos

B00B - R0002 - Toilets - Boys (9.33 m2)

No Asbestos

B00B - R0003 - Toilets-Disabled (5.88 m2)

No Asbestos

B00B - R0004 - Toilets - Girls (11.63 m2)

No Asbestos

B00B - R0005 - Cleaning Store - Distributed (2.86 m2)

No Asbestos

B00B - R0006 - Clinic - Boys (14.41 m2)

No Asbestos

B00B - R0007 - Sport Equipment Store (11.87 m2)

No Asbestos

B00B - R0008 - General Storeroom (3.04 m2)

No Asbestos

B00B - R0009 - External Movement (126.03 m2)

No Asbestos

B00B - R0010 - Plant (0.48 m2)

No Asbestos

B00B - R0011 - Shower/Change (68.12 m2)

No Asbestos

B00B - R0012 - Sport Equipment Store (18.36 m2)

No Asbestos

B00B - R0013 - Chair Store (42.22 m2)

No Asbestos

B00B - R0014 - Distribution Board Cupboard (0.79 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0015 - Multi-Purpose Space (789.49 m2)

No Asbestos

B00B - R0016 - Lift (1.52 m2)

No Asbestos

B00B - R9001 - Covered Vehicle Area/Porte Cochere (1274.56 m2)

No Asbestos

B00B - R9002 - Lift (1.52 m2)

No Asbestos

B00B - R9003 - External Movement (9.23 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Technological & Applied Studies/Music - 1958 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00D/Eaves Linings/S15			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable verge lining	Compressed AC Sheet	40m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Unable to sample at 6 Metre high					
Ceiling Void	No Asbestos Found					
Underfloor Void	Non Accessible Area - No Access - No keys on site to access underfloor voids					

Interior**B00D - R0004 - Darkroom Space (17.38 m2)**

No Asbestos

B00D - R0005 - Distribution Board Cupboard (0.36 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0006 - Design L.S. (53.16 m2)

No Asbestos

B00D - R0007 - Resource/Project Store (8.68 m2)

No Asbestos

B00D - R0008 - Resource/Project Store (8.64 m2)

No Asbestos

B00D - R0009 - Design L.S. (55.5 m2)

No Asbestos

B00D - R0010 - Cleaning Store - Distributed (3.59 m2)

No Asbestos

B00D - R0011 - Music Learning Space (53.16 m2)

No Asbestos

B00D - R0012 - Music Store (7.89 m2)

No Asbestos

B00D - R0013 - Music Store (5.02 m2)

No Asbestos

B00D - R0016 - Materials Store (9.43 m2)

No Asbestos

B00D - R0017 - Stairs (0.28 m2)

No Asbestos

B00D - R0018 - External Movement (3.88 m2)

No Asbestos

B00D - R0020 - Stairs (0.28 m2)

No Asbestos

B00D - R0021 - General Storeroom (8.57 m2)

No Asbestos

B00D - R0022 - Movement (7.94 m2)

No Asbestos

B00D - R0023 - Lift (2.1 m2)

No Asbestos

B00D - R0024 - General Storeroom (3.37 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
B00D - R0025 - Movement (6.62 m2)						
No Asbestos						
B00D - R0026 - Movement (126.78 m2)						
No Asbestos						
B00D - R0027 - Food Technology L.S. (99.74 m2)						
Wall Linings Internal	Flat AC Sheeting					
	8832/B00D/R0028/Wall Linings Internal/S1					No Asbestos Detected
B00D - R0028 - Preparation - Materials (20.3 m2)						
Wall Linings Internal	Flat AC Sheeting					
	8832/B00D/R0028/Wall Linings Internal/S1					No Asbestos Detected
B00D - R0029 - Pantry (6.75 m2)						
No Asbestos						
B00D - R0030 - General Learning Space (47.97 m2)						
No Asbestos						
B00D - R0031 - Materials Store (42.5 m2)						
No Asbestos						
B00D - R0032 - External Movement (4.76 m2)						
No Asbestos						
B00D - R0033 - External Movement (17.06 m2)						
No Asbestos						
B00D - R1002 - Materials Technology L.S. (76.69 m2)						
No Asbestos						
B00D - R1004 - Distribution Board Cupboard (0.36 m2)						Note: No inspection of live electrical installation.
No Asbestos						
B00D - R1005 - Materials Technology L.S. (95.26 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	96m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00D/R1020/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R1006 - Staff Study (33.13 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	34m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00D/R1006/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00D - R1007 - Staff - Toilet (3.8 m2)						
No Asbestos						
B00D - R1012 - Stairs (17.22 m2)						
No Asbestos						
B00D - R1013 - Stairs (15.51 m2)						
No Asbestos						
B00D - R1014 - Movement (8.06 m2)						
No Asbestos						
B00D - R1015 - Lift (2.1 m2)						
No Asbestos						
B00D - R1016 - General Storeroom (3.37 m2)						
No Asbestos						
B00D - R1017 - Movement (6.65 m2)						
No Asbestos						
B00D - R1018 - Movement (116.55 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R1019 - Dust Extraction Space (3.18 m2)						
No Asbestos						
B00D - R1020 - Materials Technology L.S. (96.13 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	97m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8832/B00D/R1020/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R1021 - Dust Extraction Space (8.86 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8832/B00D/R1020/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R1022 - Materials Store (7.82 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8832/B00D/R1020/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R1023 - Music Learning Space (100.04 m2)						
No Asbestos						
B00D - R1024 - Music Store (20.59 m2)						
No Asbestos						
B00D - R1025 - Practice/Seminar (23.22 m2)						
No Asbestos						
B00D - R1026 - General Storeroom (0.92 m2)						
No Asbestos						
B00D - R1027 - External Movement (4.77 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00E - Administration/Multi Purpose Facilities - 1958 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	90m2	Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00E/Eaves Linings/S16			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable verge lining	Compressed AC Sheet	50m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Unable to sample at 6 metre high					
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00E - M0001 - Control Room (4.84 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00E/R0023/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - M0002 - General Storeroom (3.73 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00E/R0023/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0001 - Laboratory L.S. (99.82 m2)

No Asbestos

B00E - R0002 - Movement (44.45 m2)

No Asbestos

B00E - R0003 - Preparation (24.81 m2)

No Asbestos

B00E - R0004 - General Storeroom (14.12 m2)

No Asbestos

B00E - R0005 - Staff Study (44.49 m2)

No Asbestos

B00E - R0006 - Movement (76.58 m2)

No Asbestos

B00E - R0007 - Staff Study (44.4 m2)

No Asbestos

B00E - R0008 - Staff Study (13.36 m2)

No Asbestos

B00E - R0009 - Administration - Clerical (13.87 m2)

No Asbestos

B00E - R0010 - Security Store (23.7 m2)

No Asbestos

B00E - R0011 - Administration - Clerical (24.75 m2)

Fume Cupboard	Flat AC Sheeting	4Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00E/R0011/Fume Cupboard/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0012 - General Storeroom (9.81 m2)

No Asbestos

B00E - R0013 - Movement (4.18 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - R0014 - Laboratory L.S. (88.68 m2)						
No Asbestos						
B00E - R0015 - Movement (9.06 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8832/B00E/R0020/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0016 - Staff - Toilet (2.94 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8832/B00E/R0020/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0017 - Cleaning Store - Distributed (8.82 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8832/B00E/R0020/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0018 - Cleaning Supplies Store (19.03 m2)						
No Asbestos						
B00E - R0019 - Staff Change (4.77 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8832/B00E/R0020/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0020 - Staff Study (108.29 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
8832/B00E/R0020/Floor Coverings Res/Textile/S7				No Asbestos Detected		
Ceiling Structures/Linings	Flat AC Sheeting	108m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8832/B00E/R0020/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0022 - Interview/Office - Type 1 (19.74 m2)						
No Asbestos						
B00E - R0023 - Stage (61.83 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	East facing, West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8832/B00E/R0023/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0024 - Multi-Purpose Space (285.1 m2)						
No Asbestos						
B00E - R0025 - Staff - Toilet (5.63 m2)						
No Asbestos						
B00E - R0026 - Movement (33.58 m2)						
No Asbestos						
B00E - R0027 - Toilets-Girls (5.36 m2)						
No Asbestos						
B00E - R0028 - Staff Kitchen (11.96 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8832/B00E/R0028/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)		
Workbench	Vinyl Sheet					
8832/B00E/R0028/Bench lining/S6				No Asbestos Detected		
B00E - R0029 - Public Entry (30.99 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - R0030 - Administration - Clerical (14.45 m2)						
No Asbestos						
B00E - R0031 - Principal Office (16.52 m2)						
No Asbestos						
B00E - R0032 - Staff - Toilet (3.66 m2)						
No Asbestos						
B00E - R0033 - Distribution Board Cupboard (0.42 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00E - R0034 - Staff - Toilet (4.2 m2)						
No Asbestos						
B00E - R0035 - Deputy Principal Office (14.71 m2)						
No Asbestos						
B00E - R0036 - Administration - Clerical (12.85 m2)						
No Asbestos						
B00E - R0037 - Movement (37.16 m2)						
No Asbestos						
B00E - R0038 - Staff - Toilet (4.29 m2)						
No Asbestos						
B00E - R0039 - Cleaning Store - Distributed (2.47 m2)						
No Asbestos						
B00E - R0040 - External Movement (3.22 m2)						
No Asbestos						
B00E - R0041 - External Movement (2.76 m2)						
No Asbestos						
B00E - R0042 - External Movement (3.99 m2)						
No Asbestos						
B00E - R0043 - External Movement (3.7 m2)						
No Asbestos						
B00E - R0044 - Distribution Board Cupboard (1.64 m2)				Note: No inspection of live electrical installation.		
In-fill-panel	Flat AC Sheeting	1m2	Above Electrical board	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00E/R0044/AC sheet above electrical board/S10			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0045 - External Movement (5.64 m2)						
No Asbestos						
B00E - R0046 - External Movement (10.64 m2)						
No Asbestos						
B00E - R0047 - External Movement (6.19 m2)						
No Asbestos						
B00E - R0049 - Plant (0.19 m2)						
No Asbestos						
B00E - R0050 - Movement (29.54 m2)						
No Asbestos						
B00E - R9001 - General Assistants (98.85 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1890 - Brick/Block (Brick/Block)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00F - R0002 - General Storeroom (6.71 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8832/B00D/R1020/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0003 - Staff Study (11.64 m2)

Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8832/B00D/R1020/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0004 - General Learning Space (47.75 m2)

No Asbestos

B00F - R0005 - General Learning Space (47.75 m2)

No Asbestos

B00F - R0006 - Staff Study (19.7 m2)

No Asbestos

B00F - R0008 - General Learning Space (48.6 m2)

No Asbestos

B00F - R0009 - General Learning Space (48.84 m2)

No Asbestos

B00F - R0010 - General Learning Space (49.78 m2)

No Asbestos

B00F - R0011 - General Learning Space (49.78 m2)

No Asbestos

B00F - R0012 - General Storeroom (3.57 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
8832/B00F/R0020/Floor Coverings Res/Textile/S11						

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8832/B00D/R1020/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0013 - General Storeroom (7.99 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8832/B00D/R1020/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0014 - General Storeroom (4.55 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
8832/B00F/R0020/Floor Coverings Res/Textile/S11						

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8832/B00D/R1020/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0015 - General Learning Space (51.09 m2)

No Asbestos

B00F - R0016 - Movement (10.71 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00E/R0020/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00F - R0017 - External Movement (2.11 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00E/R0020/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00F - R0018 - Stairs (7.64 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8832/B00F/R0020/Floor Coverings Res/Textile/S11			No Asbestos Detected		
B00F - R0020 - Stairs (7.01 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8832/B00F/R0020/Floor Coverings Res/Textile/S11			No Asbestos Detected		
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00D/R1020/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00F - R0021 - Movement (126.32 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	40m2	North facing, West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00D/R1020/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00F - R0022 - External Movement (15.23 m2)						
No Asbestos						
B00F - R1001 - Staff Study (12.27 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00D/R1020/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00F - R1002 - General Learning Space (49.79 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00D/R1020/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00F - R1003 - Staff Study (50.73 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	51m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00D/R1020/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00F - R1004 - Staff Study (20.39 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00D/R1020/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00F - R1006 - Computer Learning Space (49.03 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00D/R1020/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00F - R1007 - General Learning Space (52 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	52m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00D/R1020/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00F - R1008 - General Learning Space (50.56 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	51m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00D/R1020/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R1009 - General Learning Space (49.1 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00D/R1020/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R1010 - General Storeroom (21.03 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00D/R1020/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Manhole Hatch	Flat AC Sheeting	1m2	Middle portion	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8832/B00F/R1010/Ceiling Manhole Hatch/S18					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R1011 - Performance Workspace (54.4 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	55m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00D/R1020/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R1013 - Stairs (16.13 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00D/R1020/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R1014 - Stairs (10.52 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8832/B00F/R0020/Floor Coverings Res/Textile/S11					
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00D/R1020/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R1015 - Staff - Toilet (3.46 m2)						
No Asbestos						
B00F - R1016 - Movement (125.86 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8832/B00F/R0020/Floor Coverings Res/Textile/S11					
B00F - R1017 - External Movement (15.23 m2)						
No Asbestos						
B00F - R9001 - General Storeroom (7.01 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning/Science - 1967 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Void	No Asbestos Found					

Interior

B00G - R0001 - Plant (30.49 m2)

Ceiling Structures/Linings	Flat AC Sheeting	31m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00E/R0020/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0002 - Apparatus Store (24.75 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8832/B00G/R0006/Ceiling Structures/Linings/S12					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00G - R0003 - Staff Study (65.04 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8832/B00G/R0006/Ceiling Structures/Linings/S12					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Fume Cupboard	Flat AC Sheeting	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00E/R0011/Fume Cupboard/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0004 - Laboratory L.S. (92.47 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8832/B00G/R0006/Ceiling Structures/Linings/S12					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles	93m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00G/R0010/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)

B00G - R0005 - General Storeroom (25.08 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8832/B00G/R0006/Ceiling Structures/Linings/S12					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00G - R0006 - Maintenance Bulk Store (24.86 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8832/B00G/R0006/Ceiling Structures/Linings/S12					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00G/R0010/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)

B00G - R0007 - Staff Study (13.9 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8832/B00G/R0006/Ceiling Structures/Linings/S12					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00G/R0010/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)

B00G - R0008 - Distribution Board Cupboard (1.72 m2)

No Asbestos Note: No inspection of live electrical installation.

B00G - R0009 - Interview/Office - Type 1 (12.24 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8832/B00G/R0006/Ceiling Structures/Linings/S12					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8832/B00G/R0010/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)	
B00G - R0010 - Laboratory L.S. (91.94 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	92m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8832/B00G/R0010/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8832/B00G/R0006/Ceiling Structures/Linings/S12					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Fume Cupboard	Flat AC Sheeting	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8832/B00E/R0011/Fume Cupboard/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00G - R0013 - Laboratory L.S. (92.65 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	93m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8832/B00G/R0010/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8832/B00G/R0006/Ceiling Structures/Linings/S12					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Fume Cupboard	Flat AC Sheeting	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8832/B00E/R0011/Fume Cupboard/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00G - R0014 - Chemical Store (25.85 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8832/B00G/R0006/Ceiling Structures/Linings/S12					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00G - R0015 - Toilets-Boys (22.61 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8832/B00G/R1018/Partition Walls (Cubicles)/S14					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8832/B00G/R0006/Ceiling Structures/Linings/S12					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00G - R0016 - Student Drinking Facilities (15.26 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8832/B00G/R0006/Ceiling Structures/Linings/S12					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00G - R0017 - Cleaning Store - Distributed (13.9 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8832/B00G/R0006/Ceiling Structures/Linings/S12					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8832/B00G/R0010/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)	
B00G - R0018 - Distribution Board Cupboard (2.01 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00G - R0019 - General Storeroom (12.47 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8832/B00G/R0006/Ceiling Structures/Linings/S12					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00G - R0020 - External Movement (232.79 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R0021 - External Movement (78.42 m2)						
Ceiling Structures/Linings	Vermiculite 8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R0022 - External Stairs (8.31 m2)						
Ceiling Structures/Linings	Vermiculite 8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R0023 - External Stairs (8.2 m2)						
Ceiling Structures/Linings	Vermiculite 8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R0024 - Preparation - Science (39.49 m2)						
Ceiling Structures/Linings	Vermiculite 8832/B00G/R0024/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R0025 - Plant (7.69 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8832/B00G/R0026/Ceiling Structures/Linings/S17	8m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) <i>Chrysotile (white asbestos)</i>
B00G - R0026 - Plant (7.84 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8832/B00G/R0026/Ceiling Structures/Linings/S17	8m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) <i>Chrysotile (white asbestos)</i>
B00G - R1003 - Staff Study (12.5 m2)						
Ceiling Structures/Linings	Vermiculite 8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R1004 - Workroom (25.59 m2)						
Ceiling Structures/Linings	Vermiculite 8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R1005 - Librarian (12.49 m2)						
Ceiling Structures/Linings	Vermiculite 8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R1006 - Staff Study (26.88 m2)						
Ceiling Structures/Linings	Vermiculite 8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R1007 - Distribution Board Cupboard (1.72 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00G - R1008 - Resources Store (38.62 m2)						
Ceiling Structures/Linings	Vermiculite 8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R1009 - Art Learning Space (66.12 m2)						
Ceiling Structures/Linings	Vermiculite 8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R1010 - Art Learning Space (53.24 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R1011 - Resources Store (25.82 m2)						
Ceiling Structures/Linings	Vermiculite					
	8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R1012 - Art Learning Space (65.46 m2)						
Ceiling Structures/Linings	Vermiculite					
	8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R1013 - Kiln Space (25.13 m2)						
Ceiling Structures/Linings	Vermiculite					
	8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R1014 - Resources Store (12.83 m2)						
Ceiling Structures/Linings	Vermiculite					
	8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R1015 - Staff - Toilet (11.66 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00G/R1018/Partition Walls (Cubicles)/S14					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R1016 - Cleaning Store - Distributed (1.91 m2)						
No Asbestos						
B00G - R1017 - Distribution Board Cupboard (2 m2) Note: No inspection of live electrical installation.						
No Asbestos						
B00G - R1018 - Staff - Toilet (12.3 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8832/B00G/R1018/Partition Walls (Cubicles)/S14					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R1019 - External Movement (179.47 m2)						
Ceiling Structures/Linings	Vermiculite					
	8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R1021 - No Access (3.8 m2)						
No Asbestos						
B00G - R1022 - No Access (3.79 m2)						
No Asbestos						
B00G - R1023 - External Stairs (15.29 m2)						
Ceiling Structures/Linings	Vermiculite					
	8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R1024 - External Stairs (15.04 m2)						
Ceiling Structures/Linings	Vermiculite					
	8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R1025 - Main Area (186.55 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8832/B00G/R1026/Floor Coverings Res/Textile/S19				No Asbestos Detected
Ceiling Structures/Linings	Vermiculite	8832/B00G/R0024/Ceiling Structures/Linings/S20				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R1026 - Computer Room (52.14 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8832/B00G/R1026/Floor Coverings Res/Textile/S19				No Asbestos Detected
Ceiling Structures/Linings	Vermiculite	8832/B00G/R0024/Ceiling Structures/Linings/S20				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R2001 - Staff Study (78.37 m2)						
Ceiling Structures/Linings	Vermiculite	8832/B00G/R0006/Ceiling Structures/Linings/S12				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R2005 - General Learning Space (52.29 m2)						
Ceiling Structures/Linings	Vermiculite	8832/B00G/R0006/Ceiling Structures/Linings/S12				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R2006 - General Learning Space (52.22 m2)						
Ceiling Structures/Linings	Vermiculite	8832/B00G/R0006/Ceiling Structures/Linings/S12				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R2007 - General Learning Space (51.78 m2)						
Ceiling Structures/Linings	Vermiculite	8832/B00G/R0006/Ceiling Structures/Linings/S12				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R2008 - Interview/Office - Type 1 (13.82 m2)						
Ceiling Structures/Linings	Vermiculite	8832/B00G/R0006/Ceiling Structures/Linings/S12				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R2009 - Distribution Board Cupboard (2.01 m2)						
Ceiling Structures/Linings	Vermiculite	8832/B00G/R0006/Ceiling Structures/Linings/S12			Note: No inspection of live electrical installation.	Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R2010 - Senior Study (12.37 m2)						
Ceiling Structures/Linings	Vermiculite	8832/B00G/R0006/Ceiling Structures/Linings/S12				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R2011 - Computer Learning Space (51.69 m2)						
Ceiling Structures/Linings	Vermiculite	8832/B00G/R0006/Ceiling Structures/Linings/S12				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R2012 - General Learning Space (52.29 m2)						
Ceiling Structures/Linings	Vermiculite	8832/B00G/R0006/Ceiling Structures/Linings/S12				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R2014 - Music Learning Space (52.14 m2)						
Ceiling Structures/Linings	Vermiculite	8832/B00G/R0006/Ceiling Structures/Linings/S12				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R2015 - Staff Study (51.84 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00G - R2016 - General Storeroom (24.76 m2)						
Ceiling Structures/Linings	Vermiculite 8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8832/B00G/R0010/Floor Coverings Res/Textile/S13	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R2017 - Cleaning Store - Distributed (1.91 m2)						
No Asbestos						
B00G - R2018 - Distribution Board Cupboard (1.99 m2) Note: No inspection of live electrical installation.						
In-fill-panel	Flat AC Sheeting 8832/B00E/R0044/AC sheet above electrical board/S10	2m2	Above Electrical board	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R2019 - External Movement (175.58 m2)						
Ceiling Structures/Linings	Vermiculite 8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00G - R2020 - Movement (3.7 m2)						
No Asbestos						
B00G - R2021 - General Learning Space (52.65 m2)						
Ceiling Structures/Linings	Vermiculite 8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00G - R2022 - Computer Learning Space (52.65 m2)						
Ceiling Structures/Linings	Vermiculite 8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00G - R2023 - Staff Study (26.04 m2)						
Ceiling Structures/Linings	Vermiculite 8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00G - R2024 - No Access (3.51 m2)						
No Asbestos						
B00G - R2025 - No Access (3.55 m2)						
No Asbestos						
B00G - R2026 - External Stairs (8.32 m2)						
Ceiling Structures/Linings	Vermiculite 8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00G - R2027 - External Stairs (8.23 m2)						
Ceiling Structures/Linings	Vermiculite 8832/B00G/R0006/Ceiling Structures/Linings/S12					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00H - Pupil Facilities - 2002 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00H - R0001 - Cleaning Store - Distributed (2.67 m2)**

No Asbestos

B00H - R0002 - Toilets - Boys (58.87 m2)

No Asbestos

B00H - R0003 - Toilets-Disabled (4.43 m2)

No Asbestos

B00H - R0004 - Cleaning Store - Distributed (4.48 m2)

No Asbestos

B00H - R0005 - Cleaning Store - Distributed (2.7 m2)

No Asbestos

B00H - R0006 - Covered Area (173.33 m2)

No Asbestos

B00H - R0007 - Office/Store (14.1 m2)

No Asbestos

B00H - R0008 - Student Canteen (51.93 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017