


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Arthur Phillip High School (8892)
Region : Western Sydney
State Electorate : Parramatta
Local Government Area : Parramatta

Initial Survey : Noel Arnold & Associates : 22 - Apr - 2008
Reviewed By : Greencap-NAA : 10 - Jun - 2015

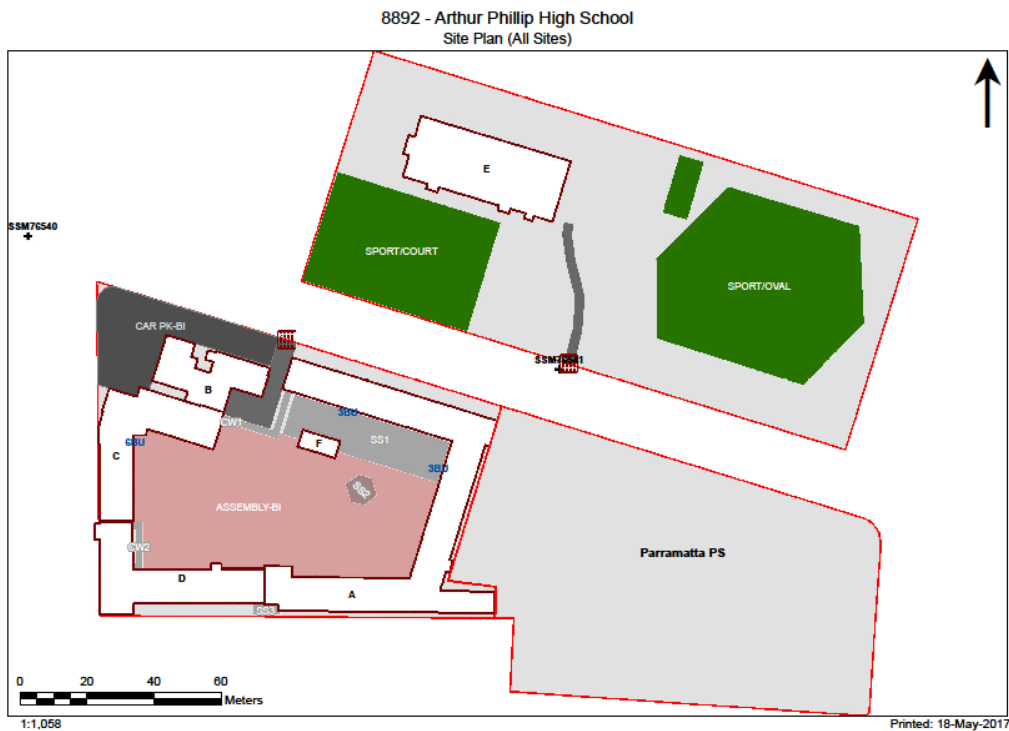

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Technological & Applied Studies - 1963 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	200m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	-------	------------	--------------------	---------	--------------------

Assumed Asbestos - Height Restriction

Underfloor Voids - Slab on Ground	Non Accessible Area					
-----------------------------------	---------------------	--	--	--	--	--

- Area inaccessible

Ceiling Voids	Non Accessible Area					
---------------	---------------------	--	--	--	--	--

- Height Restriction

Interior**B00A - R0001 - Distribution Board Cupboard (0.46 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**B00A - R0002 - Staff - Toilet (20.25 m2)**

Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------------	-------------	-----	-------	--------------------	---------	--------------------

Chrysotile (white asbestos)

Partition Walls (Cubicles)	Compressed AC Sheet	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	-----	-------	--------------------	---------	--------------------

Chrysotile (white asbestos) , Amosite (brown asbestos)

Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected

B00A - R0003 - No Access (2.17 m2)

Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**B00A - R0004 - Movement (28.45 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------------	-------------	------	------------	--------------------	---------	--------------------

Chrysotile (white asbestos)

Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected

B00A - R0005 - Design L.S. (105.15 m2)

Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles	25m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------------	-------------	------	-------	--------------------	---------	--------------------

Chrysotile (white asbestos)

Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected

B00A - R0006 - Metal Technology Bay (23.5 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0007 - Metal Technology Bay (14.39 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0008 - Materials Store (14.9 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R0009 - Welding Area (7.8 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0010 - Materials Technology L.S. (99.76 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	25m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R0011 - Welding Area (3.31 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0012 - Movement (146.3 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	147m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R0013 - Cleaning Store - Distributed (2.52 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0014 - Materials Store (3.16 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R0015 - Materials Store (5.43 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R0016 - Design L.S. (66.26 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R0020 - Interview/Office - Type 1 (11.42 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0021 - Distribution Board Cupboard (0.45 m2)						
					Note: No inspection of live electrical installation.	
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00A - R0022 - Cleaning Store - Distributed (4.3 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0023 - Staff - Toilet (9.55 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R0033 - Cleaning Supplies Store (8.76 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24				No Asbestos Detected	
B00A - R0034 - Cleaning Supplies Store (14.22 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00A - R0035 - Staff - Toilet (1.1 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00A - R0036 - Movement (197.58 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
In-fill-panel	Flat AC Sheeting					
	8892/B00A/R0036/In-fill-panel/S6				No Asbestos Detected	
B00A - R0037 - Toilets-Girls (37.52 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00A - R0038 - Toilets-Girls (78.08 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Ceiling Structures/Linings	Flat AC Sheeting					
	8892/B00A/R0038/Ceiling Structures/Linings/S27				No Asbestos Detected	
B00A - R0039 - Main Switchroom (7.72 m2)						
Electrical Backing Board	Resinous Board	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					
B00A - R0040 - General Storeroom (18.89 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00A - R0041 - Movement (16.93 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	
B00A - R0042 - General Storeroom (12.58 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00A - R0043 - Student Drinking Facilities (16.05 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00A - R0044 - Toilets-Boys (44.4 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0045 - Toilets-Boys (100.42 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0046 - Garden Store Room (16.36 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0047 - Garden Store Room (1.56 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0048 - General Assistants (33.27 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0049 - Clinic - Boys (9.05 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0050 - Movement (9.31 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0051 - Food Technology L.S. (73.99 m2)						
No Asbestos						
B00A - R0052 - Preparation (7.51 m2)						
No Asbestos						
B00A - R0053 - Staff Study (51.77 m2)						
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0054 - Food Technology L.S. (90.63 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0055 - Laundry (13.25 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0056 - Preparation (12.85 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0057 - Staff Change (6.91 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0058 - General Learning Space (16.8 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0059 - Movement (2.66 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1001 - Distribution Board Cupboard (0.46 m2)					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1002 - Staff - Toilet (19.88 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R1003 - Materials Store (2.17 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1004 - Materials Technology L.S. (86.25 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1005 - Materials Store (16.48 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1006 - Wood Technology Bay (16.29 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1007 - Materials Store (17.14 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1008 - Materials Technology L.S. (78.94 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1009 - Staff Study (20.47 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1010 - General Storeroom (2.4 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1011 - General Storeroom (9.12 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8892/B00A/R0004/Floor Coverings Res/Textile/S2	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R1012 - Design L.S. (56.21 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8892/B00A/R0004/Floor Coverings Res/Textile/S2	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R1013 - Art Learning Space (55.77 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8892/B00A/R0004/Floor Coverings Res/Textile/S2	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R1014 - Bulk Store (13.83 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R1015 - Kiln Space (28.87 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R1016 - Staff Study (11.34 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8892/B00A/R0004/Floor Coverings Res/Textile/S2	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R1017 - Distribution Board Cupboard (0.91 m2)				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B00A - R1018 - Cleaning Store - Distributed (4.5 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00A - R1019 - Staff - Toilet (9.7 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 8892/B00A/R0004/Floor Coverings Res/Textile/S2	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet 8892/B00A/R0002/Partition Walls (Cubicles)/S4	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Adhesive 8892/B00A/R2007/Floor Coverings Res/Textile/S24				No Asbestos Detected	
B00A - R1020 - Staff Study (24.23 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8892/B00A/R0004/Floor Coverings Res/Textile/S2	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8892/B00A/R2007/Floor Coverings Res/Textile/S24				No Asbestos Detected	
B00A - R1021 - Apparatus Store (26.57 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8892/B00A/R0004/Floor Coverings Res/Textile/S2	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8892/B00A/R2007/Floor Coverings Res/Textile/S24				No Asbestos Detected	
B00A - R1022 - Laboratory L.S. (91.64 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00A - R1023 - General Storeroom (9.81 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00A - R1024 - Preparation (28.51 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Flue	Bituminous Pipe 8892/B00A/R1024/Bituflue/S9	8m	North, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R1025 - Laboratory L.S. (95.16 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8892/B00A/R0004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B00A - R1026 - Special Learning Space (25.97 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8892/B00A/R0004/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8892/B00A/R0004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
8892/B00A/R2007/Floor Coverings Res/Textile/S24						
B00A - R1027 - General Storeroom (6.37 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8892/B00A/R0004/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8892/B00A/R0004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
8892/B00A/R2007/Floor Coverings Res/Textile/S24						
B00A - R1028 - Cleaning Store - Distributed (2.85 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8892/B00A/R0004/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00A - R1029 - Distribution Board Cupboard (0.61 m2) Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8892/B00A/R0004/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00A - R1030 - Movement (13.52 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8892/B00A/R0004/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00A - R1031 - Staff Study (51.53 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8892/B00A/R0004/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8892/B00A/R0004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
8892/B00A/R2007/Floor Coverings Res/Textile/S24						
B00A - R1032 - General Learning Space (66.1 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8892/B00A/R0004/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8892/B00A/R0004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R1033 - General Learning Space (52.34 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R1034 - General Learning Space (52.35 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R1035 - General Storeroom (6.21 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R1036 - Staff Study (14.02 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R1037 - General Storeroom (9.19 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R1038 - Cleaning Store - Distributed (2.59 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R1039 - Movement (288.85 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	290m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting					
	8892/B00A/R1039/In-fill-panel/S7				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24				No Asbestos Detected	
B00A - R1040 - General Storeroom (2.41 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24				No Asbestos Detected	
B00A - R1041 - Movement (10.08 m2)						
No Asbestos						
B00A - R2001 - Distribution Board Cupboard (0.46 m2)				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Electrical Backing Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					
B00A - R2002 - Staff - Toilet (20.06 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0002/Partition Walls (Cubicles)/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24				No Asbestos Detected	
B00A - R2003 - Cleaning Store - Distributed (2.3 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00A - R2004 - Music Learning Space (26.39 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00A - R2005 - Music Learning Space (59.38 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24				No Asbestos Detected	
B00A - R2006 - Music Store (11.58 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2007 - Music Learning Space (59.09 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24				No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	
B00A - R2008 - General Learning Space (53.73 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24				No Asbestos Detected	
B00A - R2009 - General Storeroom (23 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2010 - Cleaning Store - Distributed (2.48 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2011 - General Learning Space (50.43 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24				No Asbestos Detected	
B00A - R2012 - General Learning Space (53.65 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24				No Asbestos Detected	
B00A - R2013 - General Learning Space (50.57 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8892/B00A/R0004/Floor Coverings Res/Textile/S2	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R2014 - General Storeroom (10.63 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R2015 - Clinic - Girls (11.5 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8892/B00A/R0004/Floor Coverings Res/Textile/S2	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R2016 - Distribution Board Cupboard (0.93 m2)				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B00A - R2017 - Cleaning Store - Distributed (4.63 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R2018 - Staff - Toilet (9.73 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8892/B00A/R0004/Floor Coverings Res/Textile/S2	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R2019 - Staff Study (24.37 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R2020 - Chemical Store (26.56 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8892/B00A/R0004/Floor Coverings Res/Textile/S2	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R2021 - Laboratory L.S. (91.5 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2022 - Preparation (28.51 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Flue	Bituminous Pipe	10m	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R1024/Bituflue/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R2023 - General Storeroom (9.77 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00A/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R2024 - Laboratory L.S. (95.17 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2025 - Special Learning Space (25.48 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2026 - General Storeroom (6.33 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2027 - Cleaning Store - Distributed (2.84 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2028 - Distribution Board Cupboard (0.7 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Vermiculite					
	8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00A - R2029 - Movement (4.26 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R2030 - Audio Visual Workroom (27.74 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R2031 - Workroom (28.6 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R2032 - Librarian (12.46 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R2033 - Main Area (248.77 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
In-fill-panel	Flat AC Sheeting 8892/B00A/R2033/In-fill-panel/S10					No Asbestos Detected
B00A - R2034 - Seminar (10.48 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R2035 - Seminar (10.42 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R2036 - Seminar (12.11 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R2037 - Movement (8.97 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8892/B00A/R0004/Floor Coverings Res/Textile/S2	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Floor Coverings Res/Textile	Adhesive 8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R2038 - General Storeroom (15.91 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00A/R0004/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8892/B00A/R0004/Floor Coverings Res/Textile/S2	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Floor Coverings Res/Textile	Adhesive 8892/B00A/R2007/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00A - R2039 - Movement (224.02 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite		8892/B00A/R0004/Ceiling Structures/Linings/S3			Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
In-fill-panel	Flat AC Sheeting		8892/B00A/R2033/In-fill-panel/S10			No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Administration - 1876 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Height Restriction
Underfloor Voids	Non Accessible Area - Area inaccessible

Interior

B00B - R0001 - Movement (3.88 m2)

No Asbestos

B00B - R0002 - General Learning Space (53.71 m2)

No Asbestos

B00B - R0003 - Commonroom (109.5 m2)

No Asbestos

B00B - R0004 - Movement (4.67 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

Assumed Asbestos - Height Restriction

B00B - R0005 - Principal Office (21.07 m2)

No Asbestos

B00B - R0006 - Staff - Toilet (4.52 m2)

No Asbestos

B00B - R0007 - Movement (18.85 m2)

No Asbestos

B00B - R0008 - Movement (17.92 m2)

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

Assumed Asbestos - Height Restriction

B00B - R0009 - Administration - Clerical (54.46 m2)

Chalk Board	Flat AC Sheeting 8892/B00B/R0011/Chalk Board/S11					No Asbestos Detected
-------------	---	--	--	--	--	-----------------------------

B00B - R0010 - Duplicating Workroom (38.46 m2)

No Asbestos

B00B - R0011 - Duplicating Workroom (14.21 m2)

Chalk Board	Flat AC Sheeting 8892/B00B/R0011/Chalk Board/S11					No Asbestos Detected
-------------	---	--	--	--	--	-----------------------------

B00B - R0012 - Movement (16.33 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1920 - Brick/Block (Brick/Block)**Exterior**

In-fill-panel	Flat AC Sheeting 8892/B00C/R0002/In-fill-panel/S12	40m2	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior**B00C - R0001 - Movement (18.38 m2)**

No Asbestos

B00C - R0002 - Movement (52.75 m2)

In-fill-panel	Flat AC Sheeting 8892/B00C/R0002/In-fill-panel/S12	20m	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
---------------	---	-----	----------------------	--------------------	---------	--

B00C - R0003 - Deputy Principal Office (23.57 m2)

No Asbestos

B00C - R0004 - Movement (3.05 m2)

No Asbestos

B00C - R0005 - Leading Teacher (20.31 m2)

No Asbestos

B00C - R0006 - General Learning Space (47.46 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8892/B00C/R0006/Floor Coverings Res/Textile/S28	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8892/B00C/R0006/Floor Coverings Res/Textile/S29	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00C - R0007 - General Learning Space (47.78 m2)

Floor Coverings Res/Textile	Adhesive 8892/B00C/R0006/Floor Coverings Res/Textile/S29	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8892/B00C/R0006/Floor Coverings Res/Textile/S28	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00C - R0008 - General Storeroom (10.88 m2)

No Asbestos

B00C - R0009 - Movement (2.97 m2)

No Asbestos

B00C - R0010 - Performance Workspace (51.74 m2)

No Asbestos

B00C - R0011 - Interview/Office - Type 1 (15.08 m2)

Floor Coverings Res/Textile	Adhesive 8892/B00C/R0006/Floor Coverings Res/Textile/S29	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8892/B00C/R0006/Floor Coverings Res/Textile/S28	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00C - R0012 - Movement (4.6 m2)

No Asbestos

B00C - R0013 - Administration - Clerical (8.23 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00C - R0014 - Movement (118.15 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
8892/B00C/R0014/Floor Coverings Res/Textile/S13					No Asbestos Detected	
B00C - R0015 - General Learning Space (47.28 m2)						
No Asbestos						
B00C - R0016 - General Learning Space (47.47 m2)						
No Asbestos						
B00C - R0017 - General Learning Space (47.22 m2)						
No Asbestos						
B00C - R1001 - Movement (18.65 m2)						
No Asbestos						
B00C - R1002 - Movement (52.65 m2)						
In-fill-panel	Flat AC Sheeting	30m	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8892/B00C/R0002/In-fill-panel/S12					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
8892/B00C/R0014/Floor Coverings Res/Textile/S13					No Asbestos Detected	
B00C - R1003 - General Learning Space (49.91 m2)						
No Asbestos						
B00C - R1004 - General Learning Space (49.66 m2)						
No Asbestos						
B00C - R1005 - General Learning Space (49.39 m2)						
No Asbestos						
B00C - R1006 - Movement (5.87 m2)						
No Asbestos						
B00C - R1007 - Staff Study (52.61 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
8892/B00C/R0014/Floor Coverings Res/Textile/S13					No Asbestos Detected	
B00C - R1008 - Staff Study (15.22 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
8892/B00C/R0014/Floor Coverings Res/Textile/S13					No Asbestos Detected	
B00C - R1009 - General Storeroom (12.79 m2)						
No Asbestos						
B00C - R1010 - General Learning Space (48.39 m2)						
No Asbestos						
B00C - R1011 - General Learning Space (48.96 m2)						
No Asbestos						
B00C - R1012 - General Learning Space (48.57 m2)						
No Asbestos						
B00C - R1013 - Movement (118.38 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00D - General Learning - 1961 - Brick/Block (Brick/Block)

Exterior

In-fill-panel	Flat AC Sheeting 8892/B00D/R0001/In-fill-panel/S15					No Asbestos Detected
Eaves Linings	Flat AC Sheeting	150m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior

B00D - R0001 - Movement (42.09 m2)

Ceiling Structures/Linings	Vermiculite 8892/B00D/R0001/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
In-fill-panel	Flat AC Sheeting 8892/B00D/R0001/In-fill-panel/S15					No Asbestos Detected

B00D - R0002 - General Storeroom (6.38 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8892/B00D/R0002/Floor Coverings Res/Textile/S16	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8892/B00D/R0001/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Adhesive 8892/B00D/R0019/Floor Coverings Res/Textile/S25					No Asbestos Detected

B00D - R0003 - General Storeroom (2.55 m2)


Ceiling Structures/Linings	Vermiculite 8892/B00D/R0001/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	---

B00D - R0004 - Laboratory L.S. (96 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8892/B00D/R0002/Floor Coverings Res/Textile/S16	96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	------	------------	--------------------	---------	--

B00D - R0005 - Preparation (25.83 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8892/B00D/R0005/Floor Coverings Res/Textile/S17					No Asbestos Detected
Fume Cupboard	Flat AC Sheeting 8892/B00D/R0005/Fume Cupboard/S18	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Adhesive 8892/B00D/R0019/Floor Coverings Res/Textile/S25					No Asbestos Detected
Electrical Backing Board	Resinous Board 1Unit	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)

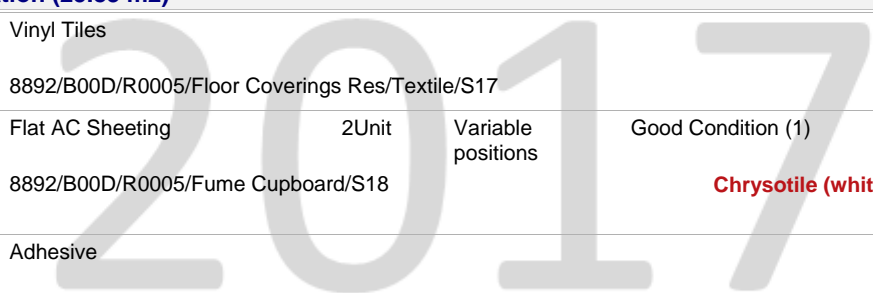

Assumed Asbestos - Electrical Hazard

B00D - R0006 - General Learning Space (51.06 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8892/B00D/R0002/Floor Coverings Res/Textile/S16	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	------	------------	--------------------	---------	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive					
	8892/B00D/R0019/Floor Coverings Res/Textile/S25					No Asbestos Detected
B00D - R0007 - Staff - Toilet (5.17 m2)						
No Asbestos						
B00D - R0008 - Distribution Board Cupboard (0.28 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00D - R0009 - General Storeroom (4.83 m2)						
No Asbestos						
B00D - R0010 - Interview/Office - Type 1 (18.21 m2)						
No Asbestos						
B00D - R0011 - Special Learning Space (8.61 m2)						
No Asbestos						
B00D - R0012 - Staff Study (27.38 m2)						
No Asbestos						
B00D - R0013 - Bulk Store (6.75 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00D/R0001/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0014 - Kiln Space (6.5 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00D/R0001/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0015 - Art Learning Space (70.14 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8892/B00D/R0005/Floor Coverings Res/Textile/S17					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	8892/B00D/R0019/Floor Coverings Res/Textile/S25					No Asbestos Detected
B00D - R0016 - General Storeroom (4.76 m2)						
No Asbestos						
B00D - R0017 - Art Learning Space (55.93 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8892/B00D/R0020/Floor Coverings Res/Textile/S19					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	8892/B00D/R0019/Floor Coverings Res/Textile/S25					No Asbestos Detected
B00D - R0018 - Darkroom Space (19.89 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00D/R0018/Floor Coverings Res/Textile/S20					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8892/B00D/R0019/Floor Coverings Res/Textile/S25					No Asbestos Detected
B00D - R0019 - General Storeroom (7.32 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8892/B00D/R0020/Floor Coverings Res/Textile/S19					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	8892/B00D/R0019/Floor Coverings Res/Textile/S25					No Asbestos Detected
B00D - R0020 - Movement (117.46 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	8892/B00D/R0020/Floor Coverings Res/Textile/S19					No Asbestos Detected
B00D - R0021 - Movement (7.46 m2)						
No Asbestos						
B00D - R0022 - Movement (4.5 m2)						
No Asbestos						
B00D - R1001 - Movement (34.13 m2)						
Ceiling Structures/Linings	Vermiculite					
	8892/B00D/R0001/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1002 - General Storeroom (8.19 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00D/R0002/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8892/B00D/R0019/Floor Coverings Res/Textile/S25					No Asbestos Detected
B00D - R1003 - Computer Learning Space (95.07 m2)						
No Asbestos						
B00D - R1004 - Staff Study (17.12 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8892/B00D/R0005/Floor Coverings Res/Textile/S17					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	8892/B00D/R0019/Floor Coverings Res/Textile/S25					No Asbestos Detected
B00D - R1005 - General Storeroom (8.55 m2)						
No Asbestos						
B00D - R1006 - Computer Learning Space (51 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00D/R0002/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8892/B00D/R0019/Floor Coverings Res/Textile/S25					No Asbestos Detected
B00D - R1007 - Staff - Toilet (5.15 m2)						
No Asbestos						
B00D - R1008 - Senior Study (26.72 m2)						
Floor Coverings Res/Textile	Adhesive					
	8892/B00D/R0019/Floor Coverings Res/Textile/S25					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00D/R0002/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)
B00D - R1009 - Computer Learning Space (55.57 m2)						
Floor Coverings Res/Textile	Adhesive					
	8892/B00D/R0019/Floor Coverings Res/Textile/S25					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8892/B00D/R0002/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)
B00D - R1010 - General Learning Space (57.35 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8892/B00D/R0002/Floor Coverings Res/Textile/S16	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8892/B00D/R0019/Floor Coverings Res/Textile/S25					No Asbestos Detected
B00D - R1011 - General Learning Space (54.54 m2)						
Floor Coverings Res/Textile	Adhesive 8892/B00D/R0019/Floor Coverings Res/Textile/S25					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8892/B00D/R0002/Floor Coverings Res/Textile/S16	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1012 - Staff Study (31.68 m2)						
Floor Coverings Res/Textile	Adhesive 8892/B00D/R0019/Floor Coverings Res/Textile/S25					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8892/B00D/R0002/Floor Coverings Res/Textile/S16	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1013 - Movement (106.47 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Multi Purpose Facilities - 1964 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	60m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	--------------	--------------------	---------	--------------------

Assumed Asbestos - Height Restriction

Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior

B00E - R0001 - Multi-Purpose Space (535.66 m2)

Wall Linings Internal	Compressed AC Sheet 8892/B00E/R0001/Wall Linings Internal/S23					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

B00E - R0002 - Sport Equipment Store (17.3 m2)

Ceiling Structures/Linings	Vermiculite 8892/B00E/R0002/Ceiling Structures/Linings/S21					Limited Samples Taken
----------------------------	---	--	--	--	--	-----------------------

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R0003 - Staff Study (16.14 m2)

Ceiling Structures/Linings	Vermiculite 8892/B00E/R0002/Ceiling Structures/Linings/S21					Limited Samples Taken
----------------------------	---	--	--	--	--	-----------------------

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R0004 - Staff Shower (4.08 m2)

Ceiling Structures/Linings	Vermiculite 8892/B00E/R0002/Ceiling Structures/Linings/S21					Limited Samples Taken
----------------------------	---	--	--	--	--	-----------------------

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R0005 - Toilets-Boys (8.69 m2)

Ceiling Structures/Linings	Vermiculite 8892/B00E/R0002/Ceiling Structures/Linings/S21					Limited Samples Taken
----------------------------	---	--	--	--	--	-----------------------

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Partition Walls (Cubicles)	Compressed AC Sheet 8892/B00E/R0005/Partition Walls (Cubicles)/S22	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---	-----	------------	--------------------	---------	--------------------

Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0006 - Cleaning Store - Distributed (1.08 m2)

No Asbestos

B00E - R0007 - Movement (1.84 m2)

No Asbestos

B00E - R0008 - Movement (18 m2)

Ceiling Structures/Linings	Vermiculite 8892/B00E/R0002/Ceiling Structures/Linings/S21					Limited Samples Taken
----------------------------	---	--	--	--	--	-----------------------

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R0009 - Cleaning Store - Distributed (1.11 m2)

No Asbestos

B00E - R0010 - Toilets-Girls (8.75 m2)

Ceiling Structures/Linings	Vermiculite 8892/B00E/R0002/Ceiling Structures/Linings/S21					Limited Samples Taken
----------------------------	---	--	--	--	--	-----------------------

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Partition Walls (Cubicles)	Compressed AC Sheet 8892/B00E/R0005/Partition Walls (Cubicles)/S22	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---	-----	------------	--------------------	---------	--------------------

Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0011 - Staff Study (16.01 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
Ceiling Structures/Linings	Vermiculite 8892/B00E/R0002/Ceiling Structures/Linings/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R0012 - Staff Shower (4.11 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00E/R0002/Ceiling Structures/Linings/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) 8892/B00E/R0005/Partition Walls (Cubicles)/S22 <i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>
B00E - R0013 - Sport Equipment Store (19.49 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00E/R0002/Ceiling Structures/Linings/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R0014 - Main Switchroom (2.47 m2)						
Ceiling Structures/Linings	Vermiculite 8892/B00E/R0002/Ceiling Structures/Linings/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R0015 - Movement (9.96 m2)						
No Asbestos						
B00E - R0016 - Stairs (3.57 m2)						
No Asbestos						
B00E - R0017 - Stairs (3.69 m2)						
No Asbestos						
B00E - R0018 - Movement (4.93 m2)						
No Asbestos						
B00E - R0019 - Movement (4.93 m2)						
No Asbestos						
B00E - R0020 - Movement (3.62 m2)						
No Asbestos						
B00E - R0021 - Movement (20.81 m2)						
No Asbestos						
B00E - R0022 - Movement (18.42 m2)						
No Asbestos						
B00E - R0023 - Stage (109.61 m2)						
No Asbestos						
B00E - R0024 - Movement (9.88 m2)						
No Asbestos						
B00E - R1001 - Shower/Change (40.65 m2)						
No Asbestos						
B00E - R1002 - Toilets-Boys (4.94 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) 8892/B00E/R0005/Partition Walls (Cubicles)/S22 <i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>
B00E - R1003 - Movement (9.57 m2)						
No Asbestos						
B00E - R1004 - Movement (3.12 m2)						
No Asbestos						
B00E - R1005 - Sport Equipment Store (11.56 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - R1006 - Movement (3.08 m2)

No Asbestos

B00E - R1007 - Shower/Change (40.66 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	------	------------	--------------------	---------	--------------------

8892/B00E/R0005/Partition Walls (Cubicles)/S22

Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R1008 - Toilets-Girls (4.94 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	-----	------------	--------------------	---------	--------------------

8892/B00E/R0005/Partition Walls (Cubicles)/S22

Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R1009 - Stairs (3.12 m2)

No Asbestos

B00E - R1010 - Stairs (3.08 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 1967 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00F - R0001 - Student Canteen (43.22 m2)

Floor Coverings Res/Textile	Vinyl Tiles	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8892/B00F/R0001/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8892/B00F/R0002/Floor Coverings Res/Textile/S26					Chrysotile (white asbestos)	
Electrical Backing Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B00F - R0002 - General Storeroom (4.59 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8892/B00F/R0001/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8892/B00F/R0002/Floor Coverings Res/Textile/S26					Chrysotile (white asbestos)	

B00F - R0003 - Staff - Toilet (3.64 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

8892_ASB_231112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017