


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Bald Blair Public School (1098)  
**Region :** New England  
**State Electorate :** Northern Tablelands  
**Local Government Area :** Guyra

**Initial Survey :** Noel Arnold & Associates : 20 - May - 2008  
**Register Issue Date :** 22 - Mar - 2017

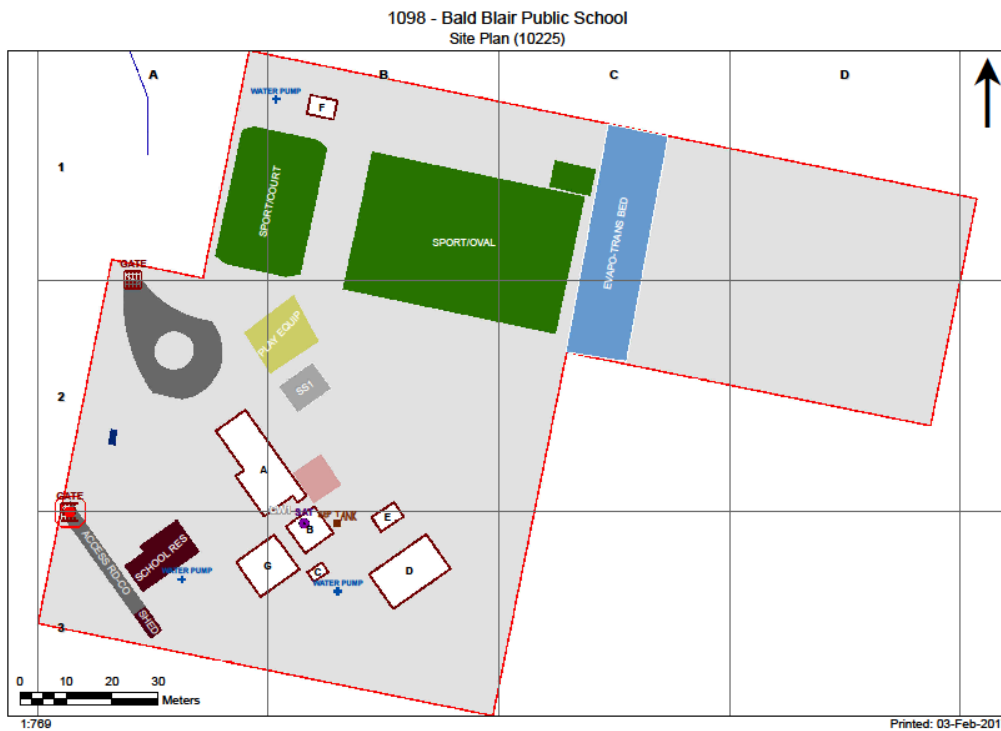

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/Library - 1955 - Timber (Timber)**

**Exterior**

Electrical Backing Board	Resinous Board	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1098/B00A/Electrical Backing Board/S8					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

**Interior**

**B00A - R0001 - External Movement**

No Asbestos

**B00A - R0002 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1098/B00A/R0002/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos) , Amosite (brown Asbestos)</b>
Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1098/B00A/R0002/Electrical Backing Board/S4					<b>Chrysotile (white asbestos)</b>

**B00A - R0003 - Home Base**

Panels Behind Heater	Compressed AC Sheet	2m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1098/B00A/R0003/Panels Behind Heater/S1					<b>Chrysotile (white asbestos) , Amosite (brown Asbestos)</b>

**B00A - R0004 - Practical Activities - 1hb**

No Asbestos

**B00A - R0005 - Principal**

No Asbestos

**B00A - R0006 - Staff Room**

No Asbestos

**B00A - R0007 - Home Base**

Chalk Board	Resinous Board					
	1098/B00A/R0007/Chalk Board/S2					<b>No Asbestos Detected</b>

**B00A - R0008 - General Storeroom**

No Asbestos

**B00A - R0009 - K.L.A. Store**

No Asbestos

**B00A - R0010 - Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Pupil Facilities/Staff Facilities - 1970 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1098/B00B/Eaves Linings/S6					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

**Interior**

**B00B - R0001 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1098/B00B/R0005/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>

**B00B - R0002 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1098/B00B/R0005/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1098/B00B/R0002/Partition Walls (Cubicles)/S7					<b>Chrysotile (white asbestos)</b>

**B00B - R0003 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1098/B00B/R0005/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>

**B00B - R0004 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1098/B00B/R0005/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1098/B00B/R0002/Partition Walls (Cubicles)/S7					<b>Chrysotile (white asbestos)</b>

**B00B - R0005 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1098/B00B/R0005/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Administration - 1970 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

**Interior**

**B00C - R0001 - General Storeroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Communal Facilities/Building Services - 1970 - Steel (Steel)**

**Exterior**

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

**Interior**

**B00D - R0004 - Special Programs Room**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Pupil Facilities - 1970 - Timber (Timber)**

**Exterior**

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

**Interior**

**B00E - R0002 - Outdoor Learning Area**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Other - 2008 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

**Interior**

**B00F - R0001 - Sports Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

**Interior**

**B00G - R0001 - Reading Area**

No Asbestos

**B00G - R0002 - K.L.A. Store**

No Asbestos

**B00G - R0003 - Practical Activities**

No Asbestos

**B00G - R0004 - External Movement**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017