


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Balgownie Public School (1106)
Region : Illawarra and South East
State Electorate : Keira
Local Government Area : Wollongong

Initial Survey : Noel Arnold & Associates : 30 - Mar - 2008
Reviewed By : AECOM : 18 - Jun - 2015

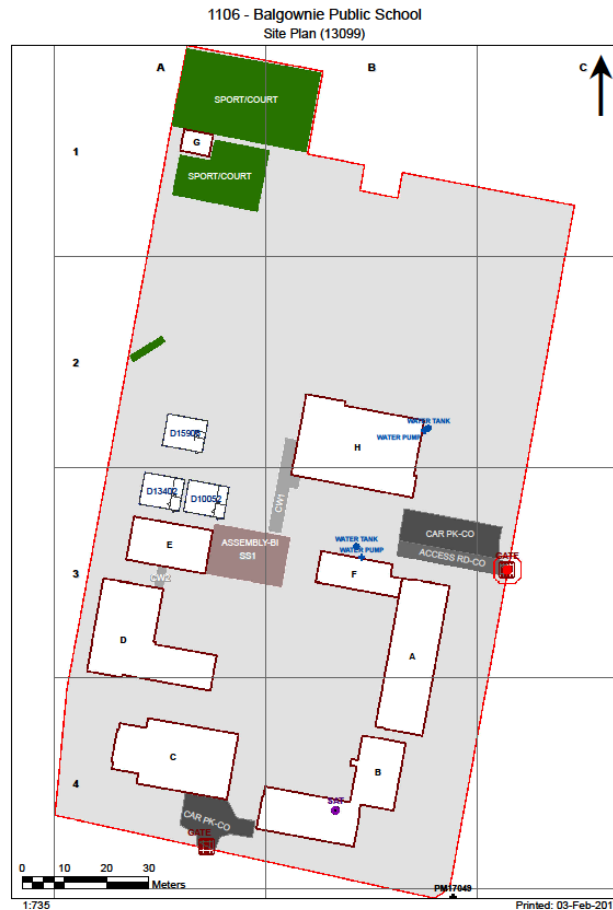

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1980 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	26m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00C/Room+1/Wall Linings Internal/S12					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	28m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00C/Room+1/Wall Linings Internal/S12					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	22m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00A/R1002/In-fill-panel/S18					Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found					
Ceiling Voids	Non Accessible Area - Area inaccessible - limited access due to height and storage.					

Interior

B00A - R0001 - Staff Toilet (3.35 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1106/B00A/R0015/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0002 - Uniform Shop (5.61 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1106/B00A/R0002/Ceiling Structures/Linings/S19					

B00A - R0003 - Canteen (26.38 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1106/B00A/R0002/Ceiling Structures/Linings/S19					

B00A - R0004 - Canteen Office/Store (7.52 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1106/B00A/R0002/Ceiling Structures/Linings/S19					

B00A - R0005 - General Storeroom (13.04 m2)

No Asbestos

B00A - R0006 - Movement (7.23 m2)

No Asbestos

B00A - R0007 - Movement (35.82 m2)

No Asbestos

B00A - R0008 - Sports Store (13.6 m2)

No Asbestos

B00A - R0009 - Main Switch Board (2.07 m2)

Wall Linings Internal	Flat AC Sheeting	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00A/R0009/Wall Linings Internal/S5					Chrysotile (white asbestos)

B00A - R0010 - Duplicating Workroom (28.57 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1106/B00A/R0015/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0011 - Staff Toilet (5.04 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1106/B00A/R0015/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0012 - Cleaning Distributed Store (1.66 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1106/B00A/R0015/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0013 - Staff Toilet (4.34 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	1106/B00A/R0015/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0014 - Interview (13.72 m2)						
Ceiling Structures/Linings	Vermiculite					
	1106/B00A/R0015/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0015 - Movement (14.36 m2)						
Ceiling Structures/Linings	Vermiculite					
	1106/B00A/R0015/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0016 - Principal (14.4 m2)						
Ceiling Structures/Linings	Vermiculite					
	1106/B00A/R0015/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0017 - Clerical Office (12.35 m2)						
Ceiling Structures/Linings	Vermiculite					
	1106/B00A/R0015/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0018 - Sick Bay (11.97 m2)						
Ceiling Structures/Linings	Vermiculite					
	1106/B00A/R0015/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0019 - Entry Vestibule (12.08 m2)						
Ceiling Structures/Linings	Vermiculite					
	1106/B00A/R0015/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00A/R0021/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
B00A - R0020 - General Storeroom (0.23 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00A/R0021/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
B00A - R0021 - General Storeroom (18.09 m2)						
Ceiling Structures/Linings	Vermiculite					
	1106/B00A/R0015/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00A/R0021/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
B00A - R0022 - Cleaning Supplies (13.07 m2)						
No Asbestos						
B00A - R0023 - Movement (7.25 m2)						
No Asbestos						
B00A - R0024 - External Movement (74 m2)						
In-fill-panel	Flat AC Sheeting	7m	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00A/R1002/In-fill-panel/S18					Chrysotile (white asbestos)
B00A - R0025 - Stairs (1.12 m2)						
No Asbestos						
B00A - R0026 - Stairs (0.95 m2)						
No Asbestos						
B00A - R1001 - General Storeroom (9.25 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00C/Room+1/Wall Linings Internal/S12					Chrysotile (white asbestos)
B00A - R1002 - Movement (79.62 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00C/Room+1/Wall Linings Internal/S12					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	12m	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00A/R1002/In-fill-panel/S18					Chrysotile (white asbestos)
B00A - R1003 - Home Base (58.69 m2)						
Ceiling Structures/Linings	Vermiculite					
	1106/B00A/R0015/Ceiling Structures/Linings/S3					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00A - R1004 - Home Base Store (7.91 m2)						
Ceiling Structures/Linings	Vermiculite					
	1106/B00A/R0015/Ceiling Structures/Linings/S3					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00A - R1005 - Movement (12.6 m2)						
Ceiling Structures/Linings	Vermiculite					
	1106/B00A/R0015/Ceiling Structures/Linings/S3					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00A/R0021/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
B00A - R1006 - Distribution Board (0.85 m2)						
						Note: No inspection of live electrical installation.
Ceiling Structures/Linings	Vermiculite					
	1106/B00A/R0015/Ceiling Structures/Linings/S3					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00A/R0021/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
B00A - R1007 - Home Base (59.28 m2)						
Ceiling Structures/Linings	Vermiculite					
	1106/B00A/R0015/Ceiling Structures/Linings/S3					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00A - R1008 - Home Base Store (6.89 m2)						
Ceiling Structures/Linings	Vermiculite					
	1106/B00A/R0015/Ceiling Structures/Linings/S3					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00A/R0021/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
B00A - R1009 - Movement (6.56 m2)						
Ceiling Structures/Linings	Vermiculite					
	1106/B00A/R0015/Ceiling Structures/Linings/S3					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00A - R1010 - Home Base (59.28 m2)						
Ceiling Structures/Linings	Vermiculite					
	1106/B00A/R0015/Ceiling Structures/Linings/S3					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00A - R1011 - Home Base Store (6.78 m2)						
Ceiling Structures/Linings	Vermiculite					
	1106/B00A/R0015/Ceiling Structures/Linings/S3					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1106/B00A/R0021/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00A - R1012 - General Storeroom (9.11 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1106/B00C/Room+1/Wall Linings Internal/S12					Chrysotile (white asbestos)	
B00A - R1013 - Stairs (16.1 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1106/B00C/Room+1/Wall Linings Internal/S12					Chrysotile (white asbestos)	
B00A - R1014 - Stairs (16.29 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1106/B00C/Room+1/Wall Linings Internal/S12					Chrysotile (white asbestos)	
B00A - R9001 - Special Programs Room (74.13 m2)						
No Asbestos						
B00A - R9002 - Kiln Room (2.4 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1888 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00B/Eaves Linings/S9				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	24m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00B/Eaves Linings/S9				Chrysotile (white asbestos)	
Wall Cladding	Flat AC Sheeting	4m2	Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00B/Eaves Linings/S9				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00B - R0001 - Home Base (47.48 m2)

No Asbestos

B00B - R0002 - Home Base (52.72 m2)

No Asbestos

B00B - R0003 - Withdrawal Space - 1hb (15.85 m2)

Floor Coverings Res/Textile	Vinyl Tiles	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00B/R0003/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	

B00B - R0004 - Movement (33.51 m2)

No Asbestos

B00B - R0005 - External Movement (1.95 m2)

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1106/B00B/R0005/Wall Linings Internal/S7					

B00B - R0006 - Movement (40.6 m2)

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1106/B00B/R0005/Wall Linings Internal/S7					

B00B - R0007 - Home Base (96.14 m2)

No Asbestos

B00B - R0008 - Raised Platform (19.72 m2)

No Asbestos

B00B - R0009 - Home Base (49.73 m2)

Wall Linings Internal	Flat AC Sheeting	2m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00B/R0009/Wall Linings Internal/S8				Chrysotile (white asbestos)	

B00B - R0010 - General Storeroom (9.43 m2)

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00B/R0003/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	

B00B - R9001 - Museum (45.8 m2)

No Asbestos

B00B - R9002 - Museum (52.08 m2)

No Asbestos

B00B - R9003 - Museum (45.29 m2)

No Asbestos

B00B - R9004 - General Storeroom (17.42 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Library - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling
 Non Accessible Area
 - Area inaccessible - due to raked ceiling.

Underfloor Voids - Slab on Ground
 No Asbestos Found

Interior

B00C - R0002 - Library Office/Workroom (24.68 m2)

No Asbestos

B00C - R0005 - No Access (1.58 m2)

Ceiling Structures/Linings	Compressed AC Sheet	1.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	-------	------------	--------------------	---------	--------------------

1106/B00C/R0005/Ceiling Structures/Linings/S20

Chrysotile (white asbestos)

Wall Linings Internal	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	---------------------	------	------------	--------------------	---------	--------------------

1106/B00C/R0005/Ceiling Structures/Linings/S20

Chrysotile (white asbestos)

B00C - R0006 - External Movement (130.8 m2)

No Asbestos

B00C - R0007 - Special Programs Room (59.43 m2)

No Asbestos

B00C - R0008 - Security Store (17.61 m2)

No Asbestos

B00C - R0009 - Reading Area (151.18 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00D - General Learning/Staff Facilities - 1970 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	36m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00D/R0001/Ceiling Structures/Linings/S21			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Gable Verge Lining	Flat AC Sheeting	24m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00D/R0001/Ceiling Structures/Linings/S21			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0001 - External Movement (3.54 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00D/R0001/Ceiling Structures/Linings/S21			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00D - R0002 - Entry Vestibule (7.64 m2)

No Asbestos

B00D - R0004 - Cleaning Distributed Store (0.35 m2)

Non Accessible

B00D - R0005 - Craft Store (8.29 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	1106/B00D/R0005/Floor Coverings Res/Textile/S13			No Asbestos Detected		

B00D - R0006 - Distribution Board (0.4 m2)

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	4m2	North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00C/Room+1/Wall Linings Internal/S12			Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00C/Room+1/Wall Linings Internal/S12			Chrysotile (white asbestos)		

B00D - R0008 - Cleaning Distributed Store (1.53 m2)

Non Accessible

B00D - R0009 - Seminar/Study (21.58 m2)

No Asbestos

B00D - R0010 - Movement (16.43 m2)

No Asbestos

B00D - R0013 - Cleaning Distributed Store (3.54 m2)

Non Accessible

B00D - R0015 - Personal Effects Storage (13.24 m2)

No Asbestos

B00D - R0016 - Home Base (85.9 m2)

No Asbestos

B00D - R0017 - Home Base (57.11 m2)

No Asbestos

B00D - R0018 - Personal Effects Storage (11.64 m2)

No Asbestos

B00D - R0019 - External Movement (1.63 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1106/B00D/R0001/Ceiling Structures/Linings/S21				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00D - R0020 - External Movement (75.67 m2)						
No Asbestos						
B00D - R0021 - Practical Activities/Movement - 1hb (45.8 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1106/B00D/R0001/Ceiling Structures/Linings/S21				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00D - R0022 - Toilets - Boys/Girls (1.36 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	1.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1106/B00D/R0001/Ceiling Structures/Linings/S21				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00D - R0023 - Toilet - Lobby (1.37 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	1.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1106/B00D/R0001/Ceiling Structures/Linings/S21				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00D - R0024 - Staff Toilet (1.57 m2)						
Wall Linings Internal	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1106/B00C/Room+1/Wall Linings Internal/S12				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	1.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1106/B00D/R0001/Ceiling Structures/Linings/S21				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00D - R0025 - Toilet - Lobby (2.52 m2)						
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1106/B00C/Room+1/Wall Linings Internal/S12				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	2.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1106/B00D/R0001/Ceiling Structures/Linings/S21				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00D - R0026 - Staff Kitchen (9.67 m2)						
Floor Coverings Res/Textile	Resinous Membrane					
1106/B00D/R0026/Floor Coverings Res/Textile/S22				No Asbestos Detected		
B00D - R0027 - Staff Room (34.72 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00E - General Learning - 1889 - Brick/Block (Brick/Block)						
Exterior						
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00E/Eaves Linings/S23					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Moulded AC sheet	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00E/Eaves Linings/S23					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Interior						
B00E - R0001 - Home Base (56.8 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1106/B00E/R0004/Ceiling Structures/Linings/S14					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
In-fill-panel	Flat AC Sheeting	4m	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00E/R0005/In-fill-panel/S15					Chrysotile (white asbestos)
B00E - R0002 - Home Base Store (4.08 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1106/B00E/R0004/Ceiling Structures/Linings/S14					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
In-fill-panel	Flat AC Sheeting	1m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00E/R0005/In-fill-panel/S15					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00E/R0002/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)
B00E - R0003 - Personal Effects Storage (18.96 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1106/B00E/R0004/Ceiling Structures/Linings/S14					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00E/R0002/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)
B00E - R0004 - Home Base (56.88 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1106/B00E/R0004/Ceiling Structures/Linings/S14					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
In-fill-panel	Flat AC Sheeting	4m	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00E/R0005/In-fill-panel/S15					Chrysotile (white asbestos)
B00E - R0005 - Home Base Store (4.1 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1106/B00E/R0004/Ceiling Structures/Linings/S14					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
In-fill-panel	Flat AC Sheeting	1m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00E/R0005/In-fill-panel/S15					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00E/R0002/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)
B00E - R0006 - External Movement (34.5 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
In-fill-panel	Flat AC Sheeting	16m	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1106/B00E/R0005/In-fill-panel/S15					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 1960 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00F - R0001 - External Movement (41.52 m2)

No Asbestos

B00F - R0002 - Toilets - Girls (35.08 m2)

Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1106/B00F/R0003/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	16m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
1106/B00F/R0003/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)	

B00F - R0003 - Toilets - Boys (39.27 m2)

Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1106/B00F/R0003/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
1106/B00F/R0003/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00G - Shed/Communal Facilities - 1965 - Brick/Block (Brick/Block)

Exterior

No Asbestos

Interior

B00G - R0001 - P.E. Store (13.03 m2)

No Asbestos

B00G - R0002 - Movement (6.91 m2)

No Asbestos

B00G - R0004 - General Storeroom (6.49 m2)

No Asbestos

B00G - R0005 - Toilet - Lobby (0.86 m2)

No Asbestos

B00G - R0006 - Toilets-Unisex (1.78 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00H - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00H - R0001 - Access Shower/Toilet (6.9 m2)**

No Asbestos

B00H - R0002 - Main Switch Board (3.35 m2)

No Asbestos

B00H - R0003 - Communal Space (237.87 m2)

No Asbestos

B00H - R0004 - Cleaning Distributed Store (3.44 m2)

No Asbestos

B00H - R0005 - Plant (1.6 m2)

No Asbestos

B00H - R0006 - Toilet - Lobby (3.33 m2)

No Asbestos

B00H - R0007 - Sound Cupboard (2.02 m2)

No Asbestos

B00H - R0008 - Toilet - Lobby (2.42 m2)

No Asbestos

B00H - R0009 - P.E. Store (12.94 m2)

No Asbestos

B00H - R0010 - Communal/Performance Store (9.49 m2)

No Asbestos

B00H - R0011 - Hall Chair Store (9.47 m2)

No Asbestos

B00H - R0012 - External Movement (25.4 m2)

No Asbestos

B00H - R0013 - Toilets - Boys (5.62 m2)

No Asbestos

B00H - R0014 - Toilets - Girls (7.19 m2)

No Asbestos

B00H - R0015 - Covered Outdoor Learning Area (182.63 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D10052 - Learning Unit - Standard/Withdrawal : Placement Date - 28/04/2005

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 601 - D13402 - Learning Unit - Standard/Withdrawal : Placement Date - 27/02/2004

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 602 - D15908 - Learning Unit - Standard With P.A.A. : Placement Date - 8/03/2006

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017