


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Baradine Central School (1130)  
**Region :** Western NSW  
**State Electorate :** Barwon  
**Local Government Area :** Warrumbungle

**Initial Survey :** Noel Arnold & Associates : 11 - Mar - 2008  
**Reviewed By :** Parsons Brinckerhoff : 25 - Aug - 2016

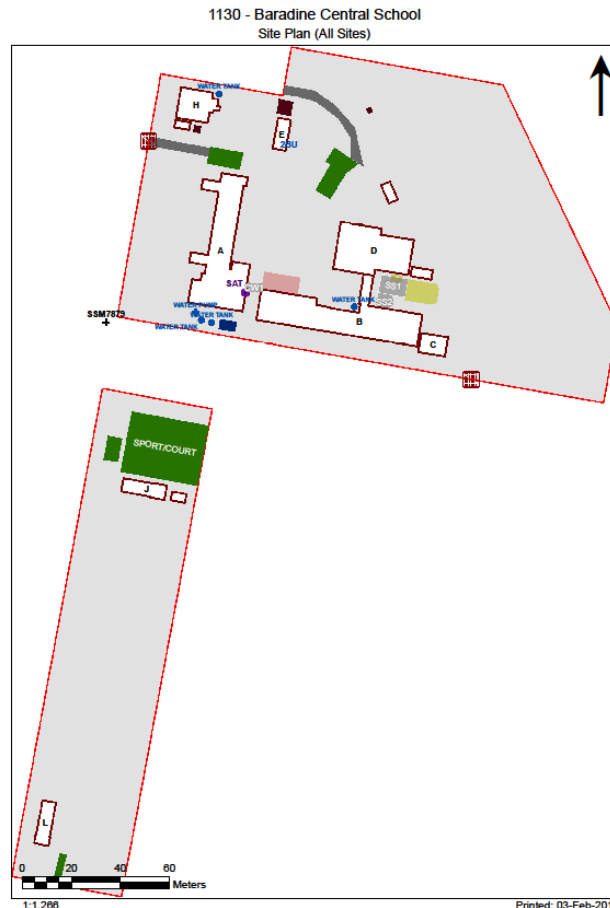

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - Administration/Library - 1968 - Brick/Block (Brick/Block)</b>						
<b>Exterior</b>						
Ceiling Void	Non Accessible Area - No Manhole in Building					
Underfloor Voids - Slab on Ground	No Asbestos Found					
<b>Interior</b>						
<b>B00A - R0001 - Sick Bay (6.49 m2)</b>						
No Asbestos						
<b>B00A - R0002 - Principal (17.76 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1130/B00A/R0009/Ceiling Structures/Linings/S11					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0003 - Public Entry (9.03 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1130/B00A/R0009/Ceiling Structures/Linings/S11					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0009 - General Learning Space (56.07 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1130/B00A/R0009/Ceiling Structures/Linings/S11					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0010 - General Storeroom (6.49 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1130/B00A/R0009/Ceiling Structures/Linings/S11					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0011 - Movement (81.15 m2)</b>						
No Asbestos						
<b>B00A - R0012 - General Storeroom (4.19 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1130/B00A/R0009/Ceiling Structures/Linings/S11					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0013 - Cleaning Distributed Store (4.28 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1130/B00A/R0009/Ceiling Structures/Linings/S11					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0014 - Interview (9.67 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1130/B00A/R0009/Ceiling Structures/Linings/S11					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0020 - Computer Resource (9.78 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1130/B00A/R0009/Ceiling Structures/Linings/S11					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0022 - Movement (35.69 m2)</b>						
No Asbestos						
<b>B00A - R0023 - Distribution Board (1.2 m2)</b>						
					Note: No inspection of live electrical installation.	
Wall Linings Internal	Flat AC Sheeting 1130/B00A/R0023/Wall Linings Internal/S1					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 1130/B00A/R0023/Ceiling Structures/Linings/S2					No Asbestos Detected
<b>B00A - R0024 - Movement (10.2 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R0025 - General Storeroom (6.51 m2)</b>						
No Asbestos						
<b>B00A - R0026 - General Storeroom (6.51 m2)</b>						
No Asbestos						
<b>B00A - R0027 - Movement (10.17 m2)</b>						
No Asbestos						
<b>B00A - R0028 - Reading Area (165.19 m2)</b>						
No Asbestos						
<b>B00A - R0030 - Library Office/Workroom (19.82 m2)</b>						
No Asbestos						
<b>B00A - R0031 - Stairs (3.99 m2)</b>						
No Asbestos						
<b>B00A - R0032 - Stairs (3.99 m2)</b>						
No Asbestos						
<b>B00A - R0035 - Sick Bay - Shower/Toilet (3.11 m2)</b>						
No Asbestos						
<b>B00A - R0036 - Clerical Office/Workroom (32.37 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
		1130/B00A/R0009/Ceiling Structures/Linings/S11				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0037 - Clerical Office (5.09 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
		1130/B00A/R0009/Ceiling Structures/Linings/S11				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0038 - Main Switch Board (3.31 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
		1130/B00A/R0009/Ceiling Structures/Linings/S11				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0039 - Hospitality Space (88.98 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
		1130/B00A/R0009/Ceiling Structures/Linings/S11				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0040 - Laundry (5.69 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
		1130/B00A/R0009/Ceiling Structures/Linings/S11				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0041 - Materials Store (10.54 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
		1130/B00A/R0009/Ceiling Structures/Linings/S11				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0042 - Preparation - Materials (15.56 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
		1130/B00A/R0009/Ceiling Structures/Linings/S11				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0043 - External Movement (77.24 m2)</b>						
No Asbestos						
<b>B00A - R0044 - Distribution Board (0.57 m2)</b>						
					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Vermiculite					
		1130/B00A/R0009/Ceiling Structures/Linings/S11				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1001 - Staff Room Annexe (24.82 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R1002 - Staff Toilet (3.58 m2)</b>						
No Asbestos						
<b>B00A - R1003 - Movement (74.44 m2)</b>						
No Asbestos						
<b>B00A - R1004 - Preparation (19.15 m2)</b>						
No Asbestos						
<b>B00A - R1005 - Apparatus Store (6.49 m2)</b>						
No Asbestos						
<b>B00A - R1006 - Laboratory L.S. (82 m2)</b>						
No Asbestos						
<b>B00A - R1007 - Distribution Board (0.5 m2)</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B00A - R1008 - Resources Space (16.52 m2)</b>						
No Asbestos						
<b>B00A - R1014 - Cleaning Distributed Store (3.58 m2)</b>						
No Asbestos						
<b>B00A - R1015 - Stairs (14.05 m2)</b>						
No Asbestos						
<b>B00A - R1016 - Stairs (13.77 m2)</b>						
No Asbestos						
<b>B00A - R1017 - Materials Technology L.S. (118.58 m2)</b>						
No Asbestos						
<b>B00A - R1018 - Materials Store (13.22 m2)</b>						
No Asbestos						
<b>B00A - R1019 - Welding Area (3.36 m2)</b>						
No Asbestos						
<b>B00A - R1020 - Welding Area (3.36 m2)</b>						
No Asbestos						
<b>B00A - R1022 - Kiln Room (4.61 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning/Staff Facilities - 1880 - Timber (Timber)****Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior****B00B - R0001 - Movement (13.42 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	1130/B00B/R0015/Ceiling Structures/Linings/S4					<b>No Asbestos Detected</b>

**B00B - R0002 - Home Base (45.7 m2)**

No Asbestos

**B00B - R0003 - Withdrawal Space - 1hb (45.7 m2)**

No Asbestos

**B00B - R0004 - Home Base (48.03 m2)**

No Asbestos

**B00B - R0005 - General Learning Space (48.04 m2)**

No Asbestos

**B00B - R0006 - Staff Room Annexe (13.43 m2)**

No Asbestos

**B00B - R0009 - Home Base (58.12 m2)**

No Asbestos

**B00B - R0010 - Home Base (55.42 m2)**

No Asbestos

**B00B - R0011 - General Learning Space (54.26 m2)**

No Asbestos

**B00B - R0012 - Staff Toilet (3.17 m2)**

Wall Linings Internal	Flat AC Sheeting					
	1130/B00B/R0012/Wall Linings Internal/S5					<b>No Asbestos Detected</b>

**B00B - R0013 - Staff Toilet (3.11 m2)**

Wall Linings Internal	Flat AC Sheeting					
	1130/B00B/R0012/Wall Linings Internal/S5					<b>No Asbestos Detected</b>

**B00B - R0014 - Staff Room (47.24 m2)**

No Asbestos

**B00B - R0015 - Movement (104.14 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	1130/B00B/R0015/Ceiling Structures/Linings/S4					<b>No Asbestos Detected</b>

**B00B - R0016 - General Storeroom (12.92 m2)**

No Asbestos

**B00B - R0017 - Movement (55.35 m2)**

No Asbestos

**B00B - R0018 - Practical Activities - 1hb (38.75 m2)**

No Asbestos

**B00B - R0019 - General Storeroom (12.02 m2)**

No Asbestos

**B00B - R0021 - Principal Office (18.99 m2)**

No Asbestos

**B00B - R0022 - Movement (3.95 m2)**

No Asbestos

**B00B - R0023 - Store (10.02 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Floor Coverings Res/Textile	Vinyl Sheet					
	1130/B00B/R0023/Floor Coverings Res/Textile/S12					<b>No Asbestos Detected</b>

**B00B - R0024 - Covered Area (50.75 m2)**

No Asbestos

**B00B - R0025 - Covered Area (61.07 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Special Purpose - 1947 - Timber (Timber)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B00C - R0001 - Craft Store (6.35 m2)**

No Asbestos

**B00C - R0002 - Special Programs Room (47.67 m2)**

No Asbestos

**B00C - R0003 - Special Programs Room (9.98 m2)**

No Asbestos

**B00C - R0004 - Craft Store (10.99 m2)**

No Asbestos

**B00C - R0005 - Movement (3.95 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Pupil Facilities - 1965 - Brick/Block (Brick/Block)****Exterior**

Ceiling Void No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

**Interior****B00D - R0002 - Raised Platform (41.7 m2)**

No Asbestos

**B00D - R0003 - Canteen (26.63 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1130/B00D/R0005/Floor Coverings Res/Textile/S7					<b>Chrysotile (white asbestos)</b>	

**B00D - R0004 - General Storeroom (2.81 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1130/B00D/R0005/Floor Coverings Res/Textile/S7					<b>Chrysotile (white asbestos)</b>	

**B00D - R0005 - Staff Toilet (3.07 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1130/B00D/R0005/Floor Coverings Res/Textile/S7					<b>Chrysotile (white asbestos)</b>	

Incinerette	Encapsulated Insulation material within unit	1Unit(s)	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Encapsulated material within unit</b>						

**B00D - R0006 - General Storeroom (4.16 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1130/B00D/R0005/Floor Coverings Res/Textile/S7					<b>Chrysotile (white asbestos)</b>	

**B00D - R0007 - Movement (5.06 m2)**

No Asbestos

**B00D - R0008 - Shower/Change (12.8 m2)**

No Asbestos

**B00D - R0009 - Toilets - Boys (16.16 m2)**

No Asbestos

**B00D - R0010 - Movement (4.98 m2)**

No Asbestos

**B00D - R0011 - Shower/Change (12.69 m2)**

No Asbestos

**B00D - R0012 - Distribution Board (0.37 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00D - R0013 - Toilets - Girls (13.62 m2)**

Incinerette	Encapsulated Insulation material within unit	1Unit(s)	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Encapsulated materila within unit</b>						

**B00D - R0014 - Cleaning Distributed Store (2.3 m2)**

No Asbestos

**B00D - R0018 - External Movement (67.32 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1130/B00D/R0018/Ceiling Structures/Linings/S13					<b>Chrysotile (white asbestos)</b>	

**B00D - R0019 - Communal Space (189.88 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	20m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
1130/B00D/R0019/Ceiling Structures/Linings/S14					<b>Chrysotile (white asbestos)</b>	



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - R0020 - Covered Area (92.21 m2)**

Recently Modified Space    Requires Inspection

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Pupil Facilities - 1964 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1130/B00E/Eaves Linings/S15					<b>Chrysotile (white asbestos)</b>
Ceiling Void	Non Accessible Area - No Manhole in Building					

**Interior**

**B00E - R0001 - Toilets - Boys (31.64 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	1130/B00E/R0001/Wall Linings Internal/S8					
Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1130/B00E/R0001/Ceiling Structures/Linings/S9					<b>Chrysotile (white asbestos)</b>
Partition Walls (Cubicles)	Compressed AC Sheet					<b>No Asbestos Detected</b>
	1130/B00E/R0001/Partition Walls (Cubicles)/S10					

**B00E - R0002 - Toilets - Girls (25.95 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1130/B00E/R0001/Ceiling Structures/Linings/S9					<b>Chrysotile (white asbestos)</b>
Partition Walls (Cubicles)	Compressed AC Sheet					<b>No Asbestos Detected</b>
	1130/B00E/R0001/Partition Walls (Cubicles)/S10					
Incinerette	Encapsulated Insulation material within unit	2Unit(s)	East	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Encapsulated material within unit</b>					
Incinerette	Woven Rope	2Unit	Upper portion	Friable Asbestos (5)	Medium (2)	High Priority (6-8)
	1130/B00E/R0002/Incinerette/S17					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Communal Facilities/Building Services - 1950 - Timber (Timber)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00F - R0001 - Sports Store (14.19 m2)**

Wall Linings Internal	Flat AC Sheeting	50m2	Variable positions	Some Damage / Unsealed (3)	Medium (2)	Low Priority (2-3)
1130/B00F/R0001/Wall Linings Internal/S6					<b>Chrysotile (white asbestos)</b>	

**B00F - R0002 - Cleaning Supplies (15.95 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Music - 1948 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	3m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1130/B00G/Eaves Linings/S16					<b>Chrysotile (white asbestos)</b>
Underfloor Voids	No Asbestos Found					
Ceiling Void	Non Accessible Area - No Manhole in Building					

**Interior**

**B00G - R0001 - Resources (28.88 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00H - Pre School Facilities - 1950 - Timber (Timber)****Exterior**

Underfloor Void	AC Fragments/Debris	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	1130/B00H/Underfloor Void/S18					<b>Chrysotile (white asbestos)</b>
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	1130/B00H/Underfloor Voids - Packing to Floor Joists/S19					<b>Chrysotile (white asbestos)</b>
Ceiling Void	AC Fragments/Debris	2m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	1130/B00H/Ceiling Void/S20					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1130/B00H/Eaves Linings/S22					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Infill panels under windows	Flat AC Sheeting	8m2	North	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	1130/B00H/Infill panels under windows/S23					<b>Chrysotile (white asbestos)</b>

**Interior****B00H - R0001 - Movement (27.21 m2)**

Barge Board	Flat AC Sheeting	4m2	North, South & West	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	1130/B00H/R0001/Barge Board/S24					<b>Chrysotile (white asbestos)</b>
Infill panel under window	Flat AC Sheeting	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1130/B00H/Infill panels under windows/S23					<b>Chrysotile (white asbestos)</b>
Electrical Backing Board	Resinous Board	1Unit	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1130/B00H/R0001/Electrical Backing Board/S25					<b>Chrysotile (white asbestos)</b>

**B00H - R0002 - Movement (6.73 m2)**

Infill panel under window	Flat AC Sheeting	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1130/B00H/Infill panels under windows/S23					<b>Chrysotile (white asbestos)</b>

**B00H - R0003 - Movement (1.5 m2)**

No Asbestos

**B00H - R0004 - General Storeroom - Pre (16.83 m2)**

Wall Linings Internal	Flat AC Sheeting	20m2	North, West & East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1130/B00H/R0009/Wall Linings Internal/S26					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1130/B00H/R0009/Wall Linings Internal/S26					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00H - R0005 - Kitchen - Pre (12.98 m2)**

Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1130/B00H/R0005/Wall Linings Internal/S27					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1130/B00H/R0009/Wall Linings Internal/S26					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00H - R0006 - Pantry (1.62 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1130/B00H/R0009/Wall Linings Internal/S26			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1130/B00H/R0009/Wall Linings Internal/S26			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00H - R0007 - General Storeroom - Pre (9.14 m2)</b>						
Wall Linings Internal	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1130/B00H/R0009/Wall Linings Internal/S26			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1130/B00H/R0009/Wall Linings Internal/S26			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00H - R0008 - Toilets - Boys/Girls - Pre (1.49 m2)</b>						
No Asbestos						
<b>B00H - R0009 - Practical Activities - E (10.52 m2)</b>						
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1130/B00H/R0009/Wall Linings Internal/S26			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1130/B00H/R0009/Wall Linings Internal/S26			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00H - R0010 - Toilets - Boys/Girls - Pre (6.11 m2)</b>						
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1130/B00H/R0009/Wall Linings Internal/S26			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1130/B00H/R0009/Wall Linings Internal/S26			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00H - R0011 - Home Base - Pre (71.45 m2)</b>						
Wall Linings Internal	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1130/B00H/R0009/Wall Linings Internal/S26			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1130/B00H/R0009/Wall Linings Internal/S26			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - Storage - 1950 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Wall Cladding	Flat AC Sheeting	30m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1130/B00I/Wall Cladding/S21					<b>Chrysotile (white asbestos)</b>

**Interior**

**B00I - R0001 - General Storeroom - Pre (16.67 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Storage - 2016 - Steel (Steel)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B00J - R0001 - Covered Area (64.42 m2)**

No Asbestos

**B00J - R0002 - Sports Store (32.72 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Pupil Facilities - 1988 - Steel (Steel)**

**Exterior**

Ceiling Void	Requires Inspection
Underfloor Void	Requires Inspection

**Interior**

**B00K - R0001 - Covered Area (20.86 m2)**

Recently Modified Space	Requires Inspection
-------------------------	---------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Agricultural Science - 2011 - Steel (Steel)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B00L - R0001 - Animal Space (78.47 m2)**

No Asbestos

**B00L - R0002 - Machine Storage (20.92 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 600 - D18256 - Learning Unit - Small : Placement Date - 23/01/2017**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - General Learning Space**

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017