


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Barellan Central School (1131)
Region : Riverina
State Electorate : Cootamundra
Local Government Area : Narrandera

Initial Survey : Noel Arnold & Associates : 08 - May - 2008
Reviewed By : Greencap-NAA : 15 - Jun - 2016

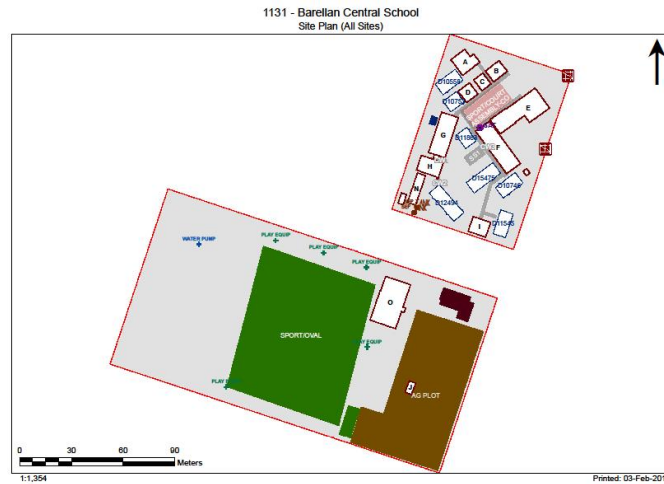

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1920 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible
Underfloor Voids	No Asbestos Found

Interior

B00A - R0001 - General Storeroom

No Asbestos

B00A - R0002 - Home Base

No Asbestos

B00A - R0003 - Withdrawal Space - 1hb

No Asbestos

B00A - R0004 - Home Base Store

No Asbestos

B00A - R0005 - Movement

No Asbestos

B00A - R0006 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1920 - Timber (Timber)

Exterior

Ceiling Voids	Non Accessible Area - Height Restriction 4m height
Underfloor Voids	No Asbestos Found

Interior

B00B - R0001 - Movement

No Asbestos

B00B - R0003 - Movement

No Asbestos

B00B - R0004 - Craft Store

No Asbestos

B00B - R0006 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1920 - Timber (Timber)

Exterior

Ceiling Voids	Non Accessible Area - Height Restriction 4m height
Underfloor Voids	No Asbestos Found

Interior

B00C - R0002 - Computer Store

No Asbestos

B00C - R0004 - Computer Learning Space

Heater Surround	Low density board	2m2	North west corner	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
	1131/B00C/R0004/Heater Surround/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1920 - Timber (Timber)

Exterior

Ceiling Voids	Non Accessible Area - Height Restriction 4m height
Underfloor Voids	No Asbestos Found

Interior

B00D - R0001 - General Storeroom

No Asbestos

B00D - R0002 - General Learning Space

Heater Surround	Low density board	2m2	North west corner	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
	1131/B00C/R0004/Heater Surround/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library - 1911 - Timber (Timber)**Exterior**

Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Electrical Hazard**Interior****B00E - R0009 - Senior Study**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1131/B00E/R0009/Floor Coverings Res/Textile/S9	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 1131/B00E/R0009/Floor Coverings Res/Textile/S10	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00E - R0010 - Covered Outdoor Learning Area

No Asbestos

B00E - R0011 - General Storeroom

No Asbestos

B00E - R0012 - Librarian

No Asbestos

B00E - R0013 - Movement

No Asbestos

B00E - R0014 - Reading Area

Floor Coverings Res/Textile	Adhesive 1131/B00E/R0009/Floor Coverings Res/Textile/S10	154m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1131/B00E/R0009/Floor Coverings Res/Textile/S9	154m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00E - R0015 - Communications Room

No Asbestos

B00E - R0016 - Staff - Toilet

No Asbestos

B00E - R0017 - Library Office/Workroom

Floor Coverings Res/Textile	Adhesive 1131/B00E/R0009/Floor Coverings Res/Textile/S10	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1131/B00E/R0009/Floor Coverings Res/Textile/S9	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00E - R0018 - Seminar/Study

Floor Coverings Res/Textile	Adhesive 1131/B00E/R0009/Floor Coverings Res/Textile/S10	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1131/B00E/R0009/Floor Coverings Res/Textile/S9	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00F - Administration/Science - 1967 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1131/B00F/Eaves Linings/S12			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

Interior**B00F - R0001 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1131/B00F/R0010/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0003 - Seminar

No Asbestos

B00F - R0004 - Duplicating Workroom

No Asbestos

B00F - R0005 - Clerical Office/Workroom

Floor Coverings Res/Textile	Adhesive					
	1131/B00F/R0006/Floor Coverings Res/Textile/S6					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1131/B00F/R0006/Floor Coverings Res/Textile/S5					No Asbestos Detected

B00F - R0006 - Principal

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1131/B00F/R0006/Floor Coverings Res/Textile/S5					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	1131/B00F/R0006/Floor Coverings Res/Textile/S6					No Asbestos Detected

B00F - R0007 - Commonroom

No Asbestos

B00F - R0008 - Staff Kitchen

No Asbestos

B00F - R0009 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting					
	1131/B00F/R0009/Wall Linings Internal/S2					No Asbestos Detected

B00F - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	55m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1131/B00F/R0010/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0011 - General Storeroom

No Asbestos

B00F - R0012 - Distribution Board

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	4m2	North facing, South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1131/B00F/R0012/Wall Linings Internal/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1131/B00F/R0012/Wall Linings Internal/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R0013 - Cleaning Supplies						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1131/B00F/R0012/Wall Linings Internal/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00F - R0014 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1131/B00F/R0010/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00F - R0017 - Public Reception						
No Asbestos						
B00F - R0018 - Administration - Clerical						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 1965 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible

Interior**B00G - R0001 - General Assistant/Bulk Store**

No Asbestos

B00G - R0002 - Toilets - Girls

No Asbestos

B00G - R0003 - Drinking Facilities

No Asbestos

B00G - R0004 - Plant

No Asbestos

B00G - R0005 - Shower/Change

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
1131/B00G/R0005/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)	

B00G - R0006 - Shower/Change

No Asbestos

B00G - R0007 - Toilets - Boys

No Asbestos

B00G - R0008 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Technological & Applied Studies - 1920 - Timber (Timber)

Exterior

Ceiling Voids	Non Accessible Area - Height Restriction 4m height
Underfloor Voids	No Asbestos Found

Interior

B00H - R0001 - General Storeroom

No Asbestos

B00H - R0002 - Movement

No Asbestos

B00H - R0003 - Food Technology L.S.

No Asbestos

B00H - R0004 - Laundry

No Asbestos

B00H - R0005 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Staff Facilities - 1920 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 1131/B00I/Eaves Linings/S8					No Asbestos Detected
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

Interior**B00I - R0001 - General Storeroom**

No Asbestos

B00I - R0002 - General Learning Space

Heater Surround	Low density board 1131/B00I/R0002/Heater Surround/S7	1Unit(s)	South facing, West facing	Friable Asbestos (5)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos)
-----------------	---	----------	------------------------------	----------------------	---------	---

B00I - R0003 - Resources Store

No Asbestos

B00I - R0004 - Practice/Seminar

No Asbestos

B00I - R0005 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting 1131/B00F/R0009/Wall Linings Internal/S2					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00I - R0006 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Shed - 1987 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00J - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pupil Facilities - 2008 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00K - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Pupil Facilities - 2008 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00L - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Electrical Services - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00M - R0001 - Main Switchroom

No Asbestos

B00M - R0002 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Multi Purpose Facilities - 2013 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00N - R0001 - Gymnasium

No Asbestos

B00N - R0002 - General Storeroom

No Asbestos

B00N - R0003 - Sport Equipment Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - General Learning/Technological - 2015 - Steel (Steel)**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior**B000 - R0001 - Workshop Area**

No Asbestos

B000 - R0002 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B000 - R0003 - Welding Area

No Asbestos

B000 - R0004 - Welding Area

No Asbestos

B000 - R0005 - Welding Store

No Asbestos

B000 - R0006 - Toilets-Disabled

No Asbestos

B000 - R0007 - Covered Outdoor Learning Area

No Asbestos

B000 - R0008 - Covered Area

No Asbestos

B000 - R0009 - Materials Store

No Asbestos

B000 - R0010 - Resource/Project Store

No Asbestos

B000 - R0011 - Project Store - Type 1

No Asbestos

B000 - R0012 - Other

No Asbestos

B000 - R0013 - Plant

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 700 - D10558 - Art Learning Space/Workshop/Store : Placement Date - 23/05/2006

Exterior

Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	17.28 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - Art Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	91 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 780 - D10746 - Woodwork/Metalwork/Heat Area/Store : Placement Date - 30/06/1995

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	17.28 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Interior

R1 - Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2

R2 - Materials Technology L.S.

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	91 m2

OS 601 - D10753 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 720 - D11545 - Science Laboratory/Prep Room : Placement Date - 9/02/1999

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	17.28 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Laboratory L.S.						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				90 m2
R2 - Preparation						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				19 m2
OS 751 - D11863 - Learning Unit - ESL : Placement Date - 7/02/2006						
Exterior						
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Interior						
R1 - Esl						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2
R2 - Esl						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2
OS 810 - D12494 - FSU/Shelter/Stores : Placement Date - 30/06/1995						
Exterior						
Eave Lining	Flat AC Sheet	Assumed Asbestos				25.92 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Interior						
R1 - Canteen						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				28 m2
R2 - Covered Area						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				109 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				4 m2
R4 - Sports Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
R5 - Garden Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R6 - Change Room						
Ceiling	Flat AC Sheet	Assumed Asbestos				3 m2
R7 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				2 m2
OS 504 - D15475 - Admin Principal/Deputy/Clerk/Store : Placement Date - 5/03/2008						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				23.04 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Clerical Office						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
R10 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				27 m2
R11 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				1 m2
R2 - Security Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				12 m2
R3 - Duplicating Wookroom						
Ceiling	Flat AC Sheet	Assumed Asbestos				12 m2
R4 - Clinic-Waiting						
Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
R5 - Deputy Principal						
Ceiling	Flat AC Sheet	Assumed Asbestos				18 m2
R6 - Principal						
Ceiling	Flat AC Sheet	Assumed Asbestos				18 m2
R7 - Staff Toilet						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2
R8 - Staff Toilet						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2
R9 - Clerk						
Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017