


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bargo Public School (1134)
Region : South Western Sydney
State Electorate : Wollondilly
Local Government Area : Wollondilly

Initial Survey : Noel Arnold & Associates : 19 - May - 2008
Reviewed By : Parsons Brinckerhoff : 25 - Nov - 2016

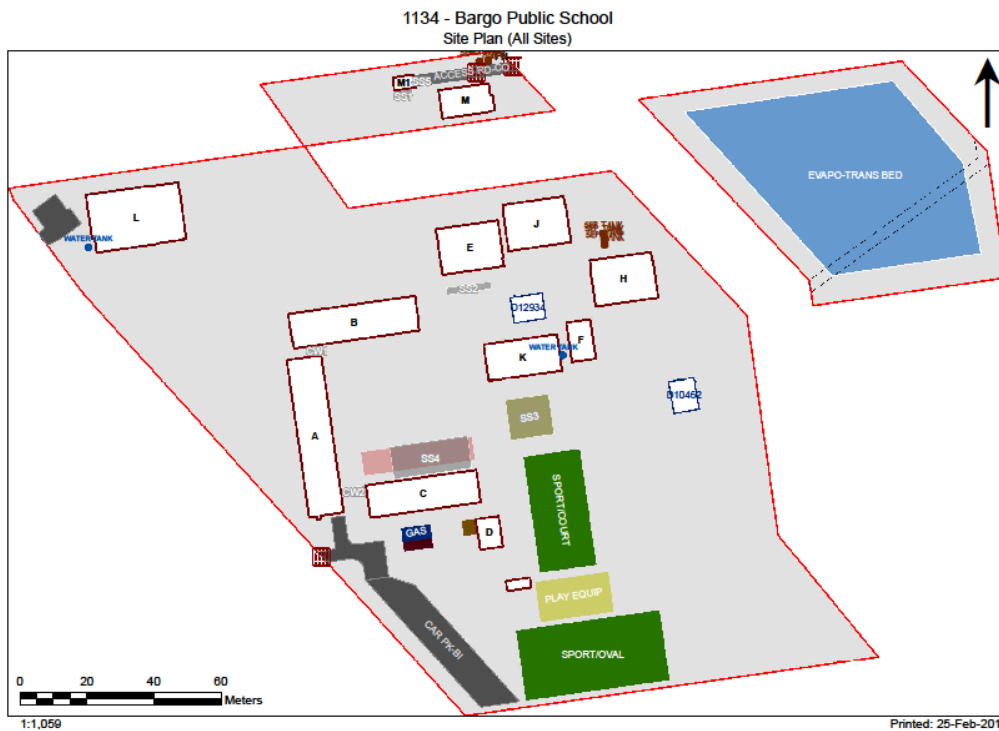

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1975 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - No Voids					
Gable Verge Lining	Flat AC Sheeting	4m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1134/B00A/Gable Verge Lining/S14				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	4m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1134/B00A/Gable Verge Lining/S14				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1134/B00A/Gable Verge Lining/S1				Chrysotile (white asbestos)	

Interior**B00A - R0001 - External Movement**

No Asbestos

B00A - R0002 - Canteen Office/Store

No Asbestos

B00A - R0003 - Staff Toilet

No Asbestos

B00A - R0004 - Canteen Office/Store

No Asbestos

B00A - R0005 - Canteen

No Asbestos

B00A - R0006 - Garden Store

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1134/B00A/R0007/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	

B00A - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1134/B00A/R0007/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	

B00A - R0008 - Uniform Shop

No Asbestos

B00A - R0009 - Sick Bay

No Asbestos

B00A - R0010 - Clerical Office

No Asbestos

B00A - R0011 - Security Store

No Asbestos

B00A - R0012 - Staff Toilet

No Asbestos

B00A - R0013 - Movement

Floor Coverings Res/Textile	Vinyl Tiles					
	1134/B00A/R0014/Floor Coverings Res/Textile/S3				No Asbestos Detected	

B00A - R0014 - Entry Vestibule

Floor Coverings Res/Textile	Vinyl Tiles					
	1134/B00A/R0014/Floor Coverings Res/Textile/S3				No Asbestos Detected	

B00A - R0015 - External Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1134/B00A/Gable Verge Lining/S1					Chrysotile (white asbestos)	
B00A - R0016 - Principal						
No Asbestos						
B00A - R0017 - Duplicating Workroom						
No Asbestos						
B00A - R0018 - Staff Kitchen						
No Asbestos						
B00A - R0019 - Handwashing Facilities						
No Asbestos						
B00A - R0020 - Staff Toilet						
No Asbestos						
B00A - R0021 - Staff Room						
No Asbestos						
B00A - R0022 - Home Base						
No Asbestos						
B00A - R0023 - Home Base Store						
No Asbestos						
B00A - R0024 - Home Base Store						
No Asbestos						
B00A - R0025 - Personal Effects Storage						
No Asbestos						
B00A - R0026 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1134/B00A/Gable Verge Lining/S1					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1975 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - No Voids					
Gable Verge Lining	Flat AC Sheeting 1134/B00B/Gable Verge Lining/S15					No Asbestos Detected

Interior**B00B - R0001 - General Assistant/Bulk Store**

No Asbestos

B00B - R0002 - Cleaning Supplies

No Asbestos

B00B - R0003 - Home Base

No Asbestos

B00B - R0006 - Home Base

No Asbestos

B00B - R0007 - Home Base

No Asbestos

B00B - R0009 - General Storeroom

No Asbestos

B00B - R0010 - Staff Room Annexe

No Asbestos

B00B - R0011 - Toilets - Boys

No Asbestos

B00B - R0012 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Middle portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1134/B00B/R0012/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)

B00B - R0013 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1134/B00B/R0013/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0014 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	76m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1134/B00B/R0014/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B00B - R0015 - Practical Activities - 1hb

No Asbestos

B00B - R0016 - Home Base Store

No Asbestos

B00B - R0017 - Practical Activities - 1hb

No Asbestos

B00B - R0018 - Home Base Store

No Asbestos

B00B - R0019 - Home Base Store

No Asbestos

B00B - R0020 - Practical Activities - 1hb

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1926 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found
Underfloor Voids	Non Accessible Area - Void area less than 300mm

Interior

B00C - R0001 - Craft Store

No Asbestos

B00C - R0002 - Staff Room Annexe

No Asbestos

B00C - R0003 - Home Base

No Asbestos

B00C - R0004 - External Movement

No Asbestos

B00C - R0005 - Toilets - Boys/Girls

Wall Linings Internal	Flat AC Sheeting	10m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
1134/B00C/R0005/Wall Linings Internal/S12					Chrysotile (white asbestos)	

B00C - R0006 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1134/B00C/R0006/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)	

B00C - R0007 - Withdrawal Space - 1hb

No Asbestos

B00C - R0008 - Home Base

No Asbestos

B00C - R0009 - Special Programs Room

No Asbestos

B00C - R0010 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1959 - Timber (Timber)**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	9m2	North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1134/B00D/Eaves Linings/S11				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	3m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1134/B00D/R0002/Wall Linings Internal/S10				Chrysotile (white asbestos)	
Underfloor Voids	No Asbestos Found					

Interior**B00D - R0001 - Practical Activities - 1hb**

Wall Linings Internal	Flat AC Sheeting	20m2	South, East, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1134/B00D/R0002/Wall Linings Internal/S10				Chrysotile (white asbestos)	

B00D - R0002 - Special Programs Room

Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1134/B00D/R0002/Wall Linings Internal/S10				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1134/B00D/R0002/Wall Linings Internal/S10				Chrysotile (white asbestos)	

B00D - R0003 - Craft Store

No Asbestos

B00D - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1995 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 1134/B00E/Eaves Linings/S16					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00E - R0001 - Personal Effects Storage

Ceiling Structures/Linings	Flat AC Sheeting 1134/B00E/R0006/Ceiling Structures/Linings/S8					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00E - R0002 - Movement

No Asbestos

B00E - R0003 - Practical Activities - 1hb

No Asbestos

B00E - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00E - R0005 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00E - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1134/B00E/R0006/Ceiling Structures/Linings/S8					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00E - R0007 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00E - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1134/B00E/R0006/Ceiling Structures/Linings/S8					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00E - R0009 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00E - R0010 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00E - R0011 - Practical Activities - 1hb

No Asbestos

B00E - R0012 - Movement


No Asbestos

B00E - R0013 - Personal Effects Storage

Ceiling Structures/Linings	Flat AC Sheeting 1134/B00E/R0006/Ceiling Structures/Linings/S8					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00E - R0014 - External Movement

No Asbestos

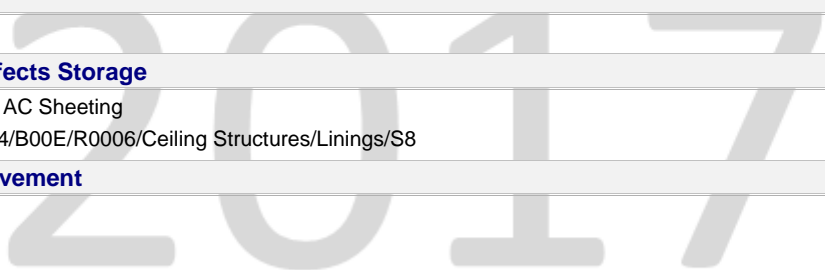

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 1994 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - No Voids
Ceiling Voids	No Asbestos Found

Interior

B00F - R0001 - Handwashing Facilities

No Asbestos

B00F - R0002 - Toilets - Boys

No Asbestos

B00F - R0003 - Handwashing Facilities

No Asbestos

B00F - R0004 - Toilets - Girls

No Asbestos

B00F - R0005 - Drinking Facilities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Administration - 1995 - Steel (Steel)

Exterior

Pillar Packing	Flat AC Sheeting 1134/B00G/Pillar Packing/S9					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00G - R0001 - Entry Vestibule

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00G - R0002 - Staff Toilet

No Asbestos

B00G - R0003 - Community Clinic

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1999 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 1134/B00H/Eaves Linings/S17					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Less than 300mm					

Interior

B00H - R0001 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0002 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0003 - Practical Activities - 1hb

No Asbestos

B00H - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1134/B00E/R0006/Ceiling Structures/Linings/S8					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00H - R0005 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0006 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 1134/B00E/R0006/Ceiling Structures/Linings/S8					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00H - R0007 - Practical Activities - 1hb

No Asbestos

B00H - R0008 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0009 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1134/B00E/R0006/Ceiling Structures/Linings/S8					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 1999 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 1134/B00J/Eaves Linings/S18					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Less than 300mm					

Interior

B00J - R0001 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0002 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0003 - Practical Activities - 1hb

No Asbestos

B00J - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1134/B00E/R0006/Ceiling Structures/Linings/S8					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00J - R0005 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0006 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 1134/B00E/R0006/Ceiling Structures/Linings/S8					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00J - R0007 - Practical Activities - 1hb

No Asbestos

B00J - R0008 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0009 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1134/B00E/R0006/Ceiling Structures/Linings/S8					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Library - 2009 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00K - R0001 - Reading Area

No Asbestos

B00K - R0002 - Library Office/Workroom

No Asbestos

B00K - R0003 - Resource/Toy Space

No Asbestos

B00K - R0004 - K.L.A. Store

No Asbestos

B00K - R0005 - Access Shower/Toilet/Change

No Asbestos

B00K - R0006 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground Non Accessible Area

- No Voids

Ceiling Voids No Asbestos Found

Interior**B00L - R0001 - Communal Space**

No Asbestos

B00L - R0002 - Raised Platform

No Asbestos

B00L - R0003 - Hall Chair Store

No Asbestos

B00L - R0004 - Communal/Performance Store

No Asbestos

B00L - R0005 - P.E. Store

No Asbestos

B00L - R0006 - Toilet - Lobby

No Asbestos

B00L - R0007 - Toilets - Girls

No Asbestos

B00L - R0008 - Sound Cupboard

No Asbestos

B00L - R0009 - Toilet - Lobby

No Asbestos

B00L - R0010 - Toilets - Boys

No Asbestos

B00L - R0011 - Cleaning Distributed Store

No Asbestos

B00L - R0012 - Plant

No Asbestos

B00L - R0013 - Main Switch Board

No Asbestos

B00L - R0014 - Access Shower/Toilet/Change

No Asbestos

B00L - R0015 - Covered Outdoor Learning Area

No Asbestos

B00L - R0016 - Movement

No Asbestos

B00L - R0017 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D10462 - Learning Unit - Standard With P.A.A. : Placement Date - 23/12/2010

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D12934 - Learning Unit - Standard With P.A.A. : Placement Date - 16/12/2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D12990 - Learning Unit - Standard With P.A.A. : Placement Date - 3/01/2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

1134_ASB_010713_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017