


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Barooga Public School (1139)
Region : Riverina
State Electorate : Murray
Local Government Area : Berrigan

Initial Survey : Noel Arnold & Associates : 12 - May - 2008
Reviewed By : Greencap-NAA : 07 - Jul - 2016

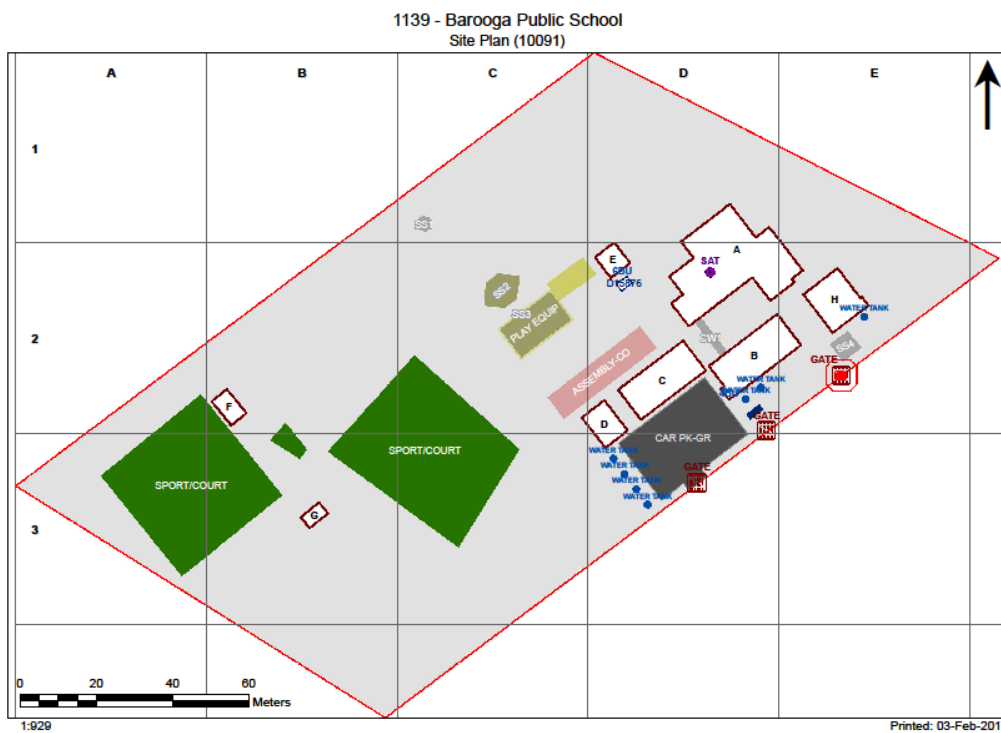

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Library - 1982 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Gable verge lining	Flat AC Sheeting 1139/B00A/Gable verge lining/S16	20m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Window In-fill-panel	Flat AC Sheeting 1139/B00B/Infill panels above and below windows/S2	22m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					

Interior

B00A - R0001 - Home Base

No Asbestos

B00A - R0002 - Home Base Store

No Asbestos

B00A - R0003 - Principal

No Asbestos

B00A - R0004 - Movement

No Asbestos

B00A - R0005 - External Movement

No Asbestos

B00A - R0006 - Clerical Office

No Asbestos

B00A - R0007 - Staff Room

No Asbestos

B00A - R0008 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting 1139/B00A/R0008/Wall Linings Internal/S8	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------	--	------	--------------	--------------------	---------	--

B00A - R0009 - General Storeroom

No Asbestos

B00A - R0010 - Cleaning Distributed Store

No Asbestos

B00A - R0011 - Sick Bay

No Asbestos

B00A - R0012 - Craft Store

No Asbestos

B00A - R0013 - Practical Activities - 1hb

No Asbestos

B00A - R0014 - Distribution Board

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting 1139/B00A/R0008/Wall Linings Internal/S8	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 1139/B00A/R0008/Wall Linings Internal/S8	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0015 - General Storeroom

No Asbestos

B00A - R0016 - General Storeroom

No Asbestos

B00A - R0017 - Home Base

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00A - R0018 - Toilets - Girls

No Asbestos

B00A - R0019 - Cleaning Distributed Store

No Asbestos

B00A - R0020 - Disabled Toilet

No Asbestos

B00A - R0021 - Home Base Store

No Asbestos

B00A - R0022 - Home Base

No Asbestos

B00A - R0023 - Home Base Store

No Asbestos

B00A - R0024 - External Movement

No Asbestos

B00A - R0025 - External Movement

No Asbestos

B00A - R0026 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1970 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	15m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1139/B00B/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Window In-fill-panel	Flat AC Sheeting	20m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1139/B00B/Infill panels above and below windows/S2				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

Interior**B00B - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	42m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1139/B00B/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

B00B - R0002 - Personal Effects Storage

No Asbestos

B00B - R0003 - Home Base Store

No Asbestos

B00B - R0004 - Home Base

No Asbestos

B00B - R0005 - Home Base

No Asbestos

B00B - R0006 - Home Base Store

No Asbestos

B00B - R0007 - Personal Effects Storage

No Asbestos

B00B - R0008 - Canteen

In-fill-panel	Flat AC Sheeting					
	1139/B00B/R0008/In-fill-panel/S9				No Asbestos Detected	

B00B - R0009 - Distribution Board

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Medium Priority (4-5)
	1139/B00B/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	5m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	1139/B00B/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Electrical Mounting Board	Resinous Board	3Unit	North facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Electrical Hazard**B00B - R0010 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1930 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1139/B00C/R0001/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

Interior**B00C - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1139/B00C/R0001/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Compressed AC Sheet					
	1139/B00C/R0001/Floor Coverings Res/Textile/S5					No Asbestos Detected

B00C - R0002 - Staff Room Annexe

No Asbestos

B00C - R0003 - General Storeroom

No Asbestos

B00C - R0004 - Home Base Store

No Asbestos

B00C - R0005 - Personal Effects Storage

No Asbestos

B00C - R0006 - Home Base

Wall Linings Internal	Flat AC Sheeting	2m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1139/B00C/R0001/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1139/B00C/R0006/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1139/B00C/R0006/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

B00C - R0007 - Covered Outdoor Learning Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00D - General Learning - 1970 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	12m2	North facing, South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1139/B00C/R0001/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0001 - Home Base Store

Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1139/B00D/R0001/Wall Linings Internal/S4				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1139/B00D/R0001/Wall Linings Internal/S4				Chrysotile (white asbestos)	

B00D - R0002 - Home Base

Wall Linings Internal	Flat AC Sheeting	75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1139/B00D/R0001/Wall Linings Internal/S4				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1139/B00D/R0001/Wall Linings Internal/S4				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1139/B00D/R0002/Floor Coverings Res/Textile/S13				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1139/B00D/R0002/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)	
Heater Backing	Low Density Fibre Board	2m2	South west corner	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
	1139/B00D/R0002/Heater Backing/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00D - R0003 - External Movement

Wall Linings Internal	Flat AC Sheeting	4m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1139/B00D/R0001/Wall Linings Internal/S4				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Compressed AC Sheet					
	1139/B00C/R0001/Floor Coverings Res/Textile/S5				No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1930 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1139/B00E/R0002/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

Interior**B00E - R0001 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1139/B00E/R0002/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1139/B00E/R0002/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)

B00E - R0002 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1139/B00E/R0002/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1139/B00E/R0002/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Shed - 1930 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1139/B00F/Eaves Linings/S15					No Asbestos Detected

Interior

B00F - R0001 - Sports Store

No Asbestos

B00F - R0002 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Other - 2008 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00G - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Library - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00H - R0001 - Reading Area

No Asbestos

B00H - R0002 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00H - R0003 - Communications Room

No Asbestos

B00H - R0004 - K.L.A. Store

No Asbestos

B00H - R0005 - Library Office/Workroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 837 - D15876 - Hcap Shower/Change/Toilet : Placement Date - 12/12/2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Disabled Shower/Toilet

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017