


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Baryulgil Public School (1146)
Region : North Coast
State Electorate : Clarence
Local Government Area : Clarence Valley

Initial Survey : Noel Arnold & Associates : 26 - May - 2008
Register Issue Date : 22 - Mar - 2017

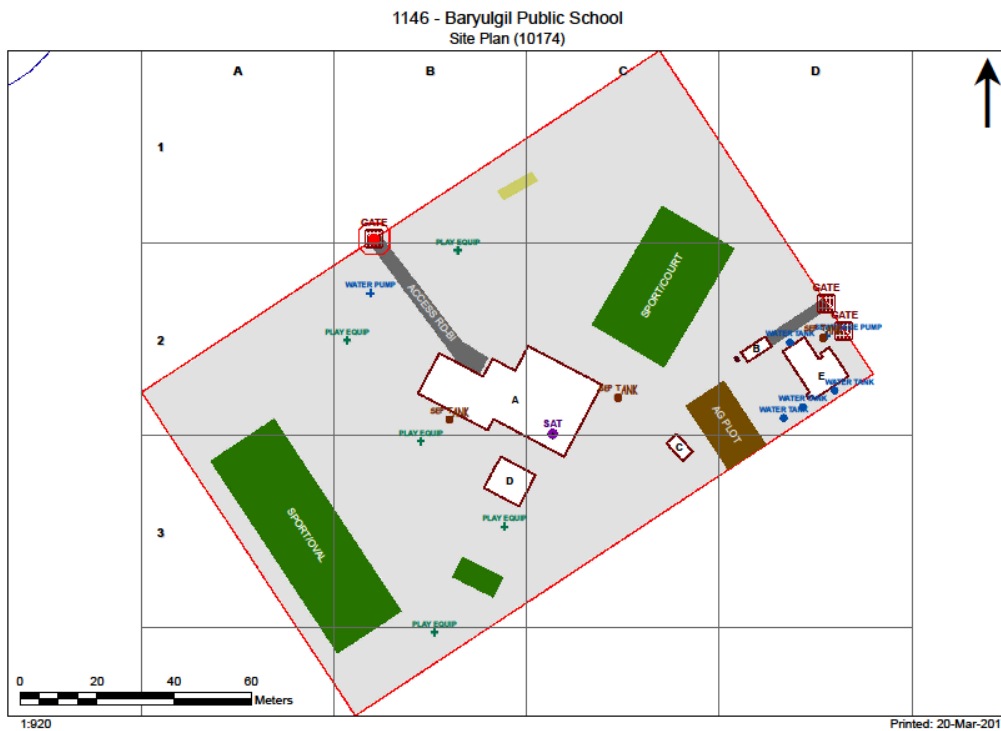

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1977 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	15m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1146/B00A/R0021/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior**B00A - R0001 - Home Base**

No Asbestos

B00A - R0002 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1146/B00A/R0002/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00A - R0003 - Toilets - Boys/Girls

No Asbestos

B00A - R0004 - Main Switch Board

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1146/B00A/R0021/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Lining to doors	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1146/B00A/R0021/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	3m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1146/B00A/R0021/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B00A - R0005 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1146/B00A/R0021/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B00A - R0006 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1146/B00A/R0021/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B00A - R0007 - No Access

Non Accessible

B00A - R0008 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1146/B00A/R0021/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B00A - R0009 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1146/B00A/R0021/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B00A - R0010 - Staff Room

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	1146/B00A/R0010/Floor Coverings Res/Textile/S3					

B00A - R0011 - Principal

No Asbestos

B00A - R0012 - General Storeroom

No Asbestos

B00A - R0013 - Clerical Office

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1146/B00A/R0021/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
1146/B00A/R0021/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00A - R0014 - Cleaning Supplies						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1146/B00A/R0021/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00A - R0015 - Entry Vestibule						
No Asbestos						
B00A - R0016 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1146/B00A/R0021/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
1146/B00A/R0021/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00A - R0017 - Movement						
No Asbestos						
B00A - R0018 - Withdrawal Space - 2hb						
No Asbestos						
B00A - R0019 - Practical Activities - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1146/B00A/R0002/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R0020 - Home Base						
No Asbestos						
B00A - R0021 - Duplicating Workroom						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1146/B00A/R0021/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	4m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
1146/B00A/R0021/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00A - R0022 - Staff Kitchen						
No Asbestos						
B00A - R0023 - Toilets - Boys/Girls						
No Asbestos						
B00A - R0024 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1146/B00A/R0021/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00A - R0025 - Movement						
No Asbestos						
B00A - R0026 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1146/B00A/R0021/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	4m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
1146/B00A/R0021/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00A - R0027 - Covered Outdoor Learning Area						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Staff Facilities - 2003 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	-----	------------	--------------------	---------	--------------------

Assumed Asbestos

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00B - R0001 - Garage/Carport

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Building Services - 2003 - Timber Shed (Timber Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00C - R0001 - Garage/Carport

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00D - R0001 - Reading Area

No Asbestos

B00D - R0002 - K.L.A. Store

No Asbestos

B00D - R0003 - Practical Activities

No Asbestos

B00D - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

1146_ASB_071016_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017