


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bass Hill Public School (1148)
Region : South Western Sydney
State Electorate : Bankstown
Local Government Area : Bankstown

Initial Survey : Noel Arnold & Associates : 04 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 13 - Oct - 2015

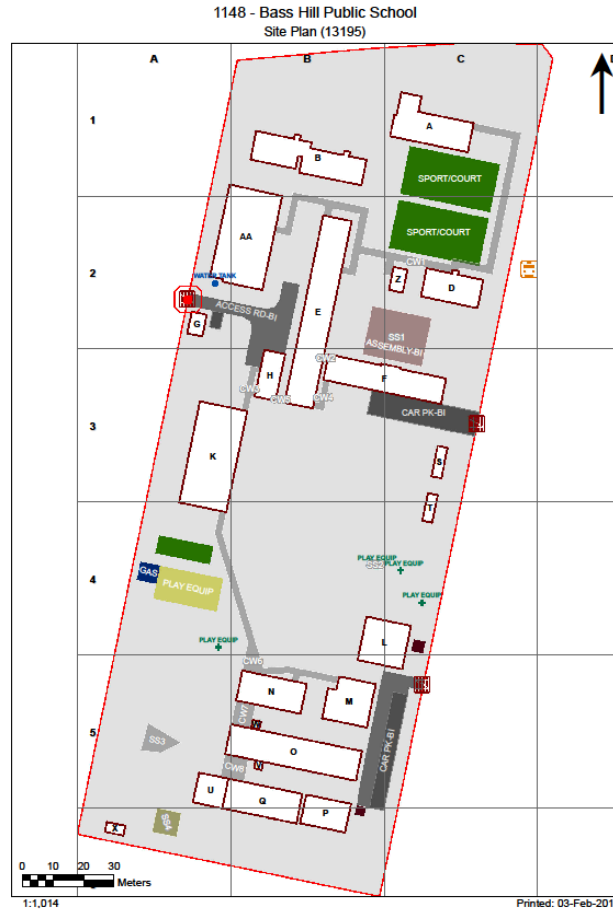

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00A - General Learning - 1953 - Brick/Block (Brick/Block)

Exterior

| | | | | | | |
|--------------------------------------------------------------|--------------------------------|------|----------------------------------------------|---------------------------------------|---------|------------------------------------|
| Eaves Linings | Flat AC Sheeting | 58m2 | North, South, East, West, Variable positions | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00A/Eaves Linings/S33 | | | | | Chrysotile (white asbestos) |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | Vinyl Tile Debris | NA | Throughout | Poor Condition - Extensive Damage (4) | Low (1) | Medium Priority (4-5) |
| | 1148/B00A/Underfloor Voids/S35 | | | | | Chrysotile (white asbestos) |
| Underfloor Voids | AC Fragments/Debris | NA | Throughout | Poor Condition - Extensive Damage (4) | Low (1) | Medium Priority (4-5) |
| | 1148/B00A/Underfloor Voids/S34 | | | | | Chrysotile (white asbestos) |
| Gable Verge Lining | Flat AC Sheeting | NA | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Assumed gable verge lining encased | | | | | | |

Interior

B00A - R0001 - General Storeroom

No Asbestos

B00A - R0002 - Home Base

No Asbestos

B00A - R0003 - Home Base

No Asbestos

B00A - R0004 - Home Base

No Asbestos

B00A - R0005 - Interview

No Asbestos

B00A - R0006 - Security Store

No Asbestos

B00A - R0008 - Movement

No Asbestos

B00A - Room+1 - Eletrical Distribution Cupboard Adjacent AR0006

| | | | | | | |
|----------------------------|--------------------------------------------|-----|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting | 2m2 | East, West | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00A/Room+1/Wall Linings Internal/S10 | | | | | Chrysotile (white asbestos) |
| Ceiling Structures/Linings | Flat AC Sheeting | 1m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00A/Room+1/Wall Linings Internal/S10 | | | | | Chrysotile (white asbestos) |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00B - General Learning - 1923 - Concrete (Concrete)**Exterior**

| | | | | | | |
|--------------------|-------------------------------------------------------|------|----------------------|---------------------------------------|---------|----------------------------------------------------------------------------------------------------------------------|
| Eaves Linings | Flat AC Sheeting 1148/B00B/Eaves Linings/S38 | 54m2 | South, East, West | Minimal Damage (2) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| Ceiling Voids | AC Fragments/Debris 1148/B00B/Ceiling Voids/S37 | NA | Throughout | Poor Condition - Extensive Damage (4) | Low (1) | Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) |
| Ceiling Voids | Flat AC Sheeting 1148/B00B/Ceiling Voids/S36 | 6m2 | Sheeting to Firewall | Minimal Damage (2) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) |
| Underfloor Voids | AC Fragments/Debris 1148/B00B/Underfloor Voids/S41 | NA | West | Poor Condition - Extensive Damage (4) | Low (1) | Medium Priority (4-5) Chrysotile (white asbestos) |
| Underfloor Voids | Packing 1148/B00B/Underfloor Voids/S42 | NA | Throughout | Poor Condition - Extensive Damage (4) | Low (1) | Medium Priority (4-5) Chrysotile (white asbestos) |
| Underfloor Voids | Fibre Cement Pipe 1148/B00B/Underfloor Voids/S43 | 1.5m | West | Some Damage - Unsealed (3) | Low (1) | Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Gable Ends | Flat AC Sheeting 1148/B00B/Gable Ends/S39 | 7m2 | South | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| Gable Verge Lining | Flat AC Sheeting 1148/B00B/Gable Verge Lining/S40 | | | | | No Asbestos Detected |

Interior**B00B - R0001 - General Storeroom**

| | | | | | | |
|-----------------------------|----------------------------------------------------------------|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles 1148/B00B/R0001/Floor Coverings Res/Textile/S15 | | | | | No Asbestos Detected |
|-----------------------------|----------------------------------------------------------------|--|--|--|--|-----------------------------|

B00B - R0002 - Staff Room Annexe

No Asbestos

B00B - R0003 - General Storeroom

No Asbestos

B00B - R0004 - Movement

No Asbestos

B00B - R0005 - Movement

No Asbestos

B00B - R0006 - Movement

| | | | | | | |
|---------------|-------------------------------------------------------|----|----------------------------|--------------------|---------|-------------------------------------------------------------------------------------|
| In-fill-panel | Flat AC Sheeting 1148/B00B/R0006/In-fill-panel/S12 | 8m | South, East, Upper portion | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) |
|---------------|-------------------------------------------------------|----|----------------------------|--------------------|---------|-------------------------------------------------------------------------------------|

B00B - R0007 - Movement

| | | | | | | |
|----------------------------|--------------------------------------------------------------------|--|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting 1148/B00B/R0007/Ceiling Structures/Linings/S11 | | | | | No Asbestos Detected |
|----------------------------|--------------------------------------------------------------------|--|--|--|--|-----------------------------|

B00B - R0008 - Home Base

| | | | | | | |
|----------------------------|--------------------------------------------------------------------|------|------------|--------------------|---------|-------------------------------------------------------------------------------------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting 1148/B00B/R0008/Ceiling Structures/Linings/S72 | 47m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) |
|----------------------------|--------------------------------------------------------------------|------|------------|--------------------|---------|-------------------------------------------------------------------------------------------------------------------|

B00B - R0009 - Home Base

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|------------------------------------------------|----------------------|--------|-----------------------------------|---------------------------------------------------------------------------------------------|-------------|-----------------------------|
| Sample No | | | | | Test Result | |
| Ceiling Structures/Linings | Flat AC Sheeting | 47m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00B/R0009/Ceiling Structures/Linings/S73 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |
| B00B - R0010 - Staff Toilet | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 5m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00B/R0010/Ceiling Structures/Linings/S13 | | | | Chrysotile (white asbestos) | | |
| In-fill-panel | Flat AC Sheeting | 4m | Upper portion, Variable positions | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00B/R0010/In-fill-panel/S14 | | | | Chrysotile (white asbestos) | | |
| B00B - R0011 - Movement | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | | | | | No Asbestos Detected |
| 1148/B00B/R0007/Ceiling Structures/Linings/S11 | | | | | | |
| B00B - R0012 - Movement | | | | | | |
| No Asbestos | | | | | | |
| B00B - R0013 - Home Base | | | | | | |
| No Asbestos | | | | | | |
| B00B - R0014 - Home Base | | | | | | |
| No Asbestos | | | | | | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00D - General Learning - 1953 - Concrete (Concrete)

Exterior

| | | | | | | |
|--------------------|---------------------------------------------------------------|-------|------------|---------------------------------------|----------|-----------------------------------------------------------|
| Eaves Linings | Flat AC Sheeting 1148/B00D/Eaves Linings/S44 | 45m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| Gable Ends | Flat AC Sheeting 1148/B00D/Gable Ends/S45 | | | | | No Asbestos Detected |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |
| Service Pit | Fibre Cement Casting (Monocrete) 1148/B00D/Service Pit/S47 | 1Unit | East | Poor Condition - Extensive Damage (4) | High (3) | High Priority (6-8) Chrysotile (white asbestos) |
| Gable Verge Lining | Flat AC Sheeting 1148/B00D/Gable Verge Lining/S46 | | | | | No Asbestos Detected |

Interior

B00D - R0001 - Home Base

No Asbestos

B00D - R0002 - Home Base Store

No Asbestos

B00D - R0003 - Personal Effects Storage

| | | | | | | |
|-----------------------------|---------------------------------------------------------------|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles 1148/B00D/R0003/Floor Coverings Res/Textile/S9 | | | | | No Asbestos Detected |
|-----------------------------|---------------------------------------------------------------|--|--|--|--|-----------------------------|

B00D - R0005 - Movement

| | | | | | | |
|-----------------------------|---------------------------------------------------------------|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles 1148/B00D/R0003/Floor Coverings Res/Textile/S9 | | | | | No Asbestos Detected |
|-----------------------------|---------------------------------------------------------------|--|--|--|--|-----------------------------|

B00D - R0006 - Movement

No Asbestos

B00D - R0007 - Personal Effects Storage

| | | | | | | |
|-----------------------------|---------------------------------------------------------------|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles 1148/B00D/R0003/Floor Coverings Res/Textile/S9 | | | | | No Asbestos Detected |
|-----------------------------|---------------------------------------------------------------|--|--|--|--|-----------------------------|

B00D - R0008 - Home Base Store

No Asbestos

B00D - R0009 - Home Base

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | Test Result | | |

B00E - General Learning - 1953 - Concrete (Concrete)

Exterior

| | | | | | | |
|--------------------|-------------------------------------------------------|-------|----------------------|---------------------------------------|---------|----------------------------------------------------------------------------------------|
| Eaves Linings | Flat AC Sheeting 1148/B00E/Eaves Linings/S48 | 140m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| Gable Ends | Flat AC Sheeting 1148/B00E/Gable Ends/S49 | | | | | No Asbestos Detected |
| In-fill-panel | Flat AC Sheeting 1148/B00E/In-fill-panel/S30 | 2m2 | North, Upper portion | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Wall Cladding | Flat AC Sheeting 1148/B00E/Wall Cladding/S31 | | | | | No Asbestos Detected |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | AC Fragments/Debris 1148/B00E/Underfloor Voids/S52 | NA | Northwest access | Poor Condition - Extensive Damage (4) | Low (1) | Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Underfloor Voids | Vinyl Tile debris 1148/B00E/Underfloor Voids/S51 | NA | Southeast access | Poor Condition - Extensive Damage (4) | Low (1) | Medium Priority (4-5) Chrysotile (white asbestos) |
| Gable Verge Lining | Flat AC Sheeting 1148/B00E/Gable Verge Lining/S50 | NA | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |

Interior

B00E - R0001 - Home Base

No Asbestos

B00E - R0002 - Home Base

No Asbestos

B00E - R0003 - Movement

| | | | | | | |
|----------------------------|--------------------------------------------------------------------|-----|------------|--------------------|---------|-------------------------------------------------------------------------------------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting 1148/B00E/R0003/Ceiling Structures/Linings/S74 | 3m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) |
|----------------------------|--------------------------------------------------------------------|-----|------------|--------------------|---------|-------------------------------------------------------------------------------------------------------------------|

B00E - R0004 - Movement

| | | | | | | |
|-----------------------------|---------------------------------------------------------------|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles 1148/B00E/R0013/Floor Coverings Res/Textile/S5 | | | | | No Asbestos Detected |
|-----------------------------|---------------------------------------------------------------|--|--|--|--|-----------------------------|

B00E - R0005 - Distribution Board

Note: No inspection of live electrical installation.

| | | | | | | |
|----------------------------|--------------------------------------------------------------------|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting 1148/B00E/R0005/Wall Linings Internal/S7 | | | | | No Asbestos Detected |
| Ceiling Structures/Linings | Flat AC Sheeting 1148/B00E/R0005/Ceiling Structures/Linings/S75 | | | | | No Asbestos Detected |

B00E - R0006 - General Storeroom

| | | | | | | |
|-----------------------------|---------------------------------------------------------------|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles 1148/B00E/R0013/Floor Coverings Res/Textile/S5 | | | | | No Asbestos Detected |
|-----------------------------|---------------------------------------------------------------|--|--|--|--|-----------------------------|

B00E - R0007 - General Assistant/Bulk Store

| | | | | | | |
|-----------------------------|---------------------------------------------------------------|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles 1148/B00E/R0013/Floor Coverings Res/Textile/S5 | | | | | No Asbestos Detected |
|-----------------------------|---------------------------------------------------------------|--|--|--|--|-----------------------------|

B00E - R0008 - Home Base

No Asbestos

B00E - R0009 - Home Base

No Asbestos

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--------------------------------------------------|----------------------|--------|-----------------------------------|---------------------------------------------------------------------------------------------|-------------|--------------------|
| Sample No | | | | | Test Result | |
| B00E - R0010 - Home Base | | | | | | |
| No Asbestos | | | | | | |
| B00E - R0011 - Security Store | | | | | | |
| No Asbestos | | | | | | |
| B00E - R0012 - Movement | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00E/R0012/Ceiling Structures/Linings/S76 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |
| B00E - R0013 - Movement | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | | | | | |
| 1148/B00E/R0013/Floor Coverings Res/Textile/S5 | | | | No Asbestos Detected | | |
| B00E - R0014 - Movement | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | | | | | |
| 1148/B00E/R0013/Floor Coverings Res/Textile/S5 | | | | No Asbestos Detected | | |
| In-fill-panel | Flat AC Sheeting | 6m | Upper portion, Variable positions | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00E/R0014/In-fill-panel/S8 | | | | Chrysotile (white asbestos) | | |
| B00E - R0015 - Sports Store | | | | | | |
| No Asbestos | | | | | | |
| B00E - R0016 - Cleaning Distributed Store | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 5m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00E/R0017/Ceiling Structures/Linings/S6 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |
| B00E - R0017 - General Storeroom | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 14m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00E/R0017/Ceiling Structures/Linings/S6 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |
| B00E - R0018 - General Storeroom | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 6m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00E/R0017/Ceiling Structures/Linings/S6 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |
| B00E - R0019 - General Storeroom | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 8m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00E/R0017/Ceiling Structures/Linings/S6 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |
| B00E - R0020 - Practical Activities - 1hb | | | | | | |
| No Asbestos | | | | | | |
| B00E - R9001 - Movement | | | | | | |
| No Asbestos | | | | | | |
| B00E - R9002 - No Access | | | | | | |
| No Asbestos | | | | | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00F - Administration - 1981 - Concrete (Concrete)

Exterior

| | | | | | | |
|--------------------|-----------------------------------------------|------|--------------|---------------------------------------|---------|---------------------------------------------------------------------------------------------|
| Eaves Linings | Flat AC Sheeting | 80m2 | North, South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00F/Eaves Linings/S56 | | | | | Chrysotile (white asbestos) |
| Eaves Linings | Flat AC Sheeting | 80m2 | North, South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00F/Eaves Linings/S111 | | | | | Chrysotile (white asbestos) |
| Ceiling Voids | Flat AC Sheeting | 12m2 | Wall lining | Minimal Damage (2) | Low (1) | Low Priority (2-3) |
| | 1148/B00F/Ceiling Voids/S53 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) |
| Ceiling Voids | Flat AC Sheeting | 12m2 | Wall lining | Minimal Damage (2) | Low (1) | Low Priority (2-3) |
| Ceiling Voids | Flat AC Sheeting | 12m2 | Wall lining | Minimal Damage (2) | Low (1) | Low Priority (2-3) |
| Ceiling Voids | AC Fragments/Debris | NA | Throughout | Poor Condition - Extensive Damage (4) | Low (1) | Medium Priority (4-5) |
| | 1148/B00F/Ceiling Voids/S55 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) |
| Ceiling Voids | Fibrous Membrane | NA | Sarking | Minimal Damage (2) | Low (1) | Low Priority (2-3) |
| | 1148/B00F/Gable Verge Lining/S112 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) |
| Ceiling Voids | Fibrous Membrane | | | | | No Asbestos Detected |
| | 1148/B00F/Ceiling Voids/S54 | | | | | |
| Gable Ends | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 1148/B00F/Gable Ends/S113 | | | | | |
| Underfloor Voids | Non Accessible Area | | | | | No Asbestos Detected |
| | 1148/B00F/Gable Ends/S113 - Area inaccessible | | | | | |
| Gable Verge Lining | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 1148/B00F/Gable Verge Lining/S57 | | | | | |

Interior

B00F - R0001 - Interview

| | | | | | | |
|----------------------------|------------------------------------------------|------|------------|--------------------|---------|---------------------------------------------------------------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 10m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00F/R0001/Ceiling Structures/Linings/S77 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) |

B00F - R0002 - Movement

No Asbestos

B00F - R0003 - Staff Room Annexe

| | | | | | | |
|----------------------------|------------------------------------------------|------|------------|--------------------|---------|---------------------------------------------------------------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 12m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00F/R0003/Ceiling Structures/Linings/S78 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) |

B00F - R0004 - Staff Room Annexe

| | | | | | | |
|----------------------------|------------------------------------------------|------|------------|--------------------|---------|---------------------------------------------------------------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 13m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00F/R0004/Ceiling Structures/Linings/S79 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) |

B00F - R0005 - General Storeroom

| | | | | | | |
|----------------------------|------------------------------------------------|-----|------------|--------------------|---------|---------------------------------------------------------------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 4m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00F/R0005/Ceiling Structures/Linings/S80 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) |

B00F - R0006 - Principal

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--------------------------------------------|--------------------------------------------------|--------|-------------------------------------|---------------------------------------------------------------------------------------------|-------------|-----------------------------|
| Sample No | | | | Test Result | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 19m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00F/R0006/Ceiling Structures/Linings/S81 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |
| B00F - R0012 - Staff Toilet | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 1148/B00F/R0012/Wall Linings Internal/S2 | | | | | |
| B00F - R0013 - Staff Toilet | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 1148/B00F/R0012/Wall Linings Internal/S2 | | | | | |
| B00F - R0014 - Staff Room Annexe | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 34m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00F/R0014/Ceiling Structures/Linings/S87 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |
| B00F - R0016 - Movement | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 65m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00F/R0016/Ceiling Structures/Linings/S3 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |
| In-fill-panel | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 1148/B00F/R0016/In-fill-panel/S4 | | | | | |
| B00F - R0017 - Duplicating Workroom | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 11m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00F/R0022/Ceiling Structures/Linings/S108 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |
| B00F - R0018 - Sick Bay | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 10m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00F/R0022/Ceiling Structures/Linings/S108 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |
| B00F - R0019 - Clerical Office | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet) | 26m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00F/R0022/Floor Coverings Res/Textile/S110 | | | Chrysotile (white asbestos) | | |
| B00F - R0020 - Entry Vestibule | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet) | 21m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00F/R0022/Floor Coverings Res/Textile/S110 | | | Chrysotile (white asbestos) | | |
| B00F - R0021 - Movement | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet) | 13m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00F/R0022/Floor Coverings Res/Textile/S110 | | | Chrysotile (white asbestos) | | |
| B00F - R0022 - Staff Room | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 41m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00F/R0022/Ceiling Structures/Linings/S108 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |
| Wall Linings Internal | Flat AC Sheeting | 12m2 | Upper portion - North, South & West | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00F/R0022/Wall Linings Internal/S109 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet) | 41m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00F/R0022/Floor Coverings Res/Textile/S110 | | | Chrysotile (white asbestos) | | |
| B00F - R0023 - Staff Kitchen | | | | | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|----------------------------|-------------------------------------------------|--------|----------------------|---------------------------------------------------------------------------------------------|-------------|--------------------|
| Sample No | | | | Test Result | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 7m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00F/R0022/Ceiling Structures/Linings/S108 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |
| Wall Linings Internal | Flat AC Sheeting | 1m2 | Upper portion, South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00F/R0022/Wall Linings Internal/S109 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00G - Administration - 1953 - Brick/Veneer (Brick/Veneer)**Exterior**

| | | | | | | |
|------------------|--------------------------------|------|------------|---------------------------------------|---------|---------------------------------------------------------------------------------------------|
| Eaves Linings | Flat AC Sheeting | 14m2 | East, West | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00G/Eaves Linings/S58 | | | | | Chrysotile (white asbestos) |
| Wall Cladding | Flat AC Sheeting | 58m2 | Throughout | Minimal Damage (2) | Low (1) | Low Priority (2-3) |
| | 1148/B00G/Wall Cladding/S1 | | | | | Chrysotile (white asbestos) |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | AC Fragments/Debris | NA | Throughout | Poor Condition - Extensive Damage (4) | Low (1) | Medium Priority (4-5) |
| | 1148/B00G/Underfloor Voids/S59 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) |

Interior**B00G - R0001 - Community Clinic**

| | | | | | | |
|-----------------------------|-------------------------------------------------|------|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 11m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00G/R0001/Ceiling Structures/Linings/S89 | | | | | Chrysotile (white asbestos) |
| Floor Coverings Res/Textile | Vinyl Tiles | 11m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00G/R0001/Floor Coverings Res/Textile/S90 | | | | | Chrysotile (white asbestos) |
| Wall Linings Internal | Flat AC Sheeting | 30m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00G/R0001/Wall Linings Internal/S91 | | | | | Chrysotile (white asbestos) |

B00G - R0002 - Entry Vestibule

| | | | | | | |
|-----------------------------|-------------------------------------------------|------|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 7m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00G/R0002/Ceiling Structures/Linings/S92 | | | | | Chrysotile (white asbestos) |
| Wall Linings Internal | Flat AC Sheeting | 24m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00G/R0002/Wall Linings Internal/S94 | | | | | Chrysotile (white asbestos) |
| Floor Coverings Res/Textile | Vinyl Tiles | 7m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00G/R0002/Floor Coverings Res/Textile/S93 | | | | | Chrysotile (white asbestos) |

B00G - R0003 - Clerical Office

| | | | | | | |
|-----------------------------|-------------------------------------------------|------|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 11m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00G/R0003/Ceiling Structures/Linings/S95 | | | | | Chrysotile (white asbestos) |
| Wall Linings Internal | Flat AC Sheeting | 30m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00G/R0003/Wall Linings Internal/S97 | | | | | Chrysotile (white asbestos) |
| Floor Coverings Res/Textile | Vinyl Tiles | 11m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00G/R0003/Floor Coverings Res/Textile/S96 | | | | | Chrysotile (white asbestos) |

B00G - R0004 - Staff Toilet

| | | | | | | |
|-----------------------------|-------------------------------------------------|------|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 4m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00G/R0004/Ceiling Structures/Linings/S98 | | | | | Chrysotile (white asbestos) |
| Wall Linings Internal | Flat AC Sheeting | 15m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00G/R0004/Wall Linings Internal/S100 | | | | | Chrysotile (white asbestos) |
| Floor Coverings Res/Textile | Vinyl Tiles | 4m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00G/R0004/Floor Coverings Res/Textile/S99 | | | | | Chrysotile (white asbestos) |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00H - Pupil Facilities - 1985 - Brick/Block (Brick/Block)**Exterior**

| | | | | | | |
|------------------|-----------------------------|-----|-------------------|--------------------|---------|------------------------------------|
| Eaves Linings | Flat AC Sheeting | 4m2 | South, East, West | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00H/Eaves Linings/S60 | | | | | Chrysotile (white asbestos) |
| Underfloor Voids | No Asbestos Found | | | | | |
| Ceiling Voids | No Asbestos Found | | | | | |

Interior**B00H - R0001 - General Storeroom**

| | | | | | | |
|----------------------------|-------------------------------------------------|-----|-------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00H/R0001/Ceiling Structures/Linings/S101 | | | | | Chrysotile (white asbestos) |
| Wall Linings Internal | Flat AC Sheeting | 6m2 | North, East | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00H/R0002/Wall Linings Internal/S16 | | | | | Chrysotile (white asbestos) |

B00H - R0002 - Movement

| | | | | | | |
|----------------------------|-------------------------------------------------|-----|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 8m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00H/R0002/Ceiling Structures/Linings/S102 | | | | | Chrysotile (white asbestos) |
| Wall Linings Internal | Flat AC Sheeting | 3m2 | West | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00H/R0002/Wall Linings Internal/S16 | | | | | Chrysotile (white asbestos) |

B00H - R0003 - Canteen Office/Store

| | | | | | | |
|----------------------------|-------------------------------------------------|-----|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00H/R0003/Ceiling Structures/Linings/S103 | | | | | Chrysotile (white asbestos) |

B00H - R0005 - Canteen Office/Store

| | | | | | | |
|----------------------------|-------------------------------------------------|-----|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00H/R0005/Ceiling Structures/Linings/S104 | | | | | Chrysotile (white asbestos) |

B00H - R0006 - Canteen

| | | | | | | |
|----------------------------|-------------------------------------------------|------|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 16m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00H/R0006/Ceiling Structures/Linings/S105 | | | | | Chrysotile (white asbestos) |

B00H - R0007 - Staff Toilet

| | | | | | | |
|----------------------------|-------------------------------------------------|-----|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 4m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00H/R0007/Ceiling Structures/Linings/S106 | | | | | Chrysotile (white asbestos) |

B00H - R0008 - Movement

No Asbestos

B00H - R0009 - Movement

No Asbestos

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00K - Library - 1954 - Brick/Veneer (Brick/Veneer)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B00K - R0001 - Reading Area

No Asbestos

B00K - R0002 - K.L.A. Store

No Asbestos

B00K - R0003 - Library Office/Workroom

No Asbestos

B00K - R0004 - Distribution Board

Note: No inspection of live electrical installation.

| | | | | | | |
|-------------------------------------------|------------------|-----|------|--------------------|------------------------------------|--------------------|
| Wall Linings Internal | Flat AC Sheeting | 9m2 | East | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00K/R0004/Wall Linings Internal/S18 | | | | | Chrysotile (white asbestos) | |

B00K - R0005 - Movement

No Asbestos

B00K - R0006 - Toilets - Boys

| | | | | | | |
|------------------------------------------------|---------------------|-----|------------|--------------------|------------------------------------|--------------------|
| Partition Walls (Cubicles) | Compressed AC Sheet | 3m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00K/R0007/Partition Walls (Cubicles)/S17 | | | | | Chrysotile (white asbestos) | |

B00K - R0007 - Toilets - Girls

| | | | | | | |
|------------------------------------------------|---------------------|-----|------------|--------------------|------------------------------------|--------------------|
| Partition Walls (Cubicles) | Compressed AC Sheet | 5m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00K/R0007/Partition Walls (Cubicles)/S17 | | | | | Chrysotile (white asbestos) | |

B00K - R0008 - Special Programs Room

No Asbestos

B00K - R0009 - Security Store

No Asbestos

B00K - R0010 - Plant

No Asbestos

B00K - R0011 - Movement

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00L - Pre-School Facilities - 1957 - Timber (Timber)**Exterior**

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior**B00L - R0002 - General Storeroom - Pre**

No Asbestos

B00L - R0003 - Staff Toilet - Pre

| | | | | | | |
|-------------------------------------------|------------------|-----|-------|--------------------|------------------------------------|--------------------|
| Wall Linings Internal | Flat AC Sheeting | 3m2 | North | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00L/R0005/Wall Linings Internal/S23 | | | | | Chrysotile (white asbestos) | |

B00L - R0005 - Cleaning Distributed Store

| | | | | | | |
|-------------------------------------------|------------------|-----|-------|--------------------|------------------------------------|--------------------|
| Wall Linings Internal | Flat AC Sheeting | 3m2 | South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00L/R0005/Wall Linings Internal/S23 | | | | | Chrysotile (white asbestos) | |

B00L - R0006 - Kitchen - Pre

| | | | | | | | |
|-------------------------------------------------|------------------|-----|-------------|--------------------|------------------------------------|-----------------------------|--|
| Floor Coverings Res/Textile | Vinyl Tiles | | | | | No Asbestos Detected | |
| 1148/B00L/R0013/Floor Coverings Res/Textile/S22 | | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | 4m2 | South, East | Good Condition (1) | Low (1) | Low Priority (2-3) | |
| 1148/B00L/R0005/Wall Linings Internal/S23 | | | | | Chrysotile (white asbestos) | | |

B00L - R0007 - Staff Room - Pre

No Asbestos

B00L - R0008 - Staff Room - Pre

No Asbestos

B00L - R0009 - Withdrawal - Pre

No Asbestos

B00L - R0010 - General Storeroom - Pre

No Asbestos

B00L - R0013 - Home Base - Pre

| | | | | | | | |
|-------------------------------------------------|-------------|--|--|--|--|-----------------------------|--|
| Floor Coverings Res/Textile | Vinyl Tiles | | | | | No Asbestos Detected | |
| 1148/B00L/R0013/Floor Coverings Res/Textile/S22 | | | | | | | |

B00L - R0014 - Toilets - Boys/Girls - Pre

| | | | | | | |
|-------------------------------------------|------------------|------|--------------------|--------------------|------------------------------------|--------------------|
| Wall Linings Internal | Flat AC Sheeting | 12m2 | Variable positions | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00L/R0005/Wall Linings Internal/S23 | | | | | Chrysotile (white asbestos) | |

B00L - R0015 - Laundry - Pre

| | | | | | | |
|------------------------------------------------|------------------|-----|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 1m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00L/R0018/Ceiling Structures/Linings/S21 | | | | | Chrysotile (white asbestos) | |
| Wall Linings Internal | Flat AC Sheeting | 8m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00L/R0005/Wall Linings Internal/S23 | | | | | Chrysotile (white asbestos) | |

B00L - R0016 - Movement

| | | | | | | |
|------------------------------------------------|------------------|-----|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 7m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00L/R0018/Ceiling Structures/Linings/S21 | | | | | Chrysotile (white asbestos) | |

B00L - R0017 - Movement

| | | | | | | |
|------------------------------------------------|------------------|------|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 18m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00L/R0018/Ceiling Structures/Linings/S21 | | | | | Chrysotile (white asbestos) | |

B00L - R0018 - Movement

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|------------------------------------------------|----------------------|--------|--------------------|--------------------|-----------------------------|--------------------|
| Sample No | | | | | Test Result | |
| Ceiling Structures/Linings | Flat AC Sheeting | 27m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00L/R0018/Ceiling Structures/Linings/S21 | | | | | Chrysotile (white asbestos) | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00M - General Learning - 1959 - Steel (Steel)

Exterior

| | | | | | | |
|------------------|-------------------------------------------------|--|--|--|--|-----------------------------|
| Eaves Linings | Flat AC Sheeting 1148/B00M/Eaves Linings/S61 | | | | | No Asbestos Detected |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |

Interior

B00M - R0001 - Home Base

No Asbestos

B00M - R0002 - Home Base

No Asbestos

B00M - R0003 - Home Base Store

No Asbestos

B00M - R0004 - No Access

No Asbestos

B00M - R0005 - Home Base Store

No Asbestos

B00M - R0006 - Movement

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00N - General Learning - 1955 - Steel (Steel)

Exterior

| | | | | | | |
|------------------|-------------------------------------------------|--|--|--|--|-----------------------------|
| Eaves Linings | Flat AC Sheeting 1148/B00N/Eaves Linings/S62 | | | | | No Asbestos Detected |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |

Interior

B00N - R0001 - Home Base

No Asbestos

B00N - R0002 - Home Base

No Asbestos

B00N - R0003 - Home Base Store

No Asbestos

B00N - R0004 - Movement

No Asbestos

B00N - R0005 - Home Base Store

No Asbestos

B00N - R0006 - Movement

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B000 - General Learning - 1958 - Steel (Steel)

Exterior

| | | | | | | |
|------------------|-------------------------------------------------|--|--|--|--|----------------------|
| Eaves Linings | Flat AC Sheeting 1148/B000/Eaves Linings/S63 | | | | | No Asbestos Detected |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |

Interior

B000 - R0001 - General Storeroom

No Asbestos

B000 - R0002 - Movement

No Asbestos

B000 - R0003 - Interview

No Asbestos

B000 - R0004 - Staff Room Annexe

No Asbestos

B000 - R0005 - Movement

No Asbestos

B000 - R0006 - Home Base - Pre

No Asbestos

B000 - R0007 - Communal Space

No Asbestos

B000 - R0008 - Home Base

No Asbestos

B000 - R0009 - Home Base

No Asbestos

B000 - R0010 - Staff Room

No Asbestos

B000 - R0011 - Staff Toilet

No Asbestos

B000 - R0012 - General Storeroom

No Asbestos

B000 - R0013 - Movement

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00P - General Learning - 1959 - Steel (Steel)

Exterior

| | | | | | | |
|------------------|-------------------------------------------------|--|--|--|--|-----------------------------|
| Eaves Linings | Flat AC Sheeting 1148/B00P/Eaves Linings/S64 | | | | | No Asbestos Detected |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |

Interior

B00P - R0001 - Hall Chair Store

| | | | | | | |
|-----------------------------|----------------------------------------------------------------|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles 1148/B00P/R0001/Floor Coverings Res/Textile/S26 | | | | | No Asbestos Detected |
|-----------------------------|----------------------------------------------------------------|--|--|--|--|-----------------------------|

B00P - R0002 - Out Of School Hours Care Centre

| | | | | | | |
|-----------------------------|----------------------------------------------------------------|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles 1148/B00P/R0001/Floor Coverings Res/Textile/S26 | | | | | No Asbestos Detected |
|-----------------------------|----------------------------------------------------------------|--|--|--|--|-----------------------------|

B00P - R0003 - Movement

| | | | | | | |
|-----------------------|-------------------------------------------|------|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting | 28m2 | East, West | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00P/R0003/Wall Linings Internal/S25 | | | | | Chrysotile (white asbestos) |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00Q - General Learning - 1953 - Steel (Steel)

Exterior

| | | | | | | |
|------------------|-------------------------------------------------|--|--|--|--|----------------------|
| Eaves Linings | Flat AC Sheeting 1148/B00Q/Eaves Linings/S65 | | | | | No Asbestos Detected |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |

Interior

B00Q - R0001 - Home Base

No Asbestos

B00Q - R0002 - Home Base

No Asbestos

B00Q - R0003 - Home Base

No Asbestos

B00Q - R0004 - General Storeroom

No Asbestos

B00Q - R0005 - Uniform Shop

No Asbestos

B00Q - R0006 - Movement

No Asbestos

B00Q - R0007 - General Storeroom

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00S - Pupil Facilities - 1956 - Concrete (Concrete)

Exterior

| | | | | | | |
|--------------------|---------------------------------------------------------------|-------|------------------------------|--------------------|---------|----------------------------------------------------------|
| Gable Verge Lining | Flat AC Sheeting 1148/B00S/Gable Verge Lining/S66 | | | | | No Asbestos Detected |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |
| Service pit | Fibre Cement Casting (Monocrete) 1148/B00S/Service pit/S67 | 1Unit | Southwest corner of building | Minimal Damage (2) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |

Interior

B00S - R0001 - Toilets - Boys

| | | | | | | |
|----------------------------|--------------------------------------------------------------------|------|------------|--------------------|---------|-------------------------------------------------------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting 1148/B00S/R0001/Ceiling Structures/Linings/S19 | 31m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) |
| In-fill-panel | Flat AC Sheeting 1148/B00S/R0001/In-fill-panel/S107 | | | | | No Asbestos Detected |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00T - Pupil Facilities - 1953 - Concrete (Concrete)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B00T - R0001 - Toilets - Girls

| | | | | | | |
|------------------------------------------------|------------------|------|------------|---------------------------------------------------------------|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 28m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00T/R0001/Ceiling Structures/Linings/S20 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00U - Pupil Facilities - 1957 - Brick/Veneer (Brick/Veneer)

Exterior

| | | | | | | |
|------------------|-------------------------------------------------|--|--|--|--|----------------------|
| Eaves Linings | Flat AC Sheeting 1148/B00U/Eaves Linings/S68 | | | | | No Asbestos Detected |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |
| Gable Ends | Flat AC Sheeting 1148/B00U/Gable Ends/S69 | | | | | No Asbestos Detected |

Interior

B00U - R0001 - Toilets - Boys

| | | | | | | |
|----------------------------|--------------------------------------------------------------------|--|--|--|--|----------------------|
| Ceiling Structures/Linings | Flat AC Sheeting 1148/B00U/R0003/Ceiling Structures/Linings/S27 | | | | | No Asbestos Detected |
|----------------------------|--------------------------------------------------------------------|--|--|--|--|----------------------|

B00U - R0002 - Toilets - Girls

| | | | | | | |
|----------------------------|--------------------------------------------------------------------|--|--|--|--|----------------------|
| Ceiling Structures/Linings | Flat AC Sheeting 1148/B00U/R0003/Ceiling Structures/Linings/S27 | | | | | No Asbestos Detected |
|----------------------------|--------------------------------------------------------------------|--|--|--|--|----------------------|

B00U - R0003 - Movement

| | | | | | | |
|----------------------------|--------------------------------------------------------------------|--|--|--|--|----------------------|
| Ceiling Structures/Linings | Flat AC Sheeting 1148/B00U/R0003/Ceiling Structures/Linings/S27 | | | | | No Asbestos Detected |
|----------------------------|--------------------------------------------------------------------|--|--|--|--|----------------------|

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00V - Pupil Facilities - 1953 - Brick/Block (Brick/Block)

Exterior

| | | | | | | |
|------------------|-------------------------------------------------|--|--|--|--|-----------------------------|
| Eaves Linings | Flat AC Sheeting 1148/B00V/Eaves Linings/S70 | | | | | No Asbestos Detected |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |

Interior

B00V - R0003 - Disabled Toilet

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00W - Pupil Facilities - 1953 - Brick/Block (Brick/Block)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B00W - R0001 - Toilets - Girls

| | | | | | | |
|------------------------------------------------|------------------|-----|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 3m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00W/R0001/Ceiling Structures/Linings/S24 | | | | | Chrysotile (white asbestos) | |

B00W - R0002 - Toilets - Boys

| | | | | | | |
|------------------------------------------------|------------------|-----|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 3m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 1148/B00W/R0001/Ceiling Structures/Linings/S24 | | | | | Chrysotile (white asbestos) | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00X - Building Services - 1953 - Concrete (Concrete)

Exterior

| | | | | | | |
|------------------|-----------------------------|-----|------------|--------------------|---------|---------------------------------------------------------------|
| Eaves Linings | Flat AC Sheeting | 5m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00X/Eaves Linings/S71 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |

Interior

B00X - R0001 - Hall Chair Store

| | | | | | | |
|----------------------------|------------------------------------------------|-----|------------|--------------------|---------|---------------------------------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 9m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00X/R0002/Ceiling Structures/Linings/S29 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) |

B00X - R0002 - General Storeroom

| | | | | | | |
|----------------------------|------------------------------------------------|-----|------------|--------------------|---------|---------------------------------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 9m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 1148/B00X/R0002/Ceiling Structures/Linings/S29 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00Z - Pupil Facilities - 1953 - Brick/Veneer (Brick/Veneer)

Exterior

| | | | | | | |
|------------------|-------------------------------------------------|--|--|--|--|-----------------------------|
| In-fill-panel | Flat AC Sheeting 1148/B00Z/In-fill-panel/S28 | | | | | No Asbestos Detected |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |

Interior

B00Z - R0001 - Drinking Facilities

No Asbestos

B00Z - R0002 - Drinking Facilities

No Asbestos

B00Z - R0003 - Access Shower/Toilet

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| | Sample No | | | | | Test Result |

B0AA - Communal Facilities/Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B0AA - R0001 - Communal Space

No Asbestos

B0AA - R0002 - Raised Platform

No Asbestos

B0AA - R0003 - Hall Chair Store

No Asbestos

B0AA - R0004 - Communal/Performance Store

No Asbestos

B0AA - R0005 - P.E. Store

No Asbestos

B0AA - R0006 - Toilet - Lobby

No Asbestos

B0AA - R0007 - Toilets - Girls

No Asbestos

B0AA - R0008 - Sound Cupboard

No Asbestos

B0AA - R0009 - Toilet - Lobby

No Asbestos

B0AA - R0010 - Toilets - Boys

No Asbestos

B0AA - R0011 - Cleaning Distributed Store

No Asbestos

B0AA - R0012 - Other

No Asbestos

B0AA - R0013 - Main Switch Board

No Asbestos

B0AA - R0014 - Access Shower/Toilet/Change

No Asbestos

B0AA - R0015 - Covered Outdoor Learning Area

No Asbestos

B0AA - R0016 - Canteen

No Asbestos

B0AA - R0017 - Canteen Office/Store

No Asbestos

B0AA - R0018 - Movement

No Asbestos

B0AA - R0019 - Ramp

No Asbestos

B0AA - R0020 - Movement

No Asbestos

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017