



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Pupil Facilities - 1975 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area - Building on slab

**Interior****B00A - R0001 - Movement (91.66 m2)**

No Asbestos

**B00A - R0002 - Movement (237.57 m2)**

Ceiling Structures/Linings	Vermiculite								
	1150/B00A/R0002/Ceiling Structures/Linings/S5								Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>									

**B00A - R0003 - Toilets - Boys (52.04 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00A/R0003/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)

Ceiling Structures/Linings	Vermiculite								
	1150/B00A/R0002/Ceiling Structures/Linings/S5								Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>									

**B00A - R0004 - Canteen (27.11 m2)**

No Asbestos

**B00A - R0005 - Staff Toilet (3.06 m2)**

No Asbestos

**B00A - R0006 - General Storeroom (3.97 m2)**

No Asbestos

**B00A - R0007 - Canteen Office/Store (7.62 m2)**

No Asbestos

**B00A - R0008 - Uniform Shop (7.69 m2)**

Ceiling Structures/Linings	Vermiculite								
	1150/B00A/R0002/Ceiling Structures/Linings/S5								Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>									

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - Library/General Learning - 1975 - Brick/Block (Brick/Block)</b>						
<b>Exterior</b>						
Underfloor Voids	Non Accessible Area - Building on slab					
Ceiling Voids	No Asbestos Found					
<b>Interior</b>						
<b>B00B - R0001 - Movement (74.6 m2)</b>						
Expansion joints	Bituminous membrane 1150/B00B/R0001/Expansion joints/S6					<b>No Asbestos Detected</b>
<b>B00B - R0002 - Movement (6.3 m2)</b>						
No Asbestos						
<b>B00B - R0003 - Home Base (72.38 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1150/B00A/R0002/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00B - R0004 - Practical Activities - 1hb (20.47 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1150/B00A/R0002/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 1150/B00B/R0004/Floor Coverings Res/Textile/S7	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Under vinyl tile adhesive 1150/B00B/R0004/Floor Coverings Res/Textile/S8					<b>No Asbestos Detected</b>
<b>B00B - R0005 - Home Base (60.38 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1150/B00A/R0002/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00B - R0006 - Practical Activities - 1hb (17.08 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1150/B00A/R0002/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 1150/B00B/R0004/Floor Coverings Res/Textile/S7	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Under vinyl tile adhesive 1150/B00B/R0004/Floor Coverings Res/Textile/S8					<b>No Asbestos Detected</b>
<b>B00B - R0007 - Home Base (71.69 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1150/B00A/R0002/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00B - R0008 - Practical Activities - 1hb (20.14 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1150/B00A/R0002/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 1150/B00B/R0004/Floor Coverings Res/Textile/S7	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Under vinyl tile adhesive 1150/B00B/R0004/Floor Coverings Res/Textile/S8					<b>No Asbestos Detected</b>
<b>B00B - R0009 - Home Base (60.52 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 1150/B00A/R0002/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00B - R0010 - Practical Activities - 1hb (17.22 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1150/B00A/R0002/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	No Asbestos Found					
<b>B00B - R0013 - Stairs (16.62 m2)</b>						
No Asbestos						
<b>B00B - R1001 - Reading Area (209.36 m2)</b>						
Window in-fill panels	Flat AC Sheeting 1150/B00B/R1010/Window in-fill panel/S9	3m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R1002 - Reading Area (52.7 m2)</b>						
No Asbestos						
<b>B00B - R1003 - Library Office/Workroom (6.46 m2)</b>						
No Asbestos						
<b>B00B - R1004 - Staff Toilet (5.21 m2)</b>						
No Asbestos						
<b>B00B - R1005 - General Storeroom (3.61 m2)</b>						
No Asbestos						
<b>B00B - R1006 - Distribution Board (0.72 m2)</b> <span style="float: right;">Note: No inspection of live electrical installation.</span>						
Ceiling Structures/Linings	Vermiculite 1150/B00A/R0002/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00B - R1007 - Cleaning Distributed Store (1.66 m2)</b>						
No Asbestos						
<b>B00B - R1008 - Library Office/Workroom (16.22 m2)</b>						
No Asbestos						
<b>B00B - R1009 - Communications Room (13.36 m2)</b>						
Safe	Friable safe insulation	12m2	Southeast	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos - Safe approx 1.8x1.5x1m</b>
<b>B00B - R1010 - Communications Room (13.36 m2)</b>						
Window in-fill panel	Flat AC Sheeting 1150/B00B/R1010/Window in-fill panel/S9	4m2	Southeast	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R1011 - K.L.A. Store (13.12 m2)</b>						
No Asbestos						
<b>B00B - R1012 - Movement (15.91 m2)</b>						
No Asbestos						
<b>B00B - R1013 - Stairs (16.51 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning/Pupil Facilities - 1939 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Building on slab					

**Interior**

**B00C - R0001 - Home Base (92.67 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1150/B00A/R0002/Ceiling Structures/Linings/S5					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00C - R0002 - Toilets - Boys/Girls (3.17 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1150/B00A/R0002/Ceiling Structures/Linings/S5					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00C - R0003 - Practical Activities - 1hb (20.07 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1150/B00A/R0002/Ceiling Structures/Linings/S5					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00B/R0004/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)

Floor Coverings Res/Textile	Under vinyl tile adhesive					No Asbestos Detected
	1150/B00B/R0004/Floor Coverings Res/Textile/S8					

**B00C - R0004 - Home Base (92.74 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1150/B00A/R0002/Ceiling Structures/Linings/S5					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00C - R0005 - Practical Activities - 1hb (20.1 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1150/B00A/R0002/Ceiling Structures/Linings/S5					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles	20.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00B/R0004/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)

Floor Coverings Res/Textile	Under vinyl tile adhesive					No Asbestos Detected
	1150/B00B/R0004/Floor Coverings Res/Textile/S8					

**B00C - R0006 - General Storeroom (3.17 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1150/B00A/R0002/Ceiling Structures/Linings/S5					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00C - R0007 - Toilets - Boys (23.27 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1150/B00A/R0002/Ceiling Structures/Linings/S5					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Southwest	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00A/R0003/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)

**B00C - R0008 - Toilets - Girls (21.28 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1150/B00A/R0002/Ceiling Structures/Linings/S5					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Southwest	Good Condition (1)	Low (1)	Low Priority (2-3)
1150/B00A/R0003/Partition Walls (Cubicles)/S4					<b>Chrysotile (white asbestos)</b>	
<b>B00C - R0009 - Practical Activities - 1hb (17.52 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
1150/B00A/R0002/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
Floor Coverings Res/Textile	Vinyl Tiles	17.55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1150/B00B/R0004/Floor Coverings Res/Textile/S7					<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Under vinyl tile adhesive					<b>No Asbestos Detected</b>
1150/B00B/R0004/Floor Coverings Res/Textile/S8					<b>No Asbestos Detected</b>	
<b>B00C - R0010 - General Storeroom (3.17 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
1150/B00A/R0002/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
<b>B00C - R0011 - Home Base (86.14 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
1150/B00A/R0002/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
<b>B00C - R0012 - Movement (97.34 m2)</b>						
Expansion joints	Bituminous membrane					<b>No Asbestos Detected</b>
1150/B00B/R0001/Expansion joints/S6					<b>No Asbestos Detected</b>	
<b>B00C - R0013 - Distribution Board (0.52 m2)</b>						
					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
1150/B00A/R0002/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Other-D.E.C. Admin - 1939 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00D - M9001 - Other - D.E.T. Admin (1.85 m2)**

No Asbestos

**B00D - M9002 - Other - D.E.T. Admin (1.42 m2)**

No Asbestos

**B00D - R0001 - Other - D.E.T. Admin (1.34 m2)**

No Asbestos

**B00D - R0002 - Other - D.E.T. Admin (6.35 m2)**

No Asbestos

**B00D - R0003 - Other - D.E.T. Admin (22.16 m2)**

No Asbestos

**B00D - R0004 - Other - D.E.T. Admin (10.92 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00D/R0004/Floor Coverings Res/Textile/S14				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Under tile adhesive					
	1150/B00D/R0004/Floor Coverings Res/Textile/S15				<b>No Asbestos Detected</b>	

**B00D - R0005 - Other - D.E.T. Admin (14.24 m2)**

No Asbestos

**B00D - R0006 - Other - D.E.T. Admin (9.25 m2)**

No Asbestos

**B00D - R0007 - Other - D.E.T. Admin (11.11 m2)**

No Asbestos

**B00D - R0008 - Other - D.E.T. Admin (11.81 m2)**

No Asbestos

**B00D - R0009 - Other - D.E.T. Admin (8.04 m2)**

No Asbestos

**B00D - R0010 - Other - D.E.T. Admin (23.04 m2)**

No Asbestos

**B00D - R0011 - Other - D.E.T. Admin (14.64 m2)**

No Asbestos

**B00D - R0012 - Other - D.E.T. Admin (45.48 m2)**

No Asbestos

**B00D - R0013 - Other - D.E.T. Admin (2.43 m2)**

No Asbestos

**B00D - R0014 - Other - D.E.T. Admin (7.41 m2)**

No Asbestos

**B00D - R0015 - Other - D.E.T. Admin (1.63 m2)**

No Asbestos

**B00D - R0016 - Other - D.E.T. Admin (8.44 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8.44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00D/R9003/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No		Test Result				
Floor Coverings Res/Textile	Adhesive under tile, under carpet					
	1150/B00D/R9003/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>
<b>B00D - R0017 - Other - D.E.T. Admin (0.14 m2)</b>						
No Asbestos						
<b>B00D - R0018 - Other - D.E.T. Admin (3.1 m2)</b>						
No Asbestos						
<b>B00D - R0019 - Other - D.E.T. Admin (12.84 m2)</b>						
No Asbestos						
<b>B00D - R0020 - Other - D.E.T. Admin (3.65 m2)</b>						
No Asbestos						
<b>B00D - R0021 - Other - D.E.T. Admin (47.8 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00D/R9003/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile under carpet					
	1150/B00D/R9003/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>
<b>B00D - R0022 - Other - D.E.T. Admin (14.27 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14.27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00D/R9003/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile under carpet					
	1150/B00D/R9003/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>
<b>B00D - R0023 - Other - D.E.T. Admin (47.47 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47.47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00D/R9003/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile under carpet					
	1150/B00D/R9003/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>
<b>B00D - R0024 - Other - D.E.T. Admin (17.63 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	17.63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00D/R9003/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile under carpet					
	1150/B00D/R9003/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>
<b>B00D - R0025 - Other - D.E.T. Admin (4.46 m2)</b>						
Window in-fill panels	Flat AC Sheeting					
	1150/B00D/R9005/Window in-fill panels/S13					<b>No Asbestos Detected</b>
<b>B00D - R0026 - Other - D.E.T. Admin (4.46 m2)</b>						
Window in-fill panels	Flat AC Sheeting					
	1150/B00D/R9005/Window in-fill panels/S13					<b>No Asbestos Detected</b>
<b>B00D - R0027 - Other - D.E.T. Admin (47.61 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47.61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00D/R9003/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile, under carpet					
	1150/B00D/R9003/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>
<b>B00D - R0028 - Other - D.E.T. Admin (14.68 m2)</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1150/B00D/R9003/Floor Coverings Res/Textile/S10	14.68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile, under carpet 1150/B00D/R9003/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>
<b>B00D - R0029 - Stairs (5.52 m2)</b>						
No Asbestos						
<b>B00D - R9001 - Other - D.E.T. Admin (4.27 m2)</b>						
No Asbestos						
<b>B00D - R9002 - Other - D.E.T. Admin (20.31 m2)</b>						
No Asbestos						
<b>B00D - R9003 - Other - D.E.T. Admin (47.69 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 1150/B00D/R9003/Floor Coverings Res/Textile/S10	47.69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Under tile adhesive 1150/B00D/R9003/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>
<b>B00D - R9004 - Other - D.E.T. Admin (8.94 m2)</b>						
No Asbestos						
<b>B00D - R9005 - Toilets - Girls (63.37 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet 1150/B00D/R9005/Partition Walls (Cubicles)/S12	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Window in-fill panels	Flat AC Sheeting 1150/B00D/R9005/Window in-fill panels/S13					<b>No Asbestos Detected</b>
<b>B00D - R9006 - Movement (1.17 m2)</b>						
No Asbestos						
<b>B00D - R9007 - Stairs (3.26 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning/Administration - 1934 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Expansion joints	Bituminous membrane 1150/B00E/Expansion joints/S21					<b>No Asbestos Detected</b>

**Interior****B00E - R0001 - General Storeroom (1.76 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1150/B00E/R0004/Floor Coverings Res/Textile/S1	1.76m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos)</b>

**B00E - R0002 - Staff Toilet (4.54 m2)**

No Asbestos

**B00E - R0003 - Principal (20.18 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 1150/B00E/R0004/Floor Coverings Res/Textile/S1	20.18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos)</b>

**B00E - R0004 - Duplicating Workroom (46.18 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 1150/B00E/R0004/Floor Coverings Res/Textile/S1	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos)</b>

*Tiles have been removed, area has had carpet installed. Asbestos removed, remediation work completed - 23/01/2017***B00E - R0005 - Movement (1.96 m2)**

No Asbestos

**B00E - R0006 - Movement (39.26 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1150/B00E/R0028/Floor Coverings Res/Textile/S16	39.26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos)</b>

Floor Coverings Res/Textile	Under tile adhesive - Tile being under carpet 1150/B00E/R0028/Floor Coverings Res/Textile/S17					<b>No Asbestos Detected</b>
-----------------------------	--	--	--	--	--	-----------------------------

**B00E - R0007 - Movement (1.98 m2)**

No Asbestos

**B00E - R0008 - Security Store (10.67 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1150/B00E/R0028/Floor Coverings Res/Textile/S16	10.67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos)</b>

Floor Coverings Res/Textile	Under tile adhesive - Tile being under carpet 1150/B00E/R0028/Floor Coverings Res/Textile/S17					<b>No Asbestos Detected</b>
-----------------------------	--	--	--	--	--	-----------------------------

Door of vault	Encapsulated Insulation material within unit <b>Assumed Asbestos - Presumed friable asbestos encased</b>	3m2	Northeast	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
---------------	---	-----	-----------	----------------------	---------	--------------------

**B00E - R0009 - Cleaning Distributed Store (6.36 m2)**

No Asbestos

**B00E - R0010 - Movement (2.79 m2)**

No Asbestos

**B00E - R0011 - Movement (2.33 m2)**

No Asbestos

**B00E - R0014 - External Movement (1.13 m2)**

No Asbestos

**B00E - R0016 - Movement (47.04 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00E - R0017 - Home Base (62.49 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1150/B00E/R0004/Floor Coverings Res/Textile/S1	62.49m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Wall in-fill panel	Flat AC Sheeting 1150/B00E/R0017/Wall in-fill panel/S18	4m2	Southern & Eastern corner	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R0018 - Movement (1.91 m2)</b>						
No Asbestos						
<b>B00E - R0019 - Movement (2.77 m2)</b>						
No Asbestos						
<b>B00E - R0020 - General Storeroom (6.34 m2)</b>						
No Asbestos						
<b>B00E - R0021 - Staff Toilet (8.85 m2)</b>						
No Asbestos						
<b>B00E - R0022 - Staff Toilet (5.95 m2)</b>						
No Asbestos						
<b>B00E - R0023 - Deputy Principal (22.36 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1150/B00E/R0004/Floor Coverings Res/Textile/S1	22.36m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<i>Existing tiles and carpet have been removed, area has had new carpet layed. Asbestos removed, remediation work completed - 23/01/2017</i>						
<b>B00E - R0024 - Cleaning Distributed Store (1.93 m2)</b>						
No Asbestos						
<b>B00E - R0025 - Staff Room Annexe (21.19 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1150/B00E/R0004/Floor Coverings Res/Textile/S1	21.19m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<i>Existing tiles and carpet have been removed, area has had new carpet layed. Asbestos removed, remediation work completed - 23/01/2017</i>						
<b>B00E - R0027 - Movement (1.96 m2)</b>						
No Asbestos						
<b>B00E - R0028 - Movement (34.46 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1150/B00E/R0028/Floor Coverings Res/Textile/S16	34.46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Under tile adhesive - Tile being under carpet 1150/B00E/R0028/Floor Coverings Res/Textile/S17					<b>No Asbestos Detected</b>
<b>B00E - R0029 - Movement (1.96 m2)</b>						
No Asbestos						
<b>B00E - R0030 - Stairs (8.97 m2)</b>						
No Asbestos						
<b>B00E - R0031 - Stairs (9 m2)</b>						
No Asbestos						
<b>B00E - R0032 - Staff Kitchen (21.36 m2)</b>						
No Asbestos						
<b>B00E - R0033 - Staff Room (54.5 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1150/B00E/R0004/Floor Coverings Res/Textile/S1	54.5m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R0034 - Special Programs Room (50.04 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00E - R0035 - Entry Vestibule (33.92 m2)</b>						
No Asbestos						
<b>B00E - R0036 - Clerical Office/Workroom (62.54 m2)</b>						
No Asbestos						
<b>B00E - R0037 - Clerical Office/Workroom (17.65 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1150/B00E/R0004/Floor Coverings Res/Textile/S1	17.65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Existing tiles have been removed, area has had new vinyl sheet laid. Asbestos removed, remediation work completed - 23/01/2017</i>						
<b>B00E - R0038 - Clerical Office/Workroom (28.16 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1150/B00E/R0004/Floor Coverings Res/Textile/S1	28.16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
<b>B00E - R1001 - Home Base (48.47 m2)</b>						
Floor Coverings Res/Textile	Vinyl sheet under carpet 1150/B00E/R1003/Floor Coverings Res/Textile/S20					<b>No Asbestos Detected</b>
<b>B00E - R1002 - Home Base (47.71 m2)</b>						
Floor Coverings Res/Textile	Vinyl sheet under carpet 1150/B00E/R1003/Floor Coverings Res/Textile/S20					<b>No Asbestos Detected</b>
<b>B00E - R1003 - Home Base (47.28 m2)</b>						
Floor Coverings Res/Textile	Vinyl sheet under carpet 1150/B00E/R1003/Floor Coverings Res/Textile/S20					<b>No Asbestos Detected</b>
<b>B00E - R1004 - Home Base (46.58 m2)</b>						
Floor Coverings Res/Textile	Vinyl sheet under carpet 1150/B00E/R1003/Floor Coverings Res/Textile/S20					<b>No Asbestos Detected</b>
<b>B00E - R1005 - Home Base (49.25 m2)</b>						
Floor Coverings Res/Textile	Vinyl sheet under carpet 1150/B00E/R1003/Floor Coverings Res/Textile/S20					<b>No Asbestos Detected</b>
<b>B00E - R1006 - Personal Effects Storage (11.79 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet 1150/B00E/R1008/Floor Coverings Res/Textile/S19					<b>No Asbestos Detected</b>
<b>B00E - R1007 - Movement (90.15 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1150/B00E/R0004/Floor Coverings Res/Textile/S1	90.15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
<b>B00E - R1008 - Personal Effects Storage (11.6 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet 1150/B00E/R1008/Floor Coverings Res/Textile/S19					<b>No Asbestos Detected</b>
<b>B00E - R1009 - Stairs (20.88 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet 1150/B00E/R1008/Floor Coverings Res/Textile/S19					<b>No Asbestos Detected</b>
<b>B00E - R1010 - Stairs (20.88 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet 1150/B00E/R1008/Floor Coverings Res/Textile/S19					<b>No Asbestos Detected</b>
<b>B00E - R9001 - General Assistant/Bulk Store (73.36 m2)</b>						
No Asbestos						
<b>B00E - R9002 - Main Switch Board (22.69 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

**B00E - R9003 - General Storeroom (6.23 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning/Support Unit - 1939 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Window beading	Putty 1150/B00F/Window beading/S27					No Asbestos Detected
Expansion joints	Bituminous membrane 1150/B00F/Expansion joints/S28					No Asbestos Detected

**Interior****B00F - R0001 - Movement (1.94 m2)**

No Asbestos

**B00F - R0002 - Movement (8.67 m2)**

Floor Coverings Res/Textile	Vinyl Sheet 1150/B00F/R0002/Floor Coverings Res/Textile/S22					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

**B00F - R0003 - Cleaning Distributed Store (6.59 m2)**

No Asbestos

**B00F - R0004 - Staff Toilet (5.45 m2)**

No Asbestos

**B00F - R0005 - Personal Effects Storage (5.47 m2)**

Floor Coverings Res/Textile	Vinyl Sheet 1150/B00F/R0002/Floor Coverings Res/Textile/S22					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

**B00F - R0006 - Movement (1.93 m2)**

No Asbestos

**B00F - R0007 - Home Base (47.74 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1150/B00F/R0008/Floor Coverings Res/Textile/S23	47.74m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile - Tile is under carpet 1150/B00F/R0008/Floor Coverings Res/Textile/S24					No Asbestos Detected

**B00F - R0008 - General Storeroom (6.25 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 1150/B00F/R0008/Floor Coverings Res/Textile/S23	6.25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile 1150/B00F/R0008/Floor Coverings Res/Textile/S24					No Asbestos Detected

**B00F - R0009 - Staff Room Annexe (13.83 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1150/B00F/R0008/Floor Coverings Res/Textile/S23	13.83m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile - Tile is under carpet 1150/B00F/R0008/Floor Coverings Res/Textile/S24					No Asbestos Detected

**B00F - R0010 - Movement (2.92 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1150/B00F/R0008/Floor Coverings Res/Textile/S23	2.92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile - Tile is under carpet 1150/B00F/R0008/Floor Coverings Res/Textile/S24					No Asbestos Detected

**B00F - R0011 - Withdrawal Space - 1hb (22.91 m2)**


Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1150/B00F/R0008/Floor Coverings Res/Textile/S23	22.91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile - Tile is under carpet 1150/B00F/R0008/Floor Coverings Res/Textile/S24					<b>No Asbestos Detected</b>
<b>B00F - R0012 - Movement (87.54 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1150/B00F/R0008/Floor Coverings Res/Textile/S23	87.54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile - Tile is under carpet 1150/B00F/R0008/Floor Coverings Res/Textile/S24					<b>No Asbestos Detected</b>
<b>B00F - R0013 - Staff Toilet (3.06 m2)</b>						
No Asbestos						
<b>B00F - R0014 - General Storeroom (0.19 m2)</b>						
No Asbestos						
<b>B00F - R0015 - Staff Room Annexe (12.84 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1150/B00F/R0008/Floor Coverings Res/Textile/S23	12.84m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile - Tile is under carpet 1150/B00F/R0008/Floor Coverings Res/Textile/S24					<b>No Asbestos Detected</b>
<b>B00F - R0016 - General Storeroom (3.6 m2)</b>						
No Asbestos						
<b>B00F - R0017 - Movement (10.21 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1150/B00F/R0008/Floor Coverings Res/Textile/S23	10.21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile - Tile is under carpet 1150/B00F/R0008/Floor Coverings Res/Textile/S24					<b>No Asbestos Detected</b>
<b>B00F - R0018 - Staff Room Annexe (8.72 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1150/B00F/R0008/Floor Coverings Res/Textile/S23	8.72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile - Tile is under carpet 1150/B00F/R0008/Floor Coverings Res/Textile/S24					<b>No Asbestos Detected</b>
<b>B00F - R0019 - Home Base (47.15 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1150/B00F/R0008/Floor Coverings Res/Textile/S23	47.15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile - Tile is under carpet 1150/B00F/R0008/Floor Coverings Res/Textile/S24					<b>No Asbestos Detected</b>
<b>B00F - R0020 - Home Base (47.81 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1150/B00F/R0008/Floor Coverings Res/Textile/S23	47.81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile - Tile is under carpet 1150/B00F/R0008/Floor Coverings Res/Textile/S24					<b>No Asbestos Detected</b>
<b>B00F - R0021 - Movement (1.88 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00F - R0022 - Movement (2.7 m2)</b>						
No Asbestos						
<b>B00F - R0023 - Cleaning Distributed Store (5.76 m2)</b>						
No Asbestos						
<b>B00F - R0024 - Personal Effects Storage (13.79 m2)</b>						
No Asbestos						
<b>B00F - R0025 - Handwashing Facilities (0.89 m2)</b>						
No Asbestos						
<b>B00F - R0026 - Movement (1.86 m2)</b>						
No Asbestos						
<b>B00F - R0027 - Movement (1.77 m2)</b>						
No Asbestos						
<b>B00F - R0028 - Movement (1.6 m2)</b>						
No Asbestos						
<b>B00F - R0029 - Communal Space (170 m2)</b>						
No Asbestos						
<b>B00F - R0030 - Raised Platform (26.41 m2)</b>						
No Asbestos						
<b>B00F - R0031 - Stairs (4.48 m2)</b>						
No Asbestos						
<b>B00F - R0032 - Stairs (8.55 m2)</b>						
No Asbestos						
<b>B00F - R0033 - Main Switch Board (5.1 m2)</b>						
No Asbestos						
<b>B00F - R1001 - Movement (7.2 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	1150/B00F/R0002/Floor Coverings Res/Textile/S22					<b>No Asbestos Detected</b>
<b>B00F - R1002 - Staff Room Annexe (11.26 m2)</b>						
No Asbestos						
<b>B00F - R1003 - Clerical Office/Workroom (32.44 m2)</b>						
Floor Coverings Res/Textile	Adhesive under tile - Tile is under carpet					
	1150/B00F/R0008/Floor Coverings Res/Textile/S24					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	32.44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00F/R0008/Floor Coverings Res/Textile/S23					<b>Chrysotile (white asbestos)</b>
<b>B00F - R1004 - Withdrawal Space - 1hb (14.59 m2)</b>						
No Asbestos						
<b>B00F - R1005 - Staff Room Annexe (47.68 m2)</b>						
No Asbestos						
<b>B00F - R1006 - General Storeroom (3.68 m2)</b>						
No Asbestos						
<b>B00F - R1007 - Staff Toilet (3.15 m2)</b>						
Incinerette	Encapsulated Insulation material within unit	1Unit(s)	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Asbestos material encased in metal</b>					
<b>B00F - R1008 - General Storeroom (0.15 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	0.15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00F/R0008/Floor Coverings Res/Textile/S23					<b>Chrysotile (white asbestos)</b>



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive under tile					
	1150/B00F/R0008/Floor Coverings Res/Textile/S24					<b>No Asbestos Detected</b>
<b>B00F - R1009 - Interview (21.58 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	21.58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00F/R0008/Floor Coverings Res/Textile/S23					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile - Tile is under carpet					
	1150/B00F/R0008/Floor Coverings Res/Textile/S24					<b>No Asbestos Detected</b>
<b>B00F - R1010 - Staff Kitchen (8.85 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	1150/B00F/R0002/Floor Coverings Res/Textile/S22					<b>No Asbestos Detected</b>
<b>B00F - R1011 - Movement (3.64 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	3.64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00F/R0008/Floor Coverings Res/Textile/S23					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile - Tile is under carpet					
	1150/B00F/R0008/Floor Coverings Res/Textile/S24					<b>No Asbestos Detected</b>
<b>B00F - R1012 - Movement (40.35 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40.35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00F/R0008/Floor Coverings Res/Textile/S23					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile - Tile is under carpet					
	1150/B00F/R0008/Floor Coverings Res/Textile/S24					<b>No Asbestos Detected</b>
<b>B00F - R1013 - Home Base (46.95 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46.95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00F/R0008/Floor Coverings Res/Textile/S23					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile - Tile is under carpet					
	1150/B00F/R0008/Floor Coverings Res/Textile/S24					<b>No Asbestos Detected</b>
<b>B00F - R1014 - Home Base (47.61 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47.61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00F/R0008/Floor Coverings Res/Textile/S23					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile - Tile is under carpet					
	1150/B00F/R0008/Floor Coverings Res/Textile/S24					<b>No Asbestos Detected</b>
<b>B00F - R1015 - Movement (25.48 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	25.48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00F/R0008/Floor Coverings Res/Textile/S23					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile - Tile is under carpet					
	1150/B00F/R0008/Floor Coverings Res/Textile/S24					<b>No Asbestos Detected</b>
<b>B00F - R1016 - Practical Activities - 1hb (9.06 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	1150/B00F/R0002/Floor Coverings Res/Textile/S22					<b>No Asbestos Detected</b>
<b>B00F - R1017 - Personal Effects Storage (12.19 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	1150/B00F/R0002/Floor Coverings Res/Textile/S22					<b>No Asbestos Detected</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00F - R1018 - Stairs (13.92 m2)</b>						
No Asbestos						
<b>B00F - R1019 - Stairs (15.34 m2)</b>						
No Asbestos						
<b>B00F - R9001 - Movement (1.15 m2)</b>						
No Asbestos						
<b>B00F - R9002 - General Storeroom (21.16 m2)</b>						
Incinerator	Encapsulated Insulation material within unit	16m2	Northwest	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Asbestos material encased in metal</b>						
<b>B00F - R9003 - General Storeroom (7 m2)</b>						
Window in-fill panel	Flat AC Sheeting					<b>No Asbestos Detected</b>
	1150/B00F/R9010/Window in-fill panel/S26					
<b>B00F - R9004 - Practical Activities - 1hb (64.3 m2)</b>						
No Asbestos						
<b>B00F - R9005 - Toilets - Girls (30.88 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00F/R9006/Partition Walls (Cubicles)/S25					<b>Chrysotile (white asbestos)</b>
<b>B00F - R9006 - Toilets - Boys (31.95 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00F/R9006/Partition Walls (Cubicles)/S25					<b>Chrysotile (white asbestos)</b>
<b>B00F - R9007 - Sports Store (20.01 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	20.01m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00F/R0008/Floor Coverings Res/Textile/S23					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile					<b>No Asbestos Detected</b>
	1150/B00F/R0008/Floor Coverings Res/Textile/S24					
<b>B00F - R9008 - Sports Store (21.39 m2)</b>						
No Asbestos						
<b>B00F - R9009 - General Storeroom (21.39 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	21.39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1150/B00F/R0008/Floor Coverings Res/Textile/S23					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive under tile					<b>No Asbestos Detected</b>
	1150/B00F/R0008/Floor Coverings Res/Textile/S24					
<b>B00F - R9010 - Stairs (3.59 m2)</b>						
Window in-fill panel	Flat AC Sheeting					<b>No Asbestos Detected</b>
	1150/B00F/R9010/Window in-fill panel/S26					

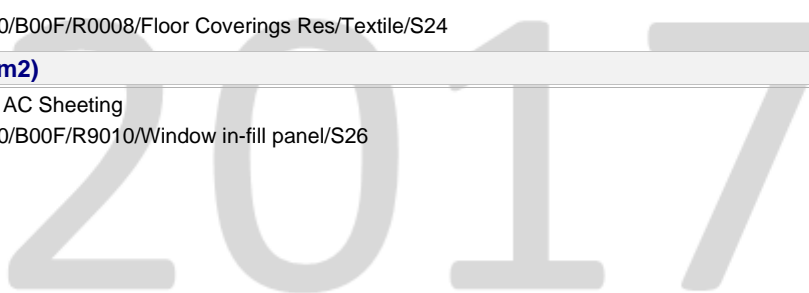

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Special Purpose - 1975 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

**Interior****B00G - R0001 - Dental Clinic (50.38 m2)**

No Asbestos

**B00G - R0002 - Dental Clinic (11.95 m2)**

Floor Coverings Res/Textile Vinyl Sheet  
1150/B00G/R0002/Floor Coverings Res/Textile/S29 **No Asbestos Detected**

**B00G - R0003 - Dental Clinic (5.13 m2)**

No Asbestos

**B00G - R0004 - Dental Clinic (0.45 m2)**

Floor Coverings Res/Textile Vinyl Sheet  
1150/B00G/R0002/Floor Coverings Res/Textile/S29 **No Asbestos Detected**

Ceiling Structures/Linings Flat AC Sheeting  
1150/B00A/R0002/Ceiling Structures/Linings/S5 **No Asbestos Detected**

Fibrous cement sheet Flat AC Sheeting  
1150/B00A/R0002/Ceiling Structures/Linings/S5 **No Asbestos Detected**

**B00G - R0005 - Dental Clinic (12.78 m2)**

Floor Coverings Res/Textile Vinyl Sheet  
1150/B00G/R0002/Floor Coverings Res/Textile/S29 **No Asbestos Detected**

**B00G - R0006 - Dental Clinic (0.32 m2)**

No Asbestos

**B00G - R0007 - Dental Clinic (4.34 m2)**

No Asbestos

**B00G - R0008 - Dental Clinic (16.32 m2)**

Floor Coverings Res/Textile Vinyl Sheet  
1150/B00G/R0008/Floor Coverings Res/Textile/S30 **No Asbestos Detected**

**B00G - R0009 - Dental Clinic (3.6 m2)**

No Asbestos

**B00G - R0010 - Dental Clinic (8.88 m2)**

Floor Coverings Res/Textile Vinyl Sheet  
1150/B00G/R0002/Floor Coverings Res/Textile/S29 **No Asbestos Detected**

**B00G - R0011 - Dental Clinic (7.85 m2)**

Floor Coverings Res/Textile Vinyl Sheet  
1150/B00G/R0002/Floor Coverings Res/Textile/S29 **No Asbestos Detected**

**B00G - R0012 - Dental Clinic (1.37 m2)**

No Asbestos

**B00G - R0013 - Dental Clinic (0.81 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00H - Communal Facilities - 2011 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - No ceiling cavity
Underfloor Voids	Non Accessible Area - Building on slab

**Interior****B00H - R0001 - Communal Space (144.75 m2)**

No Asbestos

**B00H - R0002 - Raised Platform (59.62 m2)**

No Asbestos

**B00H - R0003 - Movement (5.94 m2)**

No Asbestos

**B00H - R0004 - Ramp (10.9 m2)**

No Asbestos

**B00H - R0005 - Movement (11.28 m2)**

No Asbestos

**B00H - R0006 - Hall Chair Store (9.51 m2)**

No Asbestos

**B00H - R0007 - Communal/Performance Store (9.62 m2)**

No Asbestos

**B00H - R0008 - P.E. Store (13.03 m2)**

No Asbestos

**B00H - R0009 - Movement (2.44 m2)**

No Asbestos

**B00H - R0010 - Toilets - Girls (7.31 m2)**

No Asbestos

**B00H - R0011 - Sound Cupboard (2.1 m2)**

No Asbestos

**B00H - R0012 - Toilets - Boys (5.72 m2)**

No Asbestos

**B00H - R0013 - Movement (3.32 m2)**

No Asbestos

**B00H - R0014 - Cleaning Distributed Store (3.61 m2)**

No Asbestos

**B00H - R0015 - Other (1.56 m2)**

No Asbestos

**B00H - R0016 - Main Switch Board (3.42 m2)**

No Asbestos

**B00H - R0017 - Access Shower/Toilet/Change (6.75 m2)**

No Asbestos

**B00H - R0018 - Covered Outdoor Learning Area (154.79 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

**Demountable details as per the AMS records as of 15 Feb 2017.**

### OS 602 - D10355 - Learning Unit - Standard With P.A.A. : Placement Date - 7/01/2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

#### Exterior

No Asbestos Found.

#### Interior

##### R1 - Learning space/withdrawal/entry

No Asbestos Found.

##### R2 - Home Base Store

No Asbestos Found.

### OS 603 - D11214 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 10/01/2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

#### Exterior

No Asbestos Found.

#### Interior

##### R1 - Learning space/withdrawal/entry

No Asbestos Found.

##### R2 - Home Base Store

No Asbestos Found.

### OS 602 - D12757 - Learning Unit - Standard With P.A.A. : Placement Date - 22/11/2013

#### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

#### Interior

##### R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

##### R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

### OS 602 - D13544 - Learning Unit - Standard With P.A.A. : Placement Date - 7/01/2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

#### Exterior

No Asbestos Found.

#### Interior

##### R1 - Learning space/withdrawal/entry

No Asbestos Found.

##### R2 - Home Base Store

No Asbestos Found.

### OS 602 - D13568 - Learning Unit - Standard With P.A.A. : Placement Date - 1/12/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

#### Exterior

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						
<b>OS 602 - D15497 - Learning Unit - Standard With P.A.A. : Placement Date - 14/04/2016</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						
<b>OS 603 - D15829 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 11/12/2012</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						
<b>OS 602 - D16264 - Learning Unit - Standard With P.A.A. : Placement Date - 21/01/2010</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017