


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Beckom Public School (1160)
Region : Riverina
State Electorate : Cootamundra
Local Government Area : Coolamon

Initial Survey : Noel Arnold & Associates : 08 - May - 2008
Reviewed By : Greencap-NAA : 15 - Jun - 2016

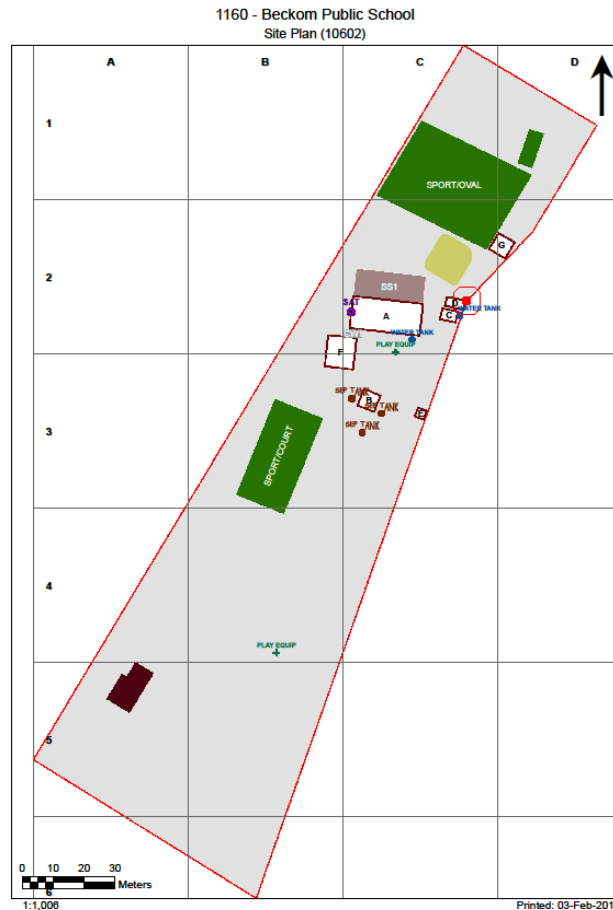

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Library - 1970 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	12m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1160/B00A/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Wall Cladding	Flat AC Sheeting	4m2	North & South above windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	1160/B00A/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
In-fill-panel below Window	Flat AC Sheeting	14m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1160/B00A/In-fill-panel below Window/S5				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	26m	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1160/B00A/Gable Verge Lining/S4				Chrysotile (white asbestos)	

Interior**B00A - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1160/B00A/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
In-fill-panel below Window	Flat AC Sheeting	12m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1160/B00A/In-fill-panel below Window/S5				Chrysotile (white asbestos)	

B00A - R0004 - Principal

Floor Coverings Res/Textile	Adhesive	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1160/B00A/R0004/Floor Coverings Res/Textile/S8				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1160/B00A/R0006/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	

B00A - R0007 - Home Base

No Asbestos

B00A - R0008 - Reading Area

No Asbestos

B00A - R0009 - Music Store

Floor Coverings Res/Textile	Vinyl Tiles					
	1160/B00A/R0010/Floor Coverings Res/Textile/S1				No Asbestos Detected	

B00A - R0010 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	1160/B00A/R0010/Floor Coverings Res/Textile/S1				No Asbestos Detected	

B00A - R0011 - Distribution Board

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	1Unit	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					

B00A - R0012 - Clerical Office

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1160/B00A/R0006/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1160/B00A/R0004/Floor Coverings Res/Textile/S8				Chrysotile (white asbestos)	

B00A - R0013 - Home Base Store

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1970 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible

Interior

B00B - R0002 - Toilets - Boys

No Asbestos

B00B - R0003 - Staff Toilet

No Asbestos

B00B - R0004 - Toilets - Girls

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 2008 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1160/B00C/Eaves Linings/S7					Chrysotile (white asbestos)

Interior

B00C - R0001 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1160/B00C/Eaves Linings/S7					Chrysotile (white asbestos)

B00C - R0002 - Drinking Facilities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Building Services - 2008 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00D - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Building Services - 2008 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00E - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - Reading Area

No Asbestos

B00F - R0002 - K.L.A. Store

No Asbestos

B00F - R0003 - Practical Activities

No Asbestos

B00F - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Storage - - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00G - R0001 - General Assistant/Bulk Store

No Asbestos

B00G - R0002 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017