


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bedgerebong Public School (1164)
Region : Western NSW
State Electorate : Orange
Local Government Area : Forbes

Initial Survey : Noel Arnold & Associates : 23 - Apr - 2008
Reviewed By : Grencap-NAA : 08 - Dec - 2016

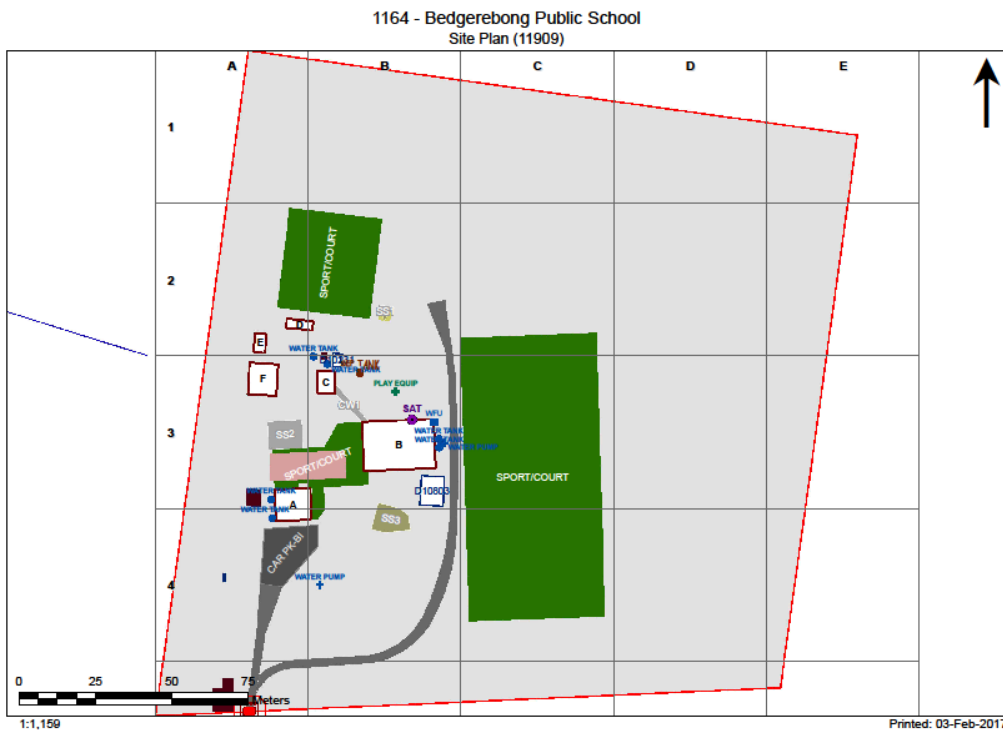

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Staff Facilities/Library - 1968 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	6m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1164/B00A/R0001/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	18m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1164/B00A/Gable Verge Lining/S3				Chrysotile (white asbestos)	
Under-Floor Void - Floating Slab	Non Accessible Area					
	- No sub-floor opening					

Interior**B00A - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1164/B00A/R0001/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	

B00A - R0002 - General Storeroom

No Asbestos

B00A - R0003 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0004 - Principal

No Asbestos

B00A - R0005 - Reading Area

No Asbestos

B00A - R0006 - Movement

No Asbestos

B00A - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1164/B00A/R0001/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
In-Fill Panel	Compressed AC Sheet	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1164/B00A/R0007/In-Fill Panel/S4				Chrysotile (white asbestos)	

B00A - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1164/B00A/R0001/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1984 - Brick/Veneer (Brick/Veneer)**Exterior**

Wall Cladding	Flat AC Sheeting 1164/B00B/Wall Cladding/S1					No Asbestos Detected
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - No manhole 5m high ceiling					

Interior**B00B - R0001 - Movement**

Door In-Fill panel	Compressed AC Sheet 1164/B00B/R0006/Door In-Fill panel/S5					No Asbestos Detected
--------------------	--	--	--	--	--	-----------------------------

B00B - R0002 - Home Base

Door In-Fill panel	Compressed AC Sheet 1164/B00B/R0006/Door In-Fill panel/S5					No Asbestos Detected
--------------------	--	--	--	--	--	-----------------------------

B00B - R0003 - Home Base Store

No Asbestos

B00B - R0004 - General Storeroom

No Asbestos

B00B - R0005 - Withdrawal Space - 1hb

No Asbestos

B00B - R0006 - Movement

Door In-Fill panel	Compressed AC Sheet 1164/B00B/R0006/Door In-Fill panel/S5					No Asbestos Detected
Electrical Mounting Board	Fibrous Membrane	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Electrical Hazard - Live**B00B - R0007 - Home Base Store**

No Asbestos

B00B - R0008 - General Storeroom

No Asbestos

B00B - R0009 - Practical Activities - 1hb

Door In-Fill panel	Compressed AC Sheet 1164/B00B/R0006/Door In-Fill panel/S5					No Asbestos Detected
--------------------	--	--	--	--	--	-----------------------------

B00B - R0010 - Home Base

Door In-Fill panel	Compressed AC Sheet 1164/B00B/R0006/Door In-Fill panel/S5					No Asbestos Detected
--------------------	--	--	--	--	--	-----------------------------

B00B - R0011 - Movement

No Asbestos

B00B - R0012 - Withdrawal Space - 1hb

Door In-Fill panel	Compressed AC Sheet 1164/B00B/R0006/Door In-Fill panel/S5					No Asbestos Detected
--------------------	--	--	--	--	--	-----------------------------

B00B - R0013 - Special Programs Room

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1968 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids - Flat Roof	Non Accessible Area - No manhole wooden ceiling 2.5m high

Interior

B00C - R0001 - Toilets - Boys

No Asbestos

B00C - R0002 - Drinking Facilities

No Asbestos

B00C - R0003 - Toilets - Girls

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Other-Community Use - 1968 - Steel (Steel)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00D - R0001 - Canteen Covered Area

No Asbestos

B00D - R0002 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1968 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

Interior

B00E - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

Interior

B00F - R0001 - Reading Area

No Asbestos

B00F - R0002 - K.L.A. Store

No Asbestos

B00F - R0003 - Practical Activities

No Asbestos

B00F - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Cleaners Shed

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids - Flat Roof No Asbestos Found

Interior

B00G - R0001 - Shed

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Bike Shed

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids - Raked Ceiling No Asbestos Found

Interior

B00H - R0001 - Shed

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 844 - D10231 - Country Toilet - Reltc - Boys/Girls : Placement Date - 26/08/2004

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	2.88 m2

Interior

R1 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	9 m2

R2 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	9 m2

OS 505 - D10803 - Admin Staff/Principal/Secure Store : Placement Date - 25/05/2005

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Entry

No Asbestos Found.

R2 - Principal

No Asbestos Found.

R3 - Staff Room

No Asbestos Found.

R4 - Security Store

No Asbestos Found.

R5 - Clerical Office

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017