


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Beecroft Public School (1166)  
**Region :** Northern Sydney  
**State Electorate :** Epping  
**Local Government Area :** Hornsby

**Initial Survey :** Noel Arnold & Associates : 30 - Jan - 2008  
**Reviewed By :** Grencap-NAA : 13 - Aug - 2014

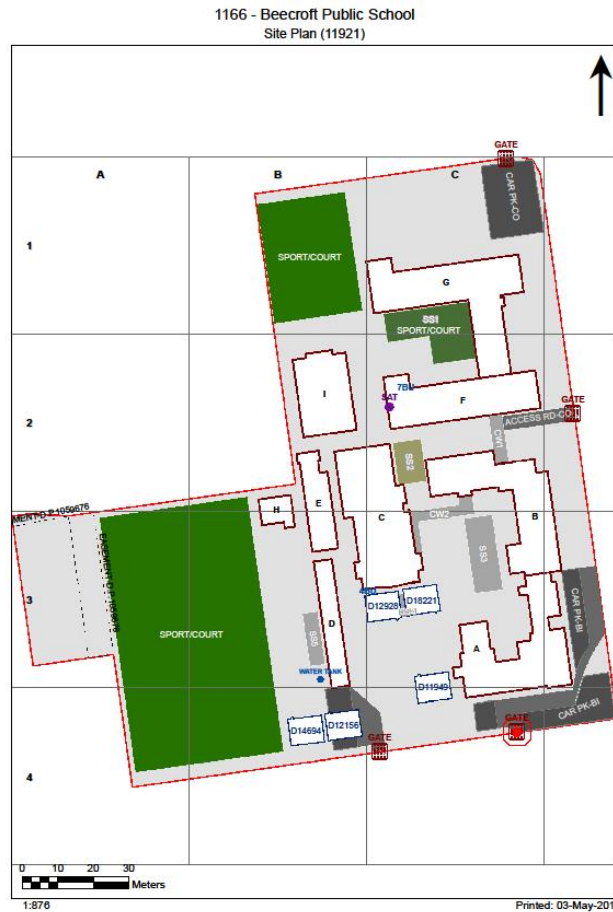

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00A - General Learning - 1869 - Brick/Block (Brick/Block)****Exterior**

|                    |  |      |                             |                    |         |  |
|--------------------|--|------|-----------------------------|--------------------|---------|--|
| Eaves Linings      | Flat AC Sheeting<br>1166/B00G/Eaves Linings/S1       | 22m2 | East facing,<br>West facing | Good Condition (1) | Low (1) | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b> |
| Underfloor Voids   | No Asbestos Found                                    |      |                             |                    |         |  |
| Gable Verge Lining | Flat AC Sheeting<br>1166/B00A/Gable Verge Lining/S22 |      |                             |                    |         | <b>No Asbestos Detected</b>                              |
| Ceiling Voids      | No Asbestos Found                                    |      |                             |                    |         |  |

**Interior****B00A - R0001 - Movement (5.44 m2)**

|                            |  |     |              |                    |         |   |
|----------------------------|--|-----|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting<br>1166/B00B/R0020/Ceiling Structures/Linings/S10 | 6m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)<br><b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
|----------------------------|--|-----|--------------|--------------------|---------|---|

**B00A - R0002 - Home Base Store (0.89 m2)**

No Asbestos

**B00A - R0003 - Withdrawal Space - 1hb (19.87 m2)**

No Asbestos

**B00A - R0004 - General Storeroom (9.56 m2)**

No Asbestos

**B00A - R0005 - Cleaning Distributed Store (0.89 m2)**

No Asbestos

**B00A - R0006 - Interview (19.66 m2)**

No Asbestos

**B00A - R0007 - General Storeroom (1.59 m2)**

No Asbestos

**B00A - R0009 - Movement (31.28 m2)**

|                            |   |  |  |  |  |   |
|----------------------------|---|--|--|--|--|---|
| Ceiling Structures/Linings | Vermiculite<br>1166/B00B/R1019/Ceiling Structures/Linings/S17 |  |  |  |  | <b>Limited Samples Taken</b><br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
|----------------------------|---|--|--|--|--|---|

|                           |                |       |             |                    |         |   |
|---------------------------|----------------|-------|-------------|--------------------|---------|---|
| Electrical Mounting Board | Resinous Board | 1Unit | East facing | Good Condition (1) | Low (1) | Low Priority (2-3)<br><b>Assumed Asbestos - Electrical Hazard</b> |
|---------------------------|----------------|-------|-------------|--------------------|---------|---|

|                          |  |     |            |                    |         |   |
|--------------------------|--|-----|------------|--------------------|---------|---|
| Electrical Backing Board | Flat AC Sheeting<br>1166/B00A/R0009/Electrical Backing Board/S19 | 1m2 | Throughout | Minimal Damage (2) | Low (1) | Low Priority (2-3)<br><b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
|--------------------------|--|-----|------------|--------------------|---------|---|

**B00A - R0010 - Personal Effects Storage (10.6 m2)**

No Asbestos

**B00A - R0011 - Staff Toilet (2.34 m2)**

No Asbestos

**B00A - R0012 - Home Base (45.2 m2)**

No Asbestos

**B00A - R0013 - Home Base (52.44 m2)**

No Asbestos

**B00A - R0014 - Movement (28.98 m2)**

No Asbestos

**B00A - R0015 - Clerical Office (44.38 m2)**

|                                |   |  |  |  |  |                             |
|--------------------------------|---|--|--|--|--|-----------------------------|
| Floor Coverings<br>Res/Textile | Vinyl Tiles & Adhesive<br>1166/B00A/R0037/Floor Coverings Res/Textile/S20 |  |  |  |  | <b>No Asbestos Detected</b> |
|--------------------------------|---|--|--|--|--|-----------------------------|

| Product   | Material Description                            | Extent | Location Reference | Material Condition | Risk Status | Control Priority  |
|---|---|--------|--------------------|--------------------|-------------|---|
| Sample No   |   |        |                    |                    | Test Result |   |
| <b>B00A - R0017 - Movement (13.32 m2)</b>                     |   |        |                    |                    |             |   |
| No Asbestos   |   |        |                    |                    |             |   |
| <b>B00A - R0018 - Staff Room (43.45 m2)</b>                   |   |        |                    |                    |             |   |
| Floor Coverings Res/Textile                                   | Vinyl Tiles & Adhesive                          |        |                    |                    |             |   |
|   | 1166/B00A/R0037/Floor Coverings Res/Textile/S20 |        |                    |                    |             | <b>No Asbestos Detected</b>                                   |
| <b>B00A - R0019 - Staff Kitchen (10.67 m2)</b>                |   |        |                    |                    |             |   |
| No Asbestos   |   |        |                    |                    |             |   |
| <b>B00A - R0020 - Staff Toilet (4.32 m2)</b>                  |   |        |                    |                    |             |   |
| No Asbestos   |   |        |                    |                    |             |   |
| <b>B00A - R0021 - Staff Kitchen (8.09 m2)</b>                 |   |        |                    |                    |             |   |
| No Asbestos   |   |        |                    |                    |             |   |
| <b>B00A - R0022 - Cleaning Distributed Store (5.01 m2)</b>    |   |        |                    |                    |             |   |
| No Asbestos   |   |        |                    |                    |             |   |
| <b>B00A - R0023 - Toilets - Boys/Girls (3.18 m2)</b>          |   |        |                    |                    |             |   |
| No Asbestos   |   |        |                    |                    |             |   |
| <b>B00A - R0024 - Community Clinic (10.86 m2)</b>             |   |        |                    |                    |             |   |
| No Asbestos   |   |        |                    |                    |             |   |
| <b>B00A - R0026 - Dental Clinic (18.85 m2)</b>                |   |        |                    |                    |             |   |
| No Asbestos   |   |        |                    |                    |             |   |
| <b>B00A - R0028 - General Storeroom (6 m2)</b>                |   |        |                    |                    |             |   |
| No Asbestos   |   |        |                    |                    |             |   |
| <b>B00A - R0029 - General Storeroom (3.26 m2)</b>             |   |        |                    |                    |             |   |
| No Asbestos   |   |        |                    |                    |             |   |
| <b>B00A - R0030 - Movement (4.62 m2)</b>                      |   |        |                    |                    |             |   |
| Ceiling Structures/Linings                                    | Flat AC Sheeting                                | 5m2    | All surfaces       | Good Condition (1) | Low (1)     | Low Priority (2-3)  |
|   | 1166/B00B/R0020/Ceiling Structures/Linings/S10  |        |                    |                    |             | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
| Panel Above Door  | Flat AC Sheeting                                | 1m2    | West facing        | Good Condition (1) | Low (1)     | Low Priority (2-3)  |
|   | 1166/B00B/R0020/Ceiling Structures/Linings/S10  |        |                    |                    |             | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
| <b>B00A - R0031 - Movement (7.46 m2)</b>                      |   |        |                    |                    |             |   |
| No Asbestos   |   |        |                    |                    |             |   |
| <b>B00A - R0032 - Movement (11.82 m2)</b>                     |   |        |                    |                    |             |   |
| Ceiling Structures/Linings                                    | Flat AC Sheeting                                | 12m2   | All surfaces       | Good Condition (1) | Low (1)     | Low Priority (2-3)  |
|   | 1166/B00B/R0020/Ceiling Structures/Linings/S10  |        |                    |                    |             | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
| Panel Above Door  | Flat AC Sheeting                                | 1m2    | West facing        | Good Condition (1) | Low (1)     | Low Priority (2-3)  |
|   | 1166/B00B/R0020/Ceiling Structures/Linings/S10  |        |                    |                    |             | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
| <b>B00A - R0033 - Covered Outdoor Learning Area (61.2 m2)</b> |   |        |                    |                    |             |   |
| No Asbestos   |   |        |                    |                    |             |   |
| <b>B00A - R0034 - Movement (17.92 m2)</b>                     |   |        |                    |                    |             |   |
| Panel Above Door  | Flat AC Sheeting                                | 1m2    | West facing        | Good Condition (1) | Low (1)     | Low Priority (2-3)  |
|   | 1166/B00B/R0020/Ceiling Structures/Linings/S10  |        |                    |                    |             | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
| <b>B00A - R0035 - Interview (8.61 m2)</b>                     |   |        |                    |                    |             |   |
| No Asbestos   |   |        |                    |                    |             |   |
| <b>B00A - R0036 - Movement (7.15 m2)</b>                      |   |        |                    |                    |             |   |

| Product                  | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority   |
|--------------------------|----------------------|--------|--------------------|--------------------|-------------|--------------------|
| Sample No                |                      |        |                    |                    | Test Result |                    |
| Electrical Backing Board | Resinous Board       | 1Unit  | South              | Good Condition (1) | Low (1)     | Low Priority (2-3) |

**Assumed Asbestos - Electrical Hazard**

**B00A - R0037 - Movement (10.05 m2)**

|                                |                        |   |  |  |  |                             |
|--------------------------------|------------------------|---|--|--|--|-----------------------------|
| Floor Coverings<br>Res/Textile | Vinyl Tiles & Adhesive | 1166/B00A/R0037/Floor Coverings Res/Textile/S20 |  |  |  | <b>No Asbestos Detected</b> |
|--------------------------------|------------------------|---|--|--|--|-----------------------------|

**B00A - R0038 - General Storeroom (3.4 m2)**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00B - General Learning - 1969 - Brick/Block (Brick/Block)**

**Exterior**

|                    |   |      |   |   |         |                    |
|--------------------|---|------|---|---|---------|--------------------|
| Window panel       | Flat AC Sheeting<br>1166/B00B/Window Panel/S9 | 38m2 | North facing,<br>South facing,<br>East facing                 | Good Condition (1)  | Low (1) | Low Priority (2-3) |
|                    |   |      |   | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |
| Gable verge lining | Flat AC Sheeting                              | 40m  | North facing,<br>South facing,<br>East facing,<br>West facing | Good Condition (1)  | Low (1) | Low Priority (2-3) |
|                    |   |      |   | <b>Assumed Asbestos - Height Restriction - Height</b>         |         |                    |
| Ceiling Voids      | No Asbestos Found                             |      |   |   |         |                    |
| Underfloor Voids   | No Asbestos Found                             |      |   |   |         |                    |

**Interior**

**B00B - R0001 - Staff Room (57.67 m2)**

No Asbestos

**B00B - R0002 - General Storeroom (7.23 m2)**

No Asbestos

**B00B - R0003 - Home Base Store (6.33 m2)**

|   |   |  |  |                              |  |  |
|---|---|--|--|------------------------------|--|--|
| Ceiling Structures/Linings  | Vermiculite<br>1166/B00B/R1019/Ceiling Structures/Linings/S17 |  |  |                              |  |  |
|   |   |  |  | <b>Limited Samples Taken</b> |  |  |
| <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |   |  |  |                              |  |  |

**B00B - R0004 - Home Base (56.87 m2)**

No Asbestos

**B00B - R0005 - Home Base Store (7.65 m2)**

No Asbestos

**B00B - R0006 - Personal Effects Storage (6.7 m2)**

|   |   |  |  |                              |  |  |
|---|---|--|--|------------------------------|--|--|
| Ceiling Structures/Linings  | Vermiculite<br>1166/B00B/R1019/Ceiling Structures/Linings/S17 |  |  |                              |  |  |
|   |   |  |  | <b>Limited Samples Taken</b> |  |  |
| <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |   |  |  |                              |  |  |

**B00B - R0007 - General Storeroom (8.41 m2)**

No Asbestos

**B00B - R0008 - Personal Effects Storage (6.62 m2)**

|   |   |  |  |                              |  |  |
|---|---|--|--|------------------------------|--|--|
| Ceiling Structures/Linings  | Vermiculite<br>1166/B00B/R1019/Ceiling Structures/Linings/S17 |  |  |                              |  |  |
|   |   |  |  | <b>Limited Samples Taken</b> |  |  |
| <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |   |  |  |                              |  |  |

**B00B - R0010 - Home Base Store (7.49 m2)**

No Asbestos

**B00B - R0011 - Home Base (57.34 m2)**

No Asbestos

**B00B - R0012 - Home Base (57.03 m2)**

No Asbestos

**B00B - R0013 - Home Base Store (7.09 m2)**

No Asbestos

**B00B - R0014 - Personal Effects Storage (13.06 m2)**

|   |   |  |  |                              |  |  |
|---|---|--|--|------------------------------|--|--|
| Ceiling Structures/Linings  | Vermiculite<br>1166/B00B/R1019/Ceiling Structures/Linings/S17 |  |  |                              |  |  |
|   |   |  |  | <b>Limited Samples Taken</b> |  |  |
| <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |   |  |  |                              |  |  |

**B00B - R0015 - Home Base Store (7.09 m2)**

No Asbestos

**B00B - R0016 - Home Base (57.82 m2)**

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

No Asbestos

**B00B - R0017 - Distribution Board (0.15 m2)**

Note: No inspection of live electrical installation.

|                           |                |       |             |                    |         |                    |
|---------------------------|----------------|-------|-------------|--------------------|---------|--------------------|
| Electrical Mounting Board | Resinous Board | 1Unit | East facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
|---------------------------|----------------|-------|-------------|--------------------|---------|--------------------|

**Assumed Asbestos - Electrical Hazard**

**B00B - R0018 - General Storeroom (8.18 m2)**

No Asbestos

**B00B - R0019 - Movement (124.98 m2)**

|   |             |  |  |  |                              |  |
|---|-------------|--|--|--|------------------------------|--|
| Ceiling Structures/Linings  | Vermiculite | 1166/B00B/R1019/Ceiling Structures/Linings/S17 |  |  | <b>Limited Samples Taken</b> |  |
| <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |             |  |  |  |                              |  |

**B00B - R0020 - Movement (4.28 m2)**

|  |                  |     |              |   |         |                    |
|--|------------------|-----|--------------|---|---------|--------------------|
| Ceiling Structures/Linings                     | Flat AC Sheeting | 5m2 | All surfaces | Good Condition (1)  | Low (1) | Low Priority (2-3) |
| 1166/B00B/R0020/Ceiling Structures/Linings/S10 |                  |     |              | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |

**B00B - R0021 - Movement (4.28 m2)**

|  |                  |     |              |   |         |                    |
|--|------------------|-----|--------------|---|---------|--------------------|
| Ceiling Structures/Linings                     | Flat AC Sheeting | 5m2 | All surfaces | Good Condition (1)  | Low (1) | Low Priority (2-3) |
| 1166/B00B/R0020/Ceiling Structures/Linings/S10 |                  |     |              | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |

**B00B - R0022 - Movement (4.31 m2)**

|  |                  |     |              |   |         |                    |
|--|------------------|-----|--------------|---|---------|--------------------|
| Ceiling Structures/Linings                     | Flat AC Sheeting | 5m2 | All surfaces | Good Condition (1)  | Low (1) | Low Priority (2-3) |
| 1166/B00B/R0020/Ceiling Structures/Linings/S10 |                  |     |              | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |

**B00B - R0023 - Staff Toilet (6.73 m2)**

No Asbestos

**B00B - R0024 - Stairs (2.46 m2)**

No Asbestos

**B00B - R0025 - Stairs (2.38 m2)**

No Asbestos

**B00B - R1001 - Home Base (72.87 m2)**

No Asbestos

**B00B - R1002 - Home Base Store (7.37 m2)**

|                             |             |   |  |  |                             |  |
|-----------------------------|-------------|---|--|--|-----------------------------|--|
| Floor Coverings Res/Textile | Vinyl Sheet | 1166/B00B/R1005/Floor Coverings Res/Textile/S18 |  |  | <b>No Asbestos Detected</b> |  |
|-----------------------------|-------------|---|--|--|-----------------------------|--|

|  |                  |     |              |   |         |                    |
|--|------------------|-----|--------------|---|---------|--------------------|
| Ceiling Structures/Linings                     | Flat AC Sheeting | 8m2 | All surfaces | Good Condition (1)  | Low (1) | Low Priority (2-3) |
| 1166/B00B/R1013/Ceiling Structures/Linings/S11 |                  |     |              | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |

**B00B - R1003 - Personal Effects Storage (6.26 m2)**

|   |             |  |  |  |                              |  |
|---|-------------|--|--|--|------------------------------|--|
| Ceiling Structures/Linings  | Vermiculite | 1166/B00B/R1019/Ceiling Structures/Linings/S17 |  |  | <b>Limited Samples Taken</b> |  |
| <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |             |  |  |  |                              |  |

**B00B - R1004 - Home Base (57.89 m2)**

No Asbestos

**B00B - R1005 - Home Base Store (8.31 m2)**

|                             |             |   |  |  |                             |  |
|-----------------------------|-------------|---|--|--|-----------------------------|--|
| Floor Coverings Res/Textile | Vinyl Sheet | 1166/B00B/R1005/Floor Coverings Res/Textile/S18 |  |  | <b>No Asbestos Detected</b> |  |
|-----------------------------|-------------|---|--|--|-----------------------------|--|

|  |                  |     |              |   |         |                    |
|--|------------------|-----|--------------|---|---------|--------------------|
| Ceiling Structures/Linings                     | Flat AC Sheeting | 9m2 | All surfaces | Good Condition (1)  | Low (1) | Low Priority (2-3) |
| 1166/B00B/R1013/Ceiling Structures/Linings/S11 |                  |     |              | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |

| Product   | Material Description                            | Extent | Location Reference | Material Condition | Risk Status | Control Priority                                       |
|---|---|--------|--------------------|--------------------|-------------|--|
| Sample No   |   |        |                    | Test Result        |             |  |
| <b>B00B - R1006 - Personal Effects Storage (7.25 m2)</b>  |   |        |                    |                    |             |  |
| Ceiling Structures/Linings  | Vermiculite                                     |        |                    |                    |             |  |
|   | 1166/B00B/R1019/Ceiling Structures/Linings/S17  |        |                    |                    |             | Limited Samples Taken                                  |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |                    |                    |             |  |
| <b>B00B - R1007 - Withdrawal Space - 1hb (19.8 m2)</b>  |   |        |                    |                    |             |  |
| Ceiling Structures/Linings  | Vermiculite                                     |        |                    |                    |             |  |
|   | 1166/B00B/R1019/Ceiling Structures/Linings/S17  |        |                    |                    |             | Limited Samples Taken                                  |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |                    |                    |             |  |
| <b>B00B - R1008 - Personal Effects Storage (7.08 m2)</b>  |   |        |                    |                    |             |  |
| Ceiling Structures/Linings  | Vermiculite                                     |        |                    |                    |             |  |
|   | 1166/B00B/R1019/Ceiling Structures/Linings/S17  |        |                    |                    |             | Limited Samples Taken                                  |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |                    |                    |             |  |
| <b>B00B - R1010 - Home Base Store (8.07 m2)</b>   |   |        |                    |                    |             |  |
| Ceiling Structures/Linings  | Flat AC Sheeting                                | 9m2    | All surfaces       | Good Condition (1) | Low (1)     | Low Priority (2-3)                                     |
|   | 1166/B00B/R1013/Ceiling Structures/Linings/S11  |        |                    |                    |             | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| <b>B00B - R1011 - Home Base (56.88 m2)</b>  |   |        |                    |                    |             |  |
| Floor Coverings Res/Textile   | Vinyl Sheet                                     |        |                    |                    |             |  |
|   | 1166/B00B/R1005/Floor Coverings Res/Textile/S18 |        |                    |                    |             | No Asbestos Detected                                   |
| <b>B00B - R1012 - Home Base (56.88 m2)</b>  |   |        |                    |                    |             |  |
| Floor Coverings Res/Textile   | Vinyl Sheet                                     |        |                    |                    |             |  |
|   | 1166/B00B/R1005/Floor Coverings Res/Textile/S18 |        |                    |                    |             | No Asbestos Detected                                   |
| <b>B00B - R1013 - Home Base Store (7.24 m2)</b>   |   |        |                    |                    |             |  |
| Ceiling Structures/Linings  | Flat AC Sheeting                                | 8m2    | All surfaces       | Good Condition (1) | Low (1)     | Low Priority (2-3)                                     |
|   | 1166/B00B/R1013/Ceiling Structures/Linings/S11  |        |                    |                    |             | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| <b>B00B - R1014 - Personal Effects Storage (12.96 m2)</b>   |   |        |                    |                    |             |  |
| Ceiling Structures/Linings  | Vermiculite                                     |        |                    |                    |             |  |
|   | 1166/B00B/R1019/Ceiling Structures/Linings/S17  |        |                    |                    |             | Limited Samples Taken                                  |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |                    |                    |             |  |
| <b>B00B - R1015 - Home Base Store (7.2 m2)</b>  |   |        |                    |                    |             |  |
| Ceiling Structures/Linings  | Flat AC Sheeting                                | 8m2    | All surfaces       | Good Condition (1) | Low (1)     | Low Priority (2-3)                                     |
|   | 1166/B00B/R1013/Ceiling Structures/Linings/S11  |        |                    |                    |             | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| <b>B00B - R1016 - Home Base (58.86 m2)</b>  |   |        |                    |                    |             |  |
| Floor Coverings Res/Textile   | Vinyl Sheet                                     |        |                    |                    |             |  |
|   | 1166/B00B/R1005/Floor Coverings Res/Textile/S18 |        |                    |                    |             | No Asbestos Detected                                   |
| <b>B00B - R1017 - Movement (84.26 m2)</b>   |   |        |                    |                    |             |  |
| Ceiling Structures/Linings  | Vermiculite                                     |        |                    |                    |             |  |
|   | 1166/B00B/R1019/Ceiling Structures/Linings/S17  |        |                    |                    |             | Limited Samples Taken                                  |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |                    |                    |             |  |
| Floor Coverings Res/Textile   | Vinyl Sheet                                     |        |                    |                    |             |  |
|   | 1166/B00B/R1005/Floor Coverings Res/Textile/S18 |        |                    |                    |             | No Asbestos Detected                                   |
| <b>B00B - R1018 - Stairs (17.01 m2)</b>   |   |        |                    |                    |             |  |
| Ceiling Structures/Linings  | Vermiculite                                     |        |                    |                    |             |  |
|   | 1166/B00B/R1019/Ceiling Structures/Linings/S17  |        |                    |                    |             | Limited Samples Taken                                  |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |                    |                    |             |  |
| <b>B00B - R1019 - Stairs (17.49 m2)</b>   |   |        |                    |                    |             |  |

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

Ceiling Structures/Linings

Vermiculite

1166/B00B/R1019/Ceiling Structures/Linings/S17

Limited Samples Taken

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

2017



| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00C - Communal Facilities - 1896 - Brick/Block (Brick/Block)****Exterior**

|                  |   |     |                               |                    |         |   |
|------------------|---|-----|-------------------------------|--------------------|---------|---|
| Eaves Linings    | Flat AC Sheeting<br>1166/B00C/Ceiling Voids/S21 | 8m2 | North facing,<br>South facing | Good Condition (1) | Low (1) | Low Priority (2-3)  |
|                  |   |     |                               |                    |         | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
| Underfloor Voids | Packing<br>1166/B00C/Underfloor Voids/S21       | 1m  | Variable positions            | Good Condition (1) | Low (1) | Low Priority (2-3)  |
|                  |   |     |                               |                    |         | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
| Ceiling Voids    | No Asbestos Found                               |     |                               |                    |         |   |

**Interior****B00C - R0002 - External Movement (6.24 m2)**

No Asbestos

**B00C - R0004 - External Movement (6.23 m2)**

No Asbestos

**B00C - R0005 - Movement (3.9 m2)**

No Asbestos

**B00C - R0006 - Toilets - Boys/Girls (1.64 m2)**

No Asbestos

**B00C - R0008 - Raised Platform (48.84 m2)**

No Asbestos

**B00C - R0010 - Toilets - Boys/Girls (1.64 m2)**

No Asbestos

**B00C - R0011 - Movement (3.9 m2)**

No Asbestos

**B00C - R0012 - Covered Outdoor Learning Area (255.98 m2)**

No Asbestos

**B00C - R0013 - Canteen (41.78 m2)**

No Asbestos

**B00C - R0014 - Canteen Office/Store (10.23 m2)**

No Asbestos

**B00C - R0015 - General Storeroom (5.15 m2)**

No Asbestos

**B00C - R0016 - Toilet - Lobby (3.52 m2)**

No Asbestos

**B00C - R0017 - General Storeroom (6.01 m2)**

No Asbestos

**B00C - R0018 - Toilet - Lobby (3.01 m2)**

No Asbestos

**B00C - R0019 - Communal Space (219.44 m2)**

No Asbestos

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00D - Pupil Facilities - 1960 - Brick/Block (Brick/Block)****Exterior**

|                  |                            |      |                               |                    |         |                                    |
|------------------|----------------------------|------|-------------------------------|--------------------|---------|------------------------------------|
| Eaves Linings    | Flat AC Sheeting           | 50m2 | North facing,<br>South facing | Good Condition (1) | Low (1) | Low Priority (2-3)                 |
|                  | 1166/B00G/Eaves Linings/S1 |      |                               |                    |         | <b>Chrysotile (white asbestos)</b> |
| Ceiling Voids    | No Asbestos Found          |      |                               |                    |         |                                    |
| Underfloor Voids | No Asbestos Found          |      |                               |                    |         |                                    |

**Interior****B00D - R0001 - General Assistant/Bulk Store (8.13 m2)**

|                            |  |     |              |                    |         |   |
|----------------------------|--|-----|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting                               | 9m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)  |
|                            | 1166/B00D/R0010/Ceiling Structures/Linings/S14 |     |              |                    |         | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |

**B00D - R0002 - Staff Toilet (5.79 m2)**

|                            |  |     |              |                    |         |   |
|----------------------------|--|-----|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting                               | 6m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)  |
|                            | 1166/B00D/R0010/Ceiling Structures/Linings/S14 |     |              |                    |         | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |

**B00D - R0003 - Sports Store (24.48 m2)**

|                            |  |      |              |                    |         |   |
|----------------------------|--|------|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting                               | 25m2 | All surfaces | Minimal Damage (2) | Low (1) | Low Priority (2-3)  |
|                            | 1166/B00D/R0010/Ceiling Structures/Linings/S14 |      |              |                    |         | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |

**B00D - R0004 - Handwashing Facilities (15.15 m2)**

No Asbestos

**B00D - R0005 - Toilets - Girls (24.41 m2)**

|                            |  |  |  |  |  |                             |
|----------------------------|--|--|--|--|--|-----------------------------|
| Partition Walls (Cubicles) | Compressed AC Sheet                            |  |  |  |  | <b>No Asbestos Detected</b> |
|                            | 1166/B00D/R0006/Partition Walls (Cubicles)/S15 |  |  |  |  |                             |

**B00D - R0006 - Toilets - Boys (27.11 m2)**

|                            |  |  |  |  |  |                             |
|----------------------------|--|--|--|--|--|-----------------------------|
| Partition Walls (Cubicles) | Compressed AC Sheet                            |  |  |  |  | <b>No Asbestos Detected</b> |
|                            | 1166/B00D/R0006/Partition Walls (Cubicles)/S15 |  |  |  |  |                             |

**B00D - R0007 - Handwashing Facilities (12.41 m2)**

No Asbestos

**B00D - R0008 - General Storeroom (27.85 m2)**

|                            |  |      |              |                    |         |   |
|----------------------------|--|------|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting                               | 28m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)  |
|                            | 1166/B00D/R0010/Ceiling Structures/Linings/S14 |      |              |                    |         | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |

**B00D - R0009 - Cleaning Supplies (5.16 m2)**

|                            |  |     |              |                    |         |   |
|----------------------------|--|-----|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting                               | 6m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)  |
|                            | 1166/B00D/R0010/Ceiling Structures/Linings/S14 |     |              |                    |         | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |

**B00D - R0010 - General Storeroom (6.13 m2)**

|                            |  |     |              |                    |         |   |
|----------------------------|--|-----|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting                               | 7m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)  |
|                            | 1166/B00D/R0010/Ceiling Structures/Linings/S14 |     |              |                    |         | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00E - Building Services - 1960 - Brick/Block (Brick/Block)**

**Exterior**

|                  |  |      |                               |                    |         |  |
|------------------|--|------|-------------------------------|--------------------|---------|--|
| Eaves Linings    | Flat AC Sheeting<br>1166/B00G/Eaves Linings/S1 | 50m2 | North facing,<br>South facing | Good Condition (1) | Low (1) | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b> |
| Ceiling Voids    | No Asbestos Found                              |      |                               |                    |         |  |
| Underfloor Voids | No Asbestos Found                              |      |                               |                    |         |  |

**Interior**

**B00E - R0005 - Cleaning Supplies (5.32 m2)**

|                            |  |     |              |                    |         |   |
|----------------------------|--|-----|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting<br>1166/B00D/R0010/Ceiling Structures/Linings/S14 | 6m2 | All surfaces | Minimal Damage (2) | Low (1) | Low Priority (2-3)<br><b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
|----------------------------|--|-----|--------------|--------------------|---------|---|

**B00E - R0006 - Garden Store (16.69 m2)**

No Asbestos

**B00E - R0007 - Out Of School Hours Care Centre (5.31 m2)**

No Asbestos

**B00E - R0008 - Out Of School Hours Care Centre (14.64 m2)**

No Asbestos

**B00E - R0009 - Out Of School Hours Care Centre (2.8 m2)**

No Asbestos

**B00E - R0010 - Out Of School Hours Care Centre (12.43 m2)**

No Asbestos

**B00E - R0011 - Out Of School Hours Care Centre (52.1 m2)**

No Asbestos

**B00E - R0012 - Out Of School Hours Care Centre (4.91 m2)**

No Asbestos

**B00E - R0013 - Out Of School Hours Care Centre (1.24 m2)**

No Asbestos

**B00E - R0014 - Out Of School Hours Care Centre (10.13 m2)**

No Asbestos

**B00E - R0015 - Out Of School Hours Care Centre (47.83 m2)**

No Asbestos

**B00E - R0016 - Out Of School Hours Care Centre (1.25 m2)**

No Asbestos

2017

| Product   | Material Description  | Extent | Location Reference            | Material Condition | Risk Status | Control Priority  |
|---|---|--------|-------------------------------|--------------------|-------------|---|
| Sample No   |   |        |                               | Test Result        |             |   |
| <b>B00F - General Learning - 1969 - Brick/Block (Brick/Block)</b> |   |        |                               |                    |             |   |
| <b>Exterior</b>   |   |        |                               |                    |             |   |
| Eaves Linings   | Flat AC Sheeting<br>1166/B00G/Eaves Linings/S1  | 65m2   | North facing,<br>South facing | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>  |
| Gable verge lining  | Flat AC Sheeting<br>1166/B00A/Gable Verge Lining/S22  |        |                               |                    |             | <b>No Asbestos Detected</b>   |
| Ceiling Voids   | No Asbestos Found   |        |                               |                    |             |   |
| Underfloor Voids  | No Asbestos Found   |        |                               |                    |             |   |
| <b>Interior</b>   |   |        |                               |                    |             |   |
| <b>B00F - R0001 - Home Base (57.66 m2)</b>                        |   |        |                               |                    |             |   |
| Ceiling Structures/Linings  | Vermiculite<br>1166/B00F/R0014/Ceiling Structures/Linings/S16                               |        |                               |                    |             | <b>Limited Samples Taken</b><br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile                                       | Vinyl Tiles<br>1166/B00F/R0015/Floor Coverings Res/Textile/S6                               | 50m2   | All surfaces                  | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>  |
| <b>B00F - R0002 - General Storeroom (4.16 m2)</b>                 |   |        |                               |                    |             |   |
| Ceiling Structures/Linings  | Vermiculite<br>1166/B00F/R0014/Ceiling Structures/Linings/S16                               |        |                               |                    |             | <b>Limited Samples Taken</b><br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile                                       | Vinyl Tiles<br>1166/B00F/R0015/Floor Coverings Res/Textile/S6                               | 5m2    | All surfaces                  | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>  |
| <b>B00F - R0003 - General Storeroom (9.18 m2)</b>                 |   |        |                               |                    |             |   |
| Ceiling Structures/Linings  | Vermiculite<br>1166/B00F/R0014/Ceiling Structures/Linings/S16                               |        |                               |                    |             | <b>Limited Samples Taken</b><br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile                                       | Vinyl Tiles<br>1166/B00F/R0015/Floor Coverings Res/Textile/S6                               | 10m2   | Throughout                    | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>  |
| <b>B00F - R0004 - General Storeroom (12.8 m2)</b>                 |   |        |                               |                    |             |   |
| Ceiling Structures/Linings  | Vermiculite<br>1166/B00F/R0014/Ceiling Structures/Linings/S16                               |        |                               |                    |             | <b>Limited Samples Taken</b><br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile                                       | Vinyl Tiles<br>1166/B00F/R0015/Floor Coverings Res/Textile/S6                               | 13m2   | All surfaces                  | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>  |
| <b>B00F - R0005 - Movement (14.52 m2)</b>                         |   |        |                               |                    |             |   |
| No Asbestos   |   |        |                               |                    |             |   |
| <b>B00F - R0006 - Home Base (56.56 m2)</b>                        |   |        |                               |                    |             |   |
| Ceiling Structures/Linings  | Vermiculite<br>1166/B00F/R0014/Ceiling Structures/Linings/S16                               |        |                               |                    |             | <b>Limited Samples Taken</b><br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile                                       | Vinyl Tiles (Under Floor Covering/Carpet)<br>1166/B00F/R0015/Floor Coverings Res/Textile/S6 | 50m2   | Throughout                    | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>  |
| <b>B00F - R0007 - Home Base Store (4.15 m2)</b>                   |   |        |                               |                    |             |   |
| Ceiling Structures/Linings  | Vermiculite<br>1166/B00F/R0014/Ceiling Structures/Linings/S16                               |        |                               |                    |             | <b>Limited Samples Taken</b><br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile                                       | Vinyl Tiles<br>1166/B00F/R0015/Floor Coverings Res/Textile/S6                               | 5m2    | All surfaces                  | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>  |

| Product   | Material Description  | Extent | Location Reference | Material Condition | Risk Status  | Control Priority   |
|---|---|--------|--------------------|--------------------|--|--|
| Sample No   |   |        |                    |                    | Test Result  |  |
| <b>B00F - R0008 - Distribution Board (0.78 m2)</b>        |   |        |                    |                    | Note: No inspection of live electrical installation. |  |
| Ceiling Structures/Linings                                | Vermiculite<br>1166/B00F/R0014/Ceiling Structures/Linings/S16 |        |                    |                    |  | Limited Samples Taken<br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile                               | Vinyl Tiles<br>1166/B00F/R0015/Floor Coverings Res/Textile/S6 | 1m2    | All surfaces       | Good Condition (1) | Low (1)  | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>   |
| Electrical Mounting Board                                 | Resinous Board<br>2Unit                                       | 2Unit  | South facing       | Good Condition (1) | Low (1)  | Low Priority (2-3)<br><b>Assumed Asbestos - Electrical Hazard</b>  |
| <b>B00F - R0009 - Personal Effects Storage (11.46 m2)</b> |   |        |                    |                    |  |  |
| Ceiling Structures/Linings                                | Vermiculite<br>1166/B00F/R0014/Ceiling Structures/Linings/S16 |        |                    |                    |  | Limited Samples Taken<br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile                               | Vinyl Tiles<br>1166/B00F/R0015/Floor Coverings Res/Textile/S6 | 12m2   | All surfaces       | Good Condition (1) | Low (1)  | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>   |
| <b>B00F - R0010 - Movement (6.89 m2)</b>                  |   |        |                    |                    |  |  |
| Ceiling Structures/Linings                                | Vermiculite<br>1166/B00F/R0014/Ceiling Structures/Linings/S16 |        |                    |                    |  | Limited Samples Taken<br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile                               | Vinyl Tiles<br>1166/B00F/R0015/Floor Coverings Res/Textile/S6 | 7m2    | All surfaces       | Good Condition (1) | Low (1)  | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>   |
| <b>B00F - R0011 - Home Base Store (4.22 m2)</b>           |   |        |                    |                    |  |  |
| Ceiling Structures/Linings                                | Vermiculite<br>1166/B00F/R0014/Ceiling Structures/Linings/S16 |        |                    |                    |  | Limited Samples Taken<br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile                               | Vinyl Tiles<br>1166/B00F/R0015/Floor Coverings Res/Textile/S6 | 5m2    | All surfaces       | Good Condition (1) | Low (1)  | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>   |
| <b>B00F - R0012 - Home Base (56.88 m2)</b>                |   |        |                    |                    |  |  |
| Ceiling Structures/Linings                                | Vermiculite<br>1166/B00F/R0014/Ceiling Structures/Linings/S16 |        |                    |                    |  | Limited Samples Taken<br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile                               | Vinyl Sheet<br>1166/B00F/R0015/Floor Coverings Res/Textile/S6 | 50m2   | All surfaces       | Good Condition (1) | Low (1)  | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>   |
| <b>B00F - R0013 - Home Base (56.88 m2)</b>                |   |        |                    |                    |  |  |
| Ceiling Structures/Linings                                | Vermiculite<br>1166/B00F/R0014/Ceiling Structures/Linings/S16 |        |                    |                    |  | Limited Samples Taken<br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| <b>B00F - R0014 - Home Base Store (4.2 m2)</b>            |   |        |                    |                    |  |  |
| Floor Coverings Res/Textile                               | Vinyl Tiles<br>1166/B00F/R0015/Floor Coverings Res/Textile/S6 | 5m2    | All surfaces       | Good Condition (1) | Low (1)  | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>   |
| Ceiling Structures/Linings                                | Vermiculite<br>1166/B00F/R0014/Ceiling Structures/Linings/S16 |        |                    |                    |  | Limited Samples Taken<br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| <b>B00F - R0015 - Personal Effects Storage (9.29 m2)</b>  |   |        |                    |                    |  |  |
| Ceiling Structures/Linings                                | Vermiculite<br>1166/B00F/R0014/Ceiling Structures/Linings/S16 |        |                    |                    |  | Limited Samples Taken<br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile                               | Vinyl Tiles<br>1166/B00F/R0015/Floor Coverings Res/Textile/S6 | 10m2   | All surfaces       | Good Condition (1) | Low (1)  | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>   |

| Product  | Material Description  | Extent | Location Reference | Material Condition | Risk Status | Control Priority  |
|--|---|--------|--------------------|--------------------|-------------|---|
| Sample No  |   |        |                    |                    | Test Result |   |
| <b>B00F - R0016 - Movement (17.56 m2)</b>                  |   |        |                    |                    |             |   |
| No Asbestos  |   |        |                    |                    |             |   |
| <b>B00F - R0017 - Movement (66.05 m2)</b>                  |   |        |                    |                    |             |   |
| No Asbestos  |   |        |                    |                    |             |   |
| <b>B00F - R0018 - Stairs (15.32 m2)</b>                    |   |        |                    |                    |             |   |
| No Asbestos  |   |        |                    |                    |             |   |
| <b>B00F - R0019 - Stairs (3.04 m2)</b>                     |   |        |                    |                    |             |   |
| No Asbestos  |   |        |                    |                    |             |   |
| <b>B00F - R0020 - Stairs (9.7 m2)</b>                      |   |        |                    |                    |             |   |
| No Asbestos  |   |        |                    |                    |             |   |
| <b>B00F - R1001 - Home Base (57.68 m2)</b>                 |   |        |                    |                    |             |   |
| Floor Coverings Res/Textile                                | Vinyl Tiles (Under Floor Covering/Carpet)<br>1166/B00F/R1005/Floor Coverings Res/Textile/S7 | 57m2   | Throughout         | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>          |
| <b>B00F - R1002 - Home Base Store (3.94 m2)</b>            |   |        |                    |                    |             |   |
| Floor Coverings Res/Textile                                | Vinyl Tiles (Under Floor Covering/Carpet)<br>1166/B00F/R1005/Floor Coverings Res/Textile/S7 | 4m2    | Throughout         | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>          |
| <b>B00F - R1003 - Personal Effects Storage (8.63 m2)</b>   |   |        |                    |                    |             |   |
| Floor Coverings Res/Textile                                | Vinyl Sheet<br>1166/B00F/R1005/Floor Coverings Res/Textile/S7                               | 9m2    | All surfaces       | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>          |
| <b>B00F - R1004 - Cleaning Distributed Store (3.02 m2)</b> |   |        |                    |                    |             |   |
| No Asbestos  |   |        |                    |                    |             |   |
| <b>B00F - R1005 - General Storeroom (10.17 m2)</b>         |   |        |                    |                    |             |   |
| Floor Coverings Res/Textile                                | Vinyl Sheet<br>1166/B00F/R1005/Floor Coverings Res/Textile/S7                               | 11m2   | All surfaces       | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>          |
| <b>B00F - R1006 - Movement (14.66 m2)</b>                  |   |        |                    |                    |             |   |
| No Asbestos  |   |        |                    |                    |             |   |
| <b>B00F - R1007 - Home Base (57.28 m2)</b>                 |   |        |                    |                    |             |   |
| Floor Coverings Res/Textile                                | Vinyl Tiles (Under Floor Covering/Carpet)<br>1166/B00F/R1005/Floor Coverings Res/Textile/S7 | 57m2   | Throughout         | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>          |
| <b>B00F - R1008 - Home Base Store (4.17 m2)</b>            |   |        |                    |                    |             |   |
| Floor Coverings Res/Textile                                | Vinyl Sheet<br>1166/B00F/R1005/Floor Coverings Res/Textile/S7                               | 5m2    | All surfaces       | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>          |
| <b>B00F - R1009 - Distribution Board (0.81 m2)</b>         |   |        |                    |                    |             |   |
| Floor Coverings Res/Textile                                | Vinyl Sheet<br>1166/B00F/R1005/Floor Coverings Res/Textile/S7                               | 1m2    | All surfaces       | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>          |
| Electrical Mounting Board                                  | Resinous Board  | 1Unit  | South facing       | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Assumed Asbestos - Electrical Hazard</b> |
| <b>B00F - R1010 - Home Base (57.28 m2)</b>                 |   |        |                    |                    |             |   |
| Floor Coverings Res/Textile                                | Vinyl Tiles (Under Floor Covering/Carpet)<br>1166/B00F/R1005/Floor Coverings Res/Textile/S7 | 57m2   | Throughout         | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>          |
| <b>B00F - R1011 - Home Base Store (4.28 m2)</b>            |   |        |                    |                    |             |   |
| Floor Coverings Res/Textile                                | Vinyl Sheet<br>1166/B00F/R1005/Floor Coverings Res/Textile/S7                               | 5m2    | All surfaces       | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>          |
| <b>B00F - R1012 - Personal Effects Storage (9.35 m2)</b>   |   |        |                    |                    |             |   |

| Product  | Material Description                      | Extent | Location Reference                           | Material Condition | Risk Status  | Control Priority   |
|--|---|--------|--|--------------------|--|--------------------|
| Sample No  |   |        |  |                    | Test Result  |                    |
| Floor Coverings Res/Textile                                | Vinyl Sheet                               | 10m2   | All surfaces                                 | Good Condition (1) | Low (1)  | Low Priority (2-3) |
| 1166/B00F/R1005/Floor Coverings Res/Textile/S7             |   |        |  |                    | Chrysotile (white asbestos)                            |                    |
| <b>B00F - R1013 - Home Base (57.28 m2)</b>                 |   |        |  |                    |  |                    |
| Floor Coverings Res/Textile                                | Vinyl Tiles (Under Floor Covering/Carpet) | 57m2   | Throughout                                   | Good Condition (1) | Low (1)  | Low Priority (2-3) |
| 1166/B00F/R1005/Floor Coverings Res/Textile/S7             |   |        |  |                    | Chrysotile (white asbestos)                            |                    |
| <b>B00F - R1014 - Home Base Store (4.17 m2)</b>            |   |        |  |                    |  |                    |
| Floor Coverings Res/Textile                                | Vinyl Sheet                               | 5m2    | All surfaces                                 | Good Condition (1) | Low (1)  | Low Priority (2-3) |
| 1166/B00F/R1005/Floor Coverings Res/Textile/S7             |   |        |  |                    | Chrysotile (white asbestos)                            |                    |
| <b>B00F - R1015 - Personal Effects Storage (9.18 m2)</b>   |   |        |  |                    |  |                    |
| No Asbestos  |   |        |  |                    |  |                    |
| <b>B00F - R1016 - Personal Effects Storage (8.31 m2)</b>   |   |        |  |                    |  |                    |
| No Asbestos  |   |        |  |                    |  |                    |
| <b>B00F - R1017 - Movement (14.33 m2)</b>                  |   |        |  |                    |  |                    |
| Ceiling Structures/Linings                                 | Flat AC Sheeting                          | 10m2   | All surfaces                                 | Good Condition (1) | Low (1)  | Low Priority (2-3) |
| 1166/B00G/R1020/Ceiling Structures/Linings/S4              |   |        |  |                    | Chrysotile (white asbestos)                            |                    |
| <b>B00F - R1018 - Movement (66.03 m2)</b>                  |   |        |  |                    |  |                    |
| Ceiling Structures/Linings                                 | Flat AC Sheeting                          | 67m2   | All surfaces                                 | Good Condition (1) | Low (1)  | Low Priority (2-3) |
| 1166/B00G/R1020/Ceiling Structures/Linings/S4              |   |        |  |                    | Chrysotile (white asbestos)                            |                    |
| <b>B00F - R1019 - Stairs (15.32 m2)</b>                    |   |        |  |                    |  |                    |
| No Asbestos  |   |        |  |                    |  |                    |
| <b>B00F - R1020 - Stairs (11.46 m2)</b>                    |   |        |  |                    |  |                    |
| No Asbestos  |   |        |  |                    |  |                    |
| <b>B00F - R9001 - Staff Toilet (5.84 m2)</b>               |   |        |  |                    |  |                    |
| No Asbestos  |   |        |  |                    |  |                    |
| <b>B00F - R9002 - Cleaning Distributed Store (3.41 m2)</b> |   |        |  |                    |  |                    |
| No Asbestos  |   |        |  |                    |  |                    |
| <b>B00F - R9003 - Staff Toilet (5.46 m2)</b>               |   |        |  |                    |  |                    |
| No Asbestos  |   |        |  |                    |  |                    |
| <b>B00F - R9004 - Special Programs Room (57.02 m2)</b>     |   |        |  |                    |  |                    |
| No Asbestos  |   |        |  |                    |  |                    |
| <b>B00F - R9005 - Main Switch Board (9.16 m2)</b>          |   |        |  |                    |  |                    |
| No Asbestos  |   |        |  |                    |  |                    |
| <b>B00F - R9006 - Handwashing Facilities (21.84 m2)</b>    |   |        |  |                    |  |                    |
| No Asbestos  |   |        |  |                    |  |                    |
| <b>B00F - R9007 - Toilets - Girls (48.38 m2)</b>           |   |        |  |                    |  |                    |
| Partition Walls (Cubicles)                                 | Compressed AC Sheet                       | 48m2   | North facing,<br>East facing,<br>West facing | Good Condition (1) | Low (1)  | Low Priority (2-3) |
| 1166/B00F/R9008/Partition Walls (Cubicles)/S8              |   |        |  |                    | Chrysotile (white asbestos) , Amosite (brown asbestos) |                    |
| <b>B00F - R9008 - Toilets - Boys (34.74 m2)</b>            |   |        |  |                    |  |                    |
| Partition Walls (Cubicles)                                 | Compressed AC Sheet                       | 28m2   | East facing,<br>West facing                  | Good Condition (1) | Low (1)  | Low Priority (2-3) |
| 1166/B00F/R9008/Partition Walls (Cubicles)/S8              |   |        |  |                    | Chrysotile (white asbestos) , Amosite (brown asbestos) |                    |
| <b>B00F - R9009 - Handwashing Facilities (23.65 m2)</b>    |   |        |  |                    |  |                    |
| No Asbestos  |   |        |  |                    |  |                    |
| <b>B00F - R9010 - Canteen (21.02 m2)</b>                   |   |        |  |                    |  |                    |

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

No Asbestos

**B00F - R9011 - General Storeroom (2.89 m2)**

No Asbestos

**B00F - R9012 - General Storeroom (3.45 m2)**

No Asbestos

**B00F - R9013 - Distribution Board (0.1 m2)**

Note: No inspection of live electrical installation.

|                           |                |       |              |                    |         |                    |
|---------------------------|----------------|-------|--------------|--------------------|---------|--------------------|
| Electrical Mounting Board | Resinous Board | 1Unit | South facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
|---------------------------|----------------|-------|--------------|--------------------|---------|--------------------|

**Assumed Asbestos - Electrical Hazard**

**B00F - R9014 - General Storeroom (2.51 m2)**

No Asbestos

**B00F - R9015 - Movement (39.6 m2)**

No Asbestos

**B00F - R9016 - P.E. Store (5.59 m2)**

No Asbestos

**B00F - R9017 - Movement (7.64 m2)**

No Asbestos

**B00F - R9018 - Movement (109.17 m2)**

No Asbestos

**B00F - R9019 - Stairs (9.67 m2)**

No Asbestos

**B00F - R9020 - Stairs (4.56 m2)**

No Asbestos

2017



| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00G - General Learning - 1969 - Brick/Block (Brick/Block)****Exterior**

|                                   |  |       |                               |                    |         |  |
|-----------------------------------|--|-------|-------------------------------|--------------------|---------|--|
| Eaves Linings                     | Flat AC Sheeting<br>1166/B00G/Eaves Linings/S1       | 120m2 | North facing,<br>South facing | Good Condition (1) | Low (1) | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b> |
| Gable Verge Linings               | Flat AC Sheeting<br>1166/B00A/Gable Verge Lining/S22 |       |                               |                    |         | <b>No Asbestos Detected</b>                              |
| Ceiling Voids                     | Non Accessible Area<br>- Height Restriction          |       |                               |                    |         |  |
| Underfloor Voids - Slab on Ground | No Asbestos Found                                    |       |                               |                    |         |  |

**Interior****B00G - R0001 - Movement (83.28 m2)**

No Asbestos

**B00G - R0002 - Personal Effects Storage (7.83 m2)**

|                             |   |     |              |                    |         |   |
|-----------------------------|---|-----|--------------|--------------------|---------|---|
| Ceiling Structures/Linings  | Vermiculite<br>1166/B00G/R0016/Ceiling Structures/Linings/S2  |     |              |                    |         | <b>Limited Samples Taken</b><br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile | Vinyl Tiles<br>1166/B00G/R0015/Floor Coverings Res/Textile/S3 | 8m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>  |

**B00G - R0003 - Home Base Store (5.81 m2)**

|                             |   |     |              |                    |         |   |
|-----------------------------|---|-----|--------------|--------------------|---------|---|
| Ceiling Structures/Linings  | Vermiculite<br>1166/B00G/R0016/Ceiling Structures/Linings/S2  |     |              |                    |         | <b>Limited Samples Taken</b><br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile | Vinyl Tiles<br>1166/B00G/R0015/Floor Coverings Res/Textile/S3 | 6m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>  |

**B00G - R0004 - Home Base (57.17 m2)**

|                             |   |      |            |                    |         |   |
|-----------------------------|---|------|------------|--------------------|---------|---|
| Ceiling Structures/Linings  | Vermiculite<br>1166/B00G/R0016/Ceiling Structures/Linings/S2                                |      |            |                    |         | <b>Limited Samples Taken</b><br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet)<br>1166/B00G/R0015/Floor Coverings Res/Textile/S3 | 50m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>  |

**B00G - R0005 - Personal Effects Storage (8.01 m2)**

|                             |   |     |              |                    |         |   |
|-----------------------------|---|-----|--------------|--------------------|---------|---|
| Ceiling Structures/Linings  | Vermiculite<br>1166/B00G/R0016/Ceiling Structures/Linings/S2  |     |              |                    |         | <b>Limited Samples Taken</b><br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile | Vinyl Tiles<br>1166/B00G/R0015/Floor Coverings Res/Textile/S3 | 9m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>  |

**B00G - R0006 - Home Base Store (5.94 m2)**

|                             |   |     |              |                    |         |   |
|-----------------------------|---|-----|--------------|--------------------|---------|---|
| Ceiling Structures/Linings  | Vermiculite<br>1166/B00G/R0016/Ceiling Structures/Linings/S2  |     |              |                    |         | <b>Limited Samples Taken</b><br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile | Vinyl Tiles<br>1166/B00G/R0015/Floor Coverings Res/Textile/S3 | 6m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>  |

**B00G - R0007 - Home Base (56.37 m2)**

|                            |  |  |  |  |  |   |
|----------------------------|--|--|--|--|--|---|
| Ceiling Structures/Linings | Vermiculite<br>1166/B00G/R0016/Ceiling Structures/Linings/S2 |  |  |  |  | <b>Limited Samples Taken</b><br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
|----------------------------|--|--|--|--|--|---|

| Product  | Material Description  | Extent | Location Reference | Material Condition | Risk Status | Control Priority   |
|--|---|--------|--------------------|--------------------|-------------|--|
| Sample No  |   |        |                    |                    | Test Result |  |
| Floor Coverings Res/Textile  | Vinyl Tiles (Under Floor Covering/Carpet)<br>1166/B00G/R0015/Floor Coverings Res/Textile/S3 | 50m2   | Throughout         | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>   |
| <b>B00G - R0008 - Personal Effects Storage (7.02 m2)</b>   |   |        |                    |                    |             |  |
| Ceiling Structures/Linings   | Vermiculite<br>1166/B00G/R0016/Ceiling Structures/Linings/S2                                |        |                    |                    |             | Limited Samples Taken<br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile  | Vinyl Tiles<br>1166/B00G/R0015/Floor Coverings Res/Textile/S3                               | 8m2    | All surfaces       | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>   |
| <b>B00G - R0009 - Home Base Store (5.84 m2)</b>  |   |        |                    |                    |             |  |
| Ceiling Structures/Linings   | Vermiculite<br>1166/B00G/R0016/Ceiling Structures/Linings/S2                                |        |                    |                    |             | Limited Samples Taken<br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile  | Vinyl Tiles<br>1166/B00G/R0015/Floor Coverings Res/Textile/S3                               | 6m2    | All surfaces       | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>   |
| <b>B00G - R0010 - Home Base (57.04 m2)</b>   |   |        |                    |                    |             |  |
| Ceiling Structures/Linings   | Vermiculite<br>1166/B00G/R0016/Ceiling Structures/Linings/S2                                |        |                    |                    |             | Limited Samples Taken<br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| <b>B00G - R0011 - Distribution Board (0.88 m2)</b> <span style="float: right;">Note: No inspection of live electrical installation.</span> |   |        |                    |                    |             |  |
| Ceiling Structures/Linings   | Vermiculite<br>1166/B00G/R0016/Ceiling Structures/Linings/S2                                |        |                    |                    |             | Limited Samples Taken<br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile  | Vinyl Tiles<br>1166/B00G/R0015/Floor Coverings Res/Textile/S3                               | 1m2    | All surfaces       | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>   |
| Electrical Mounting Board  | Resinous Board  | 1Unit  | South facing       | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Assumed Asbestos - Electrical Hazard</b>  |
| <b>B00G - R0013 - General Storeroom (1.35 m2)</b>  |   |        |                    |                    |             |  |
| No Asbestos  |   |        |                    |                    |             |  |
| <b>B00G - R0017 - Clerical Office (18.92 m2)</b>   |   |        |                    |                    |             |  |
| Ceiling Structures/Linings   | Vermiculite<br>1166/B00G/R0016/Ceiling Structures/Linings/S2                                |        |                    |                    |             | Limited Samples Taken<br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile  | Vinyl Tiles (Under Floor Covering/Carpet)<br>1166/B00G/R0015/Floor Coverings Res/Textile/S3 | 18m2   | Throughout         | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>   |
| <b>B00G - R0018 - Principal (18.86 m2)</b>   |   |        |                    |                    |             |  |
| Ceiling Structures/Linings   | Vermiculite<br>1166/B00G/R0016/Ceiling Structures/Linings/S2                                |        |                    |                    |             | Limited Samples Taken<br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| <b>B00G - R0019 - General Storeroom (3.74 m2)</b>  |   |        |                    |                    |             |  |
| Ceiling Structures/Linings   | Vermiculite<br>1166/B00G/R0016/Ceiling Structures/Linings/S2                                |        |                    |                    |             | Limited Samples Taken<br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| <b>B00G - R0020 - Staff Toilet (4.06 m2)</b>   |   |        |                    |                    |             |  |
| Ceiling Structures/Linings   | Vermiculite<br>1166/B00G/R0016/Ceiling Structures/Linings/S2                                |        |                    |                    |             | Limited Samples Taken<br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| <b>B00G - R0021 - Distribution Board (0.97 m2)</b> <span style="float: right;">Note: No inspection of live electrical installation.</span> |   |        |                    |                    |             |  |

| Product   | Material Description  | Extent | Location Reference | Material Condition | Risk Status | Control Priority   |
|---|---|--------|--------------------|--------------------|-------------|--|
| Sample No   |   |        |                    | Test Result        |             |  |
| Ceiling Structures/Linings                        | Vermiculite<br>1166/B00G/R0016/Ceiling Structures/Linings/S2                                |        |                    |                    |             | Limited Samples Taken<br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile                       | Vinyl Tiles<br>1166/B00G/R0015/Floor Coverings Res/Textile/S3                               | 1m2    | All surfaces       | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>   |
| <b>B00G - R0022 - General Storeroom (0.81 m2)</b> |   |        |                    |                    |             |  |
| Ceiling Structures/Linings                        | Vermiculite<br>1166/B00G/R0016/Ceiling Structures/Linings/S2                                |        |                    |                    |             | Limited Samples Taken<br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile                       | Vinyl Tiles<br>1166/B00G/R0015/Floor Coverings Res/Textile/S3                               | 1m2    | All surfaces       | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>   |
| <b>B00G - R0023 - Sick Bay (9.06 m2)</b>          |   |        |                    |                    |             |  |
| Ceiling Structures/Linings                        | Vermiculite<br>1166/B00G/R0016/Ceiling Structures/Linings/S2                                |        |                    |                    |             | Limited Samples Taken<br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile                       | Vinyl Tiles<br>1166/B00G/R0015/Floor Coverings Res/Textile/S3                               | 10m2   | All surfaces       | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>   |
| <b>B00G - R0024 - Deputy Principal (18.6 m2)</b>  |   |        |                    |                    |             |  |
| Ceiling Structures/Linings                        | Vermiculite<br>1166/B00G/R0016/Ceiling Structures/Linings/S2                                |        |                    |                    |             | Limited Samples Taken<br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile                       | Vinyl Tiles<br>1166/B00G/R0015/Floor Coverings Res/Textile/S3                               | 19m2   | All surfaces       | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>   |
| <b>B00G - R0025 - Music Store (11.23 m2)</b>      |   |        |                    |                    |             |  |
| Ceiling Structures/Linings                        | Vermiculite<br>1166/B00G/R0016/Ceiling Structures/Linings/S2                                |        |                    |                    |             | Limited Samples Taken<br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile                       | Vinyl Tiles (Under Floor Covering/Carpet)<br>1166/B00G/R0015/Floor Coverings Res/Textile/S3 | 10m2   | Throughout         | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>   |
| <b>B00G - R0026 - General Storeroom (3.59 m2)</b> |   |        |                    |                    |             |  |
| No Asbestos                                       |   |        |                    |                    |             |  |
| <b>B00G - R0028 - Movement (12.79 m2)</b>         |   |        |                    |                    |             |  |
| No Asbestos                                       |   |        |                    |                    |             |  |
| <b>B00G - R0029 - Stairs (1.88 m2)</b>            |   |        |                    |                    |             |  |
| No Asbestos                                       |   |        |                    |                    |             |  |
| <b>B00G - R0030 - Stairs (3.69 m2)</b>            |   |        |                    |                    |             |  |
| No Asbestos                                       |   |        |                    |                    |             |  |
| <b>B00G - R0031 - Movement (2.31 m2)</b>          |   |        |                    |                    |             |  |
| No Asbestos                                       |   |        |                    |                    |             |  |
| <b>B00G - R0035 - Clerical Office (68.43 m2)</b>  |   |        |                    |                    |             |  |
| No Asbestos                                       |   |        |                    |                    |             |  |
| <b>B00G - R0036 - General Storeroom (2.99 m2)</b> |   |        |                    |                    |             |  |
| No Asbestos                                       |   |        |                    |                    |             |  |
| <b>B00G - R0037 - Other (63.58 m2)</b>            |   |        |                    |                    |             |  |
| Ceiling Structures/Linings                        | Vermiculite<br>1166/B00G/R0016/Ceiling Structures/Linings/S2                                |        |                    |                    |             | Limited Samples Taken<br><b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |

| Product   | Material Description  | Extent | Location Reference | Material Condition | Risk Status | Control Priority             |
|---|---|--------|--------------------|--------------------|-------------|------------------------------|
| Sample No   |   |        |                    |                    | Test Result |                              |
| Floor Coverings Res/Textile   | Vinyl Tiles (Under Floor Covering/Carpet)<br>1166/B00G/R0015/Floor Coverings Res/Textile/S3 | 60m2   | Throughout         | Good Condition (1) | Low (1)     | Low Priority (2-3)           |
| <b>Chrysotile (white asbestos)</b>  |   |        |                    |                    |             |                              |
| <b>B00G - R0038 - Movement (39.37 m2)</b>   |   |        |                    |                    |             |                              |
| Floor Coverings Res/Textile   | Vinyl Tiles (Under Floor Covering/Carpet)<br>1166/B00G/R0015/Floor Coverings Res/Textile/S3 | 40m2   | Throughout         | Good Condition (1) | Low (1)     | Low Priority (2-3)           |
| <b>Chrysotile (white asbestos)</b>  |   |        |                    |                    |             |                              |
| Ceiling Structures/Linings  | Vermiculite<br>1166/B00G/R0016/Ceiling Structures/Linings/S2                                |        |                    |                    |             | <b>Limited Samples Taken</b> |
| <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |   |        |                    |                    |             |                              |
| <b>B00G - R1001 - Personal Effects Storage (7.83 m2)</b>  |   |        |                    |                    |             |                              |
| No Asbestos   |   |        |                    |                    |             |                              |
| <b>B00G - R1002 - Home Base Store (5.74 m2)</b>   |   |        |                    |                    |             |                              |
| No Asbestos   |   |        |                    |                    |             |                              |
| <b>B00G - R1003 - Home Base (57.04 m2)</b>  |   |        |                    |                    |             |                              |
| No Asbestos   |   |        |                    |                    |             |                              |
| <b>B00G - R1004 - Personal Effects Storage (7.91 m2)</b>  |   |        |                    |                    |             |                              |
| Floor Coverings Res/Textile   | Vinyl Tiles<br>1166/B00G/R0015/Floor Coverings Res/Textile/S3                               | 4m2    | North facing       | Good Condition (1) | Low (1)     | Low Priority (2-3)           |
| <b>Chrysotile (white asbestos)</b>  |   |        |                    |                    |             |                              |
| <b>B00G - R1005 - Home Base Store (5.96 m2)</b>   |   |        |                    |                    |             |                              |
| No Asbestos   |   |        |                    |                    |             |                              |
| <b>B00G - R1006 - Home Base (56.09 m2)</b>  |   |        |                    |                    |             |                              |
| No Asbestos   |   |        |                    |                    |             |                              |
| <b>B00G - R1007 - Personal Effects Storage (7.12 m2)</b>  |   |        |                    |                    |             |                              |
| No Asbestos   |   |        |                    |                    |             |                              |
| <b>B00G - R1008 - Distribution Board (0.89 m2)</b>  |   |        |                    |                    |             |                              |
| Electrical Mounting Board   | Resinous Board  | 1Unit  | South facing       | Good Condition (1) | Low (1)     | Low Priority (2-3)           |
| <b>Assumed Asbestos - Electrical Hazard</b>   |   |        |                    |                    |             |                              |
| <b>B00G - R1009 - Home Base Store (5.87 m2)</b>   |   |        |                    |                    |             |                              |
| No Asbestos   |   |        |                    |                    |             |                              |
| <b>B00G - R1010 - Home Base (56.88 m2)</b>  |   |        |                    |                    |             |                              |
| No Asbestos   |   |        |                    |                    |             |                              |
| <b>B00G - R1011 - Movement (26.78 m2)</b>   |   |        |                    |                    |             |                              |
| No Asbestos   |   |        |                    |                    |             |                              |
| <b>B00G - R1012 - Personal Effects Storage (7.96 m2)</b>  |   |        |                    |                    |             |                              |
| No Asbestos   |   |        |                    |                    |             |                              |
| <b>B00G - R1013 - Home Base Store (5.84 m2)</b>   |   |        |                    |                    |             |                              |
| No Asbestos   |   |        |                    |                    |             |                              |
| <b>B00G - R1014 - Home Base (56.88 m2)</b>  |   |        |                    |                    |             |                              |
| No Asbestos   |   |        |                    |                    |             |                              |
| <b>B00G - R1015 - Movement (80.32 m2)</b>   |   |        |                    |                    |             |                              |
| Ceiling Structures/Linings  | Flat AC Sheeting<br>1166/B00G/R1020/Ceiling Structures/Linings/S4                           | 81m2   | All surfaces       | Good Condition (1) | Low (1)     | Low Priority (2-3)           |
| <b>Chrysotile (white asbestos)</b>  |   |        |                    |                    |             |                              |
| <b>B00G - R1017 - Library Office/Workroom (6.8 m2)</b>  |   |        |                    |                    |             |                              |
| No Asbestos   |   |        |                    |                    |             |                              |
| <b>B00G - R1018 - Distribution Board (0.67 m2)</b>  |   |        |                    |                    |             |                              |
| Electrical Mounting Board   | Resinous Board  | 1Unit  | South facing       | Good Condition (1) | Low (1)     | Low Priority (2-3)           |
| <b>Assumed Asbestos - Electrical Hazard</b>   |   |        |                    |                    |             |                              |

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status                        | Control Priority   |
|---|----------------------|--------|--------------------|--------------------|------------------------------------|--------------------|
| Sample No   |                      |        |                    |                    | Test Result                        |                    |
| <b>B00G - R1019 - Stairs (15.23 m2)</b>                     |                      |        |                    |                    |                                    |                    |
| No Asbestos   |                      |        |                    |                    |                                    |                    |
| <b>B00G - R1020 - Stairs (16.38 m2)</b>                     |                      |        |                    |                    |                                    |                    |
| Ceiling Structures/Linings                                  | Flat AC Sheeting     | 17m2   | All surfaces       | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
| 1166/B00G/R1020/Ceiling Structures/Linings/S4               |                      |        |                    |                    | <b>Chrysotile (white asbestos)</b> |                    |
| <b>B00G - R1021 - Home Base Store (7.08 m2)</b>             |                      |        |                    |                    |                                    |                    |
| No Asbestos   |                      |        |                    |                    |                                    |                    |
| <b>B00G - R1022 - Home Base (72.21 m2)</b>                  |                      |        |                    |                    |                                    |                    |
| No Asbestos   |                      |        |                    |                    |                                    |                    |
| <b>B00G - R1023 - Home Base (82.21 m2)</b>                  |                      |        |                    |                    |                                    |                    |
| No Asbestos   |                      |        |                    |                    |                                    |                    |
| <b>B00G - R1024 - Home Base Store (7.08 m2)</b>             |                      |        |                    |                    |                                    |                    |
| No Asbestos   |                      |        |                    |                    |                                    |                    |
| <b>B00G - R9001 - Uniform Shop (12.47 m2)</b>               |                      |        |                    |                    |                                    |                    |
| Wall Linings Internal                                       | Flat AC Sheeting     |        |                    |                    |                                    |                    |
| 1166/B00G/R9002/Wall Linings Internal/S5                    |                      |        |                    |                    | <b>No Asbestos Detected</b>        |                    |
| <b>B00G - R9002 - Practical Activities - 1hb (12.95 m2)</b> |                      |        |                    |                    |                                    |                    |
| Wall Linings Internal                                       | Flat AC Sheeting     |        |                    |                    |                                    |                    |
| 1166/B00G/R9002/Wall Linings Internal/S5                    |                      |        |                    |                    | <b>No Asbestos Detected</b>        |                    |

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00H - Other-After School Care - 2008 - Timber (Timber)**

**Exterior**

|                  |                   |
|------------------|-------------------|
| Ceiling Voids    | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

**Interior**

**B00H - R0001 - Out Of School Hours Care Centre (62.32 m2)**

No Asbestos

**B00H - R0002 - Out Of School Hours Care Centre (4.88 m2)**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B001 - Library - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids Non Accessible Area  
- Height Restriction

Underfloor Voids - Slab on Ground No Asbestos Found

**Interior**

**B001 - R0001 - Reading Area (230.62 m2)**

No Asbestos

**B001 - R0002 - Library Office/Workroom (27.22 m2)**

No Asbestos

**B001 - R0003 - Communications Room (8.05 m2)**

No Asbestos

**B001 - R0004 - Toilet - Lobby (2.89 m2)**

No Asbestos

**B001 - R0005 - Staff Toilet (5.29 m2)**

No Asbestos

**B001 - R0006 - Cleaning Distributed Store (3.13 m2)**

No Asbestos

**B001 - R0007 - Distribution Board (0.74 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B001 - R0008 - K.L.A. Store (19.14 m2)**

No Asbestos

**B001 - R0009 - External Movement (14.45 m2)**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 603 - D11949 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 7/11/2005**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D12156 - Learning Unit - Standard With P.A.A. : Placement Date - 28/01/2015**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D12928 - Learning Unit - Standard With P.A.A. : Placement Date - 2/12/2015**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D14694 - Learning Unit - Standard With P.A.A. : Placement Date - 28/01/2015**

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D18221 - Learning Unit - Standard With P.A.A. : Placement Date - 3/11/2016**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.



| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

1166\_ASB\_231112\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017