


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Beelbangera Public School (1167)  
**Region :** Riverina  
**State Electorate :** Murray  
**Local Government Area :** Griffith

**Initial Survey :** Noel Arnold & Associates : 07 - May - 2008  
**Reviewed By :** Grencap-NAA : 15 - Jun - 2016

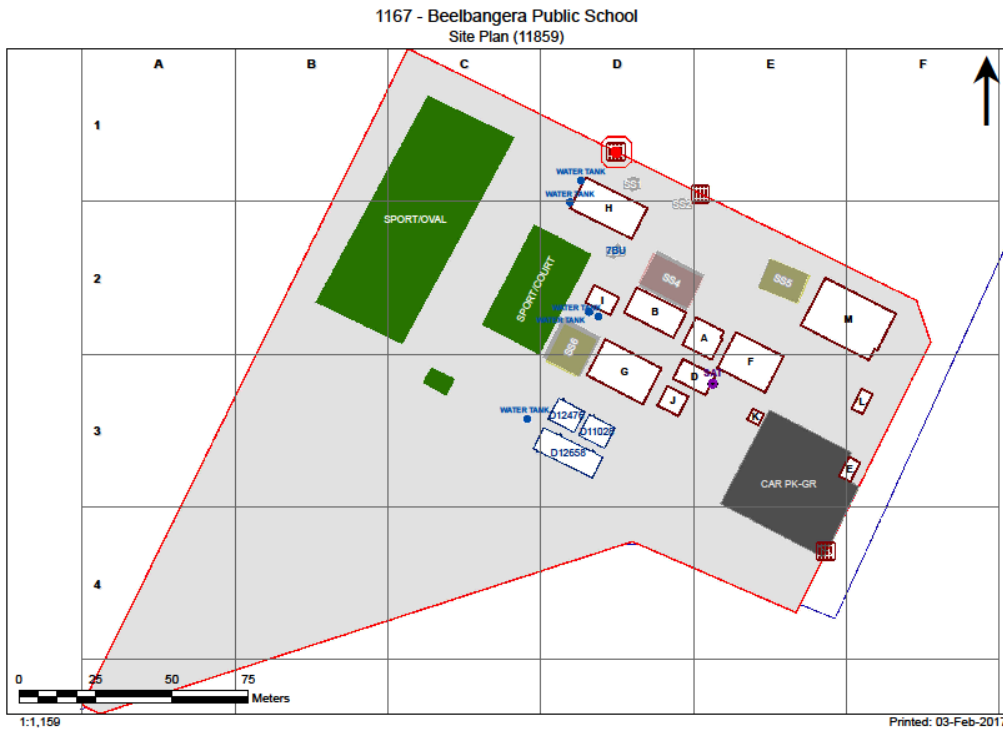

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00A - Administration/General Learning - 1922 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	20m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1167/B00A/R0001/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	Flat AC Sheeting	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1167/B00A/R0001/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>

**Interior****B00A - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1167/B00A/R0001/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
Electrical Mounting Board	Resinous Board	1Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Assumed Asbestos - Electrical Hazard</b>

**B00A - R0002 - Home Base**

Heater Backing	Flat AC Sheeting	2m2	South west corner	Good Condition (1)	Low (1)	Low Priority (2-3)
	1167/B00A/R0002/Heater Backing/S3					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00A - R0003 - Deputy Principal**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					<b>No Asbestos Detected</b>
	1167/B00A/R0003/Floor Coverings Res/Textile/S4					
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	1167/B00A/R0003/Floor Coverings Res/Textile/S5					

**B00A - R0004 - Withdrawal Space - 1hb**

No Asbestos

**B00A - R0005 - Home Base Store**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1167/B00A/R0001/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning - 1922 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1167/B00A/R0001/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

**Interior****B00B - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1167/B00A/R0001/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

**B00B - R0002 - Craft Store**

No Asbestos

**B00B - R0005 - Withdrawal Space - 1hb**

No Asbestos

**B00B - R0006 - Home Base**

Heater backing	Flat AC Sheeting	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1167/B00A/R0002/Heater Backing/S3				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					<b>No Asbestos Detected</b>
	1167/B00B/R0006/Floor Coverings Res/Textile/S6					
Floor Coverings Res/Textile	Adhesive	81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1167/B00B/R0006/Floor Coverings Res/Textile/S7					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Pupil Facilities - 1922 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 1167/B00D/R0002/Ceiling Structures/Linings/S1					<b>No Asbestos Detected</b>
Ceiling Voids	No Asbestos Found					

**Interior****B00D - R0002 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 1167/B00D/R0002/Ceiling Structures/Linings/S1					<b>No Asbestos Detected</b>
----------------------------	---	--	--	--	--	-----------------------------

**B00D - R0005 - Disabled Toilet**

Ceiling Structures/Linings	Flat AC Sheeting 1167/B00D/R0002/Ceiling Structures/Linings/S1					<b>No Asbestos Detected</b>
Water heater platform	Compressed AC Sheet 1167/B00D/R0005/Water heater platform/S8					<b>No Asbestos Detected</b>

**B00D - R0006 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting 1167/B00D/R0002/Ceiling Structures/Linings/S1					<b>No Asbestos Detected</b>
----------------------------	---	--	--	--	--	-----------------------------

**B00D - R0007 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting 1167/B00D/R0002/Ceiling Structures/Linings/S1					<b>No Asbestos Detected</b>
----------------------------	---	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Shed - 1987 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

**Interior**

**B00E - R0001 - Garden Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning - 2006 - Fibre Cement Clad (Fibre Cement Clad)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00F - R0001 - Movement**

No Asbestos

**B00F - R0002 - Practical Activities - 1hb**

No Asbestos

**B00F - R0003 - Home Base Store**Vinyl Tiles (Under Floor  
Covering/Carpet) No Asbestos Found**B00F - R0004 - Home Base**Vinyl Tiles (Under Floor  
Covering/Carpet) No Asbestos Found**B00F - R0005 - Withdrawal Space - 2hb**Vinyl Tiles (Under Floor  
Covering/Carpet) No Asbestos Found**B00F - R0006 - Home Base**Vinyl Tiles (Under Floor  
Covering/Carpet) No Asbestos Found**B00F - R0007 - Home Base Store**Vinyl Tiles (Under Floor  
Covering/Carpet) No Asbestos Found**B00F - R0008 - Practical Activities - 1hb**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning - 2006 - Fibre Cement Clad (Fibre Cement Clad)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00G - R0001 - Movement**

No Asbestos

**B00G - R0002 - K.L.A. Store**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00G - R0003 - Library Office/Workroom**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00G - R0004 - Reading Area**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00G - R0005 - Withdrawal Space - 2hb**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00G - R0006 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00G - R0007 - Home Base Store**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00G - R0008 - Practical Activities - 1hb**

No Asbestos

**B00G - R0009 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Administration - 2009 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

**Interior**

**B00H - R0001 - Entry Vestibule**

No Asbestos

**B00H - R0002 - Principal**

No Asbestos

**B00H - R0003 - Interview**

No Asbestos

**B00H - R0004 - Staff Kitchen**

No Asbestos

**B00H - R0005 - Staff Room**

No Asbestos

**B00H - R0006 - Staff Room**

No Asbestos

**B00H - R0007 - Cleaning Supplies**

No Asbestos

**B00H - R0008 - Main Switch Board**

No Asbestos

**B00H - R0009 - Security Store**

No Asbestos

**B00H - R0010 - Staff Toilet**

No Asbestos

**B00H - R0011 - Staff Toilet**

No Asbestos

**B00H - R0012 - Disabled Shower/Toilet**

No Asbestos

**B00H - R0013 - Sick Bay**

No Asbestos

**B00H - R0014 - Clerical Office**

No Asbestos

**B00H - R0015 - Movement**

No Asbestos

**B00H - R0016 - External Movement**

No Asbestos

**B00H - R0017 - External Movement**

No Asbestos





Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Pupil Facilities - 2008 - Steel (Steel)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

**Interior**

**B001 - R0001 - Sports Store**

No Asbestos

**B001 - R0002 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Pupil Facilities - 2008 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area  
 - Area inaccessible

Ceiling Voids      No Asbestos Found

**Interior**

**B00J - R0001 - Disabled Shower/Toilet**

No Asbestos

**B00J - R0002 - Toilets - Boys**

No Asbestos

**B00J - R0003 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Building Services - 2008 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area  
 - Area inaccessible

Ceiling Voids      No Asbestos Found

**Interior**

**B00K - R0001 - General Assistant/Bulk Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Other - 2008 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids	No Asbestos Found					
Wall Cladding	Fibre Cement Casting (Monocrete) 1167/B00L/Wall Cladding/S9	120m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Eaves Linings	Flat AC Sheeting 1167/B00L/Eaves Linings/S10	4m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**Interior**

**B00L - R0001 - Garage/Carport**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)****Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area

- Area inaccessible

Ceiling Voids      No Asbestos Found

**Interior****B00M - R0001 - Communal Space**

No Asbestos

**B00M - R0002 - Raised Platform**

No Asbestos

**B00M - R0003 - Hall Chair Store**

No Asbestos

**B00M - R0004 - Communal/Performance Store**

No Asbestos

**B00M - R0005 - P.E. Store**

No Asbestos

**B00M - R0006 - Toilet - Lobby**

No Asbestos

**B00M - R0007 - Toilets - Girls**

No Asbestos

**B00M - R0008 - Sound Cupboard**

No Asbestos

**B00M - R0009 - Toilet - Lobby**

No Asbestos

**B00M - R0010 - Toilets - Boys**

No Asbestos

**B00M - R0011 - Cleaning Distributed Store**

No Asbestos

**B00M - R0012 - Plant**

No Asbestos

**B00M - R0013 - Main Switch Board**

No Asbestos

**B00M - R0014 - Disabled Shower/Toilet**

No Asbestos

**B00M - R0015 - Movement**

No Asbestos

**B00M - R0016 - Movement**

No Asbestos

**B00M - R0017 - Movement**

No Asbestos

**B00M - R0018 - Covered Outdoor Learning Area**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 602 - D11028 - Learning Unit - Standard With P.A.A. : Placement Date - 1/07/2015**

### Exterior

No Asbestos Found.

### Interior

#### R1 - Learning space/withdrawal/entry

No Asbestos Found.

#### R2 - Home Base Store

No Asbestos Found.

**OS 602 - D12476 - Learning Unit - Standard With P.A.A. : Placement Date - 17/01/2007**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

### Interior

#### R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

#### R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

**OS 810 - D12658 - FSU/Shelter/Stores : Placement Date - 9/05/2007**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

### Exterior

No Asbestos Found.

### Interior

#### R1 - Canteen

No Asbestos Found.

#### R2 - Covered Area

No Asbestos Found.

#### R3 - Store

No Asbestos Found.

#### R4 - Sports Store

No Asbestos Found.

#### R5 - Garden Store

No Asbestos Found.

#### R6 - Change Room

No Asbestos Found.

#### R7 - Store

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017