


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bellbird Public School (1177)
Region : Hunter/Central Coast
State Electorate : Cessnock
Local Government Area : Cessnock

Initial Survey : Noel Arnold & Associates : 15 - May - 2008
Reviewed By : AECOM : 17 - Jun - 2016

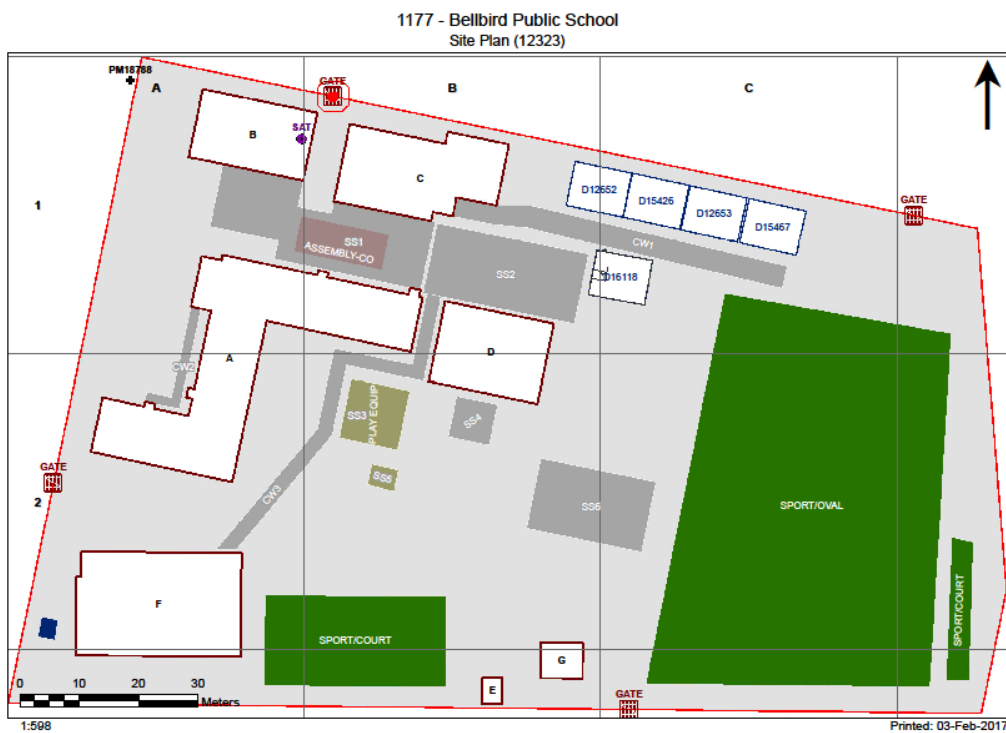

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1912 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Height Restriction 3-5M AR0016					
Underfloor Voids	Packing 1177/B00A/Underfloor Voids/S7	6Unit	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos) , Crocidolite (blue asbestos)

Interior

B00A - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1177/B00A/R0001/Ceiling Structures/Linings/S1					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00A - R0002 - Movement

No Asbestos

B00A - R0003 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting 1177/B00A/R0001/Ceiling Structures/Linings/S1					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00A - R0004 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting 1177/B00A/R0001/Ceiling Structures/Linings/S1					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00A - R0005 - Movement

No Asbestos

B00A - R0006 - Staff Room

No Asbestos

B00A - R0007 - Principal

No Asbestos

B00A - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1177/B00A/R0001/Ceiling Structures/Linings/S1					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00A - R0009 - Staff Room Annexe

No Asbestos

B00A - R0010 - Entry Vestibule

No Asbestos

B00A - R0011 - Movement

No Asbestos

B00A - R0012 - Interview

No Asbestos

B00A - R0013 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting 1177/B00A/R0013/Wall Linings Internal/S2	8m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
-----------------------	--	-----	-------------	--------------------	---------	--

B00A - R0014 - Movement

No Asbestos

B00A - R0015 - Security Store

No Asbestos

B00A - R0016 - Movement

No Asbestos

B00A - R0017 - Sick Bay

No Asbestos

B00A - R0018 - Shower/Change

No Asbestos

B00A - R0019 - Staff Toilet

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos						
B00A - R0020 - Duplicating Workroom						
No Asbestos						
B00A - R0021 - Clerical Office						
No Asbestos						
B00A - R0022 - Entry Vestibule						
No Asbestos						
B00A - R0023 - Movement						
No Asbestos						
B00A - R0024 - Movement						
No Asbestos						
B00A - R0025 - Withdrawal Space - 1hb						
No Asbestos						
B00A - R0026 - Practical Activities - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles					
1177/B00A/R0026/Floor Coverings Res/Textile/S6					No Asbestos Detected	
B00A - R0027 - Staff Toilet						
No Asbestos						
B00A - R0028 - Practical Activities - 1hb						
No Asbestos						
B00A - R0029 - Home Base						
No Asbestos						
B00A - R0030 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting					
1177/B00A/R0001/Ceiling Structures/Linings/S1					No Asbestos Detected	
B00A - R0031 - Withdrawal Space - 2hb						
No Asbestos						
B00A - R0032 - Home Base						
No Asbestos						
B00A - R0033 - General Storeroom						
No Asbestos						
B00A - R0034 - Home Base						
No Asbestos						
B00A - R0035 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting					
1177/B00A/R0001/Ceiling Structures/Linings/S1					No Asbestos Detected	
B00A - R0036 - Practical Activities - 1hb						
No Asbestos						
B00A - R0037 - Home Base						
No Asbestos						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library - 1981 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00B - R0001 - Movement

No Asbestos

B00B - R0002 - K.L.A. Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00B - R0003 - Library Office/Workroom

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00B - R0004 - Reading Area

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00B - R0005 - Distribution Board

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	-----	------------	--------------------	---------	--------------------

1177/B00B/R0005/Wall Linings Internal/S3

Chrysotile (White asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Communal Facilities/Pupil Facilities - 1977 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00C - R0001 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1177/B00C/R0005/Partition Walls (Cubicles)/S5				Chrysotile (White asbestos) , Amosite (Brown asbestos)		

B00C - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1177/B00C/R0013/Ceiling Structures/Linings/S4				Chrysotile (White asbestos)		

B00C - R0003 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1177/B00C/R0013/Ceiling Structures/Linings/S4				Chrysotile (White asbestos)		

B00C - R0004 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1177/B00C/R0013/Ceiling Structures/Linings/S4				Chrysotile (White asbestos)		

B00C - R0005 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1177/B00C/R0005/Partition Walls (Cubicles)/S5				Chrysotile (White asbestos) , Amosite (Brown asbestos)		

B00C - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1177/B00C/R0013/Ceiling Structures/Linings/S4				Chrysotile (White asbestos)		

B00C - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1177/B00C/R0013/Ceiling Structures/Linings/S4				Chrysotile (White asbestos)		

B00C - R0008 - Staff Toilet

No Asbestos

B00C - R0009 - Communal Space

No Asbestos

B00C - R0010 - P.E. Store

No Asbestos

B00C - R0011 - Canteen

No Asbestos

B00C - R0012 - Canteen Office/Store

No Asbestos

B00C - R0013 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1177/B00C/R0013/Ceiling Structures/Linings/S4				Chrysotile (White asbestos)		

B00C - R0014 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1177/B00C/R0013/Ceiling Structures/Linings/S4				Chrysotile (White asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - R0015 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1177/B00C/R0013/Ceiling Structures/Linings/S4					Chrysotile (White asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1995 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00D - R0001 - Movement

No Asbestos

B00D - R0002 - Practical Activities - 1hb

No Asbestos

B00D - R0003 - Home Base

No Asbestos

B00D - R0004 - Home Base Store

No Asbestos

B00D - R0005 - Movement

No Asbestos

B00D - R0006 - Withdrawal Space - 1hb

No Asbestos

B00D - R0007 - Home Base

No Asbestos

B00D - R0008 - Practical Activities - 1hb

No Asbestos

B00D - R0009 - Movement

No Asbestos

B00D - R0010 - Home Base Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Communal Facilities - 1976 - Concrete (Concrete)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00E - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00F - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior**B00F - R0001 - Covered Outdoor Learning Area**

No Asbestos

B00F - R0002 - Communal Space

No Asbestos

B00F - R0003 - Movement

No Asbestos

B00F - R0004 - Raised Platform

No Asbestos

B00F - R0005 - Ramp

No Asbestos

B00F - R0006 - Movement

No Asbestos

B00F - R0007 - Hall Chair Store

No Asbestos

B00F - R0008 - Communal/Performance Store

No Asbestos

B00F - R0009 - P.E. Store

No Asbestos

B00F - R0010 - Toilet - Lobby

No Asbestos

B00F - R0011 - Toilets - Girls

No Asbestos

B00F - R0012 - Sound Cupboard

No Asbestos

B00F - R0013 - Toilet - Lobby

No Asbestos

B00F - R0014 - Toilets - Boys

No Asbestos

B00F - R0015 - Cleaning Distributed Store

No Asbestos

B00F - R0016 - General Storeroom

No Asbestos

B00F - R0017 - Main Switch Board

No Asbestos

B00F - R0018 - Access Shower/Toilet

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Other - 2007 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00G - R0001 - Garden Store

No Asbestos

B00G - R0002 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D12652 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos		10 m2
---------	---------------	------------------	--	-------

OS 601 - D12653 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos		10 m2
---------	---------------	------------------	--	-------

OS 601 - D15426 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos		10 m2
---------	---------------	------------------	--	-------

OS 601 - D15467 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995

Exterior

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 602 - D16118 - Learning Unit - Standard With P.A.A. : Placement Date - 5/12/2012						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017