


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bellevue Hill Public School (1179)
Region : Sydney
State Electorate : Vacluse
Local Government Area : Woollahra

Initial Survey : Noel Arnold & Associates : 12 - Jun - 2008
Reviewed By : AECOM : 26 - May - 2015

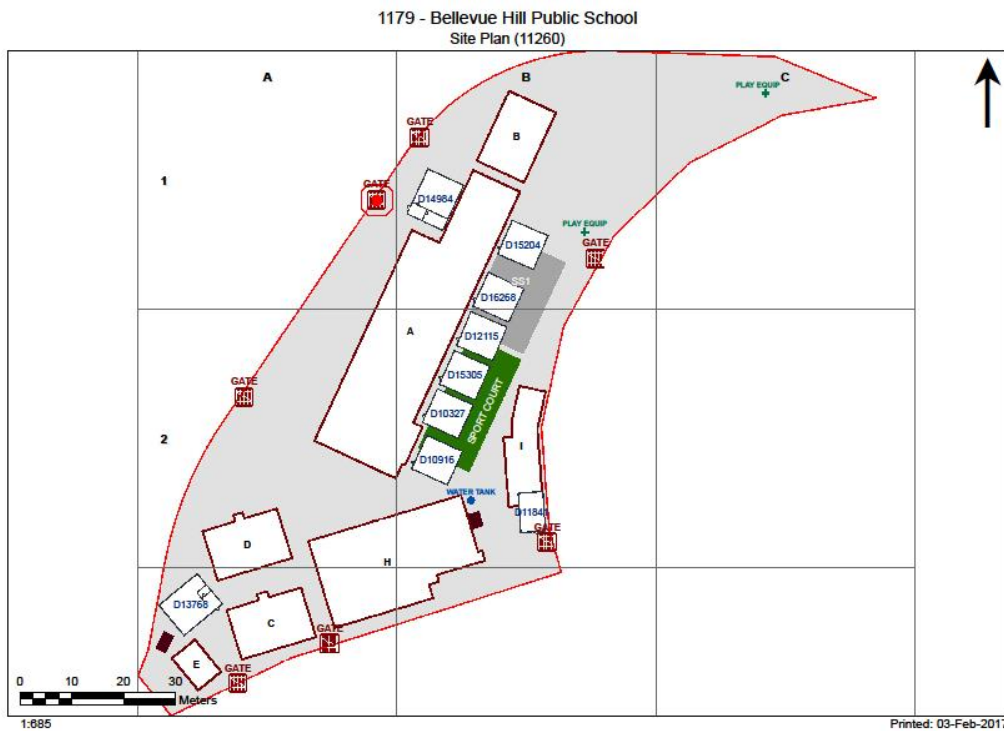

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Library - 1924 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Extreme Access Issue - No Access Point into ceiling void identified					
Underfloor Voids	Non Accessible Area - Area inaccessible - due to low clearance.					
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - No Access Point into ceiling void identified					

Interior

B00A - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	10m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R0025/Ceiling Structures/Linings/S12				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles	40m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
1179/B00A/R0004/Floor Coverings Res/Textile/S8				Chrysotile (white asbestos)		

B00A - R0006 - Movement

No Asbestos

B00A - R0007 - Home Base

No Asbestos

B00A - R0008 - Home Base

No Asbestos

B00A - R0009 - Home Base

No Asbestos

B00A - R0010 - Home Base

No Asbestos

B00A - R0013 - Movement

No Asbestos

B00A - R0014 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R0025/Ceiling Structures/Linings/S12				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R0030/Floor Coverings Res/Textile/S11				Chrysotile (white asbestos)		

B00A - R0015 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	45m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R0015/Floor Coverings Res/Textile/S7				Chrysotile (white asbestos)		

B00A - R0017 - Communal Space

No Asbestos

B00A - R0018 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R0025/Ceiling Structures/Linings/S12				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00A - R0019 - Cleaning Supplies

No Asbestos

B00A - R0020 - Movement

No Asbestos

B00A - R0021 - Clerical Office

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R0015/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
B00A - R0022 - Clerical Office						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R0025/Ceiling Structures/Linings/S12					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
1179/B00A/R0022/Floor Coverings Res/Textile/S13					No Asbestos Detected	
B00A - R0023 - Movement						
No Asbestos						
B00A - R0024 - Movement						
No Asbestos						
B00A - R0025 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R0025/Ceiling Structures/Linings/S12					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
B00A - R0026 - Cleaning Supplies						
No Asbestos						
B00A - R0027 - Sick Bay						
No Asbestos						
B00A - R0028 - Principal						
No Asbestos						
B00A - R0029 - Clerical Office						
No Asbestos						
B00A - R0030 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	30m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1179/B00A/R0030/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
B00A - R0031 - Deputy Principal - Type 1						
No Asbestos						
B00A - R0032 - Library Office/Workroom						
No Asbestos						
B00A - R0033 - Clerical/Printing						
No Asbestos						
B00A - R0034 - Home Base						
No Asbestos						
B00A - R0036 - Home Base Store						
No Asbestos						
B00A - R0037 - Home Base						
No Asbestos						
B00A - R0038 - Disabled Toilet						
No Asbestos						
B00A - R0039 - Sick Bay						
No Asbestos						
B00A - R1001 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	51m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R1012/Ceiling Structures/Linings/S16					Chrysotile (white asbestos) , Crocidolite (blue asbestos)	
B00A - R1002 - Home Base						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R1012/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00A - R1003 - Staff Room Annexe						
Ceiling Structures/Linings	Flat AC Sheeting	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R1012/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00A - R1004 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R1012/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00A - R1005 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R1012/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00A - R1006 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R1012/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00A - R1007 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R1012/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00A - R1008 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	66m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R1012/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00A - R1009 - Staff Room Annexe						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R1012/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00A - R1010 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R1012/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00A - R1011 - Toilets - Boys/Girls						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R1012/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00A - R1012 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	114m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R1012/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00A - R1013 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R1012/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00A - R1014 - Duplicating Workroom						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R1012/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00A - R1018 - Cleaning Supplies						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R1018/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R1012/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00A - R1019 - Toilets - Boys/Girls						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R1012/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00A - R1020 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R1012/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles	10m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R0004/Floor Coverings Res/Textile/S8				Chrysotile (white asbestos)		
B00A - R1021 - Staff Room						
Ceiling Structures/Linings	Flat AC Sheeting	54m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R1012/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00A - R1022 - Staff Room Annexe						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1179/B00A/R1012/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00A - R1023 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction - Height Restriction						
B00A - R1024 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction - Height Restriction						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Special Purpose - 1950 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible - limited access due to low clearance.

Interior

B00B - R0001 - Special Programs Room

No Asbestos

B00B - R0003 - Uniform Shop

No Asbestos

B00B - R0004 - External Movement

No Asbestos

B00B - R0005 - Kiln Room

No Asbestos

B00B - R0007 - Kitchen - Pre

No Asbestos

B00B - R0008 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1950 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible - limited access gained due to low clearance.

Interior

B00C - R0003 - External Movement

No Asbestos

B00C - R0004 - Home Base

No Asbestos

B00C - R0005 - Home Base

No Asbestos

B00C - R0006 - Toilets - Boys/Girls

No Asbestos

B00C - R0007 - Practical Activities/Movement - 2hb

No Asbestos

B00C - R0008 - Home Base Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1950 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible - due to low clearance.

Interior

B00D - R0001 - Home Base

No Asbestos

B00D - R0002 - Home Base

No Asbestos

B00D - R0004 - Toilets - Boys/Girls

No Asbestos

B00D - R0005 - Practical Activities/Movement - 2hb

No Asbestos

B00D - R0006 - Home Base Store

No Asbestos

B00D - R0007 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 1179/B00D/R0007/Ceiling Structures/Linings/S15
----------------------------	--

No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1960 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00E - R0001 - Canteen

Floor Coverings Res/Textile	Vinyl Tiles					
		1179/B00E/R0001/Floor Coverings Res/Textile/S10				No Asbestos Detected

B00E - R0002 - Handwashing Facilities

Floor Coverings Res/Textile	Vinyl Tiles					
		1179/B00E/R0001/Floor Coverings Res/Textile/S10				No Asbestos Detected

B00E - R0003 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00H - Pupil Facilities/Communal Facilities - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

No Asbestos

Interior

B00H - R0001 - Communal Space

No Asbestos

B00H - R0002 - Raised Platform

No Asbestos

B00H - R0003 - Sound Cupboard

No Asbestos

B00H - R0004 - Hall Chair Store

No Asbestos

B00H - R0005 - Communal/Performance Store

No Asbestos

B00H - R0006 - P.E. Store

No Asbestos

B00H - R0007 - Plant

No Asbestos

B00H - R0008 - Main Switch Board

No Asbestos

B00H - R0009 - Disabled Shower/Toilet

No Asbestos

B00H - R0010 - Cleaning Distributed Store

No Asbestos

B00H - R0011 - Toilet - Lobby

No Asbestos

B00H - R0012 - Toilets - Girls

No Asbestos

B00H - R0013 - Toilets - Boys

No Asbestos

B00H - R0014 - Toilet - Lobby

No Asbestos

B00H - R0015 - Covered Outdoor Learning Area

No Asbestos

B00H - R0016 - Movement

No Asbestos

B00H - R0017 - Plant

No Asbestos

B00H - R0018 - Movement

No Asbestos

B00H - R0019 - External Movement

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Communal Facilities - 2014 - Brick/Block (Brick/Block)

Exterior

No Asbestos

Interior

B00I - R0001 - External Movement

No Asbestos

B00I - R0002 - Sports Store

No Asbestos

B00I - R0003 - General Assistant/Bulk Store

No Asbestos

B00I - R0004 - Toilets - Boys

No Asbestos

B00I - R0005 - Toilets - Girls

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 600 - D10327 - Learning Unit - Small : Placement Date - 28/09/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - General Learning Space

No Asbestos Found.

OS 600 - D10916 - Learning Unit - Small : Placement Date - 28/09/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - General Learning Space

No Asbestos Found.

OS 750 - D11841 - Learning Unit - ESL : Placement Date - 3/07/2008

Exterior

No Asbestos Found.

Interior

R1 - Esl

No Asbestos Found.

OS 600 - D12115 - Learning Unit - Small : Placement Date - 28/09/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - General Learning Space

No Asbestos Found.

OS 602 - D13768 - Learning Unit - Standard With P.A.A. : Placement Date - 2/02/2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D14984 - Learning Unit - Standard/Withdrawal : Placement Date - 21/08/2008

Exterior

No Asbestos Found.



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Entry						
No Asbestos Found.						
R2 - General Learning Space						
No Asbestos Found.						
R3 - Store						
No Asbestos Found.						
OS 600 - D15204 - Learning Unit - Small : Placement Date - 29/09/2015						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - General Learning Space						
No Asbestos Found.						
OS 600 - D15305 - Learning Unit - Small : Placement Date - 28/09/2015						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - General Learning Space						
No Asbestos Found.						
OS 600 - D16268 - Learning Unit - Small : Placement Date - 28/09/2015						
Exterior						
No Asbestos Found.						
Interior						
R1 - General Learning Space						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017