


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Belmore North Public School (1185)
Region : South Western Sydney
State Electorate : Canterbury
Local Government Area : Canterbury

Initial Survey : Noel Arnold & Associates : 30 - May - 2008
Reviewed By : Parsons Brinckerhoff : 13 - Oct - 2015

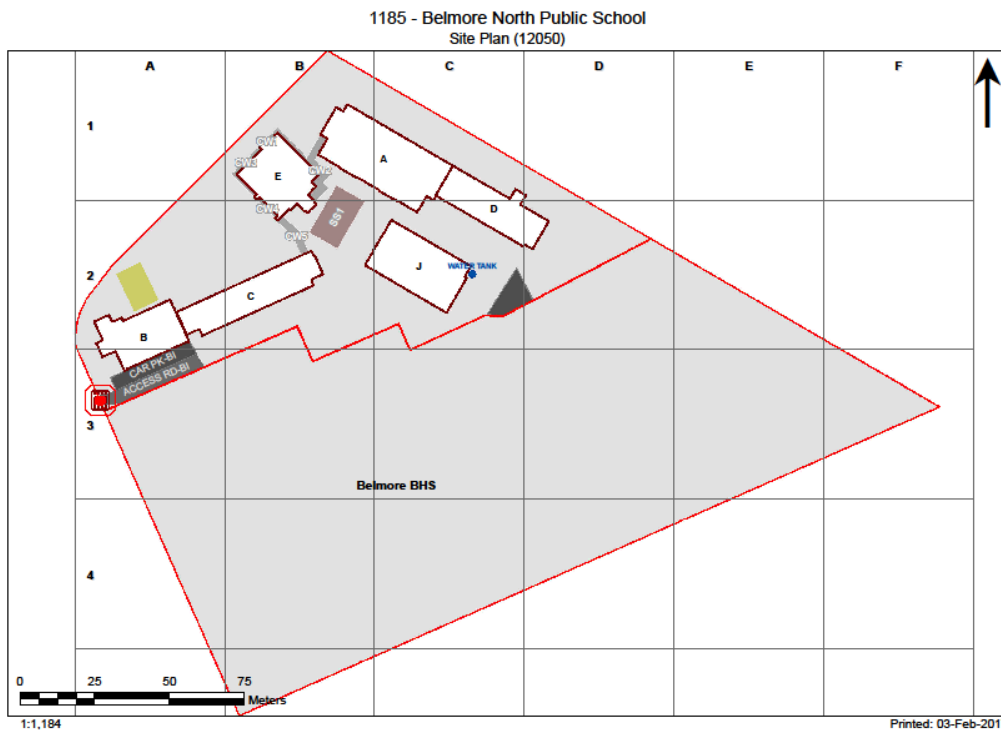

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Support Unit - 1972 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Flat AC Sheeting	200m2	Old ceiling above all rooms except R1018 and R1019	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	1185/B00A/Ceiling Voids/S16					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Flat AC Sheeting					No Asbestos Detected
	1185/B00A/Ceiling Voids/S15					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - Movement (1.5 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00A/R0001/Ceiling Structures/Linings/S26					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0002 - Movement (40.74 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	1185/B00A/R0008/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00A - R0003 - Cleaning Distributed Store (4.26 m2)

No Asbestos

B00A - R0004 - General Storeroom (11.33 m2)

Stored material	Flat AC Sheeting	1m2	Variable positions	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	1185/B00A/R0004/Stored material/S27					Chrysotile (white asbestos)

B00A - R0005 - Cleaning Distributed Store (2.49 m2)

No Asbestos

B00A - R0006 - Uniform Shop (12.79 m2)

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00A/R0006/Floor Coverings Res/Textile/S28					Chrysotile (white asbestos)

B00A - R0007 - Communal Space (153.32 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	1185/B00A/R0008/Floor Coverings Res/Textile/S1					
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1185/B00A/R0007/Ceiling Structures/Linings/S29					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0008 - Movement (103.98 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	1185/B00A/R0008/Floor Coverings Res/Textile/S1					

B00A - R0009 - Raised Platform (27.92 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	1185/B00A/R0008/Floor Coverings Res/Textile/S1					
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1185/B00A/R0009/Ceiling Structures/Linings/S30					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0010 - Movement (11.73 m2)

Wall Linings Internal	Flat AC Sheeting	12m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00A/R0010/Wall Linings Internal/S31					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0011 - P.E. Store (16.04 m2)						
No Asbestos						
B00A - R0012 - Cleaning Distributed Store (2.58 m2)						
No Asbestos						
B00A - R0013 - Movement (8.36 m2)						
No Asbestos						
B00A - R0014 - Hall Chair Store (12.83 m2)						
No Asbestos						
B00A - R0015 - Movement (1.57 m2)						
No Asbestos						
B00A - R0016 - Withdrawal Space - 1hb (23.06 m2)						
No Asbestos						
B00A - R0017 - Withdrawal Space - 1hb (22.99 m2)						
No Asbestos						
B00A - R0018 - Home Base (48.47 m2)						
No Asbestos						
B00A - R0019 - Home Base (47.22 m2)						
No Asbestos						
B00A - R0020 - Home Base (48.47 m2)						
No Asbestos						
B00A - R0021 - Special Programs Room (47.34 m2)						
No Asbestos						
B00A - R0022 - Movement (1.51 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
1185/B00A/R0022/Ceiling Structures/Linings/S32				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0023 - Stairs (7.38 m2)						
No Asbestos						
B00A - R0024 - Stairs (1.01 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1185/B00A/R0024/Floor Coverings Res/Textile/S33				Chrysotile (white asbestos)		
B00A - R0025 - Stairs (7.51 m2)						
No Asbestos						
B00A - R1001 - Craft Store (17.55 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1185/B00A/R1001/Floor Coverings Res/Textile/S34				Chrysotile (white asbestos)		
B00A - R1002 - Home Base (67.61 m2)						
No Asbestos						
B00A - R1003 - Practical Activities - 1hb (4.98 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
1185/B00A/R0008/Floor Coverings Res/Textile/S1				No Asbestos Detected		
B00A - R1004 - Home Base (65.23 m2)						
No Asbestos						
B00A - R1005 - Practical Activities - 1hb (4.68 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
1185/B00A/R0008/Floor Coverings Res/Textile/S1				No Asbestos Detected		
B00A - R1006 - Home Base - M (69.84 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
No Asbestos						
B00A - R1007 - Practical Activities - M - 1hb (16.97 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	1185/B00A/R0008/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00A - R1008 - General Storeroom (17.38 m2)						
No Asbestos						
B00A - R1009 - Movement (8.3 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	1185/B00A/R1009/Ceiling Structures/Linings/S35					No Asbestos Detected
B00A - R1010 - Movement (13.92 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	1185/B00A/R1010/Ceiling Structures/Linings/S36					No Asbestos Detected
B00A - R1011 - Cleaning Distributed Store (2.62 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00A/R1011/Ceiling Structures/Linings/S75					Chrysotile (white asbestos) , Crocidolite (blue asbestos)
B00A - R1012 - Music Store (9.04 m2)						
No Asbestos						
B00A - R1013 - Personal Effects Storage (8.97 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	1185/B00A/R0008/Floor Coverings Res/Textile/S1					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00A/R1013/Ceiling Structures/Linings/S37					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R1014 - Movement (108.81 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	1185/B00A/R0008/Floor Coverings Res/Textile/S1					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	109m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00A/R1014/Ceiling Structures/Linings/S38					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R1015 - Home Base (48.86 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00A/R1015/Ceiling Structures/Linings/S39					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R1016 - Home Base (50.33 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1185/B00A/R1016/Ceiling Structures/Linings/S40					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R1017 - Home Base (48.8 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00A/R1017/Ceiling Structures/Linings/S41					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R1018 - Home Base (50.63 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	1185/B00A/R1018/Ceiling Structures/Linings/S42					No Asbestos Detected
B00A - R1019 - Home Base (48.92 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting					
	1185/B00A/R1019/Ceiling Structures/Linings/S43				No Asbestos Detected	
B00A - R1020 - Movement (9.25 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	1185/B00A/R1020/Ceiling Structures/Linings/S44				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00A - R1021 - Stairs (4.88 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00A/R1021/Ceiling Structures/Linings/S45				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00A - R1022 - Stairs (11.59 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00A/R1022/Ceiling Structures/Linings/S46				Chrysotile (white asbestos) , Amosite (brown asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - General Learning/Support Unit - 1972 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	AC Fragments/Debris	NA	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	1185/B00B/Ceiling Voids/S18			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Voids	Flat AC Sheeting	1m2	Access hatch above R1008	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00B/Ceiling Voids/S17			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Underfloor Voids	Vinyl tile debris	NA	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	1185/B00B/Underfloor Voids/S19			Chrysotile (white asbestos)		

Interior

B00B - R0001 - Practical Activities - 1hb (54.78 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	1185/B00B/R0001/Floor Coverings Res/Textile/S10			No Asbestos Detected		

B00B - R0002 - Movement (55.85 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	1185/B00B/R0001/Floor Coverings Res/Textile/S10			No Asbestos Detected		

B00B - R0003 - Home Base (47.07 m2)

No Asbestos

B00B - R0004 - Home Base (46.95 m2)

No Asbestos

B00B - R0005 - Home Base - M (47.01 m2)

No Asbestos

B00B - R0006 - Movement (26.95 m2)

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00B/R0006/Ceiling Structures/Linings/S47			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00B - R0007 - General Storeroom (8.57 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00B/R0007/Ceiling Structures/Linings/S48			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00B - R0008 - Movement (5.46 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00B/R0008/Ceiling Structures/Linings/S49			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00B - R0009 - Cleaning Distributed Store (5.61 m2)

No Asbestos

B00B - R0010 - Distribution Board (1.25 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0011 - Staff Room Annexe (12.92 m2)

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00B/R0011/Ceiling Structures/Linings/S50			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00B - R0012 - Practical Activities - 1hb (28.02 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	1185/B00B/R0001/Floor Coverings Res/Textile/S10					No Asbestos Detected
B00B - R0013 - Stairs (8.64 m2)						
No Asbestos						
B00B - R1001 - Communal Space (54 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00B/R1001/Ceiling Structures/Linings/S51					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00B - R1002 - Movement (47.94 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00B/R1002/Ceiling Structures/Linings/S52					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	1185/B00B/R0001/Floor Coverings Res/Textile/S10					No Asbestos Detected
B00B - R1003 - Home Base (50.44 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	1185/B00B/R1003/Ceiling Structures/Linings/S53					No Asbestos Detected
B00B - R1004 - Home Base (49.43 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	1185/B00B/R1004/Ceiling Structures/Linings/S54					No Asbestos Detected
B00B - R1005 - Home Base (49.64 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	1185/B00B/R1005/Ceiling Structures/Linings/S55					No Asbestos Detected
B00B - R1006 - Home Base Store (7.36 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00B/R1006/Ceiling Structures/Linings/S56					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	1185/B00B/R0001/Floor Coverings Res/Textile/S10					No Asbestos Detected
Putty to windows	Mastic	4m	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1185/B00B/R1006/Putty to windows/S57					Chrysotile (white asbestos)
B00B - R1007 - General Storeroom (9.19 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	1185/B00B/R1007/Floor Coverings Res/Textile/S76					No Asbestos Detected
B00B - R1008 - Movement (7.13 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	1185/B00B/R1008/Ceiling Structures/Linings/S58					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles					
	1185/B00B/R0001/Floor Coverings Res/Textile/S10					No Asbestos Detected
B00B - R1009 - Staff Toilet (2.62 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	1185/B00B/R1009/Ceiling Structures/Linings/S59					No Asbestos Detected
B00B - R1010 - Practical Activities - 1hb (27.53 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00B/R1010/Ceiling Structures/Linings/S60					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Floor Coverings Res/Textile	Vinyl Tiles					
	1185/B00B/R0001/Floor Coverings Res/Textile/S10					No Asbestos Detected

B00B - R1011 - Stairs (11.46 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Pupil Facilities - 1972 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00C/Eaves Linings/S20					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	10m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00C/Gable Verge Lining/S21					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00C - R0001 - Sports Store (7.14 m2)**

No Asbestos

B00C - R0002 - Movement (4.2 m2)

Ceiling Structures/Linings	Vermiculite					
	1185/B00C/R1013/Ceiling Structures/Linings/S8					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0003 - Personal Effects Storage (6.53 m2)

Ceiling Structures/Linings	Vermiculite					
	1185/B00C/R1013/Ceiling Structures/Linings/S8					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0004 - Home Base Store (3.87 m2)

Ceiling Structures/Linings	Vermiculite					
	1185/B00C/R1013/Ceiling Structures/Linings/S8					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0005 - Toilets - Boys/Girls (3.17 m2)

Ceiling Structures/Linings	Vermiculite					
	1185/B00C/R1013/Ceiling Structures/Linings/S8					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0006 - Home Base (85.93 m2)

Ceiling Structures/Linings	Vermiculite					
	1185/B00C/R1013/Ceiling Structures/Linings/S8					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0007 - Home Base (83.83 m2)

Ceiling Structures/Linings	Vermiculite					
	1185/B00C/R1013/Ceiling Structures/Linings/S8					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0008 - Toilets - Boys/Girls (3.08 m2)

Ceiling Structures/Linings	Vermiculite					
	1185/B00C/R1013/Ceiling Structures/Linings/S8					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0009 - Home Base Store (2.72 m2)

Ceiling Structures/Linings	Vermiculite					
	1185/B00C/R1013/Ceiling Structures/Linings/S8					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0010 - Distribution Board (0.33 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite					
	1185/B00C/R1013/Ceiling Structures/Linings/S8					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0011 - Personal Effects Storage (6.78 m2)

Ceiling Structures/Linings	Vermiculite					
	1185/B00C/R1013/Ceiling Structures/Linings/S8					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0012 - Drinking Facilities (1.88 m2)						
No Asbestos						
B00C - R0013 - Toilets - Girls (48.19 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	1185/B00C/R1013/Partition Walls (Cubicles)/S7				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1185/B00C/R1013/Ceiling Structures/Linings/S8				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R0014 - Staff Toilet (2.47 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1185/B00C/R1013/Ceiling Structures/Linings/S8				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R0015 - Cleaning Distributed Store (2.4 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1185/B00C/R0015/Ceiling Structures/Linings/S77				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R0016 - Toilets - Boys (44.69 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	45m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	1185/B00C/R1013/Partition Walls (Cubicles)/S7				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1185/B00C/R1013/Ceiling Structures/Linings/S8				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R0017 - Drinking Facilities (2.05 m2)						
No Asbestos						
B00C - R0018 - General Storeroom (6.44 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1185/B00C/R1013/Ceiling Structures/Linings/S8				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R0019 - Movement (23.72 m2)						
No Asbestos						
B00C - R0020 - Cleaning Supplies (4.68 m2)						
No Asbestos						
B00C - R0021 - Movement (88.49 m2)						
In-fill-panel	Flat AC Sheeting					No Asbestos Detected
	1185/B00C/R0021/In-fill-panel/S6					
B00C - R0022 - Stairs (11.42 m2)						
Putty to windows	Mastic					No Asbestos Detected
	1185/B00C/R0022/Putty to windows/S62					
Fibre cement pot plants	Compressed AC Sheet	2Unit	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1185/B00C/R0022/Fibre cement pot plants/S61				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00C - R0023 - Stairs (3.91 m2)						
Putty to windows	Mastic					No Asbestos Detected
	1185/B00C/R0023/Putty to windows/S63					
B00C - R1001 - Movement (91.79 m2)						
In-fill-panel	Flat AC Sheeting					No Asbestos Detected
	1185/B00C/R0021/In-fill-panel/S6					
Ceiling Structures/Linings	Flat AC Sheeting	92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00C/R1001/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	
B00C - R1002 - General Storeroom (13.79 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00C - R1003 - Personal Effects Storage (6.89 m2)						
No Asbestos						
B00C - R1004 - Home Base Store (6.98 m2)						
No Asbestos						
B00C - R1005 - Home Base (56.79 m2)						
No Asbestos						
B00C - R1006 - Home Base (57.2 m2)						
No Asbestos						
B00C - R1007 - Home Base Store (6.63 m2)						
No Asbestos						
B00C - R1008 - Personal Effects Storage (13.74 m2)						
No Asbestos						
B00C - R1009 - Distribution Board (0.61 m2) Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1185/B00C/R1009/Ceiling Structures/Linings/S64					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	2m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1185/B00C/R1009/Wall Linings Internal/S65					Chrysotile (white asbestos)
B00C - R1010 - Home Base Store (5.97 m2)						
No Asbestos						
B00C - R1011 - Home Base (57.04 m2)						
No Asbestos						
B00C - R1012 - Home Base (57.82 m2)						
No Asbestos						
B00C - R1013 - Home Base Store (6.94 m2)						
No Asbestos						
B00C - R1014 - Personal Effects Storage (6.91 m2)						
No Asbestos						
B00C - R1015 - General Storeroom (13.7 m2)						
No Asbestos						
B00C - R1016 - Movement (18.66 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00C/R1001/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)
B00C - R1017 - Stairs (6.09 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00C/R1017/Ceiling Structures/Linings/S67					Chrysotile (white asbestos)
Bulkhead lining	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00C/R1017/Bulkhead lining/S66					Chrysotile (white asbestos)
B00C - R1018 - Stairs (5.34 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00C/R1018/Ceiling Structures/Linings/S68					Chrysotile (white asbestos)
B00C - R1019 - Stairs (15.3 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00C/R1019/Ceiling Structures/Linings/S70					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Bulkhead lining	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00C/R1019/Bulkhead lining/S69			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00D - General Learning/Pupil Facilities - 1972 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 1185/B00D/Eaves Linings/S22	30m2	South, Upper portion	Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)
Gable Verge Lining	Flat AC Sheeting 1185/B00D/Gable Verge Lining/S23	10m2	East	Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00D - R0001 - Movement (46.06 m2)**

Ceiling Structures/Linings	Vermiculite 1185/B00D/R0011/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

B00D - R0002 - Movement (0.85 m2)

Ceiling Structures/Linings	Vermiculite 1185/B00D/R0011/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

B00D - R0003 - Staff Toilet (2.28 m2)

Ceiling Structures/Linings	Vermiculite 1185/B00D/R0011/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

B00D - R0004 - Canteen Office/Store (2.68 m2)

Ceiling Structures/Linings	Vermiculite 1185/B00D/R0011/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

B00D - R0005 - Canteen Office/Store (2.99 m2)

Ceiling Structures/Linings	Vermiculite 1185/B00D/R0011/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

Floor Coverings Res/Textile	Vinyl Tiles 1185/B00D/R0006/Floor Coverings Res/Textile/S5	3m2	Throughout	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)
-----------------------------	---	-----	------------	--	---------	--------------------

B00D - R0006 - Canteen (26.99 m2)

Ceiling Structures/Linings	Vermiculite 1185/B00D/R0011/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

Floor Coverings Res/Textile	Vinyl Tiles 1185/B00D/R0006/Floor Coverings Res/Textile/S5	27m2	Throughout	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)
-----------------------------	---	------	------------	--	---------	--------------------

B00D - R0007 - Staff Toilet (3.33 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 1185/B00D/R0011/Partition Walls (Cubicles)/S3	2m2	Throughout	Some Damage / Unsealed (3) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)
----------------------------	--	-----	------------	--	---------	--------------------

Ceiling Structures/Linings	Vermiculite 1185/B00D/R0011/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

B00D - R0008 - Toilets - Girls (53.29 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 1185/B00D/R0011/Partition Walls (Cubicles)/S3	20m2	Throughout	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)
----------------------------	--	------	------------	--	---------	--------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	1185/B00D/R0011/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0009 - Drinking Facilities (1.63 m2)						
Ceiling Structures/Linings	Vermiculite					
	1185/B00D/R0011/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0010 - Drinking Facilities (0.77 m2)						
Ceiling Structures/Linings	Vermiculite					
	1185/B00D/R0011/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0011 - Toilets - Boys (53.19 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00D/R0011/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	1185/B00D/R0011/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0012 - Home Base (63.76 m2)						
Ceiling Structures/Linings	Vermiculite					
	1185/B00D/R0011/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0013 - Movement (70.54 m2)						
No Asbestos						
B00D - R0014 - Movement (7.35 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00D/R1009/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)
B00D - R0015 - Practical Activities - 1hb (20.47 m2)						
Ceiling Structures/Linings	Vermiculite					
	1185/B00D/R0011/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0016 - Movement (23.17 m2)						
No Asbestos						
B00D - R0017 - Stairs (2.46 m2)						
No Asbestos						
B00D - R0018 - Stairs (2.25 m2)						
No Asbestos						
B00D - R1001 - Practical Activities - 1hb (20.52 m2)						
No Asbestos						
B00D - R1002 - Home Base (50.85 m2)						
No Asbestos						
B00D - R1003 - Home Base (51.31 m2)						
No Asbestos						
B00D - R1004 - Practical Activities - 1hb (19.27 m2)						
No Asbestos						
B00D - R1005 - Practical Activities - 1hb (20.23 m2)						
No Asbestos						
B00D - R1006 - Home Base (51.3 m2)						
No Asbestos						
B00D - R1007 - Home Base (50.9 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R1008 - Practical Activities - 1hb (20.23 m2)						
No Asbestos						
B00D - R1009 - Movement (70.5 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1185/B00D/R1009/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00D - R1010 - Stairs (11.13 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1185/B00D/R1010/Ceiling Structures/Linings/S71					Chrysotile (white asbestos) , Amosite (brown asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00E - Administration/Library - 1972 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00E/Eaves Linings/S24			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00E/Gable Verge Lining/S25			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00E - R0001 - Interview (13.8 m2)

Ceiling Structures/Linings	Vermiculite					
	1185/B00E/R0010/Ceiling Structures/Linings/S11					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00E - R0002 - Staff Toilet (3.91 m2)

Ceiling Structures/Linings	Vermiculite					
	1185/B00E/R0010/Ceiling Structures/Linings/S11					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00E/R0010/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

B00E - R0003 - General Storeroom (2.99 m2)

Ceiling Structures/Linings	Vermiculite					
	1185/B00E/R0010/Ceiling Structures/Linings/S11					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00E/R0010/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

B00E - R0004 - Staff Toilet (3.13 m2)

Ceiling Structures/Linings	Vermiculite					
	1185/B00E/R0010/Ceiling Structures/Linings/S11					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00E/R0010/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00E/R0015/Partition Walls (Cubicles)/S13					Chrysotile (white asbestos)

B00E - R0005 - Principal (16.17 m2)

Ceiling Structures/Linings	Vermiculite					
	1185/B00E/R0010/Ceiling Structures/Linings/S11					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00E - R0006 - Deputy Principal (13.69 m2)

Ceiling Structures/Linings	Vermiculite					
	1185/B00E/R0010/Ceiling Structures/Linings/S11					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1185/B00E/R0010/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

B00E - R0007 - Staff Room Annexe (10.96 m2)

Ceiling Structures/Linings	Vermiculite					
	1185/B00E/R0010/Ceiling Structures/Linings/S11					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1185/B00E/R0010/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00E - R0008 - Distribution Board (0.8 m2)				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
1185/B00E/R0010/Ceiling Structures/Linings/S11				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1185/B00E/R0010/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00E - R0009 - External Movement (33.47 m2)						
No Asbestos						
B00E - R0010 - Movement (23.15 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
1185/B00E/R0010/Ceiling Structures/Linings/S11				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1185/B00E/R0010/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00E - R0011 - Duplicating Workroom (26.09 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
1185/B00E/R0010/Ceiling Structures/Linings/S11				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1185/B00E/R0010/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00E - R0012 - Staff Room (70.14 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
1185/B00E/R0010/Ceiling Structures/Linings/S11				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1185/B00E/R0010/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00E - R0013 - Movement (1.65 m2)						
No Asbestos						
B00E - R0014 - Movement (18.41 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
1185/B00E/R0010/Ceiling Structures/Linings/S11				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1185/B00E/R0010/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00E - R0015 - Staff Toilet (9.25 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
1185/B00E/R0010/Ceiling Structures/Linings/S11				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1185/B00E/R0010/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1185/B00E/R0015/Partition Walls (Cubicles)/S13				Chrysotile (white asbestos)		
B00E - R0016 - Staff Toilet (10.34 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
1185/B00E/R0010/Ceiling Structures/Linings/S11				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1185/B00E/R0010/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1185/B00E/R0015/Partition Walls (Cubicles)/S13				Chrysotile (white asbestos)		
B00E - R0017 - Sick Bay (15.87 m2)						
Ceiling Structures/Linings	Vermiculite					
1185/B00E/R0010/Ceiling Structures/Linings/S11				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1185/B00E/R0010/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00E - R0018 - General Storeroom (9.79 m2)						
Ceiling Structures/Linings	Vermiculite					
1185/B00E/R0010/Ceiling Structures/Linings/S11				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1185/B00E/R0010/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00E - R0019 - Clerical Office/Workroom (12.56 m2)						
Ceiling Structures/Linings	Vermiculite					
1185/B00E/R0010/Ceiling Structures/Linings/S11				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1185/B00E/R0010/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00E - R0020 - Clerical Office (16.72 m2)						
Ceiling Structures/Linings	Vermiculite					
1185/B00E/R0010/Ceiling Structures/Linings/S11				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1185/B00E/R0010/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00E - R0021 - Entry Vestibule (23.89 m2)						
Ceiling Structures/Linings	Vermiculite					
1185/B00E/R0010/Ceiling Structures/Linings/S11				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1185/B00E/R0010/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00E - R0022 - Cleaning Distributed Store (6.53 m2)						
Ceiling Structures/Linings	Vermiculite					
1185/B00E/R0010/Ceiling Structures/Linings/S11				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1185/B00E/R0010/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00E - R0023 - General Storeroom (15.91 m2)						
Ceiling Structures/Linings	Vermiculite					
1185/B00E/R0010/Ceiling Structures/Linings/S11				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1185/B00E/R0010/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00E - R0024 - Movement (3.31 m2)						
No Asbestos						
B00E - R0025 - External Stairs (15.97 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - R1001 - Reading Area (189.08 m2)						
Ceiling Structures/Linings	Vermiculite 1185/B00E/R0010/Ceiling Structures/Linings/S11					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 1185/B00E/R0010/Floor Coverings Res/Textile/S12	90m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1002 - Home Base (53.06 m2)						
Ceiling Structures/Linings	Vermiculite 1185/B00E/R0010/Ceiling Structures/Linings/S11					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1003 - External Movement (22 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1185/B00E/R1003/Ceiling Structures/Linings/S72	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R1004 - Library Office/Workroom (6.07 m2)						
Ceiling Structures/Linings	Vermiculite 1185/B00E/R0010/Ceiling Structures/Linings/S11					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 1185/B00E/R0010/Floor Coverings Res/Textile/S12	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1005 - Library Office/Workroom (19.29 m2)						
Ceiling Structures/Linings	Vermiculite 1185/B00E/R0010/Ceiling Structures/Linings/S11					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 1185/B00E/R0010/Floor Coverings Res/Textile/S12	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1006 - Movement (27.72 m2)						
Ceiling Structures/Linings	Vermiculite 1185/B00E/R0010/Ceiling Structures/Linings/S11					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 1185/B00E/R0010/Floor Coverings Res/Textile/S12	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1007 - Toilets - Boys (4.67 m2)						
Ceiling Structures/Linings	Vermiculite 1185/B00E/R0010/Ceiling Structures/Linings/S11					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 1185/B00E/R0010/Floor Coverings Res/Textile/S12	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet 1185/B00E/R0015/Partition Walls (Cubicles)/S13	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1008 - Distribution Board (0.7 m2)						
Ceiling Structures/Linings	Vermiculite 1185/B00E/R1008/Ceiling Structures/Linings/S73	1m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1009 - Cleaning Distributed Store (1.8 m2)						
Ceiling Structures/Linings	Vermiculite 1185/B00E/R0010/Ceiling Structures/Linings/S11					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1010 - Toilets - Girls (3.37 m2)						

1185 Belmore North Public School

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 1185/B00E/R0010/Ceiling Structures/Linings/S11				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 1185/B00E/R0010/Floor Coverings Res/Textile/S12	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Partition Walls (Cubicles)	Compressed AC Sheet 1185/B00E/R0015/Partition Walls (Cubicles)/S13	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
B00E - R1011 - K.L.A. Store (12.59 m2)						
Ceiling Structures/Linings	Vermiculite 1185/B00E/R0010/Ceiling Structures/Linings/S11				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 1185/B00E/R0010/Floor Coverings Res/Textile/S12	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
B00E - R1012 - K.L.A. Store (12.59 m2)						
Ceiling Structures/Linings	Vermiculite 1185/B00E/R0010/Ceiling Structures/Linings/S11				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 1185/B00E/R0010/Floor Coverings Res/Textile/S12	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
B00E - R1013 - External Stairs (15.97 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1185/B00E/R1013/Ceiling Structures/Linings/S74	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00J - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00J - R0001 - Communal Space (145.59 m2)**

No Asbestos

B00J - R0002 - Raised Platform (60.32 m2)

No Asbestos

B00J - R0003 - Hall Chair Store (9.49 m2)

No Asbestos

B00J - R0004 - Communal/Performance Store (9.53 m2)

No Asbestos

B00J - R0005 - P.E. Store (13.01 m2)

No Asbestos

B00J - R0006 - Toilet - Lobby (2.37 m2)

No Asbestos

B00J - R0007 - Toilets - Girls (7.37 m2)

No Asbestos

B00J - R0008 - Sound Cupboard (2.04 m2)

No Asbestos

B00J - R0009 - Toilet - Lobby (3.41 m2)

No Asbestos

B00J - R0010 - Toilets - Boys (5.74 m2)

No Asbestos

B00J - R0011 - No Access (3.56 m2)

No Asbestos

B00J - R0012 - No Access (1.6 m2)

No Asbestos

B00J - R0013 - No Access (3.26 m2)

No Asbestos

B00J - R0014 - No Access (6.9 m2)

No Asbestos

B00J - R0015 - Covered Outdoor Learning Area (170.96 m2)

No Asbestos

B00J - R0016 - Movement (7.13 m2)

No Asbestos

B00J - R0017 - Movement (11.95 m2)

No Asbestos

B00J - R0018 - Movement (10.84 m2)

No Asbestos

B00J - R0019 - Canteen (26.53 m2)

No Asbestos

B00J - R0020 - Canteen Office/Store (9.3 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017