


Asbestos Register

(Hazardous Materials and Risk Assessment)



School : Belmore South Public School (1186)
Region : South Western Sydney
State Electorate : Canterbury
Local Government Area : Canterbury

Initial Survey : Noel Arnold & Associates : 30 - May - 2008
Reviewed By : Parsons Brinckerhoff : 03 - Jan - 2017

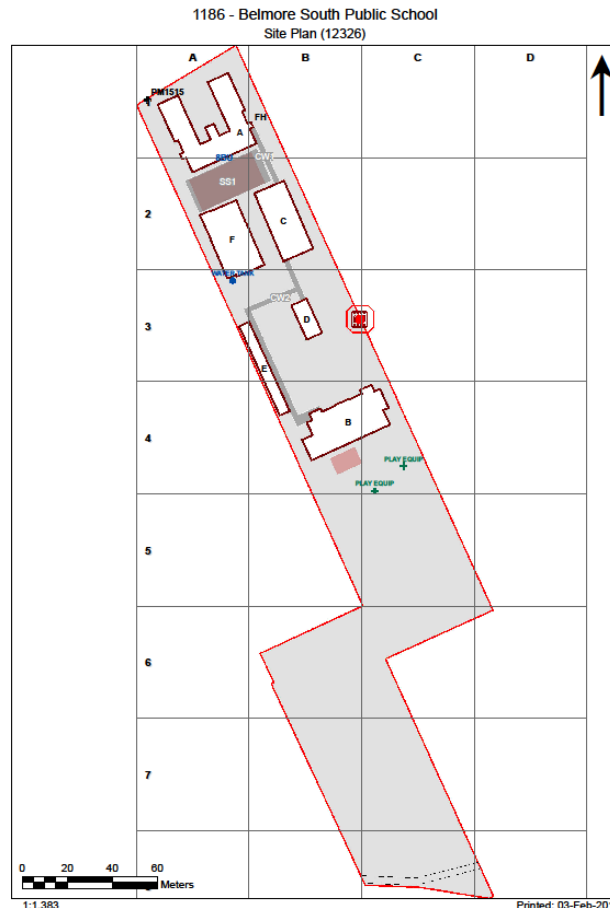

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Library - 1916 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00E/R0005/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - Home Base

No Asbestos

B00A - R0002 - Home Base Store

No Asbestos

B00A - R0003 - Special Programs Room

No Asbestos

B00A - R0004 - Special Programs Room

No Asbestos

B00A - R0005 - General Assistant/Bulk Store

No Asbestos

B00A - R0006 - General Storeroom

No Asbestos

B00A - R0007 - Movement

No Asbestos

B00A - R0008 - Movement

No Asbestos

B00A - R0009 - General Storeroom

No Asbestos

B00A - R0010 - Distribution Board

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board					
	1186/B00A/R0010/Electrical Backing Board/S14					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Sheet					
	1186/B00A/R0010/Floor Coverings Res/Textile/S15					No Asbestos Detected

B00A - R0011 - Movement

No Asbestos

B00A - R0012 - Movement

Floor Coverings Res/Textile	Vinyl Tiles					
	1186/B00A/R0012/Floor Coverings Res/Textile/S8					No Asbestos Detected
Chalk Board	Flat AC Sheeting	7m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00A/R0012/Chalk Board/S12					Chrysotile (white asbestos)

B00A - R0013 - Home Base

Chalk Board	Flat AC Sheeting	12m2	North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00B/R1007/Chalk Board/S6					Chrysotile (white asbestos)

B00A - R0014 - Home Base

Chalk Board	Flat AC Sheeting	6m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00B/R1007/Chalk Board/S6					Chrysotile (white asbestos)

B00A - R0015 - Home Base

Chalk Board	Flat AC Sheeting	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00B/R1007/Chalk Board/S6					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0016 - Home Base						
No Asbestos						
B00A - R0017 - Practical Activities - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles					
1186/B00A/R0012/Floor Coverings Res/Textile/S8					No Asbestos Detected	
B00A - R0018 - Movement						
No Asbestos						
B00A - R0019 - Sports Store						
No Asbestos						
B00A - R0020 - Communal/Performance Store						
No Asbestos						
B00A - R0021 - Movement						
No Asbestos						
B00A - R0022 - Movement						
No Asbestos						
B00A - R0023 - Cleaning Distributed Store						
No Asbestos						
B00A - R0024 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles					
1186/B00A/R0012/Floor Coverings Res/Textile/S8					No Asbestos Detected	
B00A - R0025 - Home Base						
Chalk Board	Flat AC Sheeting					
1186/B00A/R0025/Chalk Board/S13					No Asbestos Detected	
B00A - R0026 - Home Base						
No Asbestos						
B00A - R0027 - Staff Room Annexe						
No Asbestos						
B00A - R0028 - General Storeroom						
No Asbestos						
B00A - R1001 - Home Base						
No Asbestos						
B00A - R1002 - Cleaning Distributed Store						
No Asbestos						
B00A - R1003 - Home Base						
No Asbestos						
B00A - R1004 - Movement						
No Asbestos						
B00A - R1005 - Staff Toilet						
Floor Coverings Res/Textile	Vinyl Tiles					
1186/B00A/R0012/Floor Coverings Res/Textile/S8					No Asbestos Detected	
B00A - R1006 - Craft Store						
No Asbestos						
B00A - R1007 - Withdrawal Space - 1hb						
No Asbestos						
B00A - R1008 - Home Base						
No Asbestos						
B00A - R1009 - Communications Room						
No Asbestos						
B00A - R1010 - Reading Area						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R1011 - K.L.A. Store

No Asbestos

B00A - R1012 - Seminar/Study

No Asbestos

B00A - R1013 - Movement

Floor Coverings Res/Textile Vinyl Tiles

1186/B00A/R0012/Floor Coverings Res/Textile/S8

No Asbestos Detected

B00A - R1014 - Home Base

No Asbestos

B00A - R1015 - Home Base

No Asbestos

B00A - R1016 - General Storeroom

No Asbestos

B00A - R1017 - Library Office/Workroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - General Learning/Communal Facilities - 1916 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00E/R0005/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting	12m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - No access - Not possible to sample					
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00B - R0001 - Movement

Wall Linings Internal	Flat AC Sheeting	8m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00B/R0001/Wall Linings Internal/S4			Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles	20m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00B/R0001/Floor Coverings Res/Textile/S5			Chrysotile (white asbestos)		

B00B - R0002 - K.L.A. Store

No Asbestos

B00B - R0003 - Cleaning Distributed Store

No Asbestos

B00B - R0004 - Security Store

No Asbestos

B00B - R0005 - Home Base

Chalk Board	Flat AC Sheeting	5m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00B/R1007/Chalk Board/S6			Chrysotile (white asbestos)		

B00B - R0006 - Home Base

Chalk Board	Flat AC Sheeting	5m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00B/R1007/Chalk Board/S6			Chrysotile (white asbestos)		

B00B - R0007 - Home Base

Chalk Board	Flat AC Sheeting	5m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00B/R1007/Chalk Board/S6			Chrysotile (white asbestos)		

B00B - R0008 - Home Base

Chalk Board	Flat AC Sheeting	5m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00B/R1007/Chalk Board/S6			Chrysotile (white asbestos)		

B00B - R0009 - Home Base

Chalk Board	Flat AC Sheeting	5m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00B/R1007/Chalk Board/S6			Chrysotile (white asbestos)		

B00B - R0010 - Craft Store

Wall Linings Internal	Flat AC Sheeting	8m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00B/R0001/Wall Linings Internal/S4			Chrysotile (white asbestos)		

B00B - R0011 - Movement

Floor Coverings Res/Textile	Vinyl Sheet					
	1186/B00B/R0011/Floor Coverings Res/Textile/S3			No Asbestos Detected		

B00B - R0012 - Canteen

No Asbestos

B00B - R0013 - Cleaning Distributed Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00B - R0014 - P.E. Store						
No Asbestos						
B00B - R0015 - Raised Platform						
No Asbestos						
B00B - R0016 - Communal Space						
No Asbestos						
B00B - R1001 - Special Programs Room						
No Asbestos						
B00B - R1002 - Movement						
No Asbestos						
B00B - R1003 - General Storeroom						
No Asbestos						
B00B - R1004 - General Storeroom						
No Asbestos						
B00B - R1005 - Home Base						
Chalk Board	Flat AC Sheeting	5m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00B/R1007/Chalk Board/S6					Chrysotile (white asbestos)
B00B - R1006 - Home Base						
Chalk Board	Flat AC Sheeting	5m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00B/R1007/Chalk Board/S6					Chrysotile (white asbestos)
B00B - R1007 - Home Base						
Chalk Board	Flat AC Sheeting	4m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00B/R1007/Chalk Board/S6					Chrysotile (white asbestos)
B00B - R1008 - Home Base						
Chalk Board	Flat AC Sheeting	3m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00B/R1007/Chalk Board/S6					Chrysotile (white asbestos)
B00B - R1009 - Home Base						
Chalk Board	Flat AC Sheeting	5m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00B/R1007/Chalk Board/S6					Chrysotile (white asbestos)
B00B - R1010 - Toilets - Boys/Girls						
No Asbestos						
B00B - R1011 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00B/R1011/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00B - R1012 - General Storeroom						
No Asbestos						
B00B - R1013 - Special Programs Room						
Floor Coverings Res/Textile	Vinyl Sheet					
	1186/B00B/R0011/Floor Coverings Res/Textile/S3					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Administration - 1976 - Brick/Veneer (Brick/Veneer)

Exterior

New Exterior

Ceiling Void No Asbestos Found

Underfloor Voids No Asbestos Found

Interior

B00C - R0001 - Movement

Ceiling Structures/Linings Flat AC Sheeting
 1186/B00C/R0001/Ceiling Structures/Linings/S9 **No Asbestos Detected**

B00C - R0002 - Entry Vestibule

No Asbestos

B00C - R0003 - Clerical Office

No Asbestos

B00C - R0004 - Sick Bay

No Asbestos

B00C - R0005 - Sick Bay - Shower/Toilet

No Asbestos

B00C - R0006 - Interview

No Asbestos

B00C - R0007 - Deputy Principal

No Asbestos

B00C - R0008 - Interview

No Asbestos

B00C - R0009 - Staff Room Annexe

No Asbestos

B00C - R0010 - Staff Room

No Asbestos

B00C - R0011 - Cleaning Distributed Store

No Asbestos

B00C - R0012 - Disabled Toilet

No Asbestos

B00C - R0013 - Staff Toilet

No Asbestos

B00C - R0014 - Staff Toilet

No Asbestos

B00C - R0015 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00C - R0016 - Security Store

No Asbestos

B00C - R0017 - Principal

No Asbestos

B00C - R0018 - Duplicating Workroom

No Asbestos

B00C - R0019 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities/Building Services - 1916 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00E/R0005/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	No Asbestos Found					

Interior

B00D - R0001 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00D/R0002/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		

B00D - R0002 - General Assistant/Bulk Store

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1186/B00D/R0002/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		

B00D - R0003 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00E - Pupil Facilities - 1916 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1186/B00E/Eaves Linings/S10				No Asbestos Detected	
Ceiling Void	AC Fragments/Debris	1m2	Above Room R0002	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	1186/B00E/Ceiling Void/S11 Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)					

Interior

B00E - R0001 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	39m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1186/B00E/R0005/Ceiling Structures/Linings/S2 Chrysotile (white asbestos) , Amosite (brown asbestos)					

B00E - R0002 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1186/B00E/R0005/Ceiling Structures/Linings/S2 Chrysotile (white asbestos) , Amosite (brown asbestos)					

B00E - R0003 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	42m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1186/B00E/R0005/Ceiling Structures/Linings/S2 Chrysotile (white asbestos) , Amosite (brown asbestos)					

B00E - R0004 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	46m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1186/B00E/R0005/Ceiling Structures/Linings/S2 Chrysotile (white asbestos) , Amosite (brown asbestos)					

B00E - R0005 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1186/B00E/R0005/Ceiling Structures/Linings/S2 Chrysotile (white asbestos) , Amosite (brown asbestos)					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - Communal Space

No Asbestos

B00F - R0002 - Raised Platform

No Asbestos

B00F - R0003 - Chair Storeroom

No Asbestos

B00F - R0004 - Communal/Performance Store

No Asbestos

B00F - R0005 - P.E. Store

No Asbestos

B00F - R0006 - Toilet - Lobby

No Asbestos

B00F - R0007 - Toilets - Girls

No Asbestos

B00F - R0008 - Sound Cupboard

No Asbestos

B00F - R0009 - Toilet - Lobby

No Asbestos

B00F - R0010 - Toilets - Boys

No Asbestos

B00F - R0011 - Cleaning Distributed Store

No Asbestos

B00F - R0012 - Other

No Asbestos

B00F - R0013 - Main Switch Board

No Asbestos

B00F - R0014 - Access Shower/Toilet/Change

No Asbestos

B00F - R0015 - Covered Outdoor Learning Area

No Asbestos

B00F - R0016 - Movement

No Asbestos

B00F - R0017 - Movement

No Asbestos

B00F - R0018 - Ramp

No Asbestos

B00F - R0019 - Canteen

No Asbestos

B00F - R0020 - Canteen Office/Store

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017