


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bendemeer Public School (1191)
Region : New England
State Electorate : Tamworth
Local Government Area : Tamworth

Initial Survey : Noel Arnold & Associates : 05 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 08 - Aug - 2016

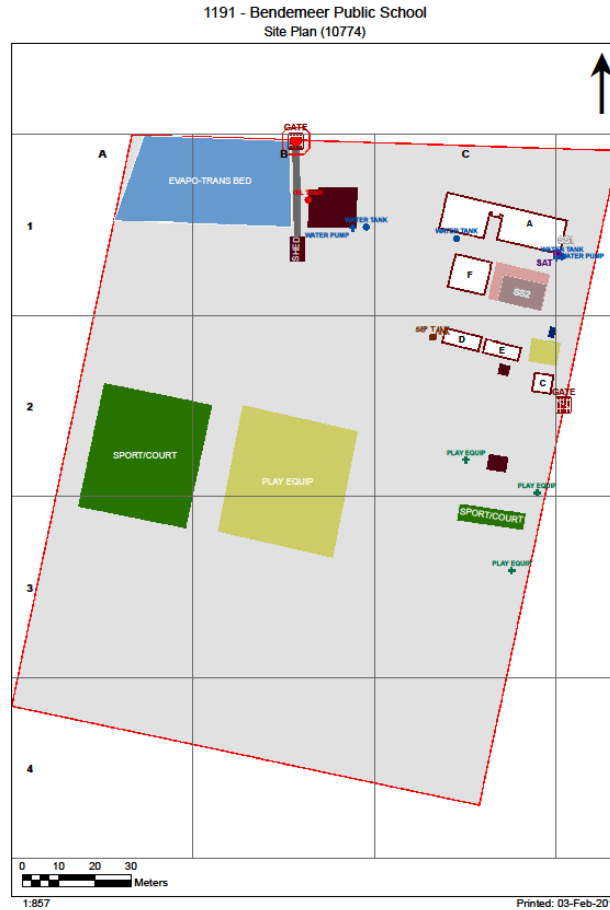

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Library - 1923 - Timber (Timber)

Exterior

Ceiling Void - Packing to floor joists	Flat AC Sheeting					
	1191/B00A/Ceiling Void - Packing to floor joists/S7					No Asbestos Detected
Ceiling Void	AC Fragments/Debris					
	1191/B00A/Ceiling Void/S8					No Asbestos Detected
Underfloor Void	AC Fragments/Debris	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	1191/B00A/Underfloor Void/S9					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

Interior

B00A - R0001 - General Storeroom

Floor Coverings Res/Textile	Vinyl Sheet					
	1191/B00A/R0009/Floor Coverings Res/Textile/S1					No Asbestos Detected

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1191/B00A/R0009/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0002 - Kiln Room

Floor Coverings Res/Textile	Vinyl Sheet					
	1191/B00A/R0009/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00A - R0004 - Reading Area

No Asbestos

B00A - R0005 - Home Base

No Asbestos

B00A - R0006 - Uniform Shop

No Asbestos

B00A - R0007 - Security Store

No Asbestos

B00A - R0008 - Home Base

No Asbestos

B00A - R0012 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting					
	1191/B00A/R0012/Ceiling Structures/Linings/S10					No Asbestos Detected

Wall Linings Internal	Flat AC Sheeting					
	1191/B00A/R0012/Ceiling Structures/Linings/S10					No Asbestos Detected

B00A - R0013 - Movement

No Asbestos

B00A - R0014 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1191/B00A/R0014/Ceiling Structures/Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Administration/Communal Facilities - 1985 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B00C - R0001 - General Storeroom

No Asbestos

B00C - R0002 - Sports Store

No Asbestos

B00C - R0003 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1950 - Timber (Timber)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Wall Cladding	Compressed AC Sheet 1191/B00D/Wall Cladding/S3					No Asbestos Detected
Eaves Linings	Flat AC Sheeting 1191/B00D/Eaves Linings/S5					No Asbestos Detected
Ceiling Void	No Asbestos Found					

Interior**B00D - R0005 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting 1191/B00D/R0006/Ceiling Structures/Linings/S12					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 1191/B00D/R0006/Ceiling Structures/Linings/S12					No Asbestos Detected

B00D - R0006 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting 1191/B00D/R0006/Ceiling Structures/Linings/S12					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 1191/B00D/R0006/Ceiling Structures/Linings/S12					No Asbestos Detected

B00D - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1191/B00D/R0006/Ceiling Structures/Linings/S12					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 1191/B00D/R0006/Ceiling Structures/Linings/S12					No Asbestos Detected

B00D - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1191/B00D/R0006/Ceiling Structures/Linings/S12					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 1191/B00D/R0006/Ceiling Structures/Linings/S12					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1950 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1191/B00E/Eaves Linings/S6					Chrysotile (white asbestos)

Interior

B00E - R0001 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Multi Purpose Facilities - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00F - R0005 - Reading Area

No Asbestos

B00F - R0006 - Library Office/Workroom

No Asbestos

B00F - R0007 - Staff Kitchen

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017