


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Berala Public School (1199)
Region : South Western Sydney
State Electorate : Auburn
Local Government Area : Auburn

Initial Survey : Noel Arnold & Associates : 30 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 28 - Aug - 2015

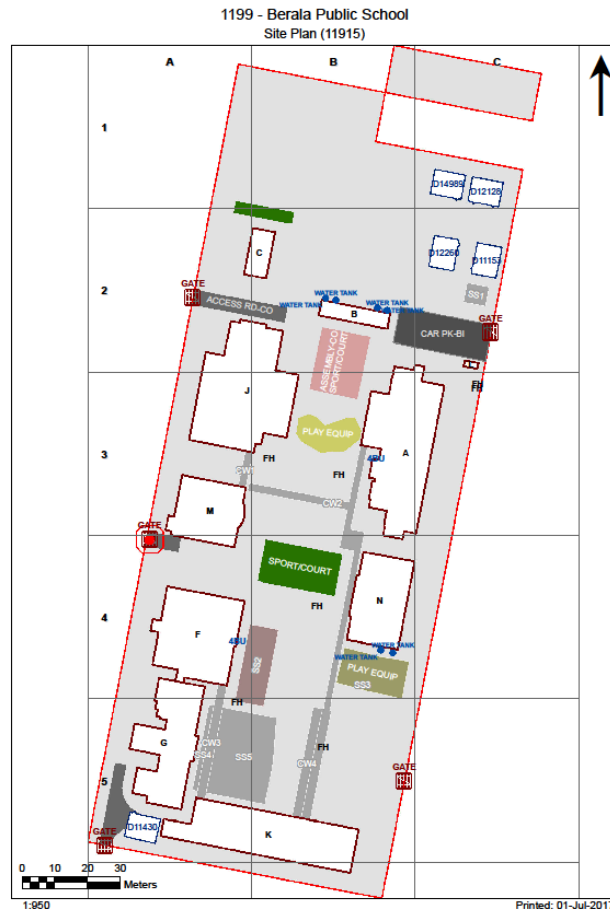

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Tiered Learning - 1924 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	Vinyl Tiles	1m2	South-West	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	1199/B00A/Underfloor Voids/S16					Chrysotile (white asbestos)
Damp Proof Course	Resinous Membrane					
	1199/B00A/Damp Proof Course/S17					No Asbestos Detected

Interior**B00A - R0001 - General Storeroom (3.79 m2)**

No Asbestos

B00A - R0002 - Craft Store (3.81 m2)

No Asbestos

B00A - R0003 - Withdrawal Space - 2hb (38.59 m2)

No Asbestos

B00A - R0004 - Home Base (47.63 m2)

No Asbestos

B00A - R0005 - Practical Activities - 1hb (47.31 m2)

Floor Coverings Res/Textile	Vinyl Tiles	48m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1199/B00A/R0005/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00A - R0006 - Home Base (47.32 m2)

No Asbestos

B00A - R0007 - Staff Room Annexe (11.82 m2)

No Asbestos

B00A - R0008 - General Storeroom (7.15 m2)

No Asbestos

B00A - R0009 - Security Store (2.86 m2)

No Asbestos

B00A - R0010 - Staff Room Annexe (18.45 m2)

No Asbestos

B00A - R0011 - Cleaning Distributed Store (6.31 m2)

No Asbestos

B00A - R0012 - Home Base (47.68 m2)

No Asbestos

B00A - R0013 - Movement (3.91 m2)

No Asbestos

B00A - R0014 - Movement (27.75 m2)

Floor Coverings Res/Textile	Vinyl Tiles	28m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1199/B00A/R0005/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00A - R0015 - Movement (18.05 m2)

No Asbestos

B00A - R0016 - Toilets - Boys (9 m2)

Partition Walls (Cubicles)	Compressed AC Sheet					
	1199/B00B/R0001/Partition Walls (Cubicles)/S1					No Asbestos Detected

B00A - R0017 - Movement (6.48 m2)

No Asbestos

B00A - R0020 - Toilets - Girls (9.4 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet					
	1199/B00B/R0001/Partition Walls (Cubicles)/S1					No Asbestos Detected
B00A - R0021 - Home Base (62.42 m2)						
No Asbestos						
B00A - R0022 - Movement (55.63 m2)						
No Asbestos						
B00A - R0023 - Home Base (55.86 m2)						
No Asbestos						
B00A - R0025 - General Storeroom (10.91 m2)						
No Asbestos						
B00A - R0026 - Security Store (12.27 m2)						
No Asbestos						
B00A - R0027 - Cleaning Distributed Store (3.21 m2)						
No Asbestos						
B00A - R0028 - General Storeroom (6.42 m2)						
No Asbestos						
B00A - R0029 - Movement (4.5 m2)						
No Asbestos						
B00A - R0031 - Movement (4.33 m2)						
No Asbestos						
B00A - R0032 - Movement (17.91 m2)						
No Asbestos						
B00A - R0033 - Drinking Facilities (4.65 m2)						
No Asbestos						
B00A - R0034 - Drinking Facilities (4.66 m2)						
No Asbestos						
B00A - R0035 - Movement (18.89 m2)						
No Asbestos						
B00A - R0036 - Movement (2.17 m2)						
No Asbestos						
B00A - R0037 - Stairs (3.49 m2)						
No Asbestos						
B00A - R0038 - Covered Outdoor Learning Area (104.09 m2)						
No Asbestos						
B00A - R0039 - Main Switch Board (5.11 m2)						
No Asbestos						
B00A - R0040 - Movement (11.44 m2)						
No Asbestos						
B00A - R0041 - Stairs (0.14 m2)						
No Asbestos						
B00A - R1001 - Home Base (48.79 m2)						
No Asbestos						
B00A - R1002 - Home Base (48.86 m2)						
No Asbestos						
B00A - R1003 - Home Base (49.33 m2)						
No Asbestos						
B00A - R1004 - Home Base (49 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1005 - Home Base (48.86 m2)						
No Asbestos						
B00A - R1006 - Home Base (49.06 m2)						
No Asbestos						
B00A - R1007 - Movement (104.1 m2)						
No Asbestos						
B00A - R1008 - Craft Store (2.56 m2)						
No Asbestos						
B00A - R1009 - Withdrawal Space - 1hb (8.74 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1199/B00A/R1011/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00A - R1010 - General Storeroom (13.66 m2)						
No Asbestos						
B00A - R1011 - General Storeroom (19.51 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1199/B00A/R1011/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00A - R1012 - Withdrawal Space - 2hb (41.73 m2)						
No Asbestos						
B00A - R1013 - Special Programs Room (60.89 m2)						
No Asbestos						
B00A - R1014 - General Storeroom (14.62 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1199/B00A/R1011/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00A - R1015 - Cleaning Distributed Store (1.87 m2)						
No Asbestos						
B00A - R1016 - Staff Toilet (8.43 m2)						
Wall Linings Internal	Flat AC Sheeting	4m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
1199/B00A/R1017/Wall Linings Internal/S4					Chrysotile (white asbestos)	
Trafalgar Incinerette	Encapsulated Insulation material within unit	1Unit(s)	East	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Encapsulated material within						
B00A - R1017 - Staff Toilet (7.86 m2)						
Wall Linings Internal	Flat AC Sheeting	6m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
1199/B00A/R1017/Wall Linings Internal/S4					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
1199/B00A/R1017/Floor Coverings Res/Textile/S5					No Asbestos Detected	
B00A - R1018 - Stairs (11.43 m2)						
No Asbestos						
B00A - R1019 - Stairs (11.09 m2)						
No Asbestos						
B00A - R9001 - Garden Store (9.09 m2)						
No Asbestos						
B00A - R9002 - Cleaning Supplies (6.48 m2)						
No Asbestos						
B00A - R9003 - Cleaning Supplies (4.26 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1950 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 1199/B00B/Eaves Linings/S12					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00B - R0001 - Toilets - Girls (27.68 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet 1199/B00B/R0001/Partition Walls (Cubicles)/S1					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 1199/B00B/R0002/Ceiling Structures/Linings/S18					No Asbestos Detected

B00B - R0002 - Drinking Facilities (16.4 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1199/B00B/R0002/Ceiling Structures/Linings/S18					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00B - R0003 - Toilets - Boys (24.27 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 1199/B00B/R0001/Partition Walls (Cubicles)/S1					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 1199/B00B/R0002/Ceiling Structures/Linings/S18					No Asbestos Detected

B00B - R0004 - General Assistant/Bulk Store (13.31 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1199/B00B/R0002/Ceiling Structures/Linings/S18					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Other-After School Care - 1913 - Timber (Timber)

Exterior

In-fill-panel	Flat AC Sheeting 1199/B00C/In-fill-panel/S14					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00C - R0001 - Out Of School Hours Care Centre (46.09 m2)

Wall Linings Internal	Flat AC Sheeting 1199/B00C/R0002/Wall Linings Internal/S21					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00C - R0002 - Out Of School Hours Care Centre (46.55 m2)

Wall Linings Internal	Flat AC Sheeting 1199/B00C/R0002/Wall Linings Internal/S21					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning/Staff Facilities - 1945 - Brick/Block (Brick/Block)**Exterior**

In-fill-panel	Compressed AC Sheet	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1199/B00F/In-fill-panel/S15					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00F - R0001 - Home Base (79.28 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1199/B00F/R0008/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - R0002 - Practical Activities - 1hb (31.95 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1199/B00F/R0008/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	1199/B00F/R0002/Floor Coverings Res/Textile/S7					

B00F - R0003 - Toilets - Boys (37.57 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1199/B00F/R0008/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	1199/B00B/R0001/Partition Walls (Cubicles)/S1					

B00F - R0004 - Main Switch Board (0.77 m2)

Door Lining	Flat AC Sheeting	3Unit(s)	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1199/B00F/R0004/Door Lining/S9					Chrysotile (white asbestos)

Electrical Backing Board	Resinous Board	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1199/B00F/R0004/Electrical Backing Board/S22					Chrysotile (white asbestos)

B00F - R0005 - Toilets - Girls (34.78 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1199/B00F/R0008/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	1199/B00B/R0001/Partition Walls (Cubicles)/S1					

B00F - R0006 - Cleaning Distributed Store (2.05 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1199/B00F/R0008/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - R0007 - Home Base (87.5 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1199/B00F/R0008/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - R0008 - Toilets - Boys/Girls (2.67 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1199/B00F/R0008/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - R0009 - Practical Activities - 1hb (16.85 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 1199/B00F/R0008/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00F - R0010 - Staff Toilet (3.51 m2)						
Ceiling Structures/Linings	Vermiculite 1199/B00F/R0008/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet 1199/B00B/R0001/Partition Walls (Cubicles)/S1					No Asbestos Detected
B00F - R0011 - Staff Toilet (4.2 m2)						
Trafalgar Incinerette	Encapsulated Insulation material within unit	1Unit(s)	East	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <i>Assumed Asbestos - Encapsulated Asbestos material</i>
Ceiling Structures/Linings	Vermiculite 1199/B00F/R0008/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet 1199/B00B/R0001/Partition Walls (Cubicles)/S1					No Asbestos Detected
B00F - R0012 - Movement (6.07 m2)						
Ceiling Structures/Linings	Vermiculite 1199/B00F/R0008/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00F - R0013 - Staff Kitchen (8.65 m2)						
Ceiling Structures/Linings	Vermiculite 1199/B00F/R0008/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00F - R0014 - Staff Room (49.93 m2)						
Ceiling Structures/Linings	Vermiculite 1199/B00F/R0008/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00F - R0016 - Movement (175.09 m2)						
No Asbestos						
B00F - R1001 - Movement (11.18 m2)						
No Asbestos						
B00F - R1002 - Movement (2.19 m2)						
Ceiling Structures/Linings	Vermiculite 1199/B00F/R0008/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00F - R1003 - Home Base (66.59 m2)						
Ceiling Structures/Linings	Vermiculite 1199/B00F/R0008/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00F - R1004 - Toilets - Boys (3.3 m2)						
Ceiling Structures/Linings	Vermiculite 1199/B00F/R0008/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00F - R1005 - Movement (17.22 m2)						
Ceiling Structures/Linings	Vermiculite 1199/B00F/R0008/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00F - R1006 - Staff Toilet (3.32 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	1199/B00F/R0008/Ceiling Structures/Linings/S6			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1007 - Home Base (66.74 m2)						
Ceiling Structures/Linings	Vermiculite	1199/B00F/R0008/Ceiling Structures/Linings/S6			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1008 - Withdrawal Space - 2hb (27.73 m2)						
Ceiling Structures/Linings	Vermiculite	1199/B00F/R0008/Ceiling Structures/Linings/S6			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1009 - Home Base (67.05 m2)						
Ceiling Structures/Linings	Vermiculite	1199/B00F/R0008/Ceiling Structures/Linings/S6			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1010 - Toilets - Girls (3.32 m2)						
Ceiling Structures/Linings	Vermiculite	1199/B00F/R0008/Ceiling Structures/Linings/S6			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1011 - Movement (10.98 m2)						
No Asbestos						
B00F - R1012 - Movement (2.45 m2)						
Ceiling Structures/Linings	Vermiculite	1199/B00F/R0008/Ceiling Structures/Linings/S6			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1013 - Movement (16.89 m2)						
Ceiling Structures/Linings	Vermiculite	1199/B00F/R0008/Ceiling Structures/Linings/S6			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1014 - Toilets - Boys (3.32 m2)						
Ceiling Structures/Linings	Vermiculite	1199/B00F/R0008/Ceiling Structures/Linings/S6			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1015 - Home Base (67.04 m2)						
Ceiling Structures/Linings	Vermiculite	1199/B00F/R0008/Ceiling Structures/Linings/S6			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1016 - Practical Activities - 1hb (7.49 m2)						
Ceiling Structures/Linings	Vermiculite	1199/B00F/R0008/Ceiling Structures/Linings/S6			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1017 - Practical Activities - 1hb (7.54 m2)						
Ceiling Structures/Linings	Vermiculite	1199/B00F/R0008/Ceiling Structures/Linings/S6			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1018 - Practical Activities - 1hb (7.53 m2)						
Ceiling Structures/Linings	Vermiculite	1199/B00F/R0008/Ceiling Structures/Linings/S6			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1019 - Practical Activities - 1hb (7.49 m2)						
Ceiling Structures/Linings	Vermiculite	1199/B00F/R0008/Ceiling Structures/Linings/S6			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00G - General Learning - 1945 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	North-West & South-West Corners	Good Condition (1)	Low (1)	Low Priority (2-3)
	1199/B00G/Eaves Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00G - R0001 - Home Base (47.18 m2)**

No Asbestos

B00G - R0002 - Home Base (47.25 m2)

No Asbestos

B00G - R0003 - Home Base (47.48 m2)

No Asbestos

B00G - R0004 - Home Base (47.33 m2)

No Asbestos

B00G - R0005 - Home Base (47.48 m2)

No Asbestos

B00G - R0006 - Movement (86.34 m2)

Ceiling Structures/Linings	Flat AC Sheeting	87m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1199/B00G/R0013/Ceiling Structures/Linings/S19				Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Vinyl Tiles					
	1199/B00G/R0007/Floor Coverings Res/Textile/S8				No Asbestos Detected	

B00G - R0007 - General Storeroom (6.21 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	1199/B00G/R0007/Floor Coverings Res/Textile/S8				No Asbestos Detected	

B00G - R0008 - Cleaning Distributed Store (2.84 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	1199/B00G/R0007/Floor Coverings Res/Textile/S8				No Asbestos Detected	

B00G - R0009 - Movement (4.43 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1199/B00G/R0013/Ceiling Structures/Linings/S19				Chrysotile (white asbestos)	

B00G - R0011 - Home Base (66.77 m2)

No Asbestos

B00G - R0012 - Movement (4.54 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1199/B00G/R0013/Ceiling Structures/Linings/S19				Chrysotile (white asbestos)	

B00G - R0013 - Staff Toilet (1.57 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1199/B00G/R0013/Ceiling Structures/Linings/S19				Chrysotile (white asbestos)	

B00G - R0014 - Duplicating Workroom (6.51 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1199/B00G/R0013/Ceiling Structures/Linings/S19				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00G - R0015 - General Assistant/Bulk Store (2.28 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1199/B00G/R0013/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
B00G - R0017 - Staff Room Annexe (15.35 m2)						
No Asbestos						
B00G - R0018 - Interview (12.27 m2)						
No Asbestos						
B00G - R0019 - General Assistant/Bulk Store (9.24 m2)						
No Asbestos						
B00G - R0020 - General Assistant/Bulk Store (19.89 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
1199/B00G/R0020/Ceiling Structures/Linings/S20					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00J - Communal Facilities/Pupil Facilities - 2003 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00J - R0001 - Covered Outdoor Learning Area (354.19 m2)**

No Asbestos

B00J - R0002 - Toilets - Boys (12.76 m2)

No Asbestos

B00J - R0003 - P.E. Store (17.75 m2)

No Asbestos

B00J - R0004 - Cleaning Distributed Store (4.05 m2)

No Asbestos

B00J - R0005 - Communal/Performance Store (14.82 m2)

No Asbestos

B00J - R0006 - Distribution Board (3.27 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00J - R0007 - Kiln Room (6.09 m2)

No Asbestos

B00J - R0008 - Movement (36.6 m2)

No Asbestos

B00J - R0009 - Raised Platform (49.51 m2)

No Asbestos

B00J - R0010 - Movement (4.58 m2)

No Asbestos

B00J - R0011 - Hall Chair Store (11.36 m2)

No Asbestos

B00J - R0012 - Communal Space (215.2 m2)

No Asbestos

B00J - R0013 - Communications Cupboard (2.03 m2)

No Asbestos

B00J - R0014 - Access Shower/Toilet (5.43 m2)

No Asbestos

B00J - R0015 - Toilets - Girls (14.52 m2)

No Asbestos

B00J - R0016 - General Assistant/Bulk Store (16.69 m2)

No Asbestos

B00J - R0017 - Movement (20.97 m2)

No Asbestos

B00J - R0018 - Canteen Office/Store (11.09 m2)

No Asbestos

B00J - R0019 - Sports Store (17.1 m2)

No Asbestos

B00J - R0020 - Canteen (44.51 m2)

No Asbestos

B00J - R0021 - Movement (7.17 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning/Library - 2003 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00K - R0001 - Movement (130.25 m2)**

No Asbestos

B00K - R0002 - Reading Area (285.73 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0003 - Distribution Board (0.79 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00K - R0004 - Library Office/Workroom (26.75 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0005 - K.L.A. Store (27.7 m2)

No Asbestos

B00K - R0006 - Communications Room (7.9 m2)

No Asbestos

B00K - R0007 - Laundry - Type 2 (7.68 m2)

No Asbestos

B00K - R0008 - Access Shower/Toilet - Type 2 (19.51 m2)

No Asbestos

B00K - R0009 - Home Base (57.18 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0010 - Home Base Store (5 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0011 - Plant (0.74 m2)

No Asbestos

B00K - R0012 - Withdrawal Space - 1hb (8.96 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0013 - Practical Activities - 2hb (20.74 m2)

No Asbestos

B00K - R0014 - Distribution Board (0.79 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00K - R0015 - Staff Toilet (6.18 m2)

No Asbestos

B00K - R0016 - Cleaning Distributed Store (3.57 m2)

No Asbestos

B00K - R0017 - Stairs (18.22 m2)

No Asbestos

B00K - R0018 - Community Clinic (32.21 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0019 - Security Store (6.53 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00K - R1001 - Practical Activities - 1hb (19.15 m2)						
No Asbestos						
B00K - R1002 - Home Base Store (5.99 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00K - R1003 - Home Base (60.06 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00K - R1004 - Withdrawal Space - 2hb (11.76 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00K - R1005 - Home Base (59.83 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00K - R1006 - Home Base Store (6.15 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00K - R1007 - Practical Activities - 1hb (18.85 m2)						
No Asbestos						
B00K - R1008 - Distribution Board (0.62 m2)						
No Asbestos					Note: No inspection of live electrical installation.	
B00K - R1009 - Practical Activities - 1hb (18.29 m2)						
No Asbestos						
B00K - R1010 - Home Base Store (6.15 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00K - R1011 - Home Base (59.96 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00K - R1012 - Withdrawal Space - 2hb (11.72 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00K - R1013 - Home Base (60.01 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00K - R1014 - Home Base Store (6.13 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00K - R1015 - Practical Activities - 1hb (18.82 m2)						
No Asbestos						
B00K - R1016 - Withdrawal Space - 1hb (8.87 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00K - R1017 - Home Base Store (5.75 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00K - R1018 - Home Base (57.49 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00K - R1019 - Practical Activities - 1hb (19.53 m2)						
No Asbestos						
B00K - R1020 - Distribution Board (0.55 m2)						
No Asbestos					Note: No inspection of live electrical installation.	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - R1021 - Stairs (16.01 m2)

No Asbestos

B00K - R1022 - Movement (112.74 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Building Services - 2004 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00L - R0001 - Plant (6.71 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Administration - 2005 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00M - R0001 - Entry Vestibule (23.29 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00M - R0002 - Clerical Office/Workroom (58.27 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00M - R0003 - Sick Bay (9.1 m2)

No Asbestos

B00M - R0004 - Security Store (13.19 m2)

No Asbestos

B00M - R0005 - Staff Toilet (4.21 m2)

No Asbestos

B00M - R0006 - Disabled Shower/Toilet (5.06 m2)

No Asbestos

B00M - R0007 - Cleaning Distributed Store (2.5 m2)

No Asbestos

B00M - R0008 - Movement (28.03 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00M - R0009 - Deputy Principal (12.86 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00M - R0010 - Deputy Principal (12.91 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00M - R0011 - Principal (17.12 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00M - R0012 - Interview (12.62 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00M - R0013 - Distribution Board (0.47 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00M - R0014 - Stairs (16.01 m2)

No Asbestos

B00M - R0015 - Movement (141.22 m2)

No Asbestos

B00M - R1001 - Staff Room (79.54 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00M - R1002 - Staff Room Annexe (26.17 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00M - R1003 - Cleaning Distributed Store (1.92 m2)

No Asbestos

B00M - R1004 - Staff Toilet (3.66 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00M - R1005 - Staff Toilet (4.45 m2)

No Asbestos

B00M - R1006 - Staff Toilet (4.45 m2)

No Asbestos

B00M - R1007 - Interview (12.71 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R1008 - Clerical Office (18.91 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R1009 - Movement (15.11 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R1010 - Distribution Board (0.31 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00M - R1011 - Movement (42.96 m2)

No Asbestos

B00M - R1012 - Stairs (15.51 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00N - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00N - R0001 - Practical Activities - 1hb (18.86 m2)**

No Asbestos

B00N - R0002 - Home Base (59.46 m2)

No Asbestos

B00N - R0003 - Home Base Store (6.11 m2)

No Asbestos

B00N - R0004 - Withdrawal Space - 1hb (7.62 m2)

No Asbestos

B00N - R0005 - Practical Activities - 2hb (18.6 m2)

No Asbestos

B00N - R0006 - Home Base (60.45 m2)

No Asbestos

B00N - R0007 - Home Base Store (6.31 m2)

No Asbestos

B00N - R0008 - Withdrawal Space - 2hb (11.7 m2)

No Asbestos

B00N - R0009 - Practical Activities/Movement - 1hb (19.1 m2)

No Asbestos

B00N - R0010 - Home Base (60.88 m2)

No Asbestos

B00N - R0011 - Home Base Store (6.26 m2)

No Asbestos

B00N - R0012 - Distribution Board (0.36 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00N - R0013 - External Movement (106.88 m2)

No Asbestos

B00N - R0014 - External Stairs (13.98 m2)

No Asbestos

B00N - R0015 - External Stairs (14.36 m2)

No Asbestos

B00N - R1001 - Home Base (59.33 m2)

No Asbestos

B00N - R1002 - Home Base Store (6.11 m2)

No Asbestos

B00N - R1003 - Withdrawal Space - 2hb (7.71 m2)

No Asbestos

B00N - R1004 - Practical Activities - 4hb (19.3 m2)

No Asbestos

B00N - R1005 - Home Base (60.45 m2)

No Asbestos

B00N - R1006 - Home Base Store (6.31 m2)

No Asbestos

B00N - R1007 - Withdrawal Space - 2hb (11.78 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00N - R1008 - Practical Activities - 4hb (19.28 m2)

No Asbestos

B00N - R1009 - Home Base (60.73 m2)

No Asbestos

B00N - R1010 - Home Base Store (6.09 m2)

No Asbestos

B00N - R1011 - External Movement (56.6 m2)

No Asbestos

B00N - R1012 - Practical Activities - 3hb (19.14 m2)

No Asbestos

B00N - R1013 - External Stairs (19.4 m2)

No Asbestos

B00N - R1014 - External Stairs (18.87 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+1 - D12260 Demountable

Exterior

Eaves Linings	Flat AC Sheeting		1199/Build+1/Eaves Linings/S10			No Asbestos Detected
Steps to Building Entrance	Compressed AC Sheet		1199/Build+1/Steps to Building Entrance/S11			No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+2 - D11153 Demountable

Exterior

Eaves Linings	Flat AC Sheeting		1199/Build+1/Eaves Linings/S10			No Asbestos Detected
Steps to Building Entrance	Compressed AC Sheet		1199/Build+1/Steps to Building Entrance/S11			No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D11153 - Learning Unit - Standard/Withdrawal : Placement Date - 25/03/2003

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 601 - D11430 - Learning Unit - Standard/Withdrawal : Placement Date - 9/04/2007

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 602 - D12010 - Learning Unit - Standard With P.A.A. : Placement Date - 30/12/2016

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 751 - D12128 - Learning Unit - ESL : Placement Date - 4/04/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Esl						
No Asbestos Found.						
R2 - Esl						
No Asbestos Found.						
OS 601 - D12260 - Learning Unit - Standard/Withdrawal : Placement Date - 6/01/2001						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 602 - D13243 - Learning Unit - Standard With P.A.A. : Placement Date - 4/04/2016						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 602 - D14989 - Learning Unit - Standard With P.A.A. : Placement Date - 4/04/2016						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

1199_ASB_010713_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017