


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Beresfield Public School (1201)
Region : Hunter/Central Coast
State Electorate : Wallsend
Local Government Area : Newcastle

Initial Survey : Noel Arnold & Associates : 26 - May - 2008
Reviewed By : Grencap-NAA : 10 - Feb - 2015

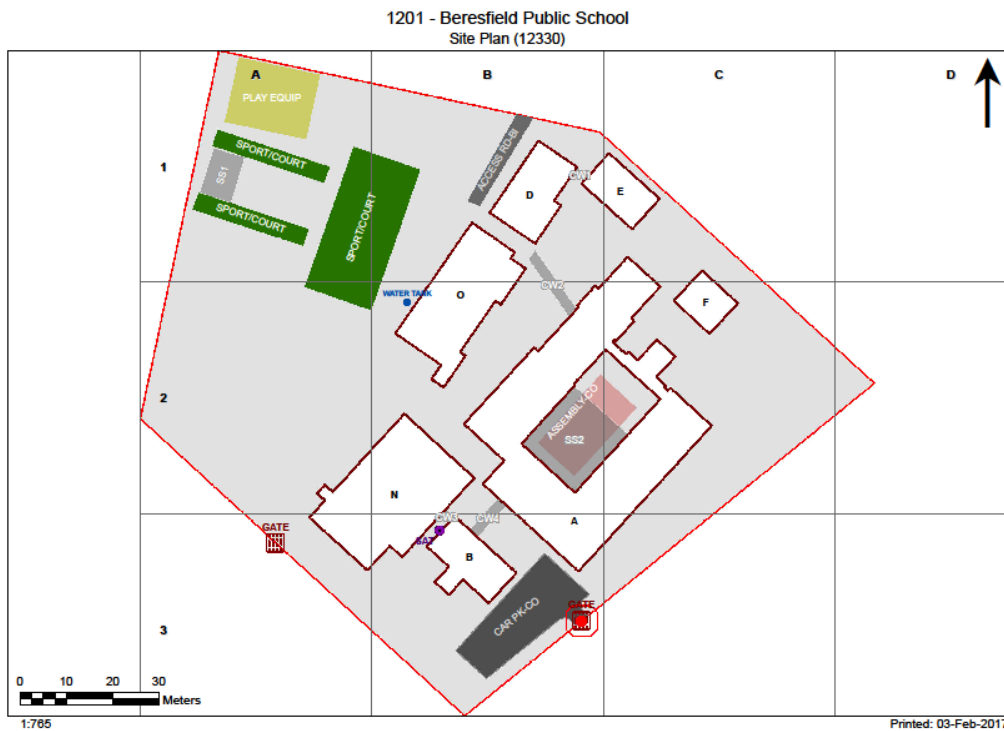

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - General Learning/Administration - 1965 - Brick/Block (Brick/Block)**Exterior**

Awnings	Flat AC Sheeting	150m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0042/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00A - R0001 - General Storeroom (12.87 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1201/B00A/R0015/Floor Coverings Res/Textile/S15			Chrysotile (white asbestos)		

B00A - R0002 - Movement (8.7 m2)

No Asbestos

B00A - R0003 - Movement (4.12 m2)

Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00A - R0004 - Home Base (56.87 m2)

Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0023/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)

B00A - R0005 - Home Base Store (5.19 m2)

Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0023/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)

B00A - R0006 - Movement (16.77 m2)

Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Wall Linings Internal	Flat AC Sheeting					
	1201/B00A/R0008/Wall Linings Internal/S19					No Asbestos Detected

B00A - R0007 - Movement (191.28 m2)

Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00A - R0008 - Home Base (56.87 m2)

Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Wall Linings Internal	Flat AC Sheeting					
	1201/B00A/R0008/Wall Linings Internal/S19					No Asbestos Detected

B00A - R0009 - Home Base Store (5.21 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0010 - Home Base (56.79 m2)						
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1201/B00C/R0001/Floor Coverings Res/Textile/S7					No Asbestos Detected
B00A - R0011 - Home Base Store (5.19 m2)						
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0012 - Practical Activities - 1hb (7.98 m2)						
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0013 - Main Switch Board (5.45 m2)						
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0014 - Movement (38.62 m2)						
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0015 - Entry Vestibule (17.81 m2)						
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0015/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	1201/B00A/R0015/Floor Coverings Res/Textile/S16					No Asbestos Detected
B00A - R0016 - Clerical Office/Workroom (26.6 m2)						
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0015/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	1201/B00A/R0015/Floor Coverings Res/Textile/S16					No Asbestos Detected
B00A - R0017 - General Storeroom (5 m2)						
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0023/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	1201/B00A/R0023/Floor Coverings Res/Textile/S18					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0018 - Staff Toilet (4.48 m2)						
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0019 - Staff Room Annexe (7 m2)						
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0020 - Movement (28.31 m2)						
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0015/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	1201/B00A/R0015/Floor Coverings Res/Textile/S16					No Asbestos Detected
B00A - R0021 - Interview (14.47 m2)						
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0015/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	1201/B00A/R0015/Floor Coverings Res/Textile/S16					No Asbestos Detected
B00A - R0022 - Principal (21.23 m2)						
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	1201/B00A/R0015/Floor Coverings Res/Textile/S16					No Asbestos Detected
B00A - R0023 - General Storeroom (1.46 m2)						
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0023/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	1201/B00A/R0023/Floor Coverings Res/Textile/S18					No Asbestos Detected
B00A - R0024 - Staff Room Annexe (6.74 m2)						
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0023/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive					
	1201/B00A/R0023/Floor Coverings Res/Textile/S18					No Asbestos Detected
B00A - R0025 - Staff Toilet (10.74 m2)						
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0026 - Movement (21.88 m2)						
No Asbestos						
B00A - R0027 - Sick Bay (20.39 m2)						
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0023/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	1201/B00A/R0023/Floor Coverings Res/Textile/S18					No Asbestos Detected
B00A - R0028 - Cleaning Distributed Store (6.55 m2)						
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0029 - Staff Room (56.72 m2)						
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0015/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)
B00A - R0031 - Distribution Board (0.4 m2)						
Note: No inspection of live electrical installation.						
Floor Coverings Res/Textile	Vinyl Tiles	0.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0015/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00A - R0032 - Movement (16.51 m2)						
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0015/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)
B00A - R0033 - Home Base - S (56.64 m2)						
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0035 - Movement (7.89 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0042/Ceiling Structures/Linings/S6					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0036 - Movement (69.83 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0042/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0037 - Staff Toilet (6.12 m2)						
No Asbestos						
B00A - R0038 - Canteen Office/Store (3.24 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	1201/B00C/R0001/Floor Coverings Res/Textile/S7			No Asbestos Detected		
B00A - R0039 - Canteen (33.32 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	1201/B00C/R0001/Floor Coverings Res/Textile/S7			No Asbestos Detected		
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					
B00A - R0040 - Toilets - Girls (54.6 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0042/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0042/Partition Walls (Cubicles)/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0041 - Sports Store (12.64 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0042/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0042 - Toilets - Boys (50.45 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0042/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0042/Partition Walls (Cubicles)/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0043 - Garden Store (3.65 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0042/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0044 - Plant (13.69 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0042/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0045 - Garden Store (11.29 m2)						
No Asbestos						
B00A - R0046 - Movement (8.43 m2)						
Ceiling Structures/Linings	Vermiculite					
	1201/B00A/R0013/Ceiling Structures/Linings/S14			Limited Samples Taken		
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00A - R0047 - Disabled Toilet (9.48 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0048 - Movement (36 m2)						
No Asbestos						
B00A - R0049 - Covered Outdoor Learning Area (31.79 m2)						
No Asbestos						
B00A - R0050 - Covered Outdoor Learning Area (8.85 m2)						
Ceiling Structures/Linings	Vermiculite 1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0051 - Covered Outdoor Learning Area (8.85 m2)						
Ceiling Structures/Linings	Vermiculite 1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0052 - Covered Outdoor Learning Area (17.83 m2)						
Ceiling Structures/Linings	Vermiculite 1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0053 - Covered Outdoor Learning Area (8.85 m2)						
Ceiling Structures/Linings	Vermiculite 1201/B00A/R0013/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1001 - Movement (204.29 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1201/B00A/R0042/Ceiling Structures/Linings/S6	204m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>
Infil panels	Flat AC Sheeting 1201/B00A/R1001/Infil panels/S20					No Asbestos Detected
B00A - R1002 - Home Base - M (56.81 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1201/B00A/R0015/Floor Coverings Res/Textile/S15	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00A - R1003 - Home Base Store - M (5.2 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1201/B00A/R0042/Ceiling Structures/Linings/S6	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>
Floor Coverings Res/Textile	Vinyl Tiles 1201/B00A/R0015/Floor Coverings Res/Textile/S15	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00A - R1004 - Movement (16.7 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 1201/B00A/R0015/Floor Coverings Res/Textile/S15	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Electrical Backing Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Assumed Asbestos - Electrical Hazard</i>
B00A - R1005 - Home Base Store (5.18 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1201/B00A/R0042/Ceiling Structures/Linings/S6	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1201/B00A/R0015/Floor Coverings Res/Textile/S15	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1006 - Home Base (56.89 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1201/B00A/R0015/Floor Coverings Res/Textile/S15	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1007 - Home Base (56.89 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1201/B00A/R0015/Floor Coverings Res/Textile/S15	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1008 - Home Base Store (5.21 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1201/B00A/R0042/Ceiling Structures/Linings/S6	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R1009 - Movement (16.53 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 1201/B00A/R0015/Floor Coverings Res/Textile/S15	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Electric Off Peak Heater	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B00A - R1010 - Home Base (62.57 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1201/B00A/R0015/Floor Coverings Res/Textile/S15	63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1011 - Home Base Store (5.26 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1201/B00A/R0042/Ceiling Structures/Linings/S6	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles 1201/B00A/R0015/Floor Coverings Res/Textile/S15	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1012 - Special Programs Room (57.04 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 1201/B00A/R0023/Floor Coverings Res/Textile/S17	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1013 - Home Base Store (4.67 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1201/B00A/R0042/Ceiling Structures/Linings/S6	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles 1201/B00A/R0023/Floor Coverings Res/Textile/S17	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1014 - Movement (8.04 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 1201/B00A/R0015/Floor Coverings Res/Textile/S15	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1015 - General Storeroom (4.19 m2)						
No Asbestos						
B00A - R1016 - Staff Toilet (10.41 m2)						
Wall Linings Internal	Flat AC Sheeting 1201/B00A/R0008/Wall Linings Internal/S19					No Asbestos Detected
B00A - R1017 - General Storeroom (20.44 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

No Asbestos

B00A - R1018 - Cleaning Distributed Store (6.5 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1201/B00A/R0042/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R1019 - Home Base (56.73 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1201/B00A/R0015/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)		

B00A - R1020 - Home Base Store (5.07 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1201/B00A/R0015/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)		

B00A - R1021 - Movement (16.47 m2)

Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1201/B00A/R0015/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)		

B00A - R1022 - Home Base Store (5.06 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1201/B00A/R0015/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)		

B00A - R1023 - Home Base (56.66 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1201/B00A/R0015/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)		

B00A - R1024 - Kiln Room (13.46 m2)

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1201/B00A/R0042/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R1025 - Movement (5.77 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1201/B00A/R0042/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R1026 - Movement (6.22 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1201/B00A/R0042/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R1027 - General Storeroom (11.72 m2)

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1201/B00A/R0015/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library - 1882 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00B - R0001 - Movement (43 m2)

Electrical Backing Board	Resinous Board	1Unit	South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-------	-------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

B00B - R0002 - K.L.A. Store (14.62 m2)

No Asbestos

B00B - R0003 - Reading Area (40.09 m2)

No Asbestos

B00B - R0004 - Library Office/Workroom (14.57 m2)

No Asbestos

B00B - R0005 - Reading Area (39.88 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Administration - 1920 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00E/R0005/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	
Wall Cladding	Flat AC Sheeting	300m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00D/R0001/Wall Linings Internal/S12				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior**B00D - R0001 - Movement (36.29 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	1201/B00D/R0001/Floor Coverings Res/Textile/S11				No Asbestos Detected	
Wall Linings Internal	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00D/R0001/Wall Linings Internal/S12				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00E/R0005/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	

B00D - R0002 - Home Base (53.58 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0023/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)	

B00D - R0003 - Home Base (53.51 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1201/B00A/R0023/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)	

B00D - R0004 - Movement (3.15 m2)

No Asbestos

B00D - R0005 - General Assistant/Bulk Store (13.36 m2)

No Asbestos

B00D - R0006 - General Assistant/Bulk Store (9.28 m2)

No Asbestos

B00D - R0007 - General Storeroom (6.1 m2)

No Asbestos

B00D - R0009 - External Movement (17.91 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Support Unit - 1920 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible

Interior

B00E - R0001 - Practical Activities - S - 1hb (34.37 m2)

No Asbestos

B00E - R0004 - Home Base - S (44.07 m2)

No Asbestos

B00E - R0005 - Movement (32.33 m2)

Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1201/B00E/R0005/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

B00E - R0006 - Disabled Toilet (9.15 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Other-Community Use - 1980 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00F - R0001 - Dental Clinic (0.53 m2)	No Asbestos
B00F - R0002 - Dental Clinic (12.64 m2)	No Asbestos
B00F - R0003 - Dental Clinic (0.67 m2)	No Asbestos
B00F - R0004 - Dental Clinic (13.75 m2)	No Asbestos
B00F - R0005 - Dental Clinic (3.55 m2)	No Asbestos
B00F - R0006 - Dental Clinic (3.06 m2)	No Asbestos
B00F - R0007 - Dental Clinic (2.92 m2)	No Asbestos
B00F - R0008 - Dental Clinic (9.64 m2)	No Asbestos
B00F - R0009 - Dental Clinic (9.69 m2)	No Asbestos
B00F - R0010 - Dental Clinic (9.42 m2)	No Asbestos
B00F - R0011 - Dental Clinic (5.16 m2)	No Asbestos
B00F - R0012 - Dental Clinic (8.12 m2)	No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00N - Communal Facilities - 2007 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00N - R0001 - Canteen Office/Store (9.84 m2)**

No Asbestos

B00N - R0002 - Canteen (25.91 m2)

No Asbestos

B00N - R0003 - Toilets - Girls (10.38 m2)

No Asbestos

B00N - R0004 - Sound Cupboard (1.87 m2)

No Asbestos

B00N - R0005 - Communal/Performance Store (8.62 m2)

No Asbestos

B00N - R0006 - Movement (30.77 m2)

No Asbestos

B00N - R0007 - Raised Platform (47.02 m2)

No Asbestos

B00N - R0008 - Movement (9.98 m2)

No Asbestos

B00N - R0009 - Communal Space (141.63 m2)

No Asbestos

B00N - R0010 - Main Switch Board Cupboard (3 m2)

No Asbestos

B00N - R0011 - Sports Store (12.96 m2)

No Asbestos

B00N - R0012 - Hall Chair Store (9.03 m2)

No Asbestos

B00N - R0013 - Cleaning Supplies (6.43 m2)

No Asbestos

B00N - R0014 - P.E. Store (12.71 m2)

No Asbestos

B00N - R0015 - Toilets - Boys (10.44 m2)

No Asbestos

B00N - R0016 - Cleaning Distributed Store (3.74 m2)

No Asbestos

B00N - R0017 - Disabled Shower/Toilet (5.15 m2)

No Asbestos

B00N - R0018 - Canteen Covered Area (179.97 m2)

No Asbestos

B00N - R0019 - External Movement (16.32 m2)

No Asbestos

B00N - R0020 - Plant (5.47 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B000 - Library/General Learning - 2011 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B000 - R0001 - External Stairs (7.34 m2)**

No Asbestos

B000 - R0002 - External Movement (108.48 m2)

No Asbestos

B000 - R0003 - External Stairs (5.88 m2)

No Asbestos

B000 - R0004 - Toilet - Lobby (2.48 m2)

No Asbestos

B000 - R0005 - Staff Toilet (4.65 m2)

No Asbestos

B000 - R0006 - Cleaning Distributed Store (2.99 m2)

No Asbestos

B000 - R0007 - Main Switch Board (0.72 m2)

No Asbestos

B000 - R0008 - Reading Area (167.61 m2)

No Asbestos

B000 - R0009 - K.L.A. Store (14.75 m2)

No Asbestos

B000 - R0010 - Communications Room (8 m2)

No Asbestos

B000 - R0011 - Library Office/Workroom (24.01 m2)

No Asbestos

B000 - R0012 - Special Programs Room (37.26 m2)

No Asbestos

B000 - R0013 - Special Programs Store (10.8 m2)

No Asbestos

B000 - R0014 - Other (0.52 m2)

No Asbestos

B000 - R1001 - External Stairs (18.62 m2)

No Asbestos

B000 - R1002 - External Movement (62.63 m2)

No Asbestos

B000 - R1003 - External Stairs (14.81 m2)

No Asbestos

B000 - R1004 - Practical Activities - 1hb (18.82 m2)

No Asbestos

B000 - R1005 - Home Base Store (6.19 m2)

No Asbestos

B000 - R1006 - Home Base (60.81 m2)

No Asbestos

B000 - R1007 - Withdrawal Space - 2hb (11.51 m2)

No Asbestos

B000 - R1008 - Practical Activities - 1hb (18.82 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B000 - R1009 - Home Base (60.81 m2)

No Asbestos

B000 - R1010 - Home Base Store (6.19 m2)

No Asbestos

B000 - R1011 - Practical Activities - 1hb (20.09 m2)

No Asbestos

B000 - R1012 - Withdrawal Space - 1hb (9 m2)

No Asbestos

B000 - R1013 - Home Base Store (5.93 m2)

No Asbestos

B000 - R1014 - Home Base (58.35 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

1201_ASB_231112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017