


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Berkeley Public School (1202)
Region : Illawarra and South East
State Electorate : Wollongong
Local Government Area : Wollongong

Initial Survey : Noel Arnold & Associates : 05 - Apr - 2008
Reviewed By : Grencap-NAA : 26 - Aug - 2014

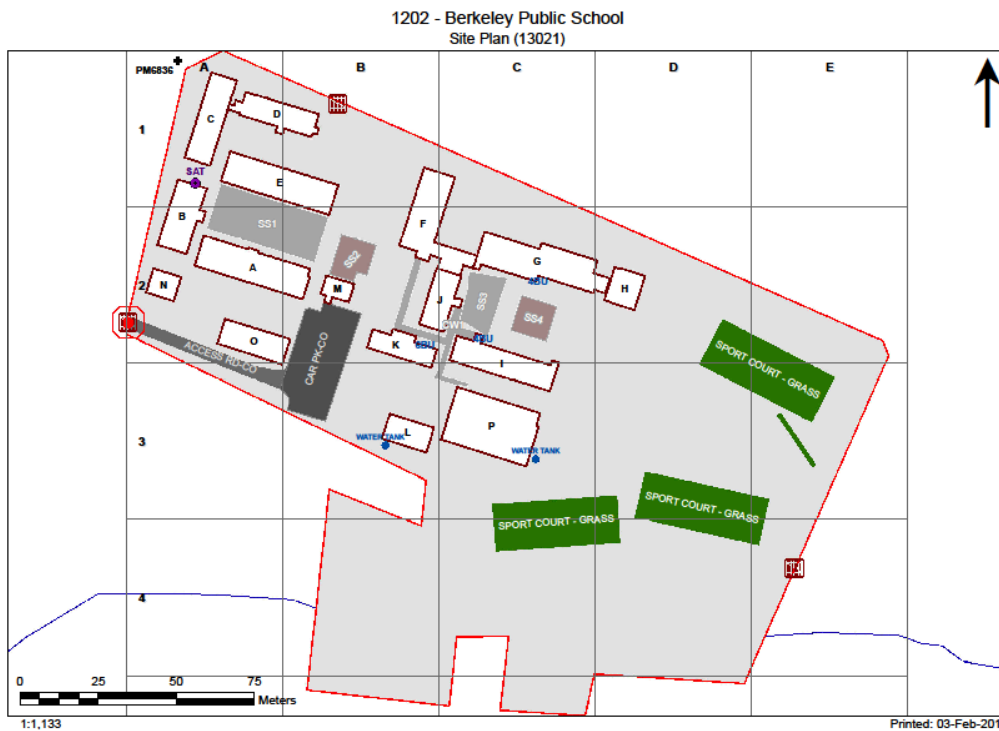

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00A - General Learning - 1951 - Timber (Timber)						
Exterior						
Gable Verge Lining	Flat AC Sheeting	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00A/Eaves Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting	50m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00A/Eaves Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)
Entry Ramp	Flat AC Sheeting					No Asbestos Detected
	1202/B00A/Entry Ramp/S11					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	300m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00A/Underfloor Voids - Packing to Floor Joists/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Interior						
B00A - R0001 - Withdrawal Space - 1hb (16.19 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00A/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0002 - Movement (23.47 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00A/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0003 - Movement (8.67 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00A/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0004 - Movement (33.88 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00A/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0005 - Home Base (53.51 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1202/B00A/R0009/Ceiling Structures/Linings/S14					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	1202/B00A/R0010/Floor Coverings Res/Textile/S16					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00A/R0010/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)
B00A - R0006 - Home Base (53.58 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1202/B00A/R0009/Ceiling Structures/Linings/S14					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	1202/B00A/R0010/Floor Coverings Res/Textile/S16					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1202/B00A/R0010/Floor Coverings Res/Textile/S15	53.58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0007 - Clerical Office (9.24 m2)						
Ceiling Structures/Linings	Vermiculite 1202/B00A/R0009/Ceiling Structures/Linings/S14					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1202/B00A/R0007/Floor Coverings Res/Textile/S17	9.24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 1202/B00A/R0007/Floor Coverings Res/Textile/S18	9.24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0008 - General Storeroom (12.62 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 1202/B00A/R0007/Floor Coverings Res/Textile/S17	12.62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1202/B00A/R0007/Floor Coverings Res/Textile/S18	12.62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0009 - Home Base (53.44 m2)						
Ceiling Structures/Linings	Vermiculite 1202/B00A/R0009/Ceiling Structures/Linings/S14					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Adhesive 1202/B00A/R0010/Floor Coverings Res/Textile/S16					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1202/B00A/R0010/Floor Coverings Res/Textile/S15	53.43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0010 - Home Base (53.59 m2)						
Ceiling Structures/Linings	Vermiculite 1202/B00A/R0009/Ceiling Structures/Linings/S14					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1202/B00A/R0010/Floor Coverings Res/Textile/S15	53.58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 1202/B00A/R0010/Floor Coverings Res/Textile/S16					No Asbestos Detected
B00A - R0011 - Movement (3.17 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 1202/B00M/R0001/Floor Coverings Res/Textile/S1	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0012 - Cleaning Supplies (5.79 m2)						
No Asbestos						
B00A - R0013 - Cleaning Supplies (12.62 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 1202/B00M/R0001/Floor Coverings Res/Textile/S1	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library - 1965 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 1202/B00B/Eaves Linings/S19	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Entry Ramp	Compressed AC Sheet 1202/B00B/Entry Ramp/S20					No Asbestos Detected
Underfloor Voids	Flat AC Sheeting 1202/B00B/Underfloor Voids/S21					No Asbestos Detected
Ceiling Voids	No Asbestos Found					

Interior**B00B - R0004 - Main Switch Board (0.85 m2)**

Wall Linings Internal	Flat AC Sheeting 1202/B00B/R0004/Wall Linings Internal/S5	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting 1202/B00B/R0004/Wall Linings Internal/S5	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00B - R0006 - Seminar/Study (13.61 m2)

No Asbestos

B00B - R0008 - Movement (4.23 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1202/B00B/R0008/Ceiling Structures/Linings/S2	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	

B00B - R0010 - Movement (5.92 m2)

Recently Modified Space Requires Inspection

B00B - R0011 - K.L.A. Store (26.11 m2)

Recently Modified Space Requires Inspection

B00B - R0012 - Library Office/Workroom (21.17 m2)

Recently Modified Space Requires Inspection

B00B - R0013 - Staff Kitchen (2.54 m2)

Recently Modified Space Requires Inspection

B00B - R0014 - Library Office/Workroom (10.19 m2)

Recently Modified Space Requires Inspection

B00B - R0015 - Reading Area (111.99 m2)

Recently Modified Space Requires Inspection

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1960 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00C/Eaves Linings/S24					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	300m2	Variable positions	Good Condition (1)	Medium (2)	Low Priority (2-3)
	1202/B00C/Underfloor Voids - Packing to Floor Joists/S22					Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	Flat AC Sheeting					No Asbestos Detected
	1202/B00C/Underfloor Voids/S23					
Ceiling Voids	No Asbestos Found					

Interior**B00C - R0006 - Home Base (57.6 m2)**

No Asbestos

B00C - R0007 - Home Base Store (4.65 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	1202/B00B/R0003/Floor Coverings Res/Textile/S3					No Asbestos Detected

B00C - R0008 - External Movement (2.41 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00B/R0008/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00C - R0009 - Movement (4.46 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	1202/B00B/R0003/Floor Coverings Res/Textile/S3					No Asbestos Detected

B00C - R0010 - Personal Effects Storage (12.16 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	1202/B00B/R0003/Floor Coverings Res/Textile/S3					No Asbestos Detected

B00C - R0011 - Home Base (57.53 m2)

No Asbestos

B00C - R0012 - Home Base Store (4.65 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	1202/B00B/R0003/Floor Coverings Res/Textile/S3					No Asbestos Detected

B00C - R0013 - Staff Room (61.11 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1202/B00C/R0013/Floor Coverings Res/Textile/S26					No Asbestos Detected

B00C - R0014 - Staff Kitchen (7.47 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	1202/B00C/R0015/Floor Coverings Res/Textile/S25					No Asbestos Detected

B00C - R0015 - Movement (3.56 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	1202/B00C/R0015/Floor Coverings Res/Textile/S25					No Asbestos Detected

B00C - Room+1 - CROO15

Floor Coverings Res/Textile	Vinyl Tiles					
	1202/B00B/R0003/Floor Coverings Res/Textile/S3					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Administration - 1960 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	55m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00D/Eaves Linings/S29					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

Interior**B00D - R0001 - Movement (2.66 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00B/R0008/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00D - R0005 - Staff Toilet (3.65 m2)

No Asbestos

B00D - R0008 - Main Switch Board (2.43 m2)

No Asbestos

B00D - R0013 - Staff Toilet (4.79 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00D/R0013/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)

B00D - R0014 - Staff Toilet (4.74 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00D/R0013/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)

Flue	Moulded fibre cement	3m	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00D/R0014/Flue/S28					Chrysotile (white asbestos) , Amosite (brown asbestos)

Cinerette	Encapsulated Insulation material within unit	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - enclosed unit					

B00D - R0015 - Movement (3.14 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00B/R0008/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00D - R0016 - Clerical Office (16.12 m2)

No Asbestos

B00D - R0017 - Entry Vestibule (13.97 m2)

No Asbestos

B00D - R0018 - Movement (30.14 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	30.14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00D/R0018/Floor Coverings Res/Textile/S27					Chrysotile (white asbestos)

B00D - R0019 - Deputy Principal (8.35 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8.35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00D/R0018/Floor Coverings Res/Textile/S27					Chrysotile (white asbestos)

B00D - R0020 - Deputy Principal (7.93 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7.93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00D/R0018/Floor Coverings Res/Textile/S27					Chrysotile (white asbestos)

B00D - R0021 - Movement (9.84 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R0022 - Principal (18.41 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1202/B00D/R0018/Floor Coverings Res/Textile/S27	18.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B00D - R0023 - Security Store (13.11 m2)						
No Asbestos						
B00D - R0024 - Sick Bay (8.98 m2)						
No Asbestos						
B00D - R0025 - Duplicating Workroom (26.86 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00E - General Learning - 1951 - Timber (Timber)						
Exterior						
Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/Eaves Linings/S30					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible					
Infill panels	Flat AC Sheeting					No Asbestos Detected
	1202/B00E/Infill panels/S35					
Interior						
B00E - R0001 - Practical Activities - 1hb (19.75 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0003/Ceiling Structures/Linings/S31					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0002 - Sports Store (22.15 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0003/Ceiling Structures/Linings/S31					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0006/Wall Linings Internal/S6					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
	1202/B00E/R0002/Floor Coverings Res/Textile/S33					
B00E - R0003 - Home Base (53.67 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0003/Ceiling Structures/Linings/S31					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0006/Wall Linings Internal/S6					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0003/Floor Coverings Res/Textile/S32					Chrysotile (white asbestos)
Heat-proof Mat	Millboard	1m2	Southwest	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0005/Heat-proof Mat/S34					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0004 - Movement (35.56 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0003/Ceiling Structures/Linings/S31					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0005 - Home Base (53.59 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0003/Ceiling Structures/Linings/S31					Chrysotile (white asbestos) , Amosite (brown asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0006/Wall Linings Internal/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0003/Floor Coverings Res/Textile/S32			Chrysotile (white asbestos)		
Heat-proof Mat	Millboard	1m2	Southwest	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0005/Heat-proof Mat/S34			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0006 - Withdrawal Space - 1hb (10.76 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0003/Ceiling Structures/Linings/S31			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0006/Wall Linings Internal/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10.76m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0003/Floor Coverings Res/Textile/S32			Chrysotile (white asbestos)		
B00E - R0007 - Staff Room (10.76 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0003/Ceiling Structures/Linings/S31			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0006/Wall Linings Internal/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0008 - Withdrawal Space - 1hb (27.69 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0003/Ceiling Structures/Linings/S31			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0011 - Home Base (53.59 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0003/Ceiling Structures/Linings/S31			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0006/Wall Linings Internal/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0003/Floor Coverings Res/Textile/S32			Chrysotile (white asbestos)		
Heat-proof Mat	Millboard	1m2	Southwest	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0005/Heat-proof Mat/S34			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0012 - Special Programs Room (53.59 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	53.58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0003/Ceiling Structures/Linings/S31			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1202/B00E/R0003/Floor Coverings Res/Textile/S32	53.58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Heat-proof Mat	Millboard 1202/B00E/R0005/Heat-proof Mat/S34	1m2	Southwest	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting 1202/B00E/R0006/Wall Linings Internal/S6	50m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Communal Facilities - 1951 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting 1202/B00F/R0011/Ceiling Structures/Linings/S38					No Asbestos Detected
Underfloor Voids	Non Accessible Area - Area inaccessible					
Infill panels	Compressed AC Sheet 1202/B00F/Infill panels/S36	24m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Infill panels	Compressed AC Sheet 1202/B00F/Infill panels/S37					No Asbestos Detected
Ceiling Voids	Vermiculite 1202/B00F/R0017/Ceiling Structures/Linings/S39					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Electrical Backing Board	Resinous Board 1202/B00F/Electrical Backing Board/S40					No Asbestos Detected

Interior**B00F - R0001 - Staff Toilet (3.78 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 1202/B00F/R0003/Floor Coverings Res/Textile/S8	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 1202/B00F/R0017/Ceiling Structures/Linings/S39					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - R0003 - General Storeroom (6.93 m2)

Floor Coverings Res/Textile	Vinyl Tiles 1202/B00F/R0003/Floor Coverings Res/Textile/S8	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 1202/B00F/R0017/Ceiling Structures/Linings/S39					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - R0004 - No Access (3.08 m2)

Floor Coverings Res/Textile	Vinyl Tiles 1202/B00F/R0003/Floor Coverings Res/Textile/S8	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 1202/B00F/R0017/Ceiling Structures/Linings/S39					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - R0011 - Movement (46.86 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1202/B00F/R0011/Ceiling Structures/Linings/S38					No Asbestos Detected
In-fill-panel	Flat AC Sheeting 1202/B00F/R0011/In-fill-panel/S7	8m	Under Window	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
In-fill-panel	Flat AC Sheeting 1202/B00F/R0011/In-fill-panel/S7	2m	Over Door	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0012 - Movement (7.34 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1202/B00F/R0011/Ceiling Structures/Linings/S38					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00F - R0014 - Movement (81.66 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Eaves	Flat AC Sheeting					
	1202/B00F/R0011/Ceiling Structures/Linings/S38					No Asbestos Detected
B00F - R0015 - General Storeroom (1.07 m2)						
Non Accessible						
B00F - R0016 - Raised Platform (28.6 m2)						
Ceiling Structures/Linings	Vermiculite					
	1202/B00F/R0017/Ceiling Structures/Linings/S39					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R0017 - Communal Space (143.79 m2)						
Ceiling Structures/Linings	Vermiculite					
	1202/B00F/R0017/Ceiling Structures/Linings/S39					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Encapsulated Insulation material within unit	5Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - insulation within units						
Floor Coverings Res/Textile	Vinyl Tiles	143.78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00F/R0003/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)
B00F - R0018 - Disabled Shower/Toilet (14.28 m2)						
Wall Linings Internal	Flat AC Sheeting					
	1202/B00F/R0018/Wall Linings Internal/S41					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting					
	1202/B00F/R0018/Ceiling Structures/Linings/S42					No Asbestos Detected
B00F - Room+1 - FR0015						
No Asbestos						
B00F - Room+2 - FR0014						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00G - General Learning - 1960 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	15m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	-------	--------------------	---------	--------------------

Assumed Asbestos - Height Restriction

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids	No Asbestos Found					

Interior**B00G - R0002 - Home Base (56.89 m2)**

Ceiling Structures/Linings	Vermiculite 1202/B00G/R0002/Ceiling Structures/Linings/S45					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 1202/B00F/R0003/Floor Coverings Res/Textile/S8	56.88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Within unit

B00G - R0003 - Home Base Store (4.15 m2)

Ceiling Structures/Linings	Vermiculite 1202/B00G/R0002/Ceiling Structures/Linings/S45					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 1202/B00F/R0003/Floor Coverings Res/Textile/S8	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00G - R0006 - Home Base (56.89 m2)

Ceiling Structures/Linings	Vermiculite 1202/B00G/R0002/Ceiling Structures/Linings/S45					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 1202/B00F/R0003/Floor Coverings Res/Textile/S8	56.88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Area inaccessible

B00G - R0007 - Home Base Store (4.14 m2)

Ceiling Structures/Linings	Vermiculite 1202/B00G/R0002/Ceiling Structures/Linings/S45					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 1202/B00F/R0003/Floor Coverings Res/Textile/S8	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00G - R0008 - External Movement (68.52 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1202/B00G/R0015/Ceiling Structures/Linings/S43					No Asbestos Detected
In-fill-panel	Flat AC Sheeting 1202/B00F/R0011/In-fill-panel/S7	8m	Under Window	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0009 - Home Base (56.74 m2)

Ceiling Structures/Linings	Vermiculite 1202/B00G/R0002/Ceiling Structures/Linings/S45					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	56.73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00F/R0003/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)
Thermacon Heater	Encapsulated Insulation material within unit	56.73m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Heater secured and stationary					
B00G - R0010 - Home Base Store (4.16 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1202/B00G/R0002/Ceiling Structures/Linings/S45					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00F/R0003/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)
B00G - R0011 - Movement (6.94 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1202/B00G/R0002/Ceiling Structures/Linings/S45					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00F/R0003/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)
B00G - R0012 - Personal Effects Storage (12.18 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1202/B00G/R0002/Ceiling Structures/Linings/S45					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00F/R0003/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)
B00G - R0013 - Home Base (56.64 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1202/B00G/R0002/Ceiling Structures/Linings/S45					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	56.64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00F/R0003/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible					
B00G - R0014 - Home Base Store (4.16 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1202/B00G/R0002/Ceiling Structures/Linings/S45					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00F/R0003/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)
B00G - R0015 - External Movement (39.85 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1202/B00G/R0015/Ceiling Structures/Linings/S43					
Infill panels	Compressed AC Sheet					No Asbestos Detected
	1202/B00G/R0015/Infill panels/S44					
Infill panels	Compressed AC Sheet					No Asbestos Detected
	1202/B00G/R0015/Infill panels/S44					
B00G - R0016 - Personal Effects Storage (19.07 m2)						
No Asbestos						
B00G - Room+1 - GROO15						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting 1202/B00G/R0015/Ceiling Structures/Linings/S43					No Asbestos Detected
In-fill-panel	Flat AC Sheeting 1202/B00F/R0011/In-fill-panel/S7	8m	Under Window	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Administration - 1960 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00H/Eaves Linings/S49					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Area inaccessible					

Interior**B00H - R0001 - External Movement (20.04 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00H/R0001/Ceiling Structures/Linings/S46					Chrysotile (white asbestos) , Amosite (brown asbestos)
In-fill-panel	Flat AC Sheeting	8m	Under Window	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00F/R0011/In-fill-panel/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
Infill panels	Compressed AC Sheet	12m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00H/R0001/Infill panels/S47					Chrysotile (white asbestos) , Amosite (brown asbestos)
Infill panels	Compressed AC Sheet	5m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00H/R0001/Infill panels/S47					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00H - R0002 - Staff Room (33.64 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1202/B00H/R0007/Ceiling Structures/Linings/S48					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	1202/B00B/R0003/Floor Coverings Res/Textile/S3					

B00H - R0003 - Staff Toilet (4.66 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1202/B00H/R0007/Ceiling Structures/Linings/S48					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	1202/B00B/R0003/Floor Coverings Res/Textile/S3					

B00H - R0004 - Staff Toilet (4.68 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1202/B00H/R0007/Ceiling Structures/Linings/S48					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	1202/B00B/R0003/Floor Coverings Res/Textile/S3					

B00H - R0005 - General Storeroom (7.64 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1202/B00H/R0007/Ceiling Structures/Linings/S48					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	1202/B00B/R0003/Floor Coverings Res/Textile/S3					

B00H - R0006 - General Storeroom (4.08 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1202/B00H/R0007/Ceiling Structures/Linings/S48					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles					
	1202/B00B/R0003/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00H - R0007 - Clerical Office (13.91 m2)						
Ceiling Structures/Linings	Vermiculite					
	1202/B00H/R0007/Ceiling Structures/Linings/S48					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	1202/B00B/R0003/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00H - R0008 - Movement (12 m2)						
Ceiling Structures/Linings	Vermiculite					
	1202/B00H/R0007/Ceiling Structures/Linings/S48					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	1202/B00B/R0003/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00H - R0009 - Sick Bay (1.5 m2)						
Ceiling Structures/Linings	Vermiculite					
	1202/B00H/R0007/Ceiling Structures/Linings/S48					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	1202/B00B/R0003/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00H - R0010 - Distribution Board (0.41 m2)						
				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00E/R0006/Wall Linings Internal/S6					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	1202/B00B/R0003/Floor Coverings Res/Textile/S3					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - General Learning - 1951 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B001/Eaves Linings/S50				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Voids	Flat AC Sheeting	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B001/Ceiling Voids/S52				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	350m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B001/Underfloor Voids - Packing to Floor Joists/S53				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Interior**B001 - R0001 - Movement (3.11 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00B/R0008/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	

B001 - R0002 - Personal Effects Storage (8.12 m2)

Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B001/R0002/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)	

B001 - R0003 - Home Base (79.62 m2)

No Asbestos

B001 - R0004 - General Storeroom (10.72 m2)

Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B001/R0002/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)	

B001 - R0005 - Toilets - Boys/Girls (1.83 m2)

Wall Linings Internal	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00B/R0004/Wall Linings Internal/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B001 - R0006 - Home Base (57.89 m2)

No Asbestos

B001 - R0007 - Home Base Store (5.52 m2)

No Asbestos

B001 - R0008 - Personal Effects Storage (5.22 m2)

Electrical Mounting Board	Resinous Board	1Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B001/R0008/Electrical Mounting Board/S51				Chrysotile (white asbestos)	

B001 - R0009 - Movement (28.35 m2)

No Asbestos

B001 - R0010 - Craft Store (1.89 m2)

No Asbestos

B001 - R0011 - General Storeroom (16.98 m2)

No Asbestos

B001 - R0012 - General Storeroom (21.98 m2)

No Asbestos

B001 - R0013 - Withdrawal Space - 1hb (16.01 m2)

No Asbestos

B001 - R0014 - Cleaning Distributed Store (3.79 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - R0015 - Movement (5.47 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

1202/B00B/R0008/Ceiling Structures/Linings/S2

Chrysotile (white asbestos)

B00I - R9001 - Hall Chair Store (47.62 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 1965 - Timber (Timber)

Exterior

Gable Verge Lining	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						
Eaves Linings	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
1202/B00J/Eaves Linings/S57				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	240m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
1202/B00J/Underfloor Voids - Packing to Floor Joists/S58				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00J - R0001 - Home Base (57.76 m2)

No Asbestos

B00J - R0002 - Home Base Store (5.54 m2)

No Asbestos

B00J - R0003 - Home Base Store (5.52 m2)

No Asbestos

B00J - R0004 - Home Base (57.82 m2)

No Asbestos

B00J - R0005 - Personal Effects Storage (5.24 m2)

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1202/B00I/R0002/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		

B00J - R0006 - Personal Effects Storage (5.23 m2)

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1202/B00I/R0002/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		

B00J - R0007 - Movement (6.79 m2)

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1202/B00I/R0002/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		

B00J - R0008 - Movement (5.98 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1202/B00B/R0008/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pupil Facilities - 1951 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00K/Eaves Linings/S55				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00K - R0001 - Movement (5.34 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00K/R0004/Ceiling Structures/Linings/S56				Chrysotile (white asbestos)	

B00K - R0002 - Toilets - Girls (61.74 m2)

Ceiling Structures/Linings	Flat AC Sheeting	62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00K/R0004/Ceiling Structures/Linings/S56				Chrysotile (white asbestos)	

B00K - R0003 - Movement (3.48 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00K/R0004/Ceiling Structures/Linings/S56				Chrysotile (white asbestos)	

B00K - R0004 - Toilets - Boys (57.05 m2)

Ceiling Structures/Linings	Flat AC Sheeting	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00K/R0004/Ceiling Structures/Linings/S56				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Special Purpose - 1938 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible

Interior

B00L - R0001 - Special Programs Room (45.59 m2)

No Asbestos

B00L - R0002 - Kiln Room (1 m2)

No Asbestos

B00L - R0003 - Special Programs Room (46.92 m2)

No Asbestos

B00L - R0004 - External Movement (25.62 m2)

Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

1202/B00L/R0004/Ceiling Structures/Linings/S54

Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Pupil Facilities - 1965 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00M/Eaves Linings/S60				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible					
Ceiling Voids	No Asbestos Found					

Interior**B00M - R0001 - Canteen (28.88 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00M/R0001/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	

B00M - R0002 - Canteen Office/Store (2 m2)

Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00M/R0001/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	

B00M - R0003 - Staff Toilet (4.7 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00M/R0001/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	

Electrical Mounting Board	Resinous Board	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00M/R0003/Electrical Mounting Board/S64				Chrysotile (white asbestos)	

B00M - R0004 - No Access (15.63 m2)

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00M/R0004/Ceiling Structures/Linings/S59				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

B00M - R0005 - Movement (3.6 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00M/R0004/Ceiling Structures/Linings/S59				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Other-Community Use - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	50m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00N/Eaves Linings/S63					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Telecommunication pit	Moulded fibre cement	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00N/Telecommunication pit/S69					Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00N - R0001 - Dental Clinic (7.93 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	1202/B00N/R0001/Floor Coverings Res/Textile/S68					No Asbestos Detected

B00N - R0002 - Movement (1.86 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	1202/B00N/R0001/Floor Coverings Res/Textile/S68					No Asbestos Detected

B00N - R0003 - Staff Toilet (3.41 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00N - R0004 - Dental Clinic (6.07 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	1202/B00N/R0001/Floor Coverings Res/Textile/S68					No Asbestos Detected

B00N - R0005 - Clerical Office (6.48 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	1202/B00N/R0001/Floor Coverings Res/Textile/S68					No Asbestos Detected

B00N - R0006 - Dental Clinic (3.79 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	1202/B00N/R0001/Floor Coverings Res/Textile/S68					No Asbestos Detected

B00N - R0007 - Cleaning Distributed Store (1.38 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00N - R0008 - Dental Clinic (8.46 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	1202/B00N/R0001/Floor Coverings Res/Textile/S68					No Asbestos Detected

B00N - R0009 - Dental Clinic (8.46 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	1202/B00N/R0001/Floor Coverings Res/Textile/S68					No Asbestos Detected

B00N - R0010 - Staff Room (5.67 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	1202/B00N/R0001/Floor Coverings Res/Textile/S68					No Asbestos Detected

B00N - R0011 - Movement (3.49 m2)

Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B00N/R0011/Wall Linings Internal/S65					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Shelving	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
1202/B00N/R0011/Shelving/S66					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1202/B00N/R0011/Ceiling Structures/Linings/S67					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet					
1202/B00N/R0001/Floor Coverings Res/Textile/S68					No Asbestos Detected	
B00N - R0012 - Staff Toilet (2.79 m2)						
No Asbestos						
B00N - R0013 - Movement (1.01 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
1202/B00N/R0001/Floor Coverings Res/Textile/S68					No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Pupil Facilities - 1965 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1202/B000/Eaves Linings/S62				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior**B000 - R0001 - Toilets - Boys (67.9 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1202/B000/R0003/Ceiling Structures/Linings/S61					

B000 - R0002 - Staff Toilet (2.28 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1202/B000/R0003/Ceiling Structures/Linings/S61					

B000 - R0003 - Toilets - Girls (34.86 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1202/B000/R0003/Ceiling Structures/Linings/S61					

B000 - R0004 - Staff Toilet (2.27 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1202/B000/R0003/Ceiling Structures/Linings/S61					

B000 - R0005 - Drinking Facilities (29.69 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1202/B000/R0003/Ceiling Structures/Linings/S61					

B000 - R0006 - Cleaning Supplies (7.88 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1202/B000/R0003/Ceiling Structures/Linings/S61					

B000 - R0007 - General Storeroom (8.03 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1202/B000/R0003/Ceiling Structures/Linings/S61					

B000 - R0008 - General Storeroom (7.96 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1202/B000/R0003/Ceiling Structures/Linings/S61					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00P - Multi Purpose Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior**B00P - R0001 - Communal Space (145.27 m2)**

No Asbestos

B00P - R0002 - Raised Platform (60.06 m2)

No Asbestos

B00P - R0003 - Chair Storeroom (9.47 m2)

No Asbestos

B00P - R0004 - Communal/Performance Store (9.43 m2)

No Asbestos

B00P - R0005 - P.E. Store (12.85 m2)

No Asbestos

B00P - R0006 - Toilet - Lobby (2.37 m2)

No Asbestos

B00P - R0007 - Toilets - Girls (7.31 m2)

No Asbestos

B00P - R0008 - Sound Cupboard (2.06 m2)

No Asbestos

B00P - R0009 - Toilet - Lobby (3.3 m2)

No Asbestos

B00P - R0010 - Toilets - Boys (5.71 m2)

No Asbestos

B00P - R0011 - Cleaning Distributed Store (3.51 m2)

No Asbestos

B00P - R0012 - Plant (1.6 m2)

No Asbestos

B00P - R0013 - Main Switch Board (3.23 m2)

No Asbestos

B00P - R0014 - Access Shower/Toilet/Change (6.87 m2)

No Asbestos

B00P - R0015 - Covered Outdoor Learning Area (162.82 m2)

No Asbestos

B00P - R0016 - Movement (6.17 m2)

No Asbestos

B00P - R0017 - Movement (12.99 m2)

No Asbestos

B00P - R0018 - Ramp (12.43 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

1202_ASB_261112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017