


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Berridale Public School (1206)
Region : Illawarra and South East
State Electorate : Monaro
Local Government Area : Snowy River

Initial Survey : Noel Arnold & Associates : 14 - May - 2008
Reviewed By : Grencap-NAA : 17 - Jun - 2016

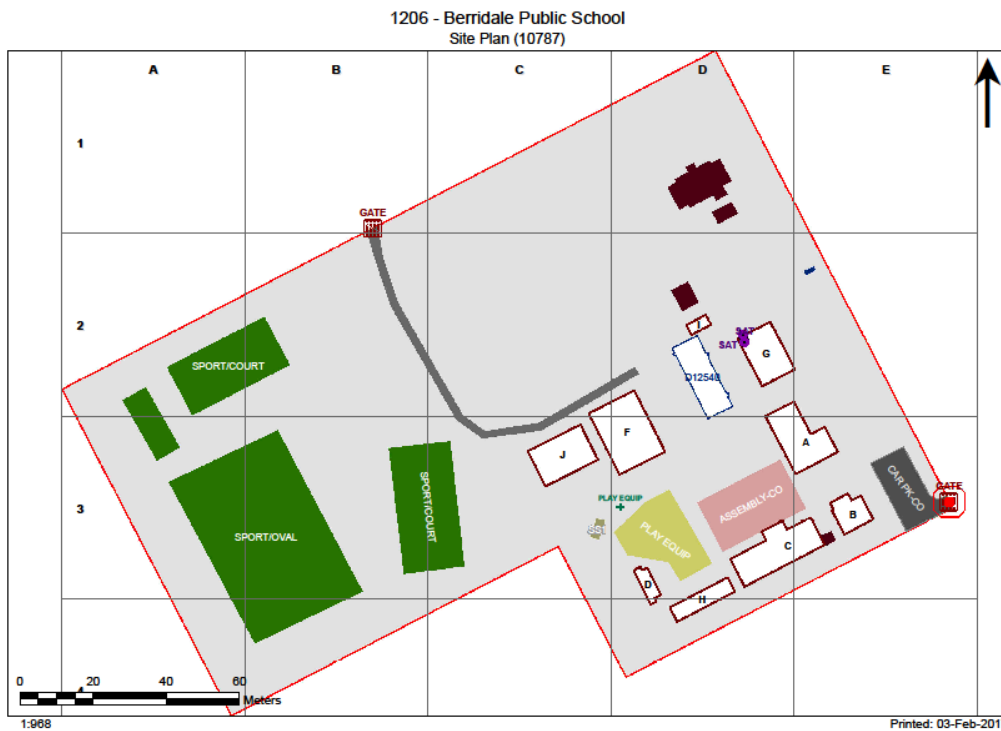

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Staff Facilities - 1883 - Sandstone (Sandstone)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids	AC Fragments/Debris 1206/B00A/Ceiling Voids/S6	26m2	Throughout	Friable Asbestos (5)	Low (1)	High Priority (6-8) Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting 1206/B00A/Eaves Linings/S11	8m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Interior**B00A - R0004 - Interview**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1206/B00A/R0005/Floor Coverings Res/Textile/S7	14.63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	---------	------------	--------------------	---------	--

B00A - R0005 - Clerical Office

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1206/B00A/R0005/Floor Coverings Res/Textile/S7	16.71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	---------	------------	--------------------	---------	--

B00A - R0007 - Entry Vestibule

Floor Coverings Res/Textile	Vinyl Sheet 1206/B00A/R0007/Floor Coverings Res/Textile/S8					No Asbestos Detected
-----------------------------	---	--	--	--	--	-----------------------------

B00A - R0008 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting 1206/B00A/R0008/Ceiling Structures/Linings/S5	0.3m2	Central	Minimal Damage (2)	Medium (2)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	-------	---------	--------------------	------------	--

B00A - R0009 - Sick Bay

No Asbestos

B00A - R0010 - Staff Kitchen

No Asbestos

B00A - R0011 - Staff Room

Sink	Resinous Membrane 1206/B00A/R0011/Sink/S9					No Asbestos Detected
------	--	--	--	--	--	-----------------------------

B00A - R0012 - Movement

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1206/B00A/R0005/Floor Coverings Res/Textile/S7	6.19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	--------	------------	--------------------	---------	--

B00A - R0014 - Toilet - Lobby

Wall Linings Internal	Flat AC Sheeting 1206/B00A/R0014/Wall Linings Internal/S10					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B00A - R0015 - Staff Toilet

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1950 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1206/B00B/Eaves Linings/S13					Chrysotile (white asbestos)	

Interior

B00B - R0001 - General Storeroom

No Asbestos

B00B - R0002 - Personal Effects Storage

No Asbestos

B00B - R0003 - Withdrawal Space - 1hb

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)				
1206/B00B/R0003/Floor Coverings Res/Textile/S12					No Asbestos Detected

B00B - R0004 - Drinking Facilities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1883 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	100m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1206/B00C/Eaves Linings/S15			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior

B00C - R0001 - Home Base

No Asbestos

B00C - R0002 - Home Base Store

No Asbestos

B00C - R0003 - Personal Effects Storage

No Asbestos

B00C - R0004 - Home Base Store

No Asbestos

B00C - R0005 - Personal Effects Storage

No Asbestos

B00C - R0007 - Home Base

No Asbestos

B00C - R0008 - Personal Effects Storage

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1206/B00C/R0008/Ceiling Structures/Linings/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0009 - Cleaning Distributed Store

Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B00C - R0010 - Toilet - Lobby

No Asbestos

B00C - R0011 - Toilets - Boys/Girls

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Storage - 1965 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00D - R0001 - General Assistant/Bulk Store

Wall Linings Internal	Flat AC Sheeting	15m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1206/B00D/R0001/Wall Linings Internal/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting					No Asbestos Detected
	1206/B00E/R0001/In-fill-panel/S4					

B00D - R0002 - External Movement

No Asbestos

B00D - R0003 - Garden Store

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1206/B00D/R0003/Wall Linings Internal/S2					

B00D - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1206/B00F/Eaves Linings/S16					No Asbestos Detected

Interior

B00F - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 1206/B00F/Eaves Linings/S16					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00F - R0002 - Practical Activities - 1hb

No Asbestos

B00F - R0003 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00F - R0004 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00F - R0005 - Outdoor Learning Area

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00F - R0006 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00F - R0007 - Outdoor Learning Area

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00F - R0008 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00F - R0009 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00F - R0010 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Library - 1950 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids - Flat Roof	No Asbestos Found

Interior

B00G - R0001 - Movement

No Asbestos

B00G - R0002 - Reading Area

Wall Linings Internal	Flat AC Sheeting	20m2	North, East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1206/B00G/R0003/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	52.26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1206/B00G/R0002/Ceiling Structures/Linings/S17			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00G - R0003 - Reading Area

Wall Linings Internal	Flat AC Sheeting	30m2	North, East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1206/B00G/R0003/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	51.97m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1206/B00G/R0002/Ceiling Structures/Linings/S17			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pupil Facilities - 2009 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00H - R0001 - Toilets - Boys

No Asbestos

B00H - R0002 - Toilets - Girls

No Asbestos

B00H - R0003 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00H - R0004 - Access Shower/Toilet/Change

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Other - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00I - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00J - R0001 - External Movement

No Asbestos

B00J - R0002 - Reading Area

No Asbestos

B00J - R0003 - Library Office/Workroom

No Asbestos

B00J - R0004 - Communications Room

No Asbestos

B00J - R0005 - K.L.A. Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 810 - D12540 - FSU/Shelter/Stores : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		25.92 m2

Interior

R1 - Canteen

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		28 m2

R2 - Covered Area

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		109 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos		4 m2
---------	---------------	------------------	--	------

R4 - Sports Store

Ceiling	Flat AC Sheet	Assumed Asbestos		10 m2
---------	---------------	------------------	--	-------

R5 - Garden Store

Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2
---------	---------------	------------------	--	------

R6 - Change Room

Ceiling	Flat AC Sheet	Assumed Asbestos		3 m2
---------	---------------	------------------	--	------

R7 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos		2 m2
---------	---------------	------------------	--	------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

1206_ASB_100913_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017