


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Berrima Public School (1209)
Region : Illawarra and South East
State Electorate : Goulburn
Local Government Area : Wingecarribee

Initial Survey : Noel Arnold & Associates : 22 - May - 2008
Reviewed By : Greencap-NAA : 16 - Jun - 2015

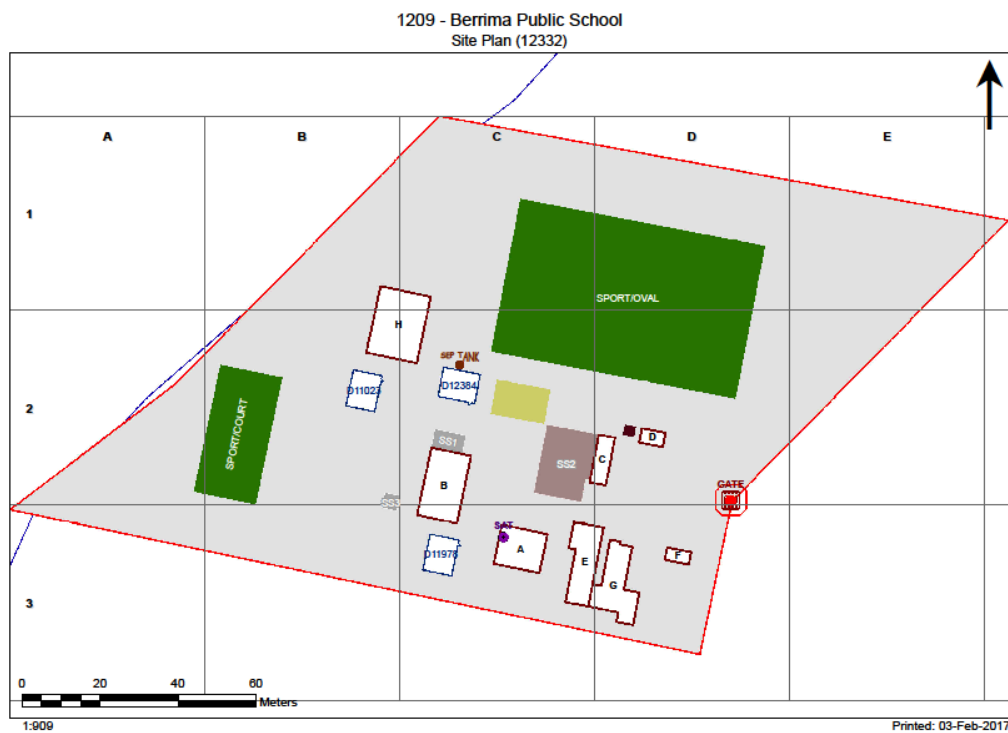

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Library/Staff Facilities - 1950 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	16m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Electrical Backing Board	Resinous Board	0.5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00A - R0001 - K.L.A. Store

No Asbestos

B00A - R0002 - Library Office/Workroom

No Asbestos

B00A - R0003 - Reading Area

No Asbestos

B00A - R0004 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1209/B00A/R0004/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1970 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	8m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1209/B00B/Eaves Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Gable Verge Lining	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1209/B00B/Gable Verge Lining/S10			Chrysotile (white asbestos)		
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior**B00B - R0001 - Personal Effects Storage**

No Asbestos

B00B - R0002 - General Storeroom

No Asbestos

B00B - R0003 - Toilets - Boys/Girls

No Asbestos

B00B - R0004 - Home Base

No Asbestos

B00B - R0005 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1209/B00B/Eaves Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
In-fill-panel	Flat AC Sheeting	6m	To windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	1209/B00B/R0005/In-fill-panel/S11			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00B - R0006 - Special Programs Room

Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1209/B00B/Eaves Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00B - R9001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00C - Pupil Facilities - 1970 - Brick/Block (Brick/Block)						
Exterior						
Eaves Linings	Flat AC Sheeting	10m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1209/B00C/Eaves Linings/S5			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible					
Interior						
B00C - R0001 - Drinking Facilities						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1209/B00C/R0001/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00C - R0002 - Toilets - Boys						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1209/B00C/R0001/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1209/B00C/R0002/Partition Walls (Cubicles)/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0003 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1209/B00C/R0001/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00C - R0004 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1209/B00C/R0001/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00C - R0005 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1209/B00C/R0001/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00C - R0006 - Toilets - Girls						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1209/B00C/R0001/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1209/B00C/R0002/Partition Walls (Cubicles)/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0007 - Drinking Facilities						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1209/B00C/R0001/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Administration - 1950 - Timber Shed (Timber Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00D - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Administration - 1869 - Sandstone (Sandstone)**Exterior**

Wall Cladding	Flat AC Sheeting	4m2	Behind water tank	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible					
Pillar Packing	Flat AC Sheeting	1m2	West	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	1209/B00E/Pillar Packing/S2					Chrysotile (white asbestos)
Underfloor Voids	Non Accessible Area - Area inaccessible					
Ceiling Voids	Non Accessible Area - Area inaccessible					

Interior**B00E - R0003 - Staff Room**

In-fill-panel	Flat AC Sheeting	2m	To old fireplace	Good Condition (1)	Low (1)	Low Priority (2-3)
	1209/B00E/R0005/In-fill-panel/S1					Chrysotile (white asbestos)

B00E - R0004 - Movement

No Asbestos

B00E - R0005 - Interview

In-fill-panel	Flat AC Sheeting	1m	Adjacent to heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	1209/B00E/R0005/In-fill-panel/S1					Chrysotile (white asbestos)

B00E - R0006 - Personal Effects Storage

No Asbestos

B00E - R0007 - General Storeroom

No Asbestos

B00E - R0008 - Clerical Office

No Asbestos

B00E - R0009 - Entry Vestibule

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Other-General Storeroom - 1920 - Timber Shed (Timber Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning/Pupil Facilities - 1869 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids Non Accessible Area
- Area inaccessible

Underfloor Voids Non Accessible Area
- Area inaccessible

Interior**B00G - R0001 - Staff Toilet**

No Asbestos

B00G - R0002 - Movement

No Asbestos

B00G - R0003 - Canteen

No Asbestos

B00G - R0004 - Movement

No Asbestos

B00G - R0005 - Principal

No Asbestos

B00G - R0006 - Special Programs Store

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1209/B00G/R0006/Ceiling Structures/Linings/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00G - R0007 - Movement

Electrical Backing Board	Resinous Board	0.5m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B00G - R0008 - External Movement

No Asbestos

B00G - R0009 - Special Programs Store

No Asbestos

B00G - R0010 - Movement

No Asbestos

B00G - R0011 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1209/B00G/R0006/Ceiling Structures/Linings/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1209/B00G/R0011/Wall Linings Internal/S4				Chrysotile (white asbestos)		

B00G - R0012 - Staff Toilet

No Asbestos

B00G - R0013 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00H - R0001 - External Movement

No Asbestos

B00H - R0002 - Practical Activities - 1hb

No Asbestos

B00H - R0003 - Home Base Store

No Asbestos

B00H - R0004 - Home Base

No Asbestos

B00H - R0005 - Withdrawal Space - 2hb

No Asbestos

B00H - R0006 - Home Base

No Asbestos

B00H - R0007 - Home Base Store

No Asbestos

B00H - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D11023 - Learning Unit - Standard With P.A.A. : Placement Date - 19/02/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 603 - D11978 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 19/12/2012

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D12384 - Learning Unit - Standard/Withdrawal : Placement Date - 22/06/2006

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017